

KONFIGURACIJA

Hyundai Kona '17




Vehicle information


Make:	Hyundai	License:	
Gearbox:	Automatic	Body color:	
Model:	Kona '17	VIN:	TMAK281GFLJ023846
Fuel type:	Electric	Power:	150 kW
Version:	Kona Electric 64kWh Comf.Smart	First registration	28/06/2021
Mileage:	161299 km	N° of doors:	

Damage summary

Front	3
Interior	1
Left	5
Rear	3
Right	6

Commercial pictures

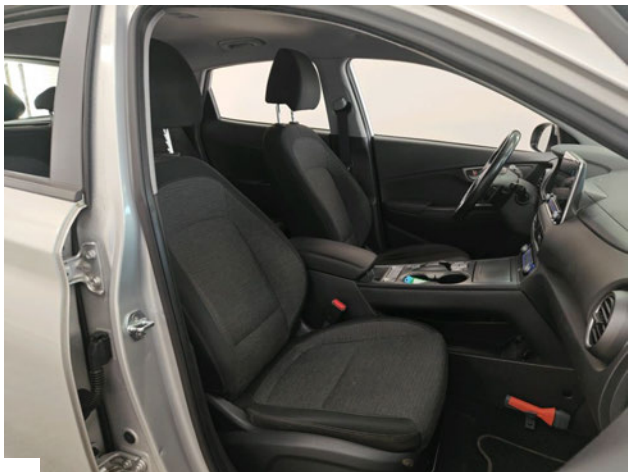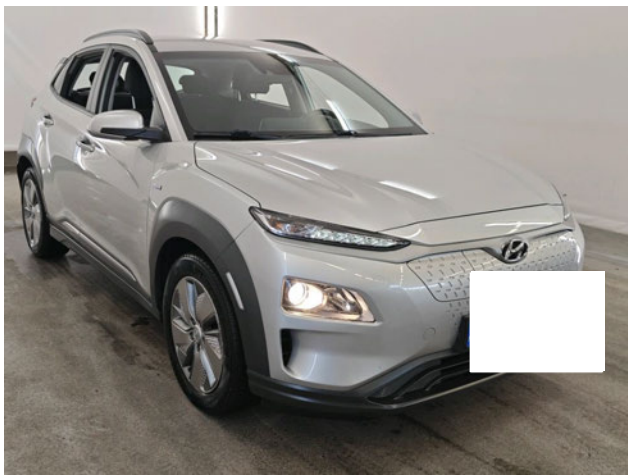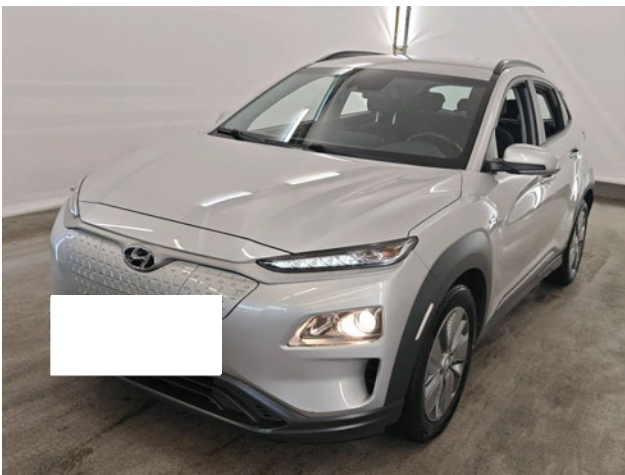

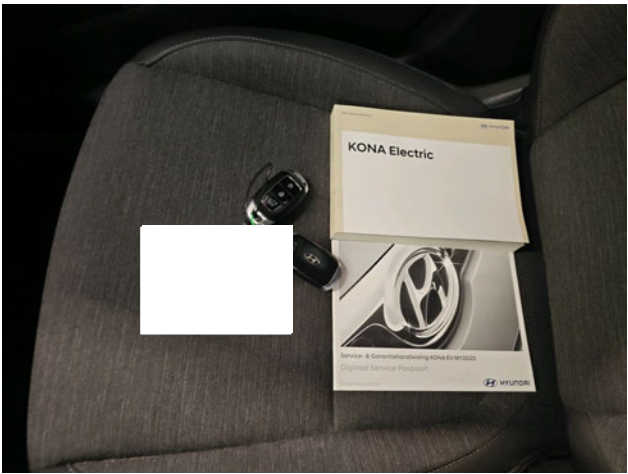

Batterijcertificaat

Datum van diagnose: 08/07/2026

Raadpleeg het Moba-certificaat door deze QR-code te scannen

100%

Status van de gezondheid (SOH)*

Hyundai Kona


VIN : TMAK281GFLJ023846

Kilometerstand : 161.300 km

* SOH berekend op basis van fabrieksgegevens. Informatie om rekening mee te houden voor de fabrieksgarantie

Meer weten over: www.get-moba.com

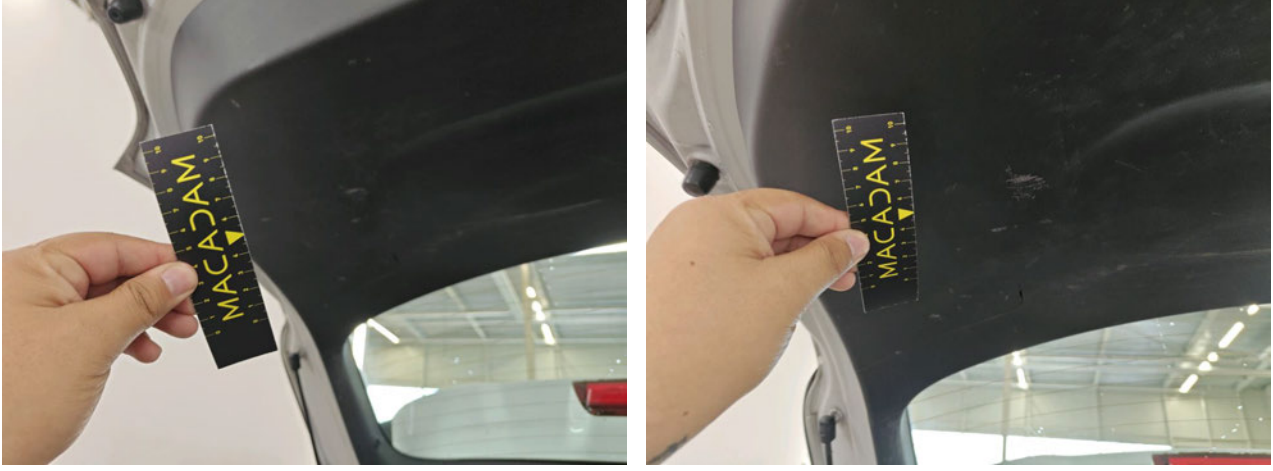

Options according to the inspector			
Central consol F	Yes	GPS	Yes
Rear view camera	Yes	Telephone equipment	Yes
Radio multimedia			
Yes			
Damages			
Alloy rim FR Scratch(es) Repair and paint (complete) Right			
Alloy rim RR Scratch(es) Repair and paint (complete) Right			
Bonnet Stone chip(s) Repair and paint (complete) Front			
Boot lid covering R Scratch(es) Smart repair Rear			

Bumper F
Scratch(es)
Repair and paint (complete)
Front



Bumper moulding FR
Scratch(es)
Replace
Front



Bumper R
Scratch(es)
Replace
Rear



Door FL
Scratch(es)
Repair and paint (complete)
Left



Door FR
Scratch(es)
Repair and paint (complete)
Right




Door frame FL
Dent(s) and scratch(es)
Repair and paint (complete)
Left



Door frame FR
Dent(s) and scratch(es)
Repair and paint (complete)
Right



Door RL
Scratch(es)
Repair and paint (complete)
Left

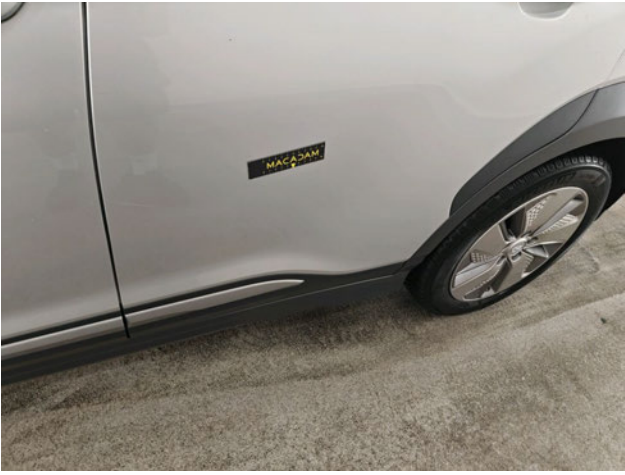

Door RR
Scratch(es)
Repair and paint (complete)
Right




Interior
Stain
Cleaning
Interior



Internal boot lining R
Scratch(es)
Smart repair
Rear




Wheel arch cover FR
Scratch(es)
Replace
Right

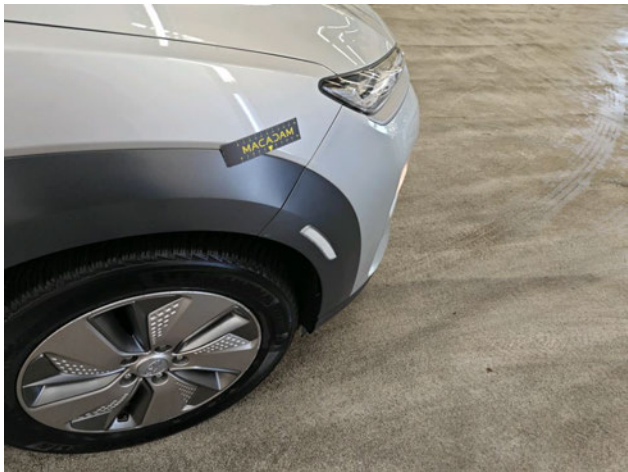

Wing FL
Scratch(es)
Repair and paint (complete)
Left



Wing RL
Scratch(es)
Repair and paint (complete)
Left

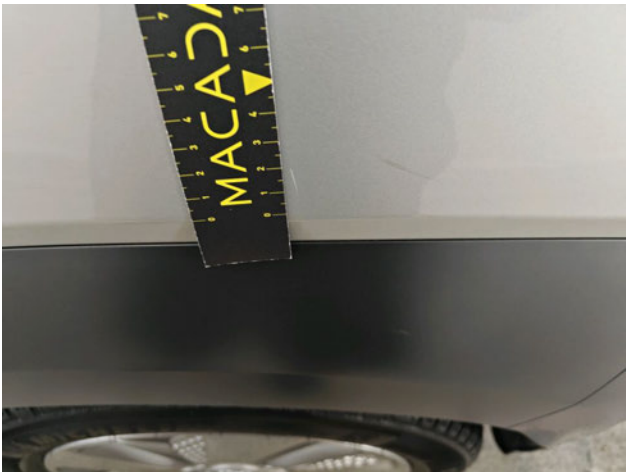

Tyres		
	Front Left	
	Winter	
	215/55/17/94/H	
	Michelin	
	5.9 mm	
	Front Right	
	Winter	
	215/55/17/94/H	
	Michelin	
	5.7 mm	
	Rear Left	
	Winter	
	215/55/17/94/H	
	Michelin	
	5.5 mm	
	Rear Right	
	Winter	
	215/55/17/94/H	
	Michelin	
	5.4 mm	

Checks			
Certificate of Conformity	No	CO2 Emission	0
Digital maintenance	Yes	GPS storage	Yes
GPS storage	HD	Luggage cover	Yes
Number head rests	5	Number of charging cables (rapid charge)	1
Number of keys total	2	Reset to factory settings	Yes, vehicle is reset to factory settings
Service book	Yes	User's manual	Yes

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non-disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.