



PEUGEOT PARTNER: FS-607-AQ

Vinnumber:	VR3EFYHYCLJ667169	Versionname:	PEUGEOT PARTNER BLUEHDI 100 S&S 950KG LONG ASPHALT VU [4P] bvm 5-102CH-5cv (fourgonnettesimple cabine)
First Registrationdate:	12/08/2020	Fiscalpower:	
Expertise Mileage:	134176	Power Kw:	75
Bodytype:	Transporter	Body colour:	White
Gearbox:	MAN 5 VIT	Paint type:	Opaque
Transmission:	Front	Interior colour:	Black
Fueltype:	Diesel	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	3		
Number head rests:	3		
Type of rims (mounted):	Steel		
Category:	Light Commercial Vehicle		

Options

Number of keys total	1	Radio	
Number keys remote	1	Front parking sensors	
GPS big screen color		Rear parking sensors	
Windows electric F		Sliding door right-side	
Cruise Control		Rear view camera	
Steering wheel multifunctional		Seat cover lining	Lining Other
Type of climate control	Manual climate control		

Tyres

	205/60/16/96 V			
Summer tyres:	Fr.L.	Hankook: 10%	Fr.R.	Hankook: 35%
	Re.L.	Hankook: 10%	Re.R.	Hankook: 10%
Tyre profile depth FL				7.4
Tyre profile depth FR				5.9
Tyre profile depth RL				7.6
Tyre profile depth RR				7.4
Tyre size FL				205/60 R 16 96 V
Tyre size FR				205/60 R 16 96 V
Tyre size RL				205/60 R 16 96 V
Tyre size RR				205/60 R 16 96 V
Tyre type FL				All seasons
Tyre type FR				All seasons
Tyre type RL				All seasons
Tyre type RR				All seasons
Tyre make FL				260
Tyre make FR				260
Tyre make RL				260
Tyre make RR				260

Assistance equipment

Spare wheel	Yes	Jack	Yes
-------------	-----	------	-----

Remote ignition key, Missing, Repair/replace (lump sum)



Interior, Dirty, Cleaning




Wing FL, Stone chip(s), Paint



Outside rear-view mirror housing L, Scratch(es), Replace



Outside rear-view mirror base L, Scratch(es), Acceptable

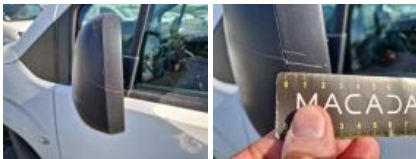

Door FL, Scratch(es), Paint



Side panel L, Dent(s), Acceptable



Outer sill R, Dent(s) and scratch(es), Replace and paint



Sliding door R, Dent(s), Repair and paint (complete)



Boot door panel RR, Stone chip(s), Paint



Boot door panel RL, Stone chip(s), Paint



Bodywork, Glue residues, Sticker removal small



Historique Maintenance

Immatriculation: **FS-607-AQ** Date de 1ère immatriculation: **12/08/2020**

Modèle: **Peugeot PARTNER BLUEHDI 100 S&S 950KG LONG ASPHALT VU [4P] bvm 5-102CH-5cv (fourgonnettesimple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
12/04/2026	133.972	PROFIL PLUS	REPLACEMENT PNEUS ETE
26/08/2025	120.706	SARL GARAGE RABAULT	AMORTISSEURS AV RPLT
	0		FILTRE CLIM RPLT
	0		REVISION
	0		RECYCLAGE
	0		PLAQUETTES AV RPLT
	0		COURROIE ACCESSOIRES RPLT
	0		DIVERS CLIM
	0		REVISION
	0		FILTRE A AIR RPLT
27/01/2025	110.740	PROFIL PLUS	REPLACEMENT PNEUS 4 SAISONS
04/09/2024	102.011	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
04/01/2024	92.502	AUTOMOBILIS	DISQUES PLAQUETTES AV RPLT
22/12/2023	92.108	AUTOMOBILIS	REVISION
	0		BALAIS ESSUIE GLACE AV
19/04/2023	76.053	GOODYEAR FRANCE	REPLACEMENT PNEUS ETE
21/10/2022	62.012	AUTOMOBILIS	DISQUES PLAQUETTES AR RPLT
	0		DISQUES PLAQUETTES AV RPLT
	0		RECYCLAGE
17/10/2022	60.625	AUTOMOBILIS	REVISION ET CLIM
	0		LIQUIDE DE FREIN
	0		RECYCLAGE
	0		BALAIS ESSUIE GLACE AV
	0		REVISION ET CLIM
	0		REVISION ET CLIM
	0		REVISION ET CLIM
14/04/2022	47.380	GOODYEAR FRANCE	REPARATION DE ROUE
24/12/2021	36.068	GOODYEAR FRANCE	REPLACEMENT PNEUS ETE
14/11/2021	31.507	AUTOMOBILIS	RECYCLAGE
	0		PLAQUETTES AV RPLT
12/10/2021	29.630	AUTOMOBILIS	REVISION
	0		RECYCLAGE

Historique Maintenance

Immatriculation: **FS-607-AQ**

Date de 1ère immatriculation: **12/08/2020**

Modèle: **Peugeot PARTNER BLUEHDI 100 S&S 950KG LONG ASPHALT VU [4P] bvm 5-102CH-5cv
(fourgonnettesimple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
	0		BALAIS ESSUIE GLACE AV
11/08/2021	24.485	GOODYEAR FRANCE	REPARATION DE ROUE