



Expertise

Protocol number: 46056801
Order No. / Reference: 26512411
Inspection date: 18 Jun 2026

Manufacturer: Volkswagen
VIN: WVGZZZ5NZNW505310

Model: Tiguan 2.0 TDI SCR DSG R-Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan 2.0 TDI SCR DSG R-Line	
Vehicle Identification number	WVGZZZ5NZNW505310
Mileage (Read)	139,331 km
First registration	10 Jan 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Anthracite-Grey



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	12,700 km
Last service on / at	11/2025 at 126,390 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF454887
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BZG 18901		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,220 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 100V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	255/45 R19 100V	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104H	Winter tyres on Light alloy	Michelin	6mm / 6mm
2)	235/55 R18 104H	Winter tyres on Light alloy	Michelin	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R17 99V	Summer tyres on Steel	Michelin	8 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger including knee airbag on the driver's side (passenger airbag deactivation - knee airbag on the driver's side)
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- Electrically adjustable and heated exterior mirrors (driver's side exterior mirror aspherical)
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles (interior door operation in matte chrome)
- Diesel particulate filter
- Tachometer
- Parking aid (warning signals for obstacles in the front and rear area)
- Driving assistant "Travel Assist" and lane keeping assistant "Lane Assist"
- Electric windows front and rear
- High beam control Light Assist
- Pedestrian detection
- Transmission: 7-speed DSG
- rear window wiper
- Interior mirror automatically dimming
- LED license plate lighting
- Air conditioning system "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Front headrests (safety-optimized - adjustable lengthwise and height)
- Steering wheel: Multifunction sports steering wheel in leather, heated, with touch controls and paddle shifters
- Light in the front footwell
- Front center armrest adjustable in height and length, with storage box and rear air vents
- Emergency call service (no registration required, service is activated upon delivery)
- Pedals and footrest in brushed stainless steel
- Upholstery: Cloth
- Radio accessories: 8 speakers
- Rain sensor
- Tire pressure monitoring system
- Wheels: AirStop tires 255/45 R 19, optimized for low rolling resistance
- Wheels: Alloy (4) "Valencia" 8.5 J x 19, Volkswagen R (tires 255/45 R 19)
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear including belt tensioner for the outer rear seats - warning tone and light for unfastened seat belts at the front and rear)
- Seats: Top comfort seats in the front
- Seats: Front seats with height adjustment
- Airbag: Head airbag system for front and rear passengers including front side airbags
- 30-color ambient lighting
- Adaptive Cruise Control ACC (DSG) (Adaptive Cruise Control ACC "stop & go", with speed limiter - Emergency Brake Assist "Front Assist" (for ACC up to 210 km/h))
- third brake light
- black roof rails
- Decorative inlays "Carbon Grey" (for instrument panel and front door panels)
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic parking brake including auto-hold function
- Electronic stability program with counter-steering support (including ABS, ASR, EDS, MSR and trailer stabilization)
- Automatic headlight control with LED daytime running lights ("Coming home" and "Leaving home" function)
- Windscreen made of laminated safety glass, heat and sound insulating
- Rear window heated
- Rear spoiler in R-style
- ISOFIX mounting points, also for i-Size child seats (device for attaching 2 child seats to the rear seats)
- Instrument cluster with electronic speedometer (odometer, trip meter, tachometer)
- Rear headrests (3)
- LED reading lights, 2 in the front and 2 in the rear
- LED matrix headlights (LED matrix headlights with LED daytime running lights and cornering lights - dynamic headlight range control, with dynamic cornering lights - bad weather lights and turning lights)
- Fatigue detection
- Non-smoking version (storage compartment and 12V socket at the front)
- Package: Winter (front windshield washer nozzles automatically heated - front seats heated)
- Radio "Ready 2 Discover" incl. "Streaming & Internet" (20.3 cm TFT touchscreen - FM radio reception - Prepared for later activation: "Discover Media" navigation function incl. "Streaming & Internet" - Dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - Radio station logos - MP3 playback - USB-C interface with Apple compatibility - Output power 4 x 20 watts - 3-band tone control - Telephone interface - Gesture control - Digital radio reception DAB+)
- Electromechanical power steering (speed-dependent control)
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Seats: Rear bench seat asymmetrically split (longitudinally sliding and folding - with pass-through and center armrest)
- Start-stop system with brake energy recuperation
- Bumpers in body color, in "R-Line" styling



- 12-volt power outlet (on the rear center console and in the luggage compartment)
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote keys

Extra equipment

- Airbag: Side airbags for the outer rear seats (including front side airbags and head airbag system)
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Tailgate with electric opening and closing, adjustable opening angle
- Navigation system "Discover Pro" incl. "Streaming & Internet" (App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Digital radio reception DAB+ - 23.4 cm TFT touchscreen with gesture control - FM radio and diversity antenna - RDS - MP3 playback - 2 USB-C ports - 4 x 20 watts of power - Map with 2D display - "Comfort" phone interface connectable via Bluetooth - Wireless charging - Traffic sign recognition - Voice control - Points of interest - We Connect Plus incl. We Connect free for 3 years)
- Package: Sport package (progressive steering - tinted rear side windows and rear window - sport suspension)
- Rear View reversing camera
- Power outlet: 2 USB-C ports on the front

- Textile floor mats front and rear with decorative stitching in grey
- Green thermal insulation glazing, sides and rear
- Foldable towbar (electric release)
- Electrically adjustable, folding, and heated exterior mirrors, ambient lighting, passenger-side mirror lowering function
- Fire extinguisher
- Wirelessly heated windshield (infrared-reflective, noise-reducing)
- Paint finish: Pearl effect
- LED matrix headlights - IQ.LIGHT (Dynamic Light Assist high beam control for LED matrix headlights - LED headlights with LED daytime running lights and cornering lights - LED taillights, dark red)
- Mesh partition
- Package: Cargo package including spare wheel 215/65 R 17 (230 V socket in the luggage compartment - on-board tools and jack - luggage compartment lighting - luggage compartment floor - spare wheel 6.5 J x 17, steel, for 18-, 19- and 20-inch alloy wheels)
- Package: Driver Assistance Package "Plus"
- Package: Winter, additionally with heated outer rear seats (windscreen washer nozzles automatically heated - front seats and outer rear seats heated)
- "Comfort" telephone interface with inductive charging function

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Interior	Interior (Tierhaare) - Soiled - Clean
2	Door - rear right side	Door handle - outside - Scratch(es) - Smart repair
3	Door - rear right side	Door edge - Scratch(es) - Smart repair
4	Door - front left side	Door edge - Scratch(es) - Smart repair
5	Door - front right side	Door edge - Scratch(es) - Smart repair
6	Sill - left side	Sill - Scratch(es) - Smart repair
7	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
8	Door - rear left side	Door - Scratch(es) - Paint
9	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Boot lid / rear door	Boot lid - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, not professionally repaired, Invoice of repair done	Non-existent

Repainting

No.	Repainting
1	Boot lid / rear door, Mudguard - left side, Professionally carried out, Invoice of repair done

Paint coat thickness measurement

Boot lid / rear door	279 µm	Mudguard - left side	336 µm
----------------------	--------	----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

An unprofessionally repaired previous damage was found at the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

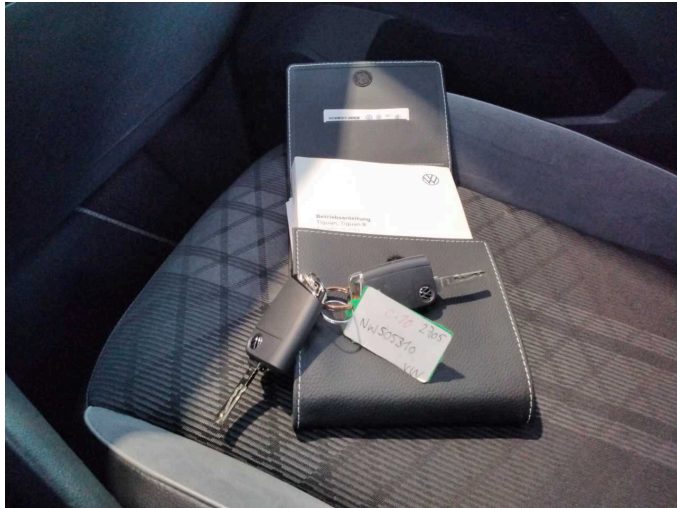


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres

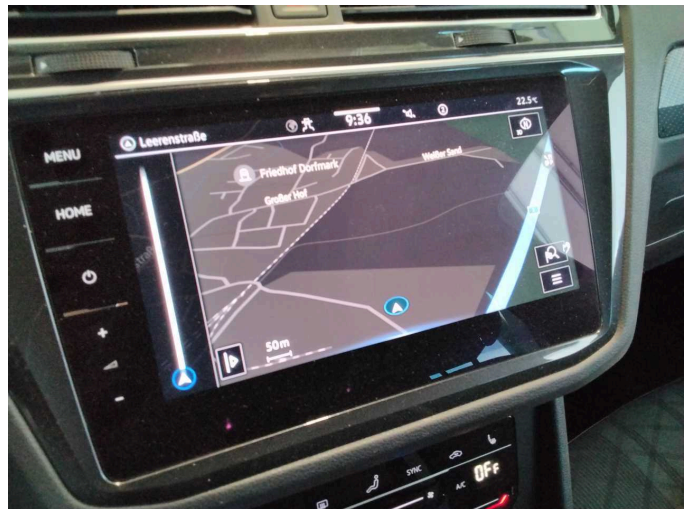


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

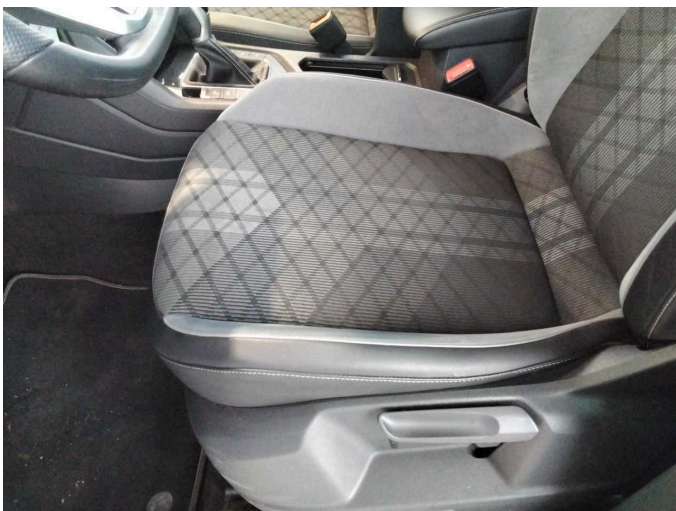


Figure 23: Misc.

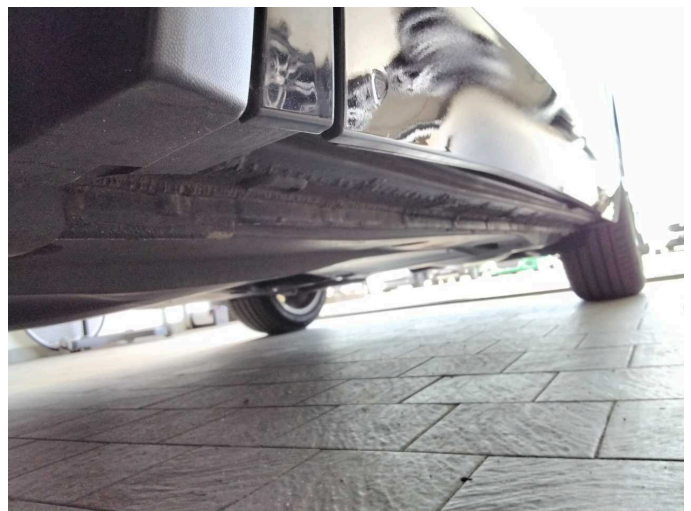


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Damage 1: Interior: Interior (Tierhaare) - Soiled - Clean




Damage 1: Interior: Interior (Tierhaare) - Soiled - Clean



Damage 1: Interior: Interior (Tierhaare) - Soiled - Clean

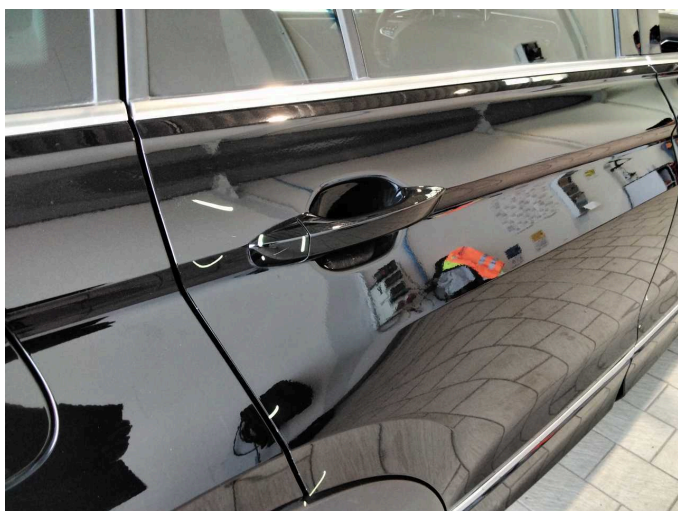


Damage 2: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair

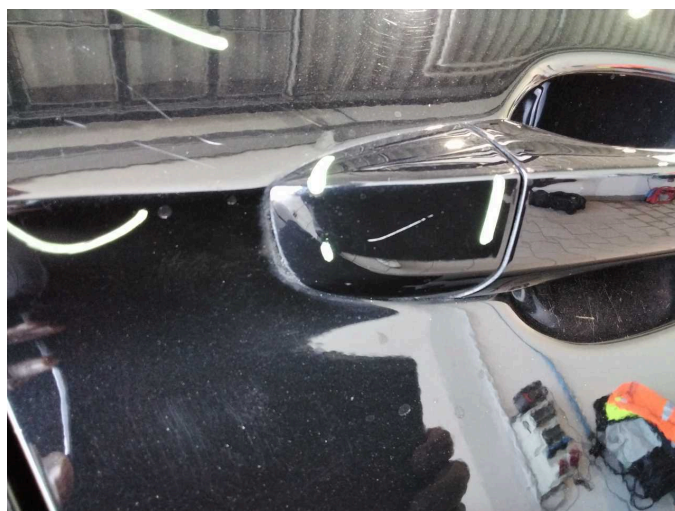


Damage 2: Door - rear right side: Door handle - outside - Scratch(es) - Smart repair



Damage 3: Door - rear right side: Door edge - Scratch(es) - Smart repair

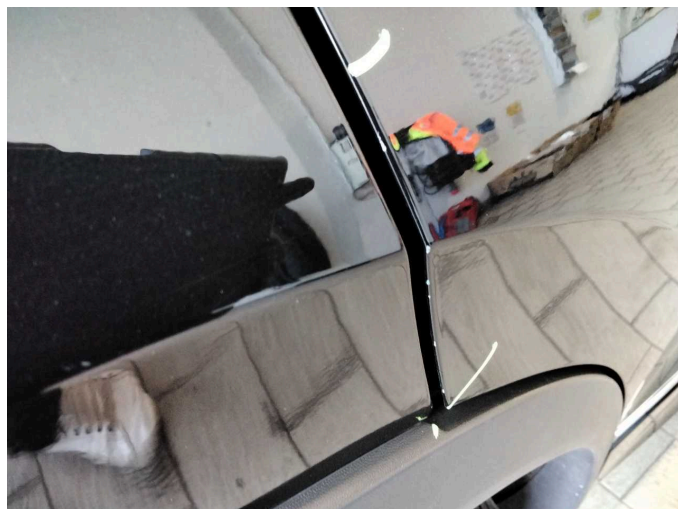

Damage 3: Door - rear right side: Door edge - Scratch(es) - Smart repair

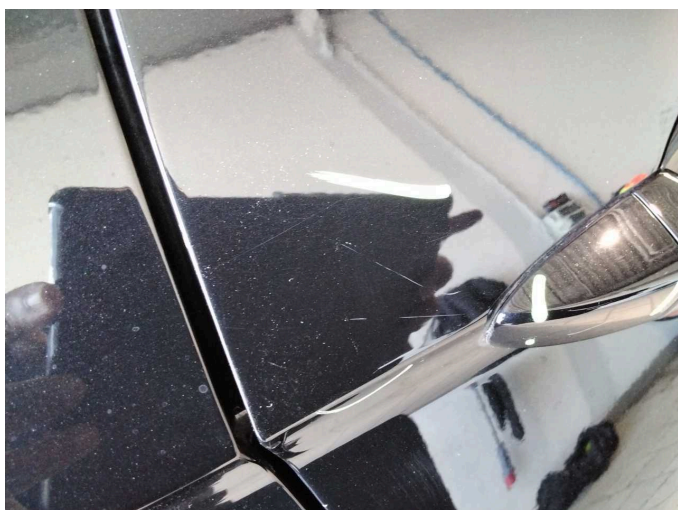


Damage 3: Door - rear right side: Door edge - Scratch(es) - Smart repair




Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door edge - Scratch(es) - Smart repair

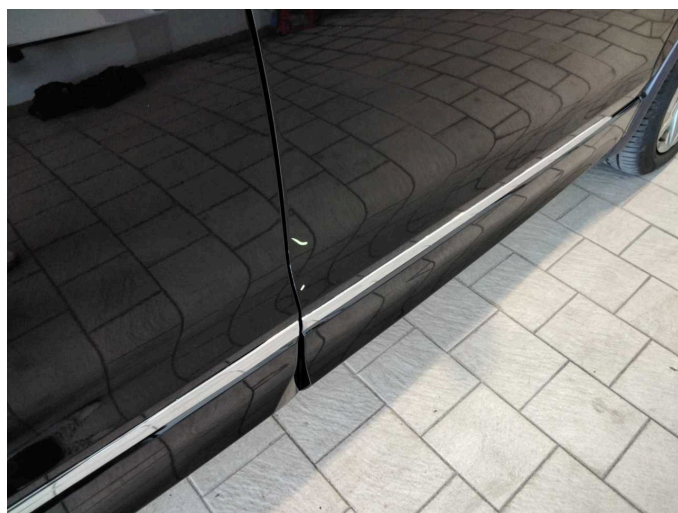

Damage 5: Door - front right side: Door edge - Scratch(es) - Smart repair

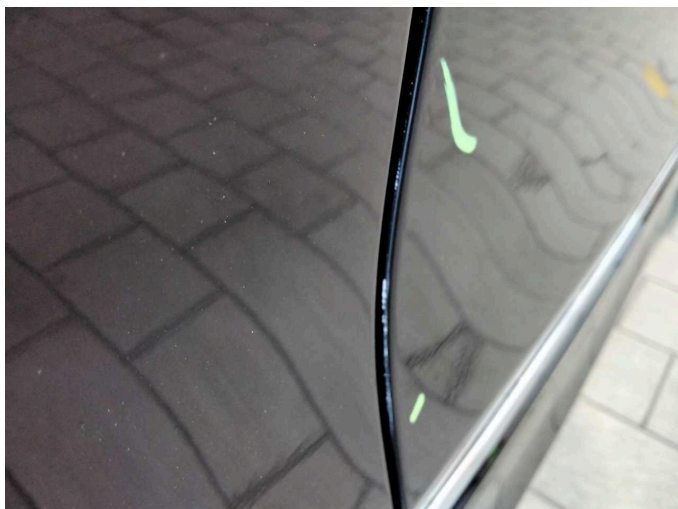


Damage 5: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 6: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 6: Sill - left side: Sill - Scratch(es) - Smart repair

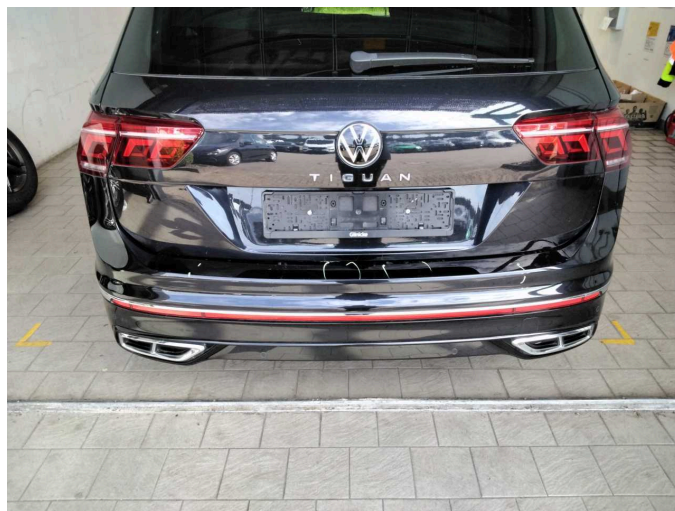

Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

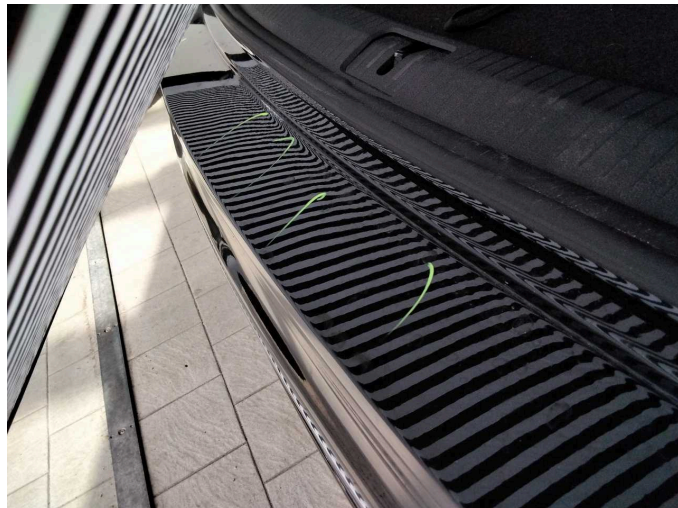


Damage 7: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 8: Door - rear left side: Door - Scratch(es) - Paint

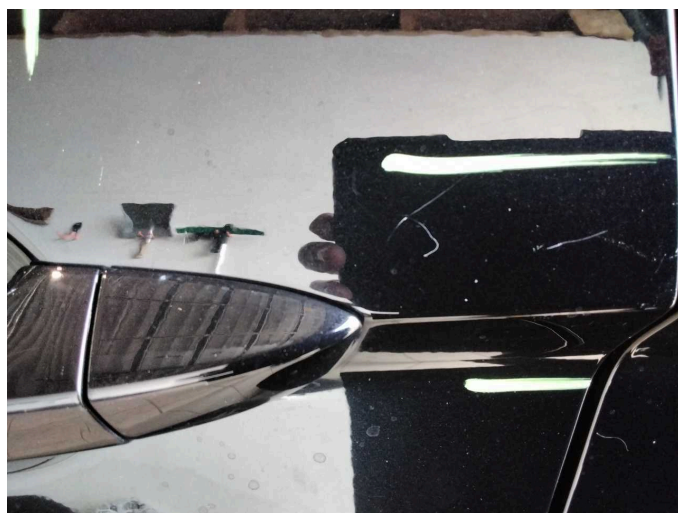

Damage 8: Door - rear left side: Door - Scratch(es) - Paint

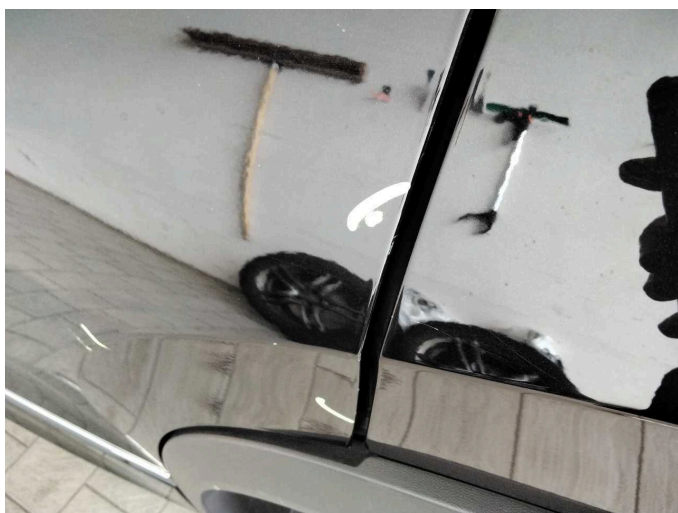

Damage 8: Door - rear left side: Door - Scratch(es) - Paint

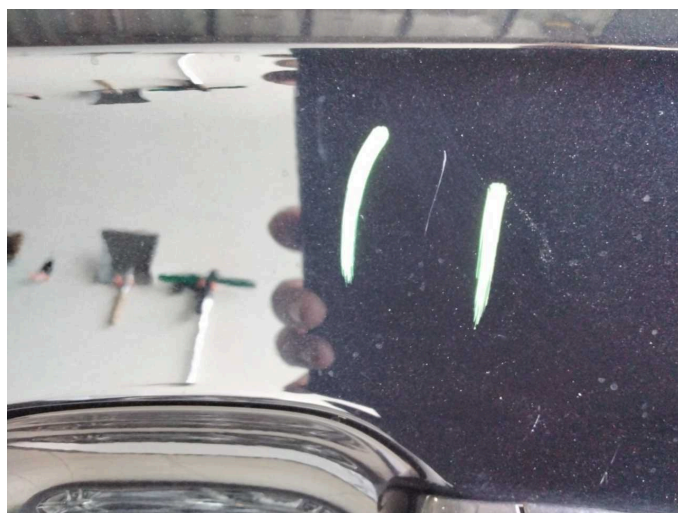

Damage 8: Door - rear left side: Door - Scratch(es) - Paint



Damage 8: Door - rear left side: Door - Scratch(es) - Paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 9: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

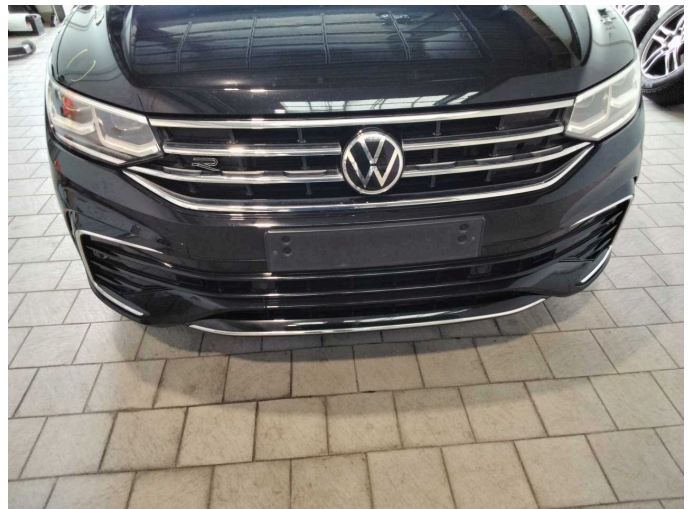

Wear and tear 2: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 3: Boot lid / rear door: Boot lid - dent(s) - No deduction



Wear and tear 3: Boot lid / rear door: Boot lid - dent(s) - No deduction




Repainting 1: Boot lid / rear door, Mudguard - left side



Repainting 1: Boot lid / rear door, Mudguard - left side



Repainting 1: Boot lid / rear door, Mudguard - left side

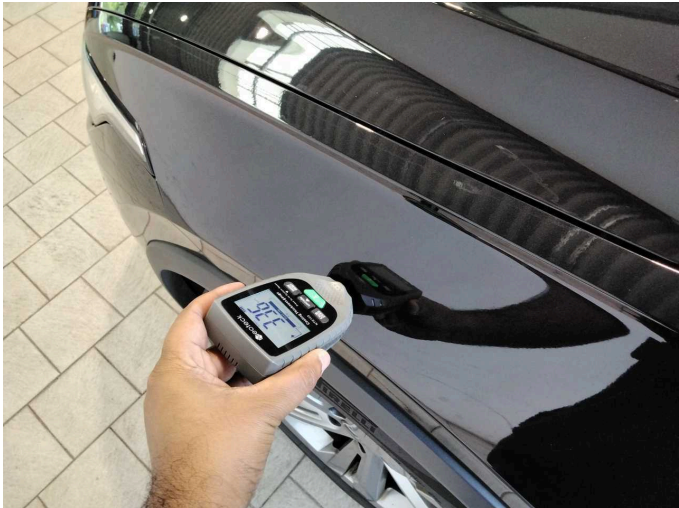

Repainting 1: Boot lid / rear door, Mudguard - left side