



Expertise

Protocol number: 46548989
Order No. / Reference: 26599984
Inspection date: 15 Jul 2026

Manufacturer: Skoda
VIN: TMBLK8NX0NY073809

Model: Octavia Combi 2.0 TDI DSG 4x4 Scout



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI DSG 4x4 Scout	
Vehicle Identification number	TMBLK8NX0NY073809
Mileage (Read)	100,643 km
First registration	6 Oct 2022
Number of holders	1
Power / Engine displacement	147 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	590 Tag(e)
Last service on / at	02/2026 at 91,338 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ953223
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWM 00033		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,114 kg	Empty weight	

Tyres

Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91Y	Summer tyres on Light alloy	Goodyear	4mm / 4mm
2)	225/45 R18 91Y	Summer tyres on Light alloy	Goodyear	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
2)	205/55 R17 95V	Winter tyres on Light alloy	Bridgestone	4mm / 4mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 12/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Airbag: Center airbag front
- Ambient lighting (dashboard, front trim strips and footwell with selectable color climate) in the interior as well as logo projector on the outside)
- Automatically dimming exterior mirror (driver's side)
- Electrically folding exterior mirrors
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative strip in ash brown
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant (Coming Home / Leaving Home function)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec: Start/stop system including brake energy recuperation
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Child safety lock for the rear doors and windows
- Removable boot cover
- Headrests (5) front and rear height adjustable
- Paint finish: Special paint finish, solid color
- LED fog lights
- LED license plate lights
- LED matrix headlights and dynamic high beam assist (AFS) (Dynamic and automatic headlight range control - headlight cleaning system including washer fluid level control)
- Steering wheel: height and reach adjustable
- Rear center armrest with pass-through option
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Front and rear parking sensors
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Voice control
- Rain sensor
- Tire mobility kit (tire repair spray incl. compressor)
- Storage compartments (Four roof grab handles, rear with coat hooks; holder for the warning vest under the driver's seat; storage compartments in the front door panels with 1.5l bottle holders; storage compartments in the rear door panels with 0.5l bottle holders; ticket holder on the windshield; coat hooks on the B-pillars; storage compartments in the doors with felt lining)
- All-wheel drive 4x4
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Center section of the dashboard with fabric covering
- Electrically adjustable and heated exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Glasses compartment in the headliner
- Roof rails, anodized
- Diesel particulate filter
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Driving profile selection
- Chassis: Chassis lift (15 mm increased ground clearance - modified damper settings - engine underbody protection)
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Tinted windows
- Heated rear window
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger and anti-allergen filter & activated carbon filter - air-conditioned and illuminated glove compartment)
- LED taillights in crystal glass look and animated turn signals
- LED headlights with LED daytime running lights
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Heated steering wheel including heated front seats
- Steering wheel: Leather steering wheel with multifunction buttons and paddle shifters (leather steering wheel and gearshift lever with leather elements - infotainment and driver assistance system operation)
- Pedals in stainless steel look
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Bluetooth hands-free system
- Radio accessories: SmartLink (Apple CarPlay - Android Auto)
- Tire pressure monitoring
- Wheels: 18" Braga alloy wheels (7.5J x 18, ET 48 with 225/45 R18 tires)
- Safety lights in the front side doors
- Seats: Rear seat backrest split 60:40, foldable



- Electromechanical power steering
- Seat belts (Three three-point seat belts in the rear)
- Seats: Height-adjustable driver and passenger seats (including lumbar support)
- Speed limiter
- Lane keeping assistant (Lane Assist)
- 12V socket in the trunk
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Phone: Wireless SmartLink for Apple CarPlay
- Textile floor mats
- Front door sill trims
- Lashing eyes in the trunk
- Immobiliser

- SKODA Care Connect (SOS emergency call function (eCall+ including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection option for rapid assistance in case of breakdown) - Information service (connection option to the hotline for all questions relating to vehicle functions) - Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Central locking including remote control integrated into the key and EASY Start

Extra equipment

- Swiveling trailer hitch including trailer stabilization and adapter
- Paint finish: Pearl effect
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Heated windscreen
- Luggage net partition
- Stainless steel rear protection strip
- Package: Infotainment Columbus Plus (Columbus navigation system - Infotainment Online (3-year term) - Head-Up Display)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Wheel / tyres	Tyre - front right side (Druckverlust; Mehrkosten können entstehen) - Perform diagnosis
3	Side panel - rear right side	Elbow - Scratch(es) - Smart repair
4	Boot lid / rear door	Rear spoiler - Scratch(es) - Paint
5	Bonnet	Bonnet - Stone chips - Repair and paint



Wear and tear

No.	Component group	Description
1	Roof	Roof - dent(s) - No deduction
2	Side panel - rear right side	Sill - Scratch(es) - No deduction
3	Door - rear right side	Door - dent(s) - No deduction
4	Roof	Roof rail - left side - Stone chips - No deduction
5	Front bumper	Front bumper - Stone chips - No deduction
6	2nd wheel set	Tyres - complete set (Über 4mm Profiltiefe) - No deduction
7	2nd wheel set	1 alloy rim - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 30 Apr 2024	1.088,76 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

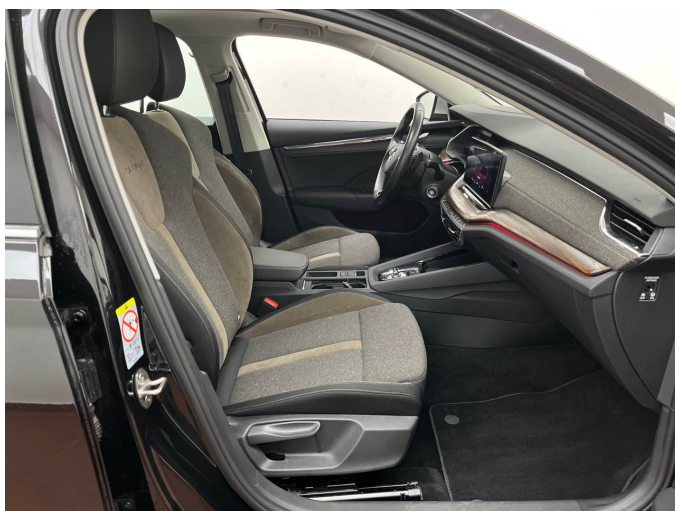


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

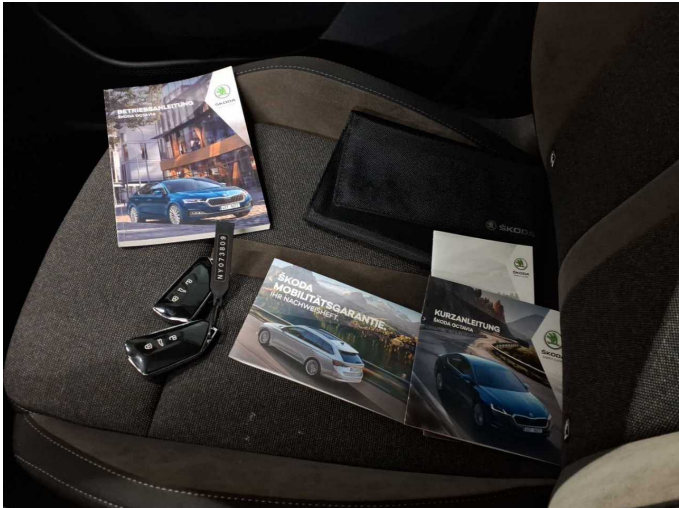


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

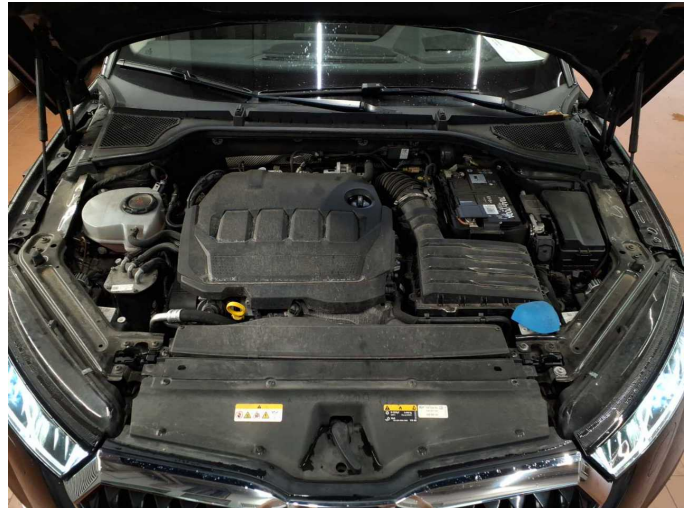


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

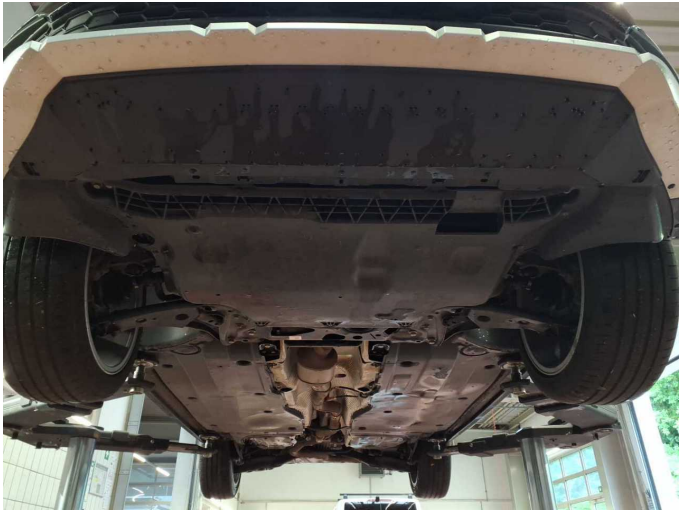



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

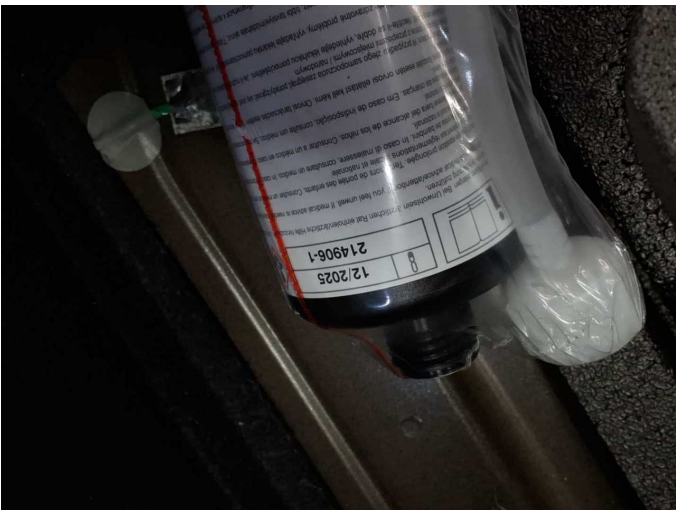

Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Wheel / tyres: Tyre - front right side (Druckverlust: Mehrkosten können entstehen) - Perform diagnosis



Damage 2: Wheel / tyres: Tyre - front right side (Druckverlust; Mehrkosten können entstehen) - Perform diagnosis



Damage 3: Side panel - rear right side: Elbow - Scratch(es) - Smart repair

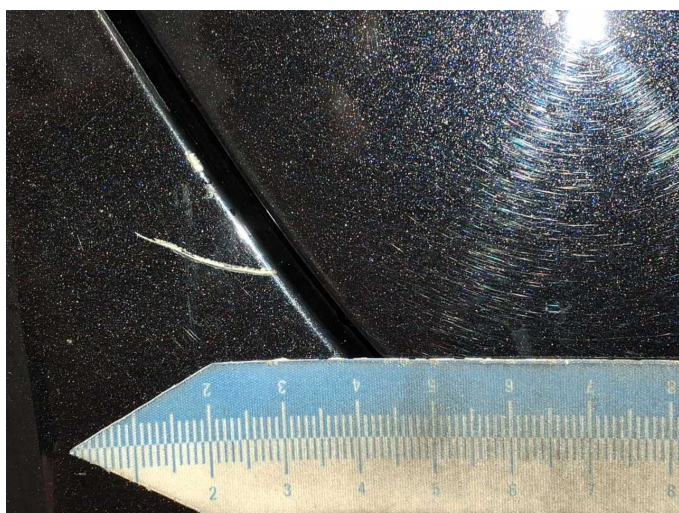

Damage 3: Side panel - rear right side: Elbow - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Rear spoiler - Scratch(es) - Paint



Damage 4: Boot lid / rear door: Rear spoiler - Scratch(es) - Paint




Damage 5: Bonnet: Bonnet - Stone chips - Repair and paint



Damage 5: Bonnet: Bonnet - Stone chips - Repair and paint



Damage 5: Bonnet: Bonnet - Stone chips - Repair and paint

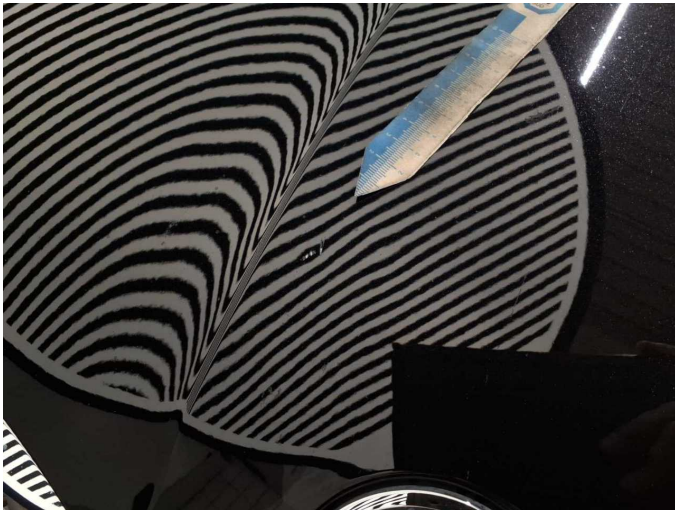

Damage 5: Bonnet: Bonnet - Stone chips - Repair and paint



Wear and tear 1: Roof: Roof - dent(s) - No deduction




Wear and tear 1: Roof: Roof - dent(s) - No deduction



Wear and tear 1: Roof: Roof - dent(s) - No deduction



Wear and tear 2: Side panel - rear right side: Sill - Scratch(es) - No deduction

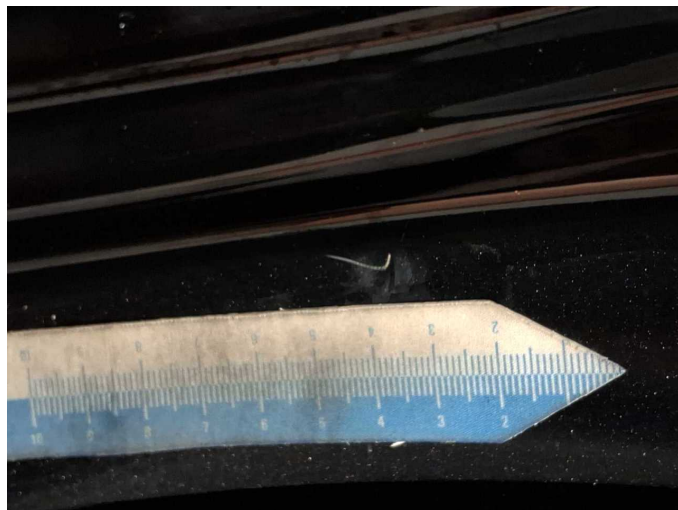

Wear and tear 2: Side panel - rear right side: Sill - Scratch(es) - No deduction



Wear and tear 3: Door - rear right side: Door - dent(s) - No deduction



Wear and tear 3: Door - rear right side: Door - dent(s) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLK8NX0NY073809

Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI DSG 4x4 Scout

Datum	KM-Stand	Beschreibung
25.02.2026	91.338	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.09.2025	78.362	AU
26.08.2025	75.889	Batterie ern; Systemtest/Eigendiagnose
15.01.2025	61.210	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
21.11.2023	31.352	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges