



Expertise

Protocol number: 46426043
Order No. / Reference: 26554411
Inspection date: 9 Jul 2026

Manufacturer: Audi

Model: A6 50 TDI quattro tiptronic sport

VIN: WAUZZZF2XPN085191



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A6 50 TDI quattro tiptronic sport	
Vehicle Identification number	WAUZZZF2XPN085191
Mileage (Read)	122,809 km
First registration	8 Sept 2023
Number of holders	1
Next periodical technical inspection	09/2026
(Report not on hand)	
Power / Engine displacement	210 kw / 2,967 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 6
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	Saloon car
Colour / colour code	Mythosschwarz Metallic
Doors / Seats	4 / 5
Upholstery type	Leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	1,200 km
Last service on / at	10/2025 at 100,424 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GV236869
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BTI 02732		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,475 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/55 R18 102Y	Summer tyres on Light alloy	Michelin	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R17 99H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	225/60 R17 99H	Winter tyres on Light alloy	Pirelli	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service m.connect remote & control
- Electrically adjustable and heated exterior mirrors
- third brake light
- Decorative inlays aluminum fragment
- Tachometer
- Door sills with aluminum inlay front and rear
- Driver information system with color display
- Automatically opening luggage compartment lid/manually opening luggage compartment lid
- Interior lighting
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- LED headlights
- Steering column, manually adjustable in height and axis
- front center armrest
- Package Gloss
- Progressive steering
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus with MMI touch response
- Seats: 4-way lumbar support
- Sun visor on driver and passenger side
- Start-stop system
- Glazing: Rear window, rear door and side windows in clear glass
- Central locking
- Airbag for driver and front passenger
- All-wheel drive "quattro" with self-locking center differential
- Audi connect navigation & infotainment
- Audi drive select
- Audi pre sense front
- Exterior mirror housings in body color
- Fabric headliner
- Diesel particulate filter (DPF) with nitrogen oxide catalyst and AdBlue tank
- Electronic Stability Control (ESC)
- key fob
- Cruise control system including speed limiter
- Transmission: 8-speed automatic transmission tiptronic
- Interior mirror dimming
- 2-zone automatic climate control
- Headrests (4)
- Steering wheel: Leather steering wheel, 3-spoke, with multifunction and paddle shifters
- MMI navigation with MMI touch response
- Non-smoking package
- Wheel: Alloy wheels, 5-arm design
- Wheel: Tire repair kit
- Radio accessories: 8 speakers (passive) front and rear
- Seats: Front sports seats
- Lane Departure Warning
- Glazing: Windscreen in heat-insulating glazing
- Electronic immobilizer
- Thermal insulation glazing on the sides and rear



Extra equipment

- Swiveling towbar with electric release (with swiveling ball head, trailer stabilization via electronic stability control (ESC), release via button in the luggage compartment, the integrated swiveling system socket allows continuous operation of electrical devices in the trailer or caravan while driving)
- Comfort key with sensor-controlled luggage compartment unlocking (The vehicle can be opened by operating the door handle without actively using the key. To lock the vehicle from the outside, simply touch one of the sensor buttons on the door handles. The drive authorization is also activated without actively using the comfort key. The driver must be inside the vehicle and have the comfort key with them. The engine is started and stopped using the engine start/stop button in the center console.)
- Assistance Package Plus (Parking Assistance Package with Remote Parking Assist Plus (surround view cameras, Remote Parking Assist Plus) - City Assistance Package (Intersection Assist, Lane Change Warning, Exit Warning, Rear Cross Traffic Assist, Audi pre sense 360°) - Tour Assistance Package (Adaptive Driving Assist, Adaptive Speed Assist, Speed Limiter, Efficiency Assist, Turn Assist, Evasive Steering Assist, Camera-based Traffic Sign Recognition, Emergency Assist, High Beam Assist))
- Package: Storage package (2 cup holders in the rear center armrest, luggage compartment net for fixing to the lashing eyes on the luggage compartment floor)
- Seat covers in Valcona leather (for sports seats) (seat center panels, seat side bolsters, headrests and front center armrest in Valcona leather, door panel inserts in Alcantara)
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and sport seats plus also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- Electric sunshade for the rear window (manual for the rear door windows)
- Telephone: Audi smartphone interface (The Audi smartphone interface (Android Auto and Apple CarPlay) connects your smartphone to your Audi and seamlessly displays your smartphone content directly on the MMI display via USB. Navigation, telephony, music and selected third-party apps can be conveniently controlled via the MMI touchscreen as well as via voice control on your smartphone.)
- Chassis: Sport chassis (with firmer spring and damping for more direct road contact and sportier handling, lowered by 20 mm compared to standard chassis, shock absorbers and coil springs on front and rear axles)
- High beam assist (within the system's limits, it automatically detects oncoming headlights, taillights of other road users, and built-up areas. Depending on the traffic situation, the high beam is automatically switched on or off.)
- Fuel tank (73 liters) (fuel tank for 73 liters of gasoline/diesel fuel)
- Paint finish: Metallic
- Ambient lighting package (in addition to the standard interior lighting: - Ambient fabric lighting in the front/rear doors - Pre-view lighting from the front/rear door handles - Ambient lighting of the instrument panel)
- Business Package (Assistance Package Tour: Adaptive Driving Assistant supports the driver with acceleration, braking, maintaining speed and distance, and lane keeping. Adaptive Cruise Control, Speed Limiter. Efficiency Assistant supports the driver with predictive driving. Parking Aid Plus, 4-zone automatic climate control, heated front seats, Audi phone box, automatically dimming interior mirror, automatically dimming exterior mirrors, adaptive windscreen wipers with integrated washer nozzles, high-beam assistant)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Seats: Split-folding rear seat backrest (pronounced outer rear seats, visually adapted to the front seats, and an additional central seat option - 3 L-shaped rear headrests, manually height-adjustable for good rear visibility - three 3-point seat belts - rear seat backrest split 40:20:40 or fully foldable - one-piece, foldable rear center armrest with storage compartment)
- Telephone: Audi Phone Box (Up to two smartphones can be paired with the vehicle simultaneously via Bluetooth, allowing you to play music through the vehicle or make phone calls from either smartphone. The universal smartphone holder connects to the vehicle's antenna, improving both reception and call quality. The smartphone can also be charged wirelessly using the Qi standard or via USB.)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door (Polieren) - Soiled - Smart repair
2	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
3	Front bumper	Front bumper - Scratched - Repair and paint
4	Side panel - rear right side	Side panel - Scratch(es) - Paint
5	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Mudguard - left side	Mudguard - left side - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction
4	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich - Mehrkosten möglich.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

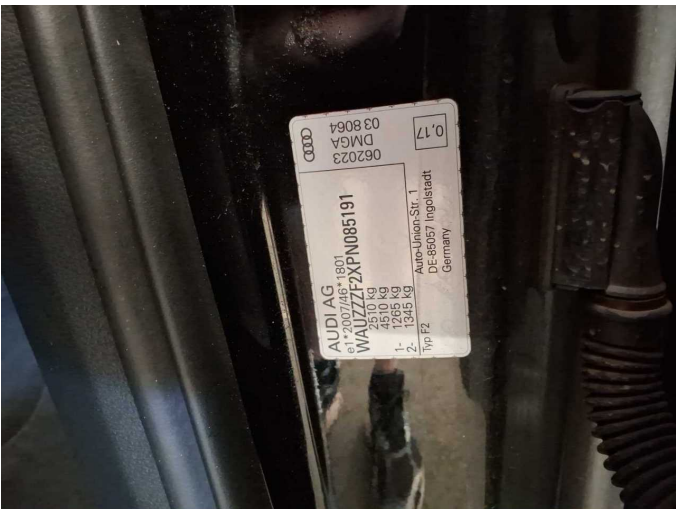


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

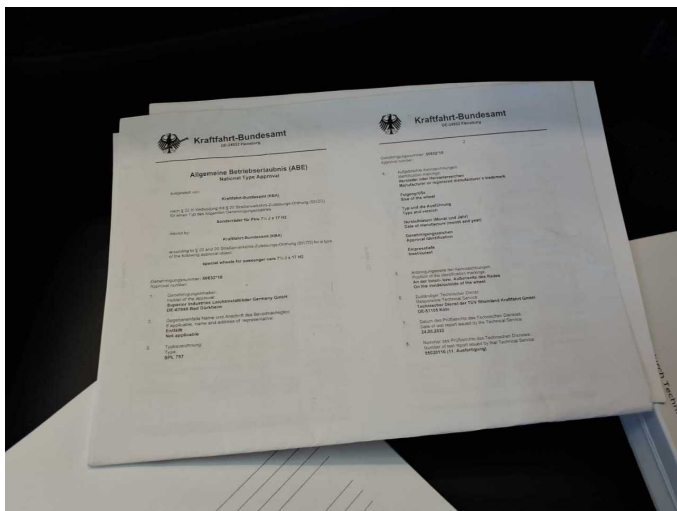


Figure 15: Documents

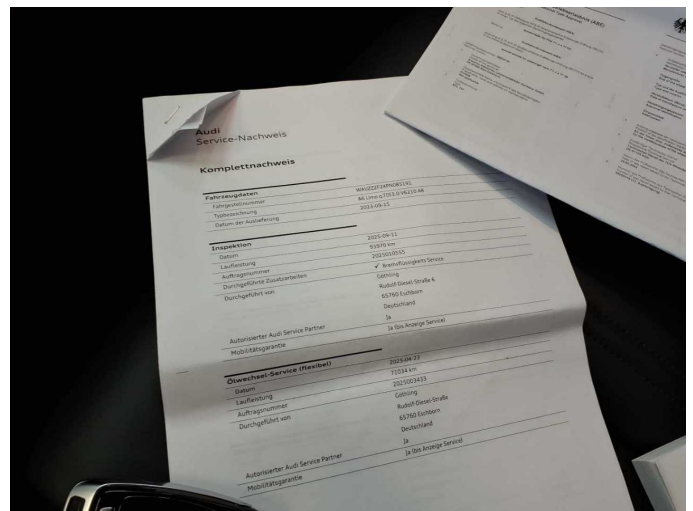


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.

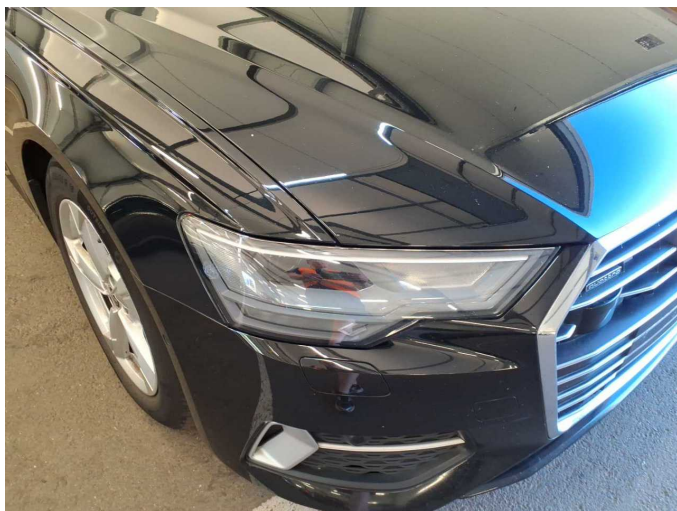


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.


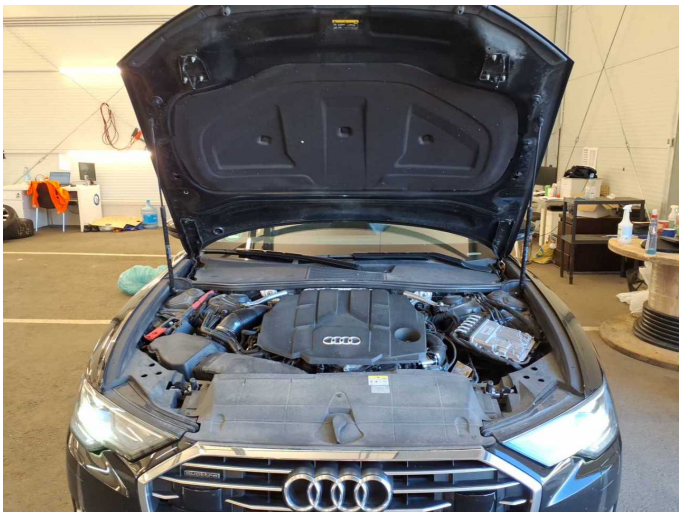



Figure 36: Misc.




Figure 37: Misc.

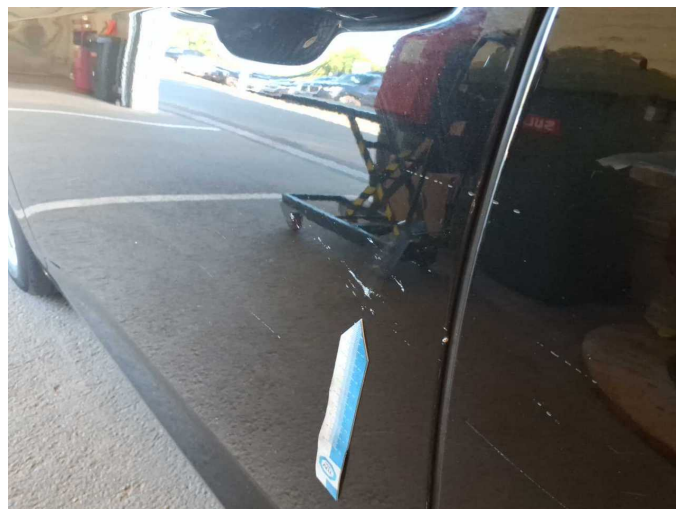


Damage 1: Door - front left side: Door (Polieren) - Soiled - Smart repair

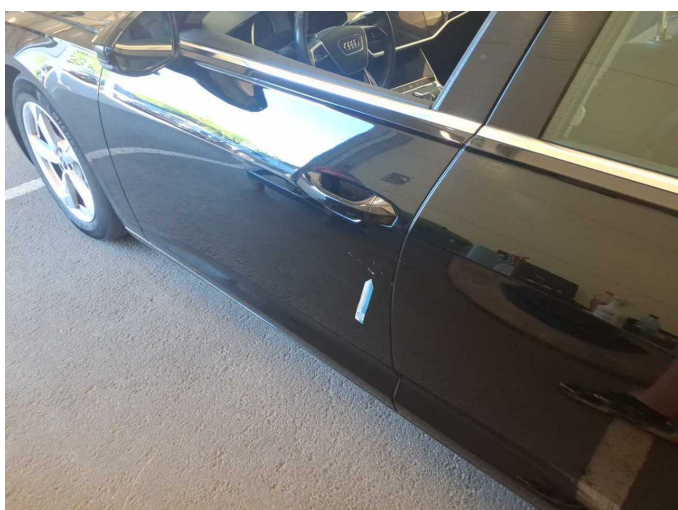


Damage 1: Door - front left side: Door (Polieren) - Soiled - Smart repair

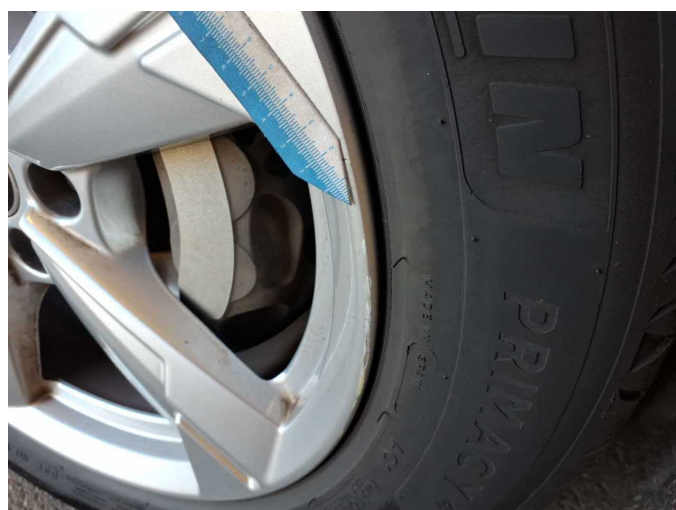


Damage 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value

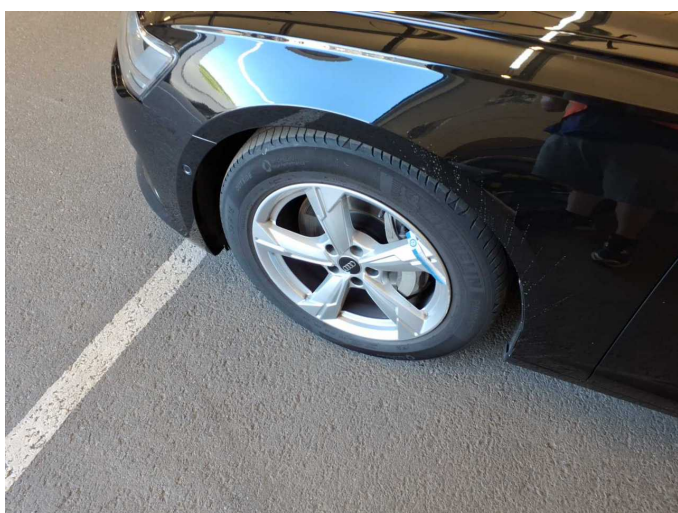

Damage 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value

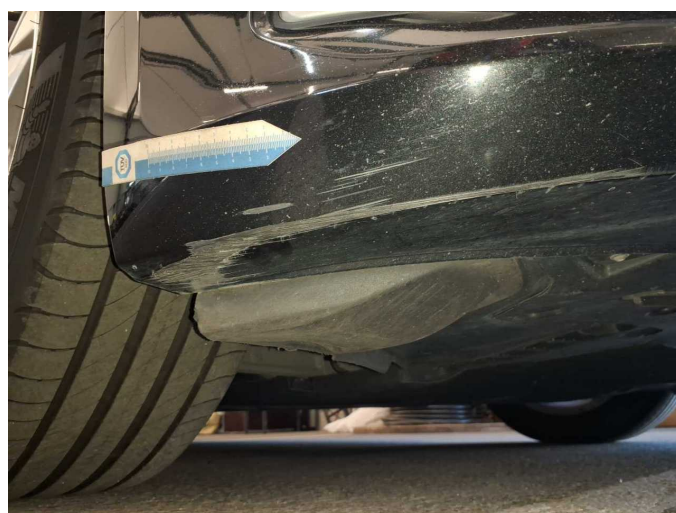

Damage 3: Front bumper: Front bumper - Scratched - Repair and paint

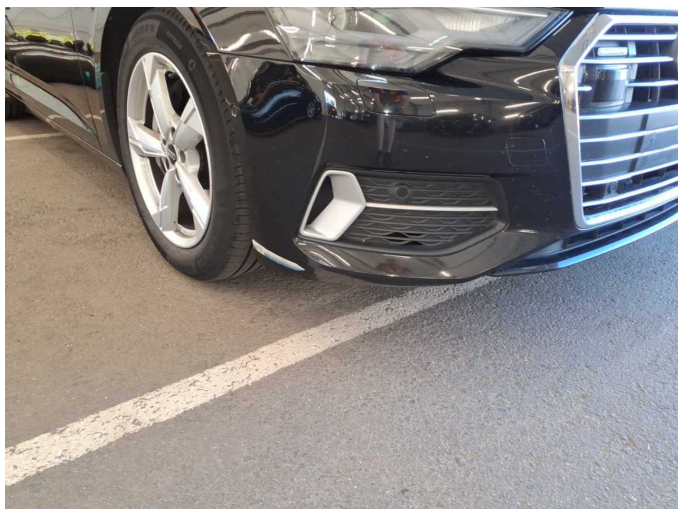


Damage 3: Front bumper: Front bumper - Scratched - Repair and paint



Damage 3: Front bumper: Front bumper - Scratched - Repair and paint




Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint

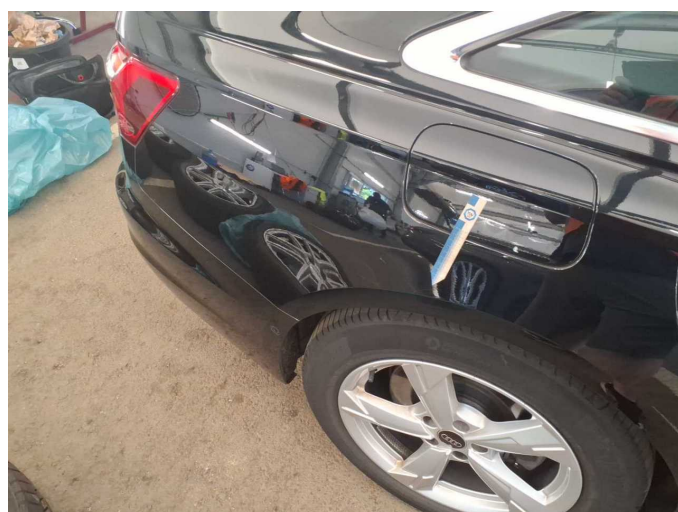

Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint




Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint

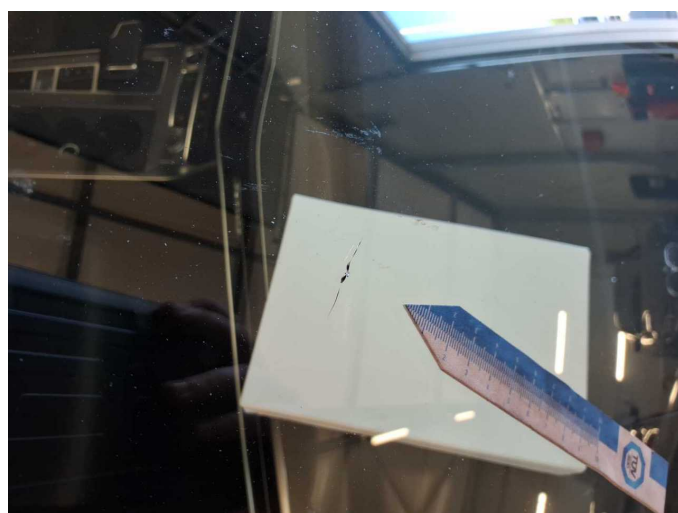


Damage 5: Vehicle glazing: Windscreen - Broken / torn - Replace




Damage 5: Vehicle glazing: Windscreen - Broken / torn - Replace

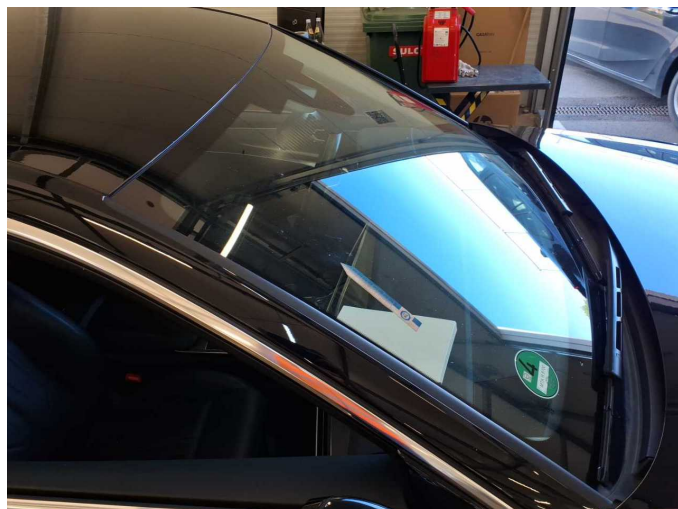


Damage 5: Vehicle glazing: Windscreen - Broken / torn - Replace

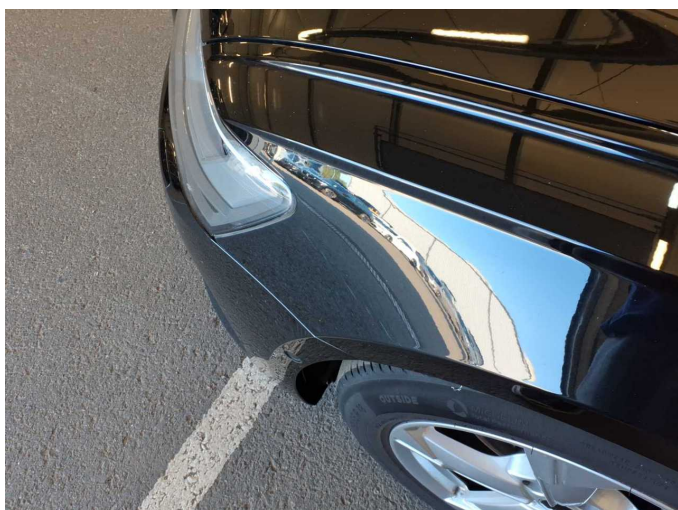

Wear and tear 1: Mudguard - left side: Mudguard - left side - Scratch(es)
- No deduction

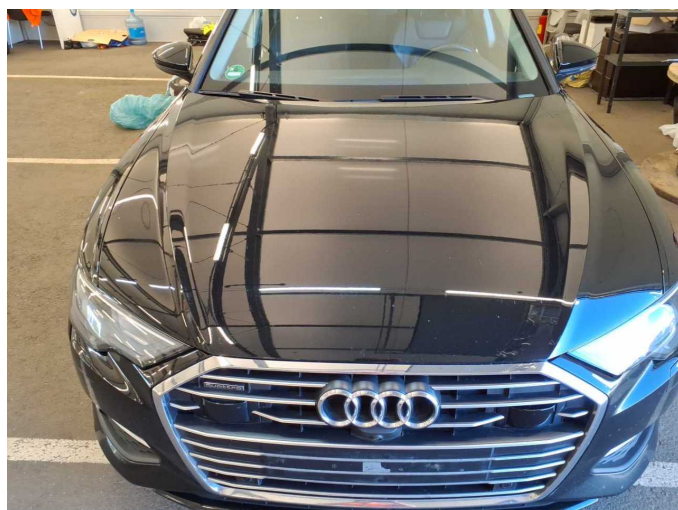

Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction

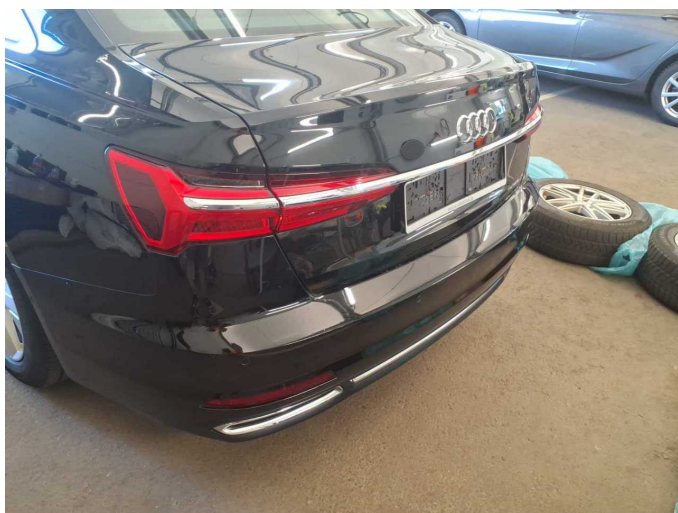

Wear and tear 4: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF2XPN085191
Hersteller / Modell: AUDI AUDI A6 50 TDI quattro tiptronic sport

Datum	KM-Stand	Beschreibung
23.10.2025	100.424	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
11.09.2025	93.970	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
23.04.2025	71.034	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.02.2025	61.191	Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose
12.12.2024	54.499	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
11.06.2024	30.934	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Regelwartungsdienst
18.04.2024	25.310	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges