DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	W0V7H9EN0 R4012418	Registration date	24/06/2024	Exterior Color	Unknown
Brand	OPEL	Licence Plate	Y-908 421	Odometer	40 287 km
Model	CROSSLAND 1.5 Diesel 81kW Elegance				

Inspection Details

Arrival Date	08/07/2026	Inspection ID	7052435	Inspection date	13/07/2026
Assign Date	08/07/2026	Fleet owner	Leasys Privat Leasing	Inspection loc.	Leasys AKB Zörbig



Generic equipment

Removable element

Spare wheel kit	✓
Toolkit	✓
Rear parcel shelf	✓
Separation net	✓
Floor mat BR	✓
Floor mat BL	✓
Floor mat FR	✓
Floor mat FL	✓
Aerial cable	✓


Technical Document

Spare key	✓
Remote key	✓
User manual	✗
Warranty booklet	✗
Log books	✗
Service	✗

Tyres

Bridgestone 195/60/16 H All seasons
5.0 mm

Bridgestone 195/60/16 H All seasons
5.0 mm

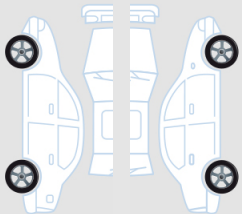

Bridgestone 195/60/16 H All seasons
6.0 mm

Bridgestone 195/60/16 H All seasons
6.0 mm

Exception / Damage

1



Part	User manual	Repair Time	-	Part Cost	20.00€
Position	-	Repair Cost	-	Gross Cost	20.00€
Damages	Missing	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	- 3.00
Repair mode	Replace	Flat Rate	-	**Net Cost**	**17.00€**

2



Part	Warranty booklet	Repair Time	-	Part Cost	20.00€
Position	-	Repair Cost	-	Gross Cost	20.00€
Damages	Missing	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**20.00€**

3



Part	Service manual holder	Repair Time	-	Part Cost	20.00€
Position	-	Repair Cost	-	Gross Cost	20.00€
Damages	Missing	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**20.00€**

4



Part	Service	Repair Time	-	Part Cost	300.00€
Position	-	Repair Cost	-	Gross Cost	300.00€
Damages	Missing	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**300.00€**

Serviceheft fehlt

5



Part	Door sill	Repair Time	0.30	Part Cost	-
Position	Back left	Repair Cost	42.00€	Gross Cost	162.00€
Damages	Scratched	Paint Time	0.80	Depreciation %	-
Severity	-	Paint cost	120.00€	Depreciation	-
Repair mode	Lumpsum repair	Flat Rate	162.00€	**Net Cost**	**162.00€**

6



Part	Bumper	Repair Time	-	Part Cost	-
Position	Back right	Repair Cost	-	Gross Cost	37.50€
Damages	Scratched	Paint Time	0.25	Depreciation %	-
Severity	-	Paint cost	37.50€	Depreciation	-
Repair mode	Polishing	Flat Rate	37.50€	**Net Cost**	**37.50€**

7



Part	Door	Repair Time	-	Part Cost	-
Position	Front right	Repair Cost	-	Gross Cost	37.50€
Damages	Scratched	Paint Time	0.25	Depreciation %	-
Severity	-	Paint cost	37.50€	Depreciation	-
Repair mode	Smart Repair	Flat Rate	37.50€	**Net Cost**	**37.50€**

8

Part	Bumper	Repair Time	-	Part Cost	-
Position	Front	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

9

Part	Bonnet	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	15.00%
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

DEKRA Automotive Solutions

10



Part	Windscreen	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	-

Summary Inspection

Gross Price	597.00€	Depreciation	-3.00€	Net Price	594.00€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	140.00€	0.30	42.00€	-	-	42.00€
Paintwork	150.00€	1.30	195.00€	-	-	195.00€
Paint preparation	150.00€	0.00	0.00€	-	-	0.00€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	360.00€	0.83 %	-3.00€	357.00€
Flat Rate	-360.00€	-	-	-360.00€