



Expertise

Protocol number: 46564636
Order No. / Reference: 26702165
Inspection date: 16 Jul 2026

Manufacturer: Opel

Model: Insignia Grand Sport 2.0 Diesel Automatik Business

VIN: W0VZT6EP1M1029827



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Insignia Grand Sport 2.0 Diesel Automatik Business

Vehicle Identification number W0VZT6EP1M1029827
Mileage (Read) 137,957 km
First registration 7 Feb 2022
Number of holders 1
Next periodical technical inspection 02/2027
(Report on hand)

Power / Engine displacement 128 kw / 1,995 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Automatic / 8
Type of drive Front drive
Type of vehicle Saloon car

Colour / colour code Jade Weiß
Doors / Seats 5 / 5
Upholstery type Cloth
Colour of upholstery Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	38 %
Last service on / at	12/2025 at 120,389 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF946223
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMB 00202		
Permitted total weight	2,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101W	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	225/55 R17 101W	Summer tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments
- Airbag: Front and rear outer head airbags
- Ambient lighting
- Electrically adjustable and heated exterior mirrors for driver and passenger side
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Transmission: 8-speed automatic transmission
- Child safety lock in the rear doors, manual
- Front headrests
- Paint finish: Solid
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1 (AGR, Driver)
- Parkpilot, front and rear parking aid
- Quickheat rapid heating system
- Radio: Multimedia Navi Pro with 8" color touchscreen display
- Wheels: 7.5 J x 17 alloy wheels in a 5 double-spoke design
- Seat belts: Three-point seat belts in all seats
- Visibility equipment
- Start/Stop System
- Traction Control (TC) Plus
- Pre-installation for child seat mounting system "ISOFIX"
- Thermal insulation glazing, green tinted
- Second folding ignition key
- Airbag: Front airbags and side airbags, driver and front passenger
- Anti-lock braking system (ABS)
- Hill Start Assist
- third brake light
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Pedestrian protection including active hood
- Speed controller
- Back window, heater
- Automatic climate control, two zones
- Rear headrests (3 pieces)
- LED headlights
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake
- Upholstery: Billy fabric, black
- Radio: Digital radio reception DAB+
- Tire repair kit
- Tire pressure gauge
- Rear seat backrest folds forward in a 60:40 split
- Power steering
- safety net
- Lane Keeping Assist
- Bumpers painted in body color
- Traffic sign assistant
- Immobiliser
- Central locking with remote control

Extra equipment

- Package: Business Premium (Easy Access Package: Keyless locking and starting system, sensor-controlled tailgate, electric loading sill protection, stainless steel - Charging Package: Wireless charging, 2 USB ports, rear center console - Park & Go: Digital reversing camera, reversing assistant, lane change assistant, blind spot warning in both exterior mirrors - Innovation Package 1: IntelliLux LED Pixel headlights, traffic sign assistant - Solar Protect heat-insulating glass, heavily tinted, in the rear)
- Electric glass sliding/tilting roof (with pre-selection function and spoiler position, including anti-pinch protection, comfort closing function via radio remote control of the central locking system, and manually operated sunshade)
- Package: Sound (Bose sound system)
- Swiveling trailer hitch (including trailer stability program)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Broken / torn - Replace
2	Mudguard - right side	Mudguard - right side (Lackläufer) - Paint defect - Cover / polish
3	Door - front right side	Door - Scratched - Smart repair
4	Door - rear right side	Door (Lack Pickel) - Paint defect - Smart repair
5	Door - front left side	Door - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit complete

Repainting

No. Repainting

1	Door - rear left side
---	-----------------------

Paint coat thickness measurement

Door - rear left side	283 µm
-----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

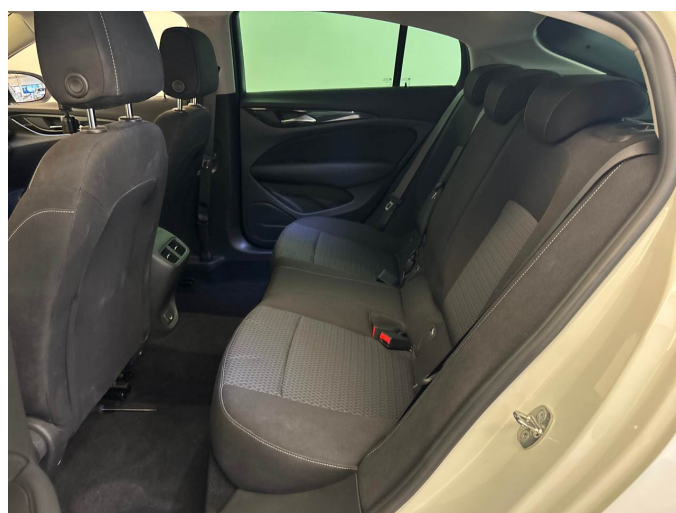


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

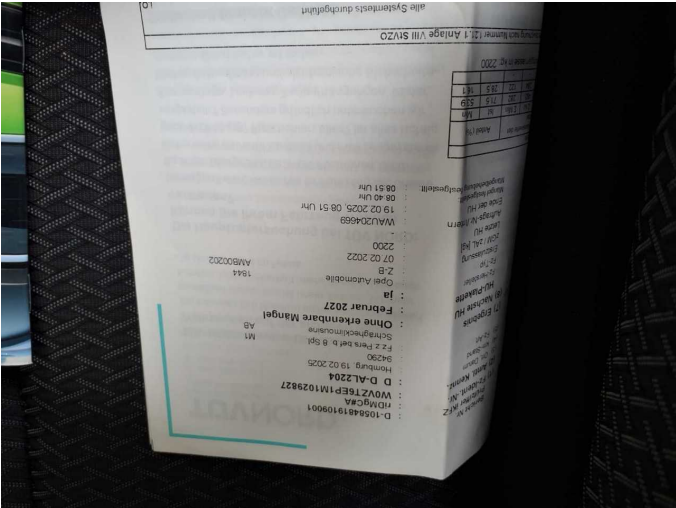


Figure 13: Documents

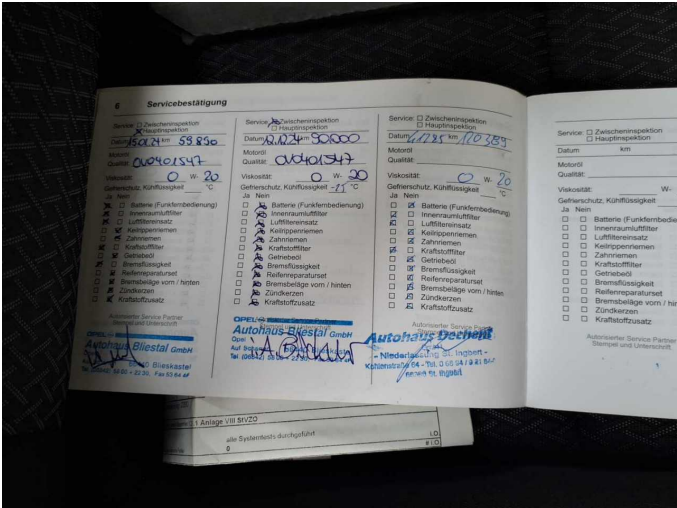


Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres

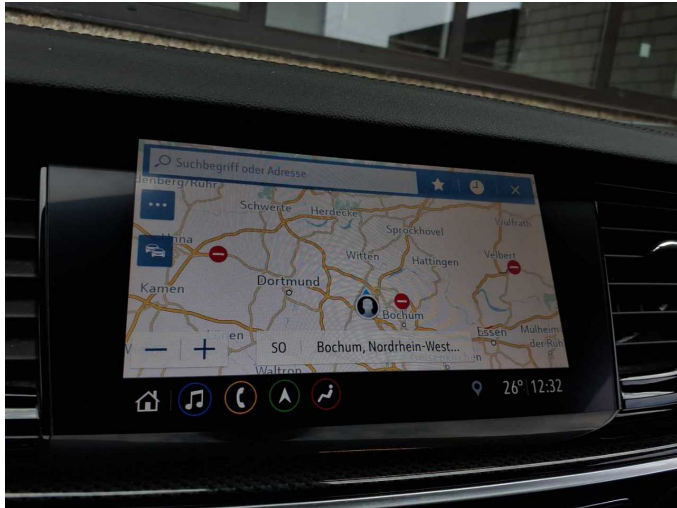


Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

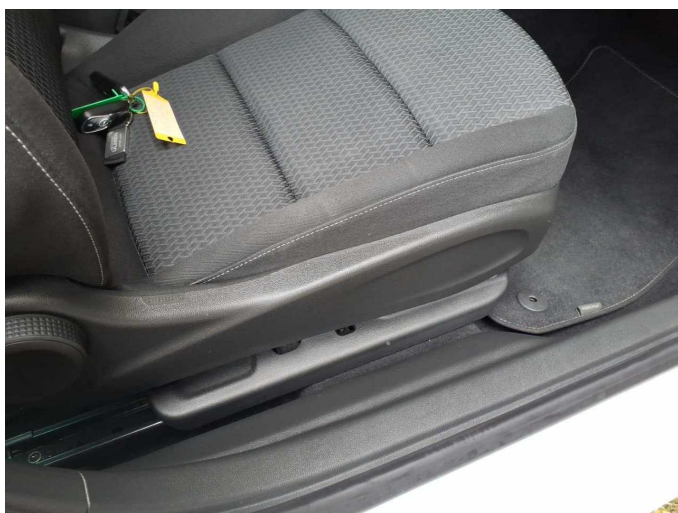


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.

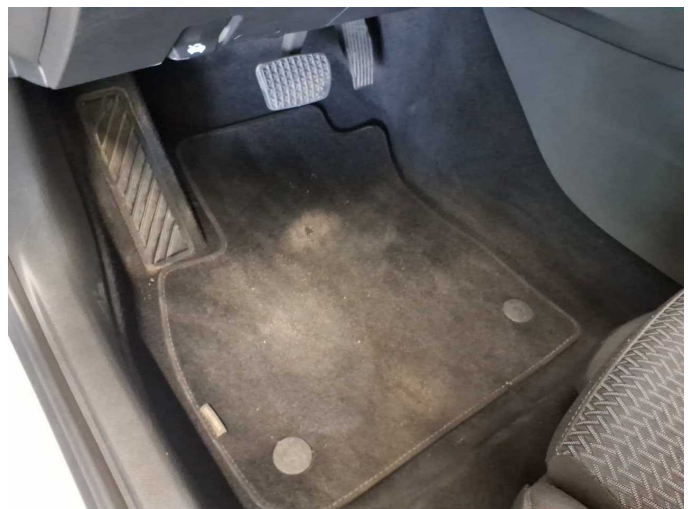

Damage 1: Trim / covers: Floor mats - Broken / torn - Replace



Damage 1: Trim / covers: Floor mats - Broken / torn - Replace



Damage 2: Mudguard - right side: Mudguard - right side (Lackläufer) - Paint defect - Cover / polish



Damage 2: Mudguard - right side: Mudguard - right side (Lackläufer) - Paint defect - Cover / polish



Damage 2: Mudguard - right side: Mudguard - right side (Lackläufer) - Paint defect - Cover / polish



Damage 2: Mudguard - right side: Mudguard - right side (Lackläufer) - Paint defect - Cover / polish



Damage 3: Door - front right side: Door - Scratched - Smart repair



Damage 3: Door - front right side: Door - Scratched - Smart repair



Damage 4: Door - rear right side: Door (Lack Pickel) - Paint defect - Smart repair



Damage 4: Door - rear right side: Door (Lack Pickel) - Paint defect - Smart repair



Damage 5: Door - front left side: Door - Scratched - Paint



Damage 5: Door - front left side: Door - Scratched - Paint




Damage 5: Door - front left side: Door - Scratched - Paint



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Missing part 1: Equipment: Tirefit complete - Missing - Replace

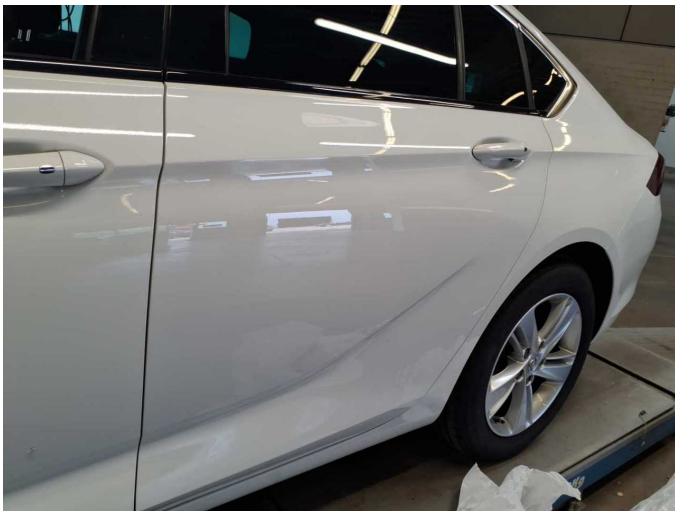

Repainting 1: Door - rear left side



Repainting 1: Door - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZT6EP1M1029827

Hersteller / Modell: OPEL OPEL Insignia Grand Sport 2.0 Diesel Automatik Business

Datum	KM-Stand	Beschreibung
04.12.2025	120.389	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.02.2025	94.289	AU; Bremsscheiben + Klötze v
12.12.2024	90.000	Motoröl b. Wartung; Regelwartungsdienst
15.01.2024	59.890	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.02.2023	29.940	Motoröl b. Wartung; Regelwartungsdienst