



Expertise

Protocol number: 46797815
Order No. / Reference: 26605984
Inspection date: 28 Jul 2026

Manufacturer: Mercedes-Benz

Model: E 300 de 4Matic T 9G-TRONIC Exclusive

VIN: W1K2132111B052167



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz E 300 de 4Matic T 9G-TRONIC Exclusive	
Vehicle Identification number	W1K2132111B052167
Mileage (Read)	115,515 km
First registration	4 Mar 2022
Number of holders	2
Next periodical technical inspection	03/2027
(Report on hand)	
Fuel type	Hybr.D/E ext.aufl
Engine displacement / Cylinder	1,950 ccm / 4
Power	143 kW
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Hightechsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	273 Tag(e)
Last service on / at	04/2026 at 109,230 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF804592
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ATL 00039		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,850 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100Y	Summer tyres on Light alloy	Goodyear	6mm / 6mm
2)	275/40 R18 103Y	Summer tyres on Light alloy	Goodyear	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	275/40 R18 103V	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with hill start assist, pre-filling and drying braking in wet conditions
- Airbag: Automatic passenger airbag deactivation
- Airbag: Side airbag for driver and front passenger
- Acoustic environmental protection
- Premium ambient lighting with 64 colors and 3 color zones
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Attention Assist
- Basic services
- On-board computer
- Diesel particulate filter
- Third brake light
- EASY-PACK cargo cover including EASY-PACK safety net
- Electronic Stability Program (ESP)
- Chassis: Air suspension on the rear axle with level control
- Electric window regulator with comfort operation and anti-pinch protection, 4-way
- Heated rear window with timer
- Interior headliner in nevagrau fabric
- KEYLESS START
- Climate: Pre-conditioning
- Headrests 5-way adjustable for driver and front passenger, 4-way adjustable, and 2-way adjustable in the rear.
- Steering wheel: Multifunction steering wheel in Nappa leather in a 3-spoke design
- Mercedes-Benz emergency call system
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AVANTGARDE Exterior (for plug-in hybrid)
- Package: Seating comfort
- PRE-SAFE system
- Radio: MBUX multimedia system
- Radio accessories: Communication module (LTE) for using Mercedes me connect services
- Windscreen wipers with rain sensor
- Seats: i-Size child seat attachment
- Power outlet: 12V socket in the cargo area
- High-visibility vest for drivers
- Green, heat-insulating glass all around
- Decorative elements, light brown open-pored ash wood
- AdBlue tank with a capacity of 23.5 liters
- Airbag for driver and front passenger
- Airbag: Kneebag for driver
- Airbag: Windowbags left/right
- 4MATIC all-wheel drive
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Foldable armrest for driver and front passenger
- Left and right exterior mirrors, heated and electrically adjustable, painted in body color
- Brake assist, active
- Tachometer
- DYNAMIC SELECT
- EASY-PACK tailgate
- Chassis: AGILITY CONTROL chassis with selective damping system
- Velour floor mats
- Transmission: 9-speed automatic, 9G-TRONIC
- rear window wiper
- Instrument panel and door sills in ARTICO man-made leather
- THERMATIC automatic climate control
- Charging cable for household socket, 5m, smooth
- Charging system: AC charging system 7.4 kW
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Center console with on-the-fly storage compartment
- Navigation: Hard disk navigation
- Package: Storage compartment (for plug-in hybrid)
- Package: Public Charging
- Upholstery: ARTICO man-made leather
- Radio: Extended MBUX functions
- Radio accessories: Digital radio
- Tire pressure monitoring system
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable, 40/20/40 split
- Touchpad
- Electronic immobilizer
- Central locking



Extra equipment

- Adaptive High Beam Assist (You activate the system with one operation and then benefit from the long beam range.)
- Head-up display (lens and mirror system projects a virtual image into the driver's field of vision - full-color display that is easily readable even on sunny days and at night - depending on the equipment, display of, for example, navigation instructions, speed, speed limits or settings of cruise control or active distance assist DISTRONIC)
- Package: AMG Line Exterior (18-inch AMG light-alloy wheels in 5-twin-spoke design, front axle 245/45 R 18 on 8 J x 18 ET 43, rear axle 275/40 R 18 on 9 J x 18 ET 53 - radiator grille with integrated Mercedes star - AMG front apron, side skirts and rear apron in diffuser look - brake system with larger brake discs on the front axle - side skirts and window surrounds in polished aluminum - roof rails in polished aluminum - hood with pronounced power domes - exhaust system with 2 tailpipe trims)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC incl. Active Speed Limit Assist, Extended Automatic Restart on Highways, Route-Based Speed Adaptation with Traffic Jam Function (only when selecting Parking Packages), Active Steering Assist incl. Active Emergency Stop Assist with SOS Function, Emergency Lane Radio, Active Brake Assist incl. Turning and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist incl. Exit Warning, Pedestrian Warning Radio, PRE-SAFE PLUS)
- Package: Mirrors (both exterior mirrors electrically foldable (button in the driver's door control panel) - automatic lowering of the passenger-side mirror glass to parking position when reverse gear is engaged - interior mirror and driver's side exterior mirror automatically dimming continuously - ambient lighting of the exterior mirror to illuminate the entry area)
- Package: Parking package with 360° camera (including Active Parking Assist with PARKTRONIC and 360° camera)
- Paint finish: Metallic
- Seats: Heated seats for driver and front passenger (selectable in three stages - Intelligent and comfortable: The seat heating switches off automatically)
- Center console wood ash light brown open-pore
- KEYLESS-GO (with recessed door handle lighting - the system allows the vehicle to be conveniently opened, started and locked - simply by carrying the electronic key.)
- Package: Acoustic Comfort Package (windshield and front side windows in laminated safety glass with special film and reflective coating: noise and heat insulating, infrared and UV absorbing, burglar-resistant - further sound insulation measures: reinforced fleece in the doors, reinforced rear floor carpet, insulated chassis components)
- Package: Business (MBUX High-End Package - Connectivity Package Navigation - Traffic Sign Assist - Smartphone Integration (Apple CarPlay and Android Auto) - Preparation for Digital Key Handover - Widescreen Cockpit - Wireless Charging System for Mobile Devices - MBUX Augmented Reality for Navigation - Heated Seats for Driver and Front Passenger - Parking Package with Rearview Camera - Fuel Tank with 66 Liter Capacity (916) (60l for Diesel Plug-in Hybrids).)
- Package: Night for AMG Line Exterior (18-inch AMG light-alloy wheels in 5-twin-spoke design, painted high-gloss black and polished with front axle 245/45 R 18 on 8 J x 18 ET 43, rear axle 275/40 R 18 on 9 J x 18 ET 53 - AMG front apron with front splitter in high-gloss black - Belt trim strip, window surround and trim strip in the rear bumper in high-gloss black - Exterior mirror housings in high-gloss black - Roof rails in black - Heat-insulating dark tinted glass from the B-pillar)
- Roof rack (Expand your transport options. You can combine the base carrier with a variety of Mercedes-Benz roof accessories – such as roof boxes, bicycle carriers or ski racks. It is precisely matched to the body and offers the best possible safety and aerodynamics.)
- Sunroof: Panoramic electric sunroof in glass design (with comfort and automatic rain closing, PRE-SAFE closing function, electric sunshade and anti-pinch protection)
- Towbar with ESP trailer stabilization (fully electrically foldable and retractable)
- Wheels: 18-inch (45.7 cm) AMG light-alloy wheels in a 5-twin-spoke design, high-gloss black finish. (High-sheen finish, front axle: 8 J x 18 ET 43, tire size 245/45 R 18; rear axle: 9 J x 18 ET 53, tire size 275/40 R 18)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	2nd wheel set	1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction
2	2nd wheel set	1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction
3	Trim / covers	Brightware / decorative strip - Glued / labelled - De-glue / neutralise
4	Door - rear right side	Door - dent(s) - Smooth repair work
5	Sill - right side	Sill - dent(s) - Smart repair
6	Side panel - rear left side	Sill - dent(s) - Smart repair
7	Side panel - rear right side	Sill - dent(s) - Smart repair
8	Sill - left side	Sill - dent(s) - Smart repair
9	Wheel / tyres	Alloy rim - front left side - Scratched - Loss in value
10	Trim / covers	Door trim - front left side - Broken / torn - Loss in value
11	Roof	Roof rail - left side - Dent / paintcoat damage - Repair and paint
12	Rear bumper	Rear bumper - Scratched - Paint
13	Vehicle glazing	Windscreen (Sandstrahleffekt) - Stone chips - Replace
14	Bonnet	Bonnet (Sandstrahleffekt) - Stone chips - Paint
15	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint

Accident damages

No. Accident

- 1 Front, Underbody

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

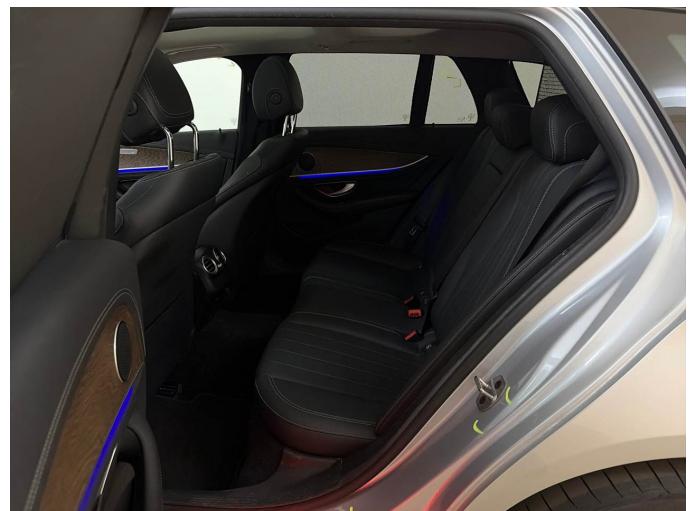


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres

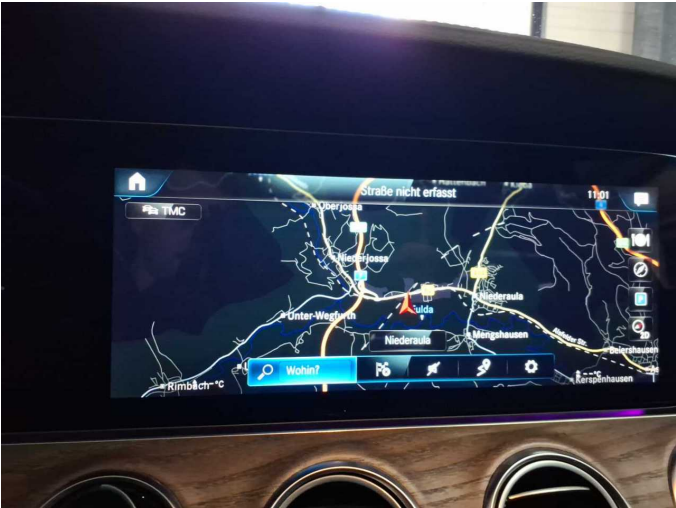


Figure 15: Navigation

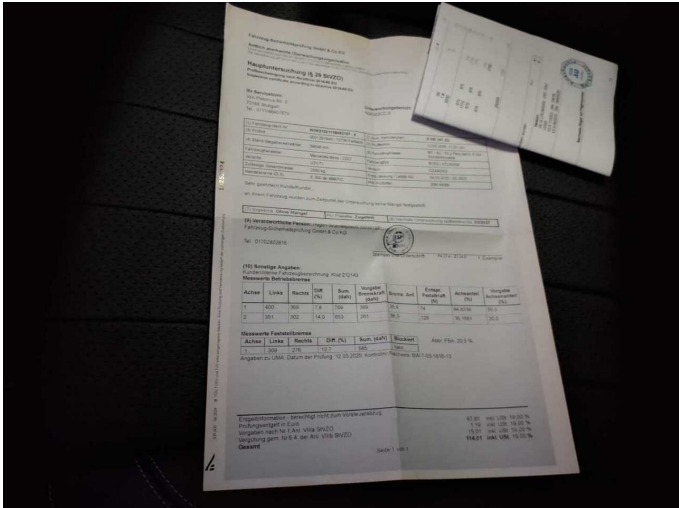


Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

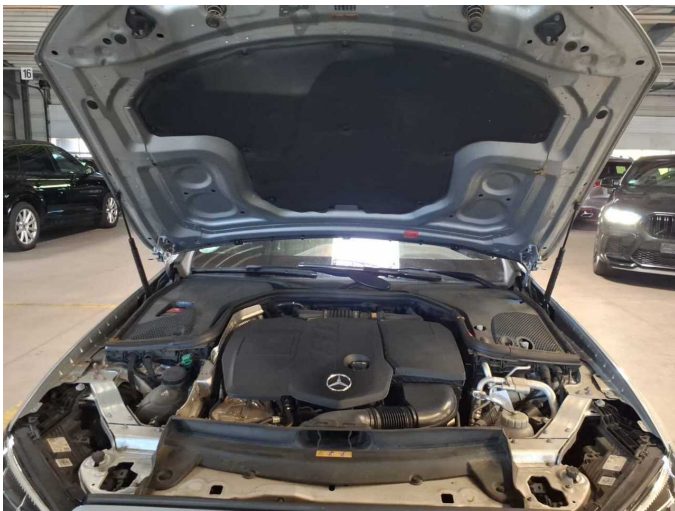


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

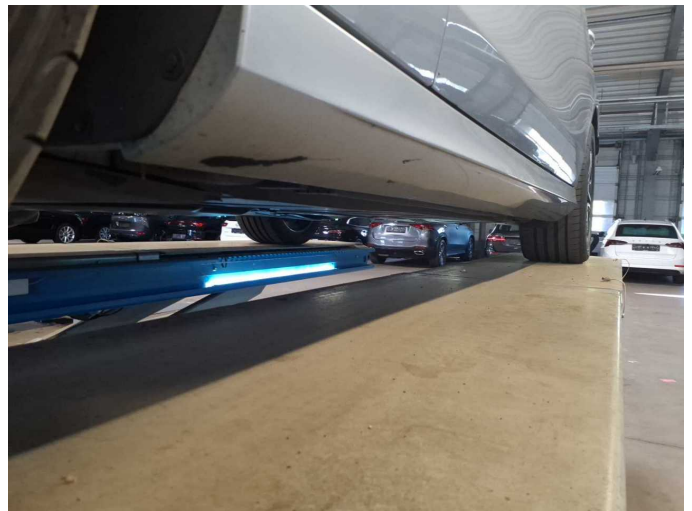


Figure 28: Misc.

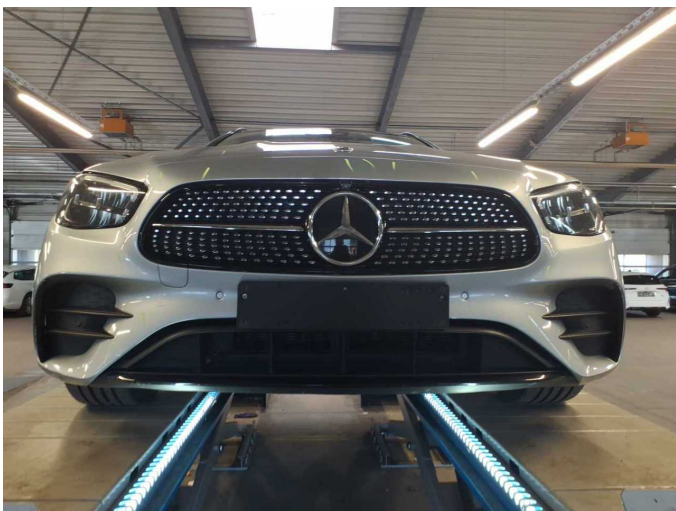


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction



Damage 1: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction



Damage 1: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction



Damage 1: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction



Damage 2: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction




Damage 2: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction



Damage 2: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction




Damage 2: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction

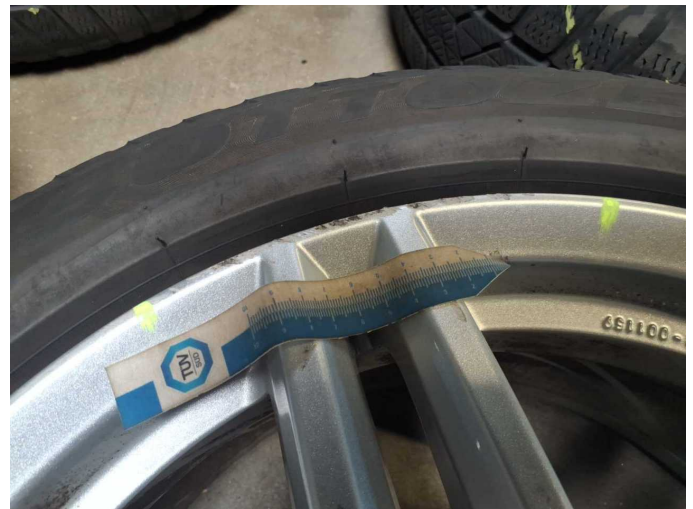

Damage 2: 2nd wheel set: 1 alloy rim (nicht bestandteil der Serienausstattung) - Scratched - No deduction



Damage 3: Trim / covers: Brightware / decorative strip - Glued / labelled - De-glue / neutralise

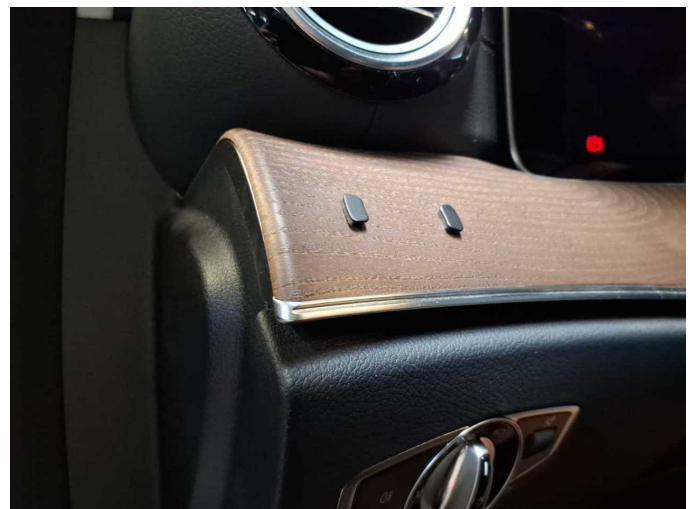


Damage 3: Trim / covers: Brightware / decorative strip - Glued / labelled - De-glue / neutralise




Damage 4: Door - rear right side: Door - dent(s) - Smooth repair work




Damage 4: Door - rear right side: Door - dent(s) - Smooth repair work

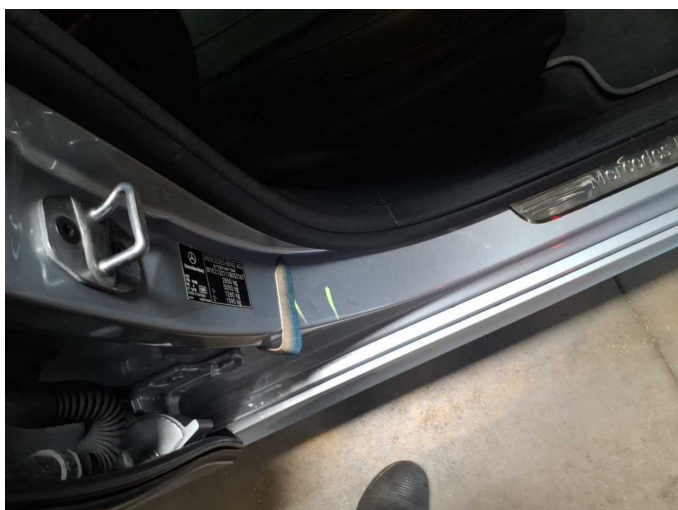

Damage 5: Sill - right side: Sill - dent(s) - Smart repair

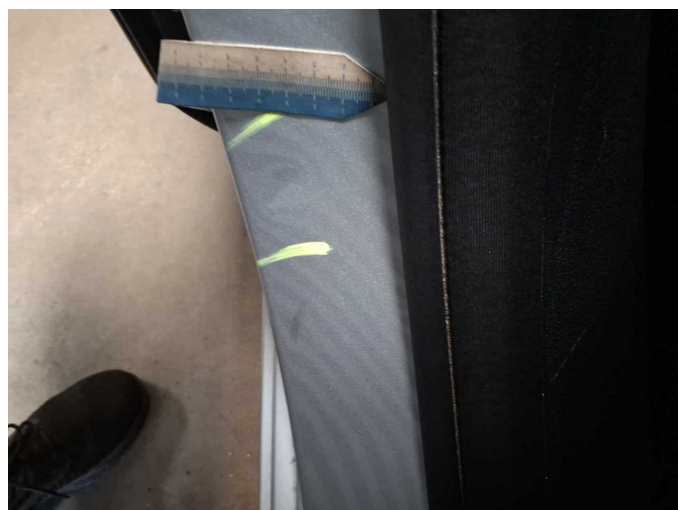

Damage 5: Sill - right side: Sill - dent(s) - Smart repair

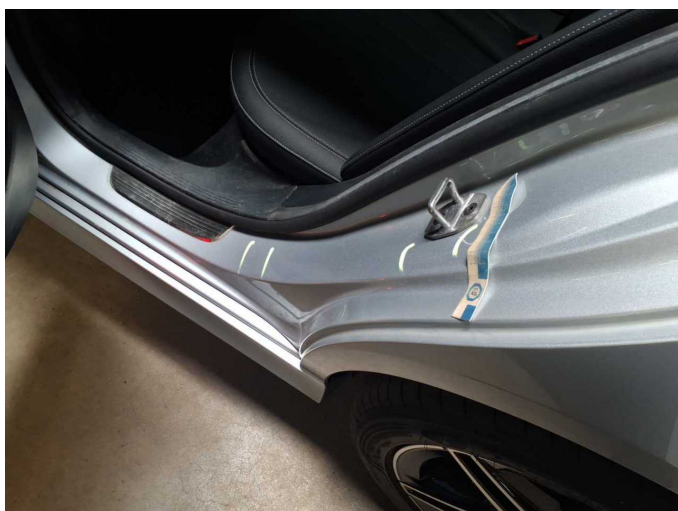

Damage 6: Side panel - rear left side: Sill - dent(s) - Smart repair



Damage 6: Side panel - rear left side: Sill - dent(s) - Smart repair



Damage 6: Side panel - rear left side: Sill - dent(s) - Smart repair



Damage 7: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 7: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 7: Side panel - rear right side: Sill - dent(s) - Smart repair



Damage 8: Sill - left side: Sill - dent(s) - Smart repair



Damage 8: Sill - left side: Sill - dent(s) - Smart repair



Damage 9: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front left side - Scratched - Loss in value



Damage 10: Trim / covers: Door trim - front left side - Broken / torn - Loss in value



Damage 10: Trim / covers: Door trim - front left side - Broken / torn - Loss in value



Damage 11: Roof: Roof rail - left side - Dent / paintcoat damage - Repair and paint



Damage 11: Roof: Roof rail - left side - Dent / paintcoat damage - Repair and paint



Damage 12: Rear bumper: Rear bumper - Scratched - Paint




Damage 12: Rear bumper: Rear bumper - Scratched - Paint




Damage 12: Rear bumper: Rear bumper - Scratched - Paint



Damage 12: Rear bumper: Rear bumper - Scratched - Paint

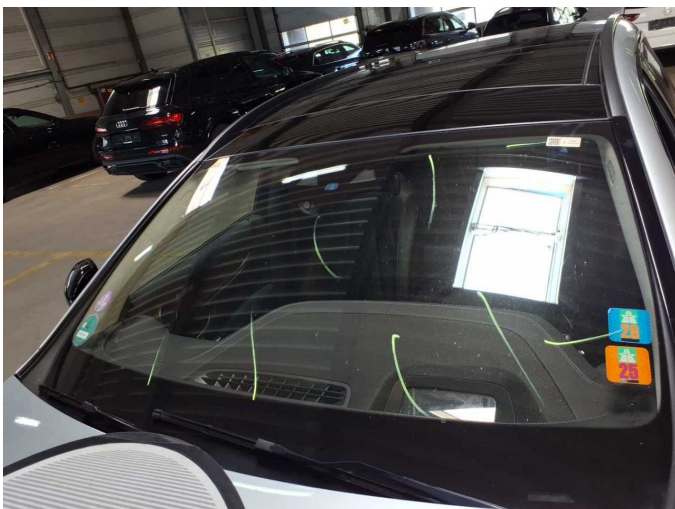

Damage 13: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace

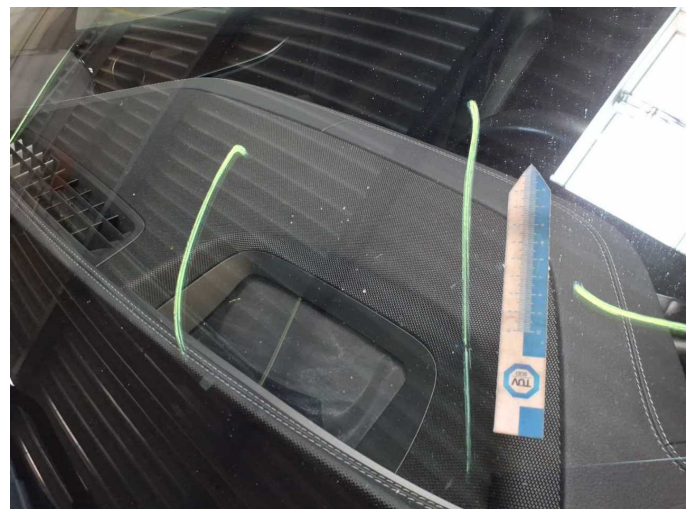


Damage 13: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace



Damage 13: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace




Damage 13: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace

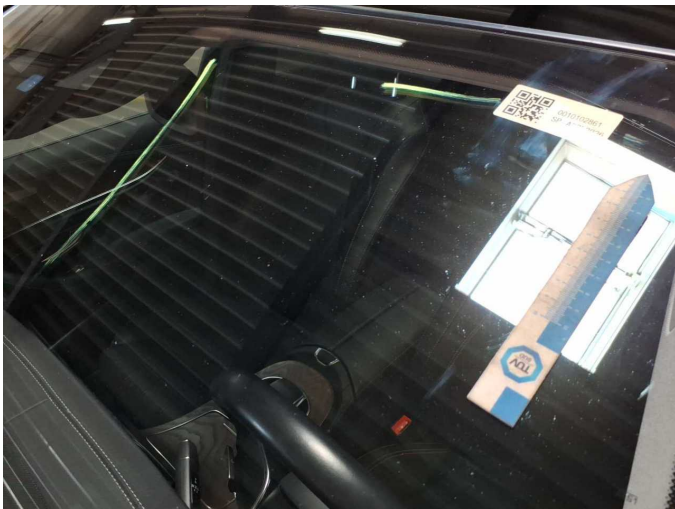


Damage 13: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace




Damage 14: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

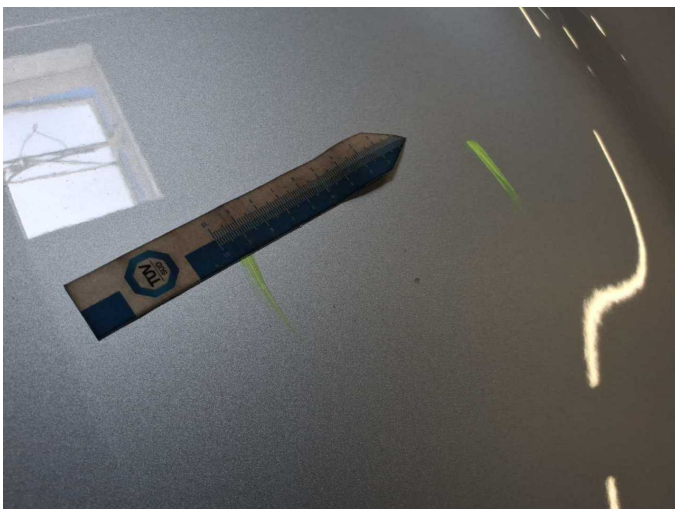

Damage 14: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

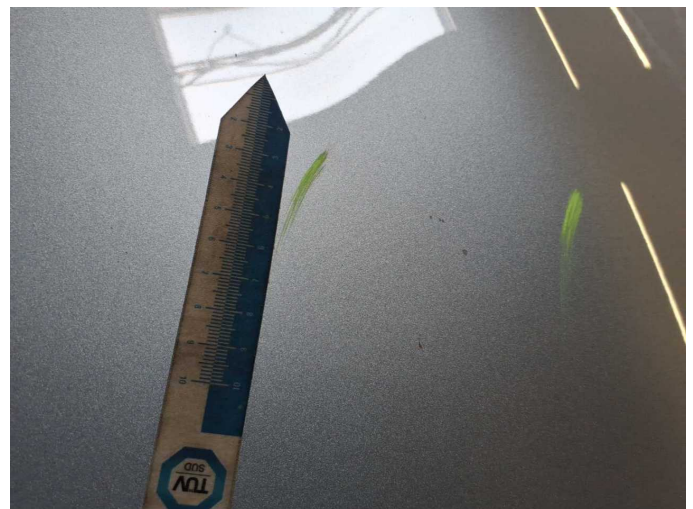


Damage 14: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

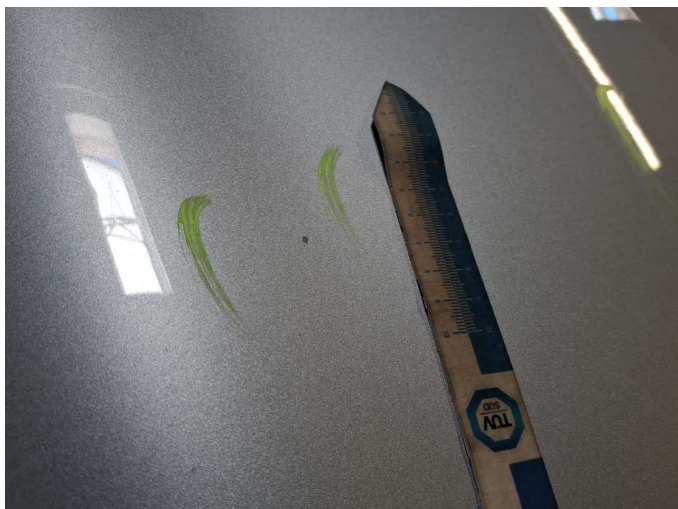


Damage 14: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 14: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

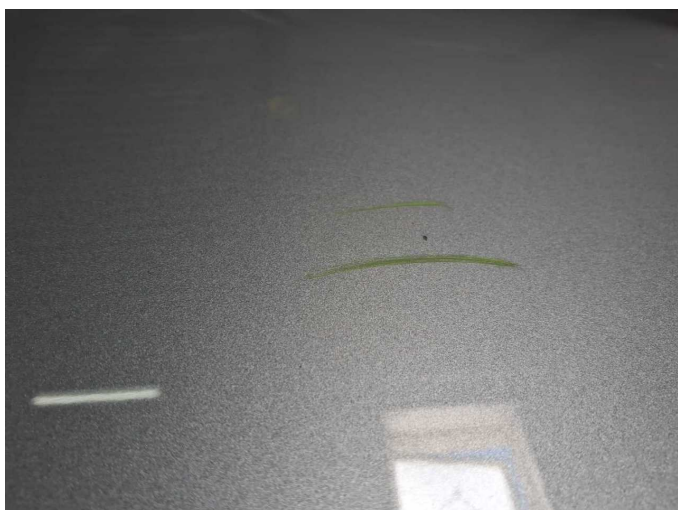

Damage 14: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

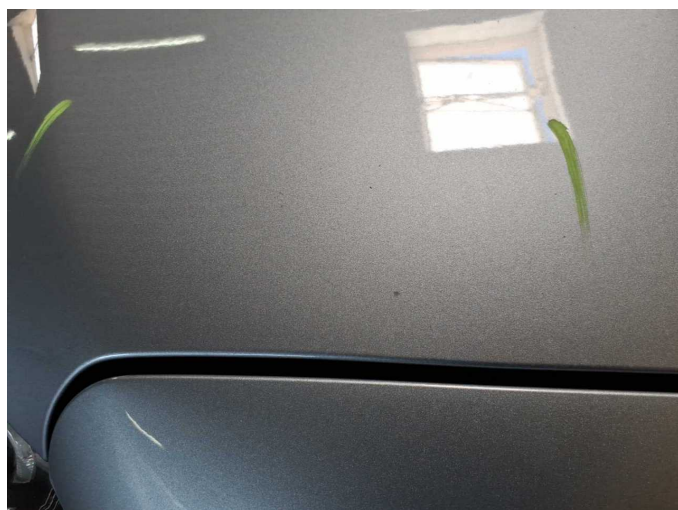

Damage 14: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint



Damage 15: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 15: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Accident 1: Front, Underbody



Accident 1: Front, Underbody




Accident 1: Front, Underbody

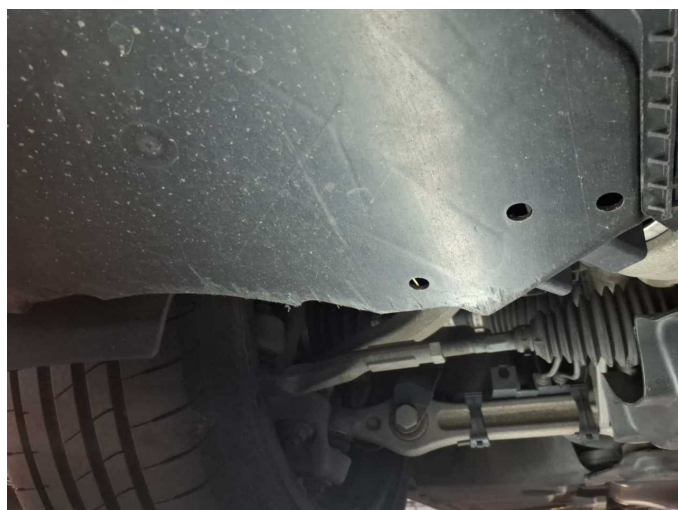

Accident 1: Front, Underbody



Accident 1: Front, Underbody

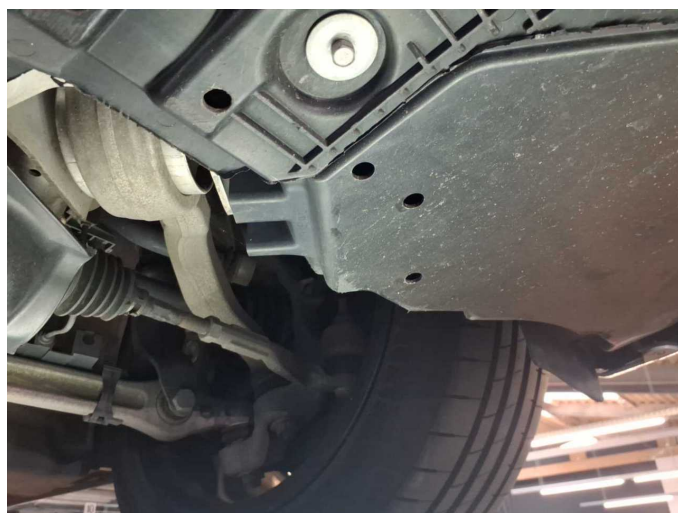

Accident 1: Front, Underbody



Accident 1: Front, Underbody



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K2132111B052167

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ E 300 de 4Matic T 9G-TRONIC Exclusive

Datum	KM-Stand	Beschreibung
28.04.2026	109.230	Bremsscheiben+Beläge v+h; Regelwartungsdienst
02.10.2025	84.810	Regelwartungsdienst
08.07.2025	70.543	Systemtest/Eigendiagnose
13.03.2025	59.048	AU
11.03.2025	59.048	Regelwartungsdienst
15.04.2024	34.549	Regelwartungsdienst
02.03.2023	14.020	Regelwartungsdienst