



RENAULT CLIO: GD-035-PF

Vinnumber:	VF1RJA00868305751	Versionname:	RENAULT CLIO Business E-Tech hybride 140 -21N
First Registrationdate:	15/12/2021	Fiscalpower:	VP [5P] bva 6-140CH-5cv (bi-corps)
Expertise Mileage:	133752	Power Kw:	103
Bodytype:	Berline	Body colour:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Interior colour:	Anthracite
Fueltype:	Hybrid	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Anthracite
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Seat cover lining	Lining Other
Steering wheel leather			
Type of climate control	Manual climate control		

Tyres

	195/55/16/91 H			
Summer tyres:	Fr.L.	Hankook: 15%	Fr.R.	Hankook: 15%
	Re.L.	Goodyear: 15%	Re.R.	Goodyear: 25%
Tyre profile depth FL				7.2
Tyre profile depth FR				7.1
Tyre profile depth RL				7.1
Tyre profile depth RR				6.4
Tyre size FL				195/55 R 16 91 H
Tyre size FR				195/55 R 16 91 H
Tyre size RL				195/55 R 16 87 H
Tyre size RR				195/55 R 16 87 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				260
Tyre make FR				260
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Malfunction indicator, Blinking, Check



Air vent, mid-dashboard, Broken, Replace



Remote ignition key, Missing, Repair/replace (lump sum)



Seat cover FR, Stain, Cleaning



Roof liner, Tear, Repair/replace (lump sum)



Seat cover FL, Burned, Replace




Seat cover R, Stain, Cleaning



Tyre RR, Out of tolerance, Replace



Tyre RL, Out of tolerance, Replace

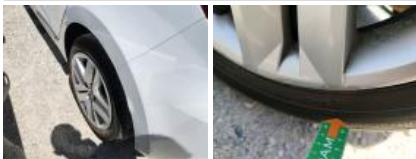

Door FL, Dent(s) and scratch(es), Acceptable



Door RL, Dent(s), Repair and paint (complete)



Bumper F, Broken, Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Acceptable



Wiper arm rear, Incomplete, Replace



Rear spoiler, Scratch(es), Paint



Rear roof pillar covering L, Broken, Replace



Rear roof pillar covering R, Broken, Replace



Bodywork, Not original part, Sticker removal small



Aerial, Missing, Replace



Historique Maintenance

Immatriculation: **GD-035-PF** Date de 1ère immatriculation: **15/12/2021**

Modèle: **Renault CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
10/05/2026	131.313	PROFIL PLUS	REPLACEMENT PNEUS 4 SAISONS
11/03/2026	122.916	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
18/11/2025	107.111	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS HIVER
14/10/2025	101.466	GRAND SUD AUTO	RECYCLAGE
	0		BALAIS ESSUIE GLACE AV
	0		REVISION
24/04/2025	76.627	L'OCCITANE AUTOMOBILES	PLAQUETTES AV RPLT
	0		REVISION
	0		LIQUIDE DE FREIN
	0		RECYCLAGE
03/12/2024	61.682	PAMIERES AUTOMOBILES	REVISION
	0		PILE DE CLE RPLT
16/10/2024	55.277	PAMIERES AUTOMOBILES	JANTE RPLT
	0		POSE EQUILIBRAGE ROUES
20/08/2024	50.338	PAMIERES AUTOMOBILES	DIVERS CARROSSERIE
20/08/2024	50.338	PAMIERES AUTOMOBILES	TLG POUBELLE PNEU
06/08/2024	48.680	FLEET SOLUTIONS FRANCE	REPLACEMENT PNEUS 4 SAISONS
10/05/2024	45.402	PEYROT ET FILS	PLAQUETTES AV RPLT
	0		BALAI ESSUIE GLACE AR
	0		BALAIS ESSUIE GLACE AV
15/05/2023	30.572	NORAUTO SAS (PRODUIT SPE)	REPLACEMENT PNEUS ETE
10/05/2023	30.564	PEYROT ET FILS	REVISION ET CLIM
05/10/2022	12.350	NORAUTO SAS (PRODUIT SPE)	REPLACEMENT PNEUS HIVER
27/09/2022	11.358	PEYROT ET FILS	BALAIS ESSUIE GLACE AV