



U5YH5815GPL140718

Angaben zum Fahrzeug

Halter		Besichtigungszustand	ausreichend
Kennzeichen		Laufleistung (abgelesen)	51.582 km
Hersteller	Kia	Restlauf bis Service	8.416 km
Typ/Modell	Ceed	HU (Bericht lag vor)	11/2027
Fahrgestellnummer	U5YH5815GPL140718	Leistung	118 kW
Hubraum	1.482 ccm	Zylinder	4
Erstzulassung	11.11.2022	Polster/Farbe	Stoff / Schwarz-Anthrazit
Letzte Wartung	02/2026, 45.990 km	Lackierung	Grau
Kraftstoffart	Benzin	Getriebe	Automatik

Zustandsbericht

Wertmindernde Faktoren

Nr.	Bauteilgruppe	Beschreibung
1	Rad/Reifen	Leichtmetallfelge hinten rechts (Materialabtrag) - Abrieb - erneuern
2	Motorhaube	Motorhaube - verkratzt / verschürft - lackieren

Gebrauchsspuren

Nr.	Bauteilgruppe	Beschreibung
1	Verglasung	Frontscheibe (Oberflächlich) - Steinschlag - kein Abzug

Fehlteile

Fehlteil

Festgestellte Nachlackierungen

Nr.	Ort
1	Tür hinten rechts, fachgerecht ausgeführt, Reparaturrechnung nicht vorhanden

Hauptbereifung

Achse	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Verktgl.	Zul.
1	225/45 R17 91W	Michelin	Sommerreifen	5mm - 5mm	i.O.	i.O.
2	225/45 R17 91W	Michelin	Sommerreifen	7mm - 7mm	i.O.	i.O.

Ersatz

Typ	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Ablaufdatum
Tirefit					11/2027

Der Verschleißzustand sowie evtl. Schäden an der Bereifung sind wertmäßig berücksichtigt.

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
TÜV SÜD Auto Partner: MVI
Oberschleißheim
Mittenheimer Str. 64
85764 Oberschleißheim

Besichtigungsdatum: 27.07.2026
Protokollnummer: 46796416
Erstellt durch: Paula Busch
Besichtigt durch: Furkan Kara



Angaben zum Fahrzeug

Hersteller	Kia	Besichtigungszustand	ausreichend
Typ/Modell	Ceed	Laufleistung (abgelesen)	51.582 km
Fahrgestellnummer	U5YH5815GPL140718	Erstzulassung	11.11.2022

Angaben zum Auftrag:

Auftragsgemäß erfolgte die Fahrzeugzustandsbewertung in demontagefreien Zustand.

Grundlage dieses Produktes stellt der Leitfaden für Fahrzeugrücknahmen und Bewertungen gemäß des Schadengrenzmusterkatalog des Auftraggebers dar. Die expliziten Feststellungen im Einzelfall trifft der Sachverständige objektiv im Rahmen der vorgegebenen Standards aufgrund eigener Sachkunde.

Fahrzeug-Identifizierung:

Die Fahrzeug-Identifizierungsnummer (FIN) wurde am Fahrzeug abgelesen und die Übereinstimmung im Verlauf der Besichtigung durch den Unterzeichner mit den vorgelegten Unterlagen festgestellt.

Besichtigungsbedingungen:

Die Besichtigungsbedingungen waren zur Beurteilung des Fahrzeuges ausreichend.

Allgemeinzustand:

Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.

Unterschrift Sachverständiger (Paula Busch)

Vorliegendes Druckexemplar wurde auf elektronischem Wege erzeugt. Der benannte Sachverständige versichert, dass der Inhalt die von ihm getroffenen Feststellungen korrekt wiedergibt. Es ist ohne Originalunterschrift gültig.

Übersichtsfotos

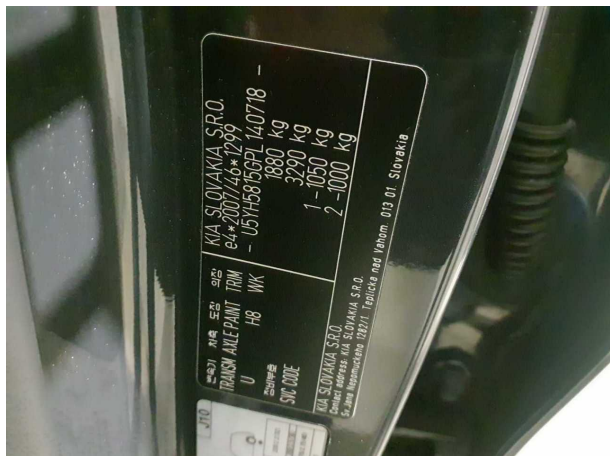


Abbildung 1: FIN



Abbildung 2: Schräg vorne



Abbildung 3: Schräg vorne



Abbildung 4: Schräg hinten



Abbildung 5: Schräg hinten



Abbildung 6: Montierte Bereifung

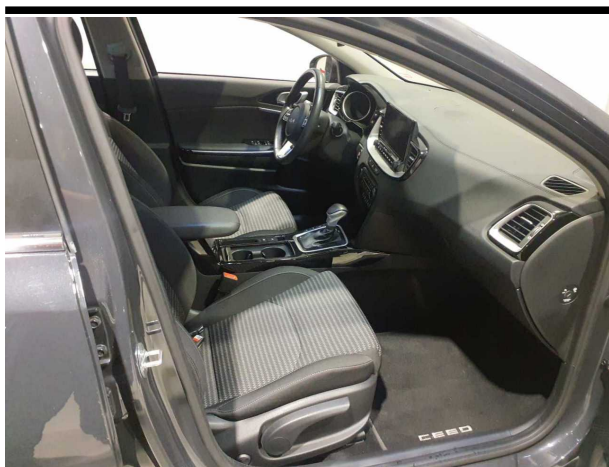


Abbildung 7: Innenraum vorne



Abbildung 8: Laderaum



Abbildung 9: Laderaum



Abbildung 10: Kombiinstrument

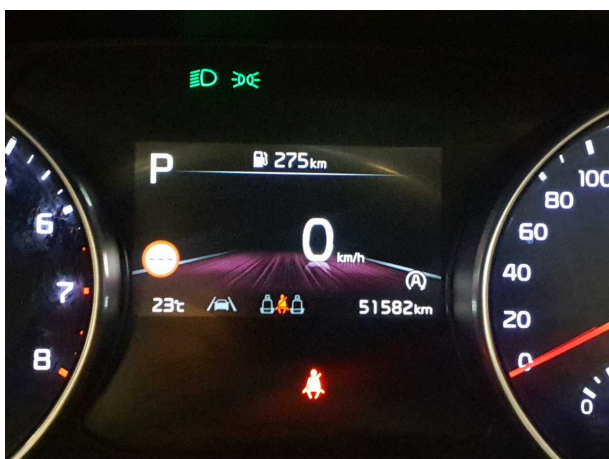


Abbildung 11: Kombiinstrument



Abbildung 12: Instrumententafel

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
TÜV SÜD Auto Partner: MVI
Oberschleißheim
Mittenheimer Str. 64
85764 Oberschleißheim

Besichtigungsdatum: 27.07.2026
Protokollnummer: 46796416
Erstellt durch: Paula Busch
Besichtigt durch: Furkan Kara

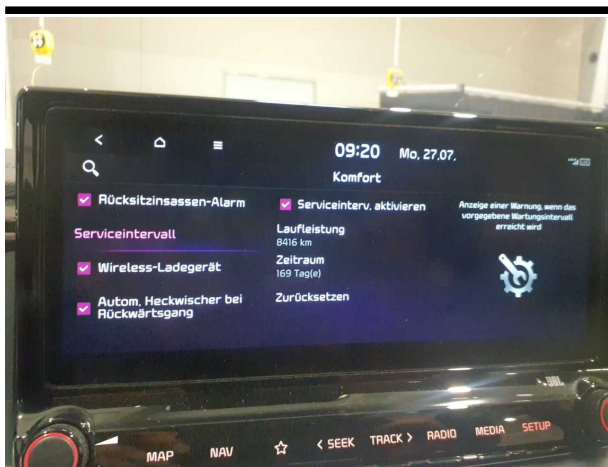


Abbildung 13: Instrumententafel



Abbildung 14: Dokumente

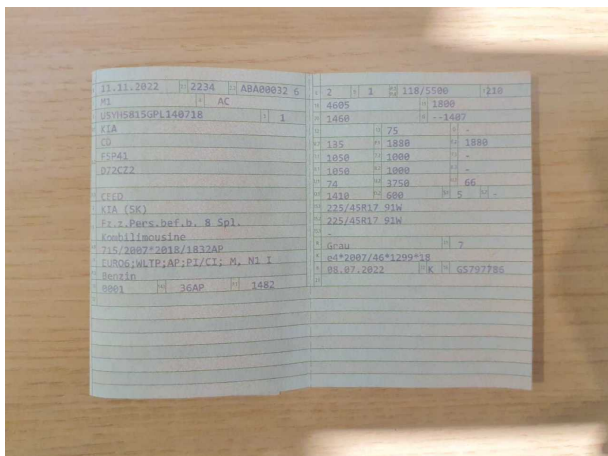


Abbildung 15: Dokumente

Beschädigungsfotos




Beschädigung #1: Rad/Reifen: Leichtmetallfelge hinten rechts (Materialabtrag) - Abrieb - erneuern




Beschädigung #1: Rad/Reifen: Leichtmetallfelge hinten rechts (Materialabtrag) - Abrieb - erneuern




Beschädigung #2: Motorhaube: Motorhaube - verkratzt / versch...
- lackieren

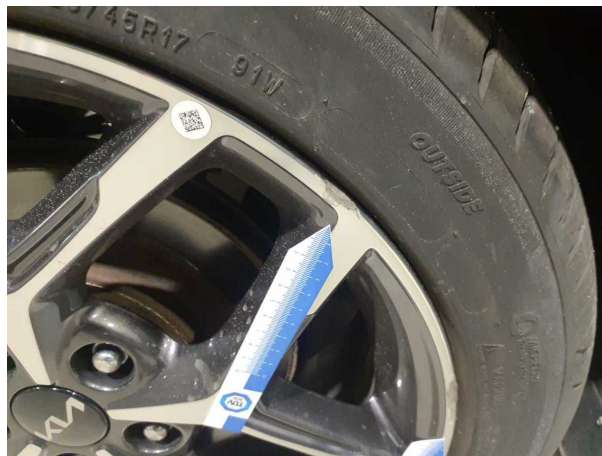

Beschädigung #1: Rad/Reifen: Leichtmetallfelge hinten rechts (Materialabtrag) - Abrieb - erneuern

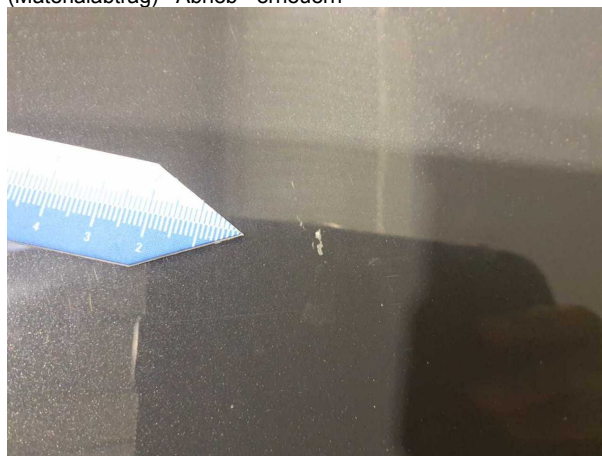

Beschädigung #2: Motorhaube: Motorhaube - verkratzt /
verschürft - lackieren

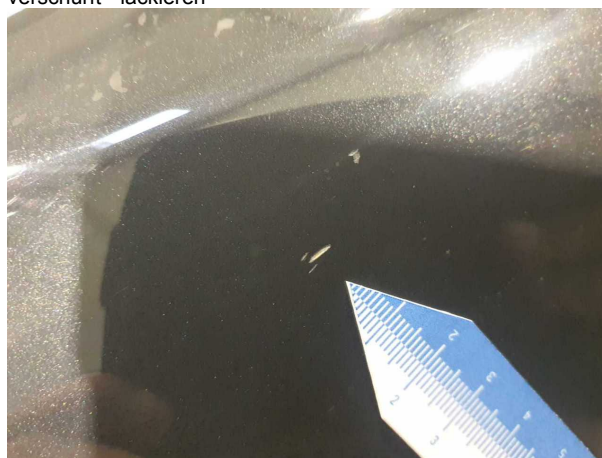

Beschädigung #2: Motorhaube: Motorhaube - verkratzt /
verschürft - lackieren

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
TÜV SÜD Auto Partner: MVI
Oberschleißheim
Mittenheimer Str. 64
85764 Oberschleißheim

Besichtigungsdatum: 27.07.2026
Protokollnummer: 46796416
Erstellt durch: Paula Busch
Besichtigt durch: Furkan Kara



Beschädigung #2: Motorhaube: Motorhaube - verkratzt / versch...
- lackieren

TÜV SÜD Auto Partner GmbH
Gutenbergstraße 13
70771 Leinfelden-Echterdingen

Besichtigungsort
TÜV SÜD Auto Partner: MVI
Oberschleißheim
Mittenheimer Str. 64
85764 Oberschleißheim

Besichtigungsdatum: 27.07.2026
Protokollnummer: 46796416
Erstellt durch: Paula Busch
Besichtigt durch: Furkan Kara



Nachlackierungsfotos



Nachlackierung 1: Tür hinten rechts

Power plant

20. Manufacturer of the engine: Hyundai or Kia
21. Engine code as marked on the engine: G4LH
22. Working principle: Spark ignition / 4-stroke
23. Pure electric: no
23.1. Class of Hybrid (electric) vehicle:
24. Number and arrangement of cylinders: 4; inline
25. Engine capacity: 1482 cm³
26. Fuel: Gasoline
26.1. Mono fuel/Bi fuel/flex fuel/Dual-fuel: Mono fuel
26.2. (Dual fuel only)
27. Maximum power
27.1. Maximum net power: 117.50 kW at 5500 min-1
27.3. Maximum net power (electric motor): kW
27.4. Maximum 30 minutes power (electric motor): kW

28. Gearbox(type): Automatic

28.1 Gearbox ratios(to complete for vehicles with manual shift transmissions)

1.Gear	2.Gear	3.Gear	4.Gear	5.Gear	6.Gear	7.Gear	8.Gear

28.1.1. Final drive ratios(if applicable):

28.1.2. Final drive ratios(to complete if and where applicable)

1.Gear	2.Gear	3.Gear	4.Gear	5.Gear	6.Gear	7.Gear	8.Gear

Maximum Speed

29. Maximum Speed: 210 km/h

Axles and Suspension

30. Axle(s) track
1. 1555 mm
2. 1563 mm

35. Fitted tyre/wheel combination/energy efficiency class of rolling resistance coefficients (RRC) and tyre category used for CO2 determination

Axle 1: 225/45R17 91W 7.0Jx17/ET53 / B/C1

Axle 2: 225/45R17 91W 7.0Jx17/ET53 / B/C1

Brakes

36. Trailer brake connections:

Bodywork

38. Code for bodywork: AC(station wagon)
40. Colour of the vehicle: GREY
41. Number and configuration of doors: 5 ; 2 le,2 ri, 1 re
42. Number of seating positions (including driver): 5
42.1. Seat(s) designated for use only when the vehicle is stationary:
42.3. Number of wheelchair user accessible position:

Environmental performance

46. Sound level
-Stationary: 74.00 dB(A) at engine speed: 3750 min-1
-Drive -by: 66.00 dB(A)

47. Exhaust emission level: EURO6;WLTP;AP;PI/Ci; M, N1 I

47.1. Parameters for emission testing V . .

47.1.1. Test mass, kg: 1597
47.1.2. Frontal area, m²: 2.23
47.1.2.1. Projected frontal area of air entrance of the front grille, cm²:

47.1.3. Road load coefficients:
47.1.3.0. F0, N: 130.8
47.1.3.1. F1, N/ (KM/h): 0.692
47.1.3.2. F2, N/ (KM/h): 0.02931

47.2. Driving cycle
47.2.1. Driving Cycle class: 3b
47.2.2. Downscaling factor (f_{dsc}):
47.2.3. Capped speed: N

48. Exhaust emissions: EC 2018/1832AP
Number of the base regulatory act and latest amending regulatory act applicable: 715/2007

48.1. Smoke corrected absorption coefficient: (m-1)

48.1.2. Test procedure: type I (NEDC average values, WLTP highest values) or WHSC (EURO VI)

CO: 187.2 mg/km THC: 25.2 mg/km
NMHC: 20.66 mg/km NOx: 42.4 mg/km
THC + NOx: mg/km NH3: mg/km
Particulates: 0.17 mg/km Particles: 0.88 E+11
(mass) (number)

48.2. Declared maximum RDE values (if applicable)

Complete RDE trip: 60 NOx Particle Number: 6E+10

Urban RDE trip: 60 NOx Particle Number: 6E+10

48.2.2. Test procedure: WHTC (EURO VI)

CO: mg/km NOx:: mg/km
NMHC: mg/km THC: mg/km
CH4: mg/km NH3: mg/km
Particulates: mg/km Particles: E+11
(mass) (number)

49. CO2-Emissions / fuel consumption / electric energy consumption

49.1. All powertrains except pure electric vehicles

NEDC values	CO2 emissions	Fuel consumption
Urban conditions	g/km	l/100km
Extra-urban conditions	g/km	l/100km
Combined	g/km	l/100km
Weighted, combined	g/km	l/100km
Deviation factor		
Verification factor		

49.2. Pure electric vehicles and OVC hybrid electric vehicles

Electric energy consumption(veighted, combined) Wh/km

Electric range Km

49.3. Vehicle fitted with eco-innovation(s): yes
49.3.1. General code of eco innovation(s): e9 29+ e9 28
49.3.2. Total CO2 emissions savings due to the eco-innovation(s): 2.08
49.3.2.1. NEDC savings: g/km
49.3.2.2. WLTP savings: 2.08 g/km

49.4. All powertrains, except pure electric vehicle under Regulation (EU) 2017/1151

WLTP values	CO2 emissions	Fuel consumptions
Low	173 g/km	7.6 l/100km
Medium	132 g/km	5.8 l/100km
High	116 g/km	5.1 l/100km
Extra High	139 g/km	6.1 l/100km
Combined	135 g/km	6 l/100km
Weighted combined	g/km	l/100km

49.5. Pure electric vehicles and OVC hybrid electric vehicles under Regulation (EU) 2017/1151

49.5.1. Pure electric vehicles
Electric energy consumption: Wh/km
Electric range: km
Electric range city: km

49.5.2. OVC hybrid electric vehicles
Electric energy consumption (ECAC, weighted): Wh/km
Electric range (EAER): km
Electric range city (EAER city): km

51. For special purpose vehicles: designation in accordance with point 5 of Part A of annex I to Regulation (EU)2018/858 of the European Parliament and of the Council:

52. Remarks:

13:1407*30:A1:1559;A2:1567*35:225/45R17
91W,7.0Jx17/ET53;225/45R17 91V,7.0Jx17/ET53,225/40ZR18
92Y,7.5Jx18/ET53*Vehicle equipped with a 24 GHz short-range radar equipment(narrow band only)*

For this vehicle the registration document no. GS 797 786 has already been issued for Germany.



**COMPLETE VEHICLES
CERTIFICATE OF CONFORMITY**

Übereinstimmungsbescheinigung
Πιστοποιητικό Συμμόρφωσης
Certificat de Conformité
Certificate of Conformity
Certificato di Conformità
Conformiteitscertificaat
Świadectwo Zgodności
Certifikat o skladnosti
Certificado de Conformidad

The Undersigned S.U.CHO, GENERAL MANAGER herewith certifies that the vehicle

0.1.	Make (Trade name of manufacture)	KIA
0.2.	Type	CD
	Variant	F5P41
	Version	D72CZ2
0.2.1.	Commercial Name	Ceed
0.2.3.	Identifiers:	
0.2.3.1.	Interpolation family's identifier:	IP-091894-U5Y-1
0.2.3.2.	ATCT family's identifier:	AT-091893-U5Y-1
0.2.3.3.	PEMS family's identifier:	9-KMS-3-0
0.2.3.4.	Roadload family's identifier:	RL-04-U5Y-2018-0004
0.2.3.5.	Roadload Matrix family's identifier:	
0.2.3.6.	Periodic regeneration family's identifier:	
0.2.3.7.	Evaporative test family's identifier:	EV-000003-TMA-1
0.4.	Vehicle Category:	M1
0.5.	Company name and address of Manufacturer:	Kia Slovakia s.r.o., Sv. Jana Nepomuckeho 1282/1, Teplicka nad Vahom, 013 01 Slovak Republic
0.6.	Location and method of attachment of the statutory plates :	
	On the left hand B-post, bonded	
	Location of the vehicle identification number:	
	Under the right front seat	
0.9.	Name and address of the manufacturer's representative (if any)	
	Hyundai Motor Europe Technical Center GmbH, Hyundai-Platz, 65428 Russelsheim, Germany	
0.10.	Vehicle identification number:	U5YH5815GPL140718
0.11.	Date of manufacture of the vehicle:	29.09.2022

General construction characteristics:

1.	Number of axles and wheels:	2 ; 4
3.	Powered axles:	1, Front
3.1	Specify if the vehicle is:	non-automated

Main Dimensions:

4.	Wheelbase:	2650 mm
4.1.	Axle spacing:	2650 mm
5.	Length:	4605 mm
6.	Width:	1800 mm
7.	Height:	1460 mm

Masses

13.	Mass in running order:	1407 kg
13.2.	Actual mass of the vehicle:	1522 kg
16.	Technically permissible maximum masses	
16.1.	Technically permissible maximum laden mass:	1880 kg
16.2.	Technically permissible maximum mass on each axle:	1. 1050 kg 2. 1000 kg
16.4.	Technically permissible maximum mass of the combination:	3290 kg
18.	Technically permissible maximum towable mass in case of:	
18.1.	Drawbar trailer:	kg
18.3.	Centre-axle trailer:	1410 kg
18.4.	Unbraked trailer:	600 kg
19.	Technically permissible maximum static vertical mass at the coupling point:	75 kg

conforms in all respects to the type described in approval e4*2007/46*1299*18 granted on 08.07.2022 and can be permanently registered in Member states having right hand traffic and using metric units for the speedometer and metric units for the odometers.

Frankfurt, 12.10.2022

1625387