



Expertise

Protocol number: 46568236
Order No. / Reference: 26664891
Inspection date: 16 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1N4M1CB8PW284437

Model: GLB 200 d 8G-DCT EDITION 2022



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 200 d 8G-DCT EDITION 2022	
Vehicle Identification number	W1N4M1CB8PW284437
Mileage (Read)	153,563 km
First registration	27 Apr 2023
Number of holders	1
Power / Engine displacement	110 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	NACHTSCHWARZ UNILACK
Doors / Seats	5 / 7
Upholstery type	Alcantara / Leather
Colour of upholstery	Black-Red
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-2,704 km
Last service on / at	05/2025 at 125,857 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS709580
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AHY 00157		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,195 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99W	Summer tyres on Light alloy	Pirelli	3mm / 3mm
2)	235/50 R19 99W	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaanlage

Standard equipment

- Airbag for driver and front passenger
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- AMG floor mats (in black with "AMG" lettering)
- AMG sports pedal assembly (made of brushed stainless steel with rubber studs)
- AMG Styling (AMG front apron with chrome front splitter - AMG rear apron with diffuser look - chrome trim element and two visible tailpipe trims)
- Anti-lock braking system (ABS)
- Rear armrest
- ATTENTION ASSIST (can detect typical signs of fatigue via steering behavior and can warn the driver of impending microsleep)
- On-board computer
- Brake assist
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT (Simply drive the way you want. At the touch of a button, DYNAMIC SELECT offers various driving programs that predefine, for example, the engine, transmission, suspension, or steering. Sport mode provides a decidedly dynamic driving experience, while the basic Comfort program offers a very balanced ride. ECO mode, on the other hand, prioritizes maximum efficiency, saving fuel and money.)
- Speed Limit Assist (The Speed Limit Assist makes it easy for you to comply with the regulations and avoid unnecessary speeding tickets. The system shows what is permitted: It can detect the current speed limit via the camera and display it in the instrument cluster. Additional restrictive signs for special weather conditions such as wet conditions are also detected.)
- KEYLESS-GO start function
- Communication module (LTE) for the use of Mercedes me connect services (communication module with permanently installed SIM card of the mobile communications standard LTE - two mobile communications antennas)
- Fuel tank with larger volume 60 l
- Loading floor height-adjustable and removable
- LED High Performance Headlights (LED High Performance headlights offer you greater safety at night and a distinctive, striking look. Thanks to LED technology, they illuminate the road better than conventional headlights - with lower energy consumption.)
- Steering column mechanically adjustable lengthwise and heightwise.
- Mercedes-Benz Emergency Call System (The Mercedes-Benz Emergency Call System can provide a crucial time advantage in an emergency. A communication module with its own SIM card automatically triggers an emergency call upon detection of an accident, which can shorten the time until emergency services arrive. The emergency call can also be triggered manually to organize assistance.)
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist
- Ambient lighting (in 64 colors, all colors are individually selectable - eight color worlds consisting of two colors each - the colors are statically set or slowly exchange each other in dynamic mode - the brightness of the LEDs can be adjusted in ten steps and three zones - the interior of the air vents is finished in silver chrome and illuminated - AMG Line and Progressive: additional lighting of the piping of the instrument panel above the trim element and in the doors)
- Automatic passenger airbag deactivation
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated turn signal light)
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Door sills with "Mercedes-Benz" lettering
- Door sill trims with Mercedes-Benz lettering, illuminated and with interchangeable cover
- Electronic Stability Program (ESP)
- Chassis: Comfort chassis
- Electric window regulators (4)
- Luggage net on driver and passenger seatbacks
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Halogen headlights including integrated LED daytime running lights
- Rear window heated
- rear window wiper
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control (1-zone climate control - automatically controlled air distribution - recirculation function - tunnel mode in conjunction with navigation system - fine dust filter)
- Headrests (2)
- Rear headrests (3)
- Paint finish: Solid
- Cargo area cover (roller blind) (stores under the cargo floor)
- Steering wheel: Multifunction sports steering wheel in Nappa leather (The multifunction sports steering wheel in Nappa leather with chrome control panels is flattened at the bottom and perforated in the grip area – an excellent choice for sporty driving. Among other things, the touch control buttons on the left and right operate a variety of functions, including navigation, telephony, and entertainment. Last but not least, you can also set the cruise control and distance control: everything under control without taking your hands off the steering wheel.)



- Package: Light and Sight Package (Overhead control unit with 4 light elements (including glasses compartment) - Interior light/reading light rear in mounting plate (rear/left/right) - Touchpad lighting (front) - Reading lights (front/left/right), console ambient light - Make-up lights (front/left/right) - Signal and ambient light - Exit signal light (front/left/right) - Footwell lighting (front/left/right) - Cupholder/storage compartment lighting - Occasional storage compartment lighting)
- Package: Seating comfort (height adjustment for passenger seat - seat cushion tilt adjustment for driver and passenger seats - seat cushion depth adjustment for improved seating comfort through a 60 mm wider thigh support area - specific seat design)
- Radio accessories: Digital radio
- Radio accessories: Media Display 10.25"
- Radio accessories: Touchpad (integrated into the center console, including a hand rest - single and multi-finger gestures, swiping movements and zoom gestures by spreading and pinching the fingers - recognizes handwritten characters: letters, special characters and numbers - clear haptic feedback)
- Rain and light sensor
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Power steering
- Seats: Rear seat backrests foldable (in a 40/20/40 ratio and adjustable to 7 tilt positions)
- Seats: Sports seats (with adjustable headrest)
- Seats: Front seats mechanically adjustable (Good seating comfort as standard - the standard seat is upholstered in a high-quality fabric combination. You can manually adjust your individual seating position longitudinally and vertically.)
- Cruise control (Drive relaxed and fuel-efficiently, especially on longer journeys. Simply select your desired speed and your vehicle will regulate it. In addition to the cruising speed, the speed limiter helps you maintain a maximum speed. This increases road safety and protects you from expensive speeding tickets.)
- Navigation accessories: Extended MBUX functions (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via "Hey Mercedes" - Wi-Fi hotspot - internet radio)
- Package: Night (AMG Line) (Door trim in black with inlay in running board design in high-gloss black - Exterior mirror housings in black - Belt edge trim and window line trim strip in high-gloss black - Roof rails in black - Heat-insulating dark tinted glass - 48.3 cm (19") AMG light alloy wheels in 5-twin-spoke design, aerodynamically optimized, high-gloss black and glossy, with 235/50 R 19 tires on 7.5 J x 19 ET 53 - Diamond grille with chrome pins, individual flames in black and chrome inlays, as well as AMG-specific front airbags with inlays in high-gloss black - AMG rear airbags with trim elements in high-gloss black)
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio: MBUX multimedia system (instrument display with 17.78 cm (7") diagonal - media display with 17.78 cm (7") diagonal and touch function - touch control buttons on the steering wheel - radio (FM/AM) - USB interface in the center console under the armrest - Bluetooth telephony with contact transfer and audio streaming of music data - display of vehicle functions (driver assistance system, driving programs and vehicle settings) - favorites memory - smartphone-related voice control - activated by long press on the voice button on the steering wheel)
- Remote Services Plus (The Remote Services Plus package transforms mobility into a new experience, offering greater comfort and safety. Status queries provide information about the remaining range. You can remotely control certain functions and locate your vehicle. Services such as maintenance management coordinate service appointments, saving you valuable time.)
- Sport brake system (drilled brake discs, brake calipers at the front and badges at the rear with Mercedes-Benz lettering)
- 12V power outlet in center console
- Fully digital instrument display (high-resolution 10.25" display)
- High-visibility vest for drivers
- Immobiliser
- Decorative elements carbon structure



Extra equipment

- Heated seats for driver and front passenger
- MULTIBEAM LED (18 individually controllable high-performance LEDs per MULTIBEAM LED module for creating a column-shaped high beam with 16 controllable individual segments - Low beam and high beam in LED projection technology - Adaptive Highbeam Assist Plus (glare-free permanent high beam) - Cornering lights or cornering lights with roundabout and intersection function (only in conjunction with hard drive navigation) - Active curve illumination when high beam is activated - City light, country road light and motorway light - Adaptive full-LED rear lights)
- Package: Cargo area (12V socket - reversible mat - nets on the left and right sides (left net is omitted in conjunction with 3rd row of seats for 2 persons (847)) - open compartment under net on the left - tension straps on the left and right sides - chrome loading sill protector)
- Package: Parking package with reversing camera (Active parking assistant with visual and acoustic warning of detected obstacles, notification of detected parking spaces in the instrument cluster via arrow display, assists with parking in and out of parallel and perpendicular parking spaces - reversing camera in the tailgate: display in the multimedia system screen with schematic representation and guidelines - ultrasonic sensors: located in the front and rear bumpers)
- Seats: 3rd row of seats for 2 people
- Seats: 4-way lumbar support for driver and front passenger
- Storage compartment in center console with roller blind (The roller blind for the storage compartment in the center console offers you an elegant privacy screen made of high-quality material. This looks good, the interior appears even tidier, and everything important is within easy reach. Typical everyday items such as a smartphone, wallet, or various keys fit into the practical storage compartment.)
- Telephone accessories: Wireless charging system for mobile devices (wireless charging according to Qi standard for compatible mobile phones - fast connection setup between multimedia system and mobile phone via Near Field Communication (NFC) for identification of the mobile device - storage compartment for wireless charging is located in the storage compartment at the front of the center console)
- Black fabric headliner
- Blind Spot Assist
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Climate control: THERMOTRONIC automatic climate control (two zones with individually adjustable temperature for driver and front passenger - automatic control of temperature, air volume and air distribution (Auto button) - sensors maintain the desired climate - fine dust activated carbon filter - dew point sensor prevents window fogging and enables energy-efficient climate control - rear center vents for improved climate comfort in the rear - residual heat button for heating/ventilation when the vehicle is switched off (country-dependent))
- EASY-PACK tailgate (electrically opening and closing tailgate - switch for electrically opening the tailgate in the driver's door - switch for electrically closing the tailgate at the bottom edge of the tailgate - manual cargo cover for covering the cargo area)
- Heated windshield washer system
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Parking assistant with PARKTRONIC - Preparation for live traffic information)
- Package: MBUX High-End Package (Hard drive navigation - Smartphone integration - Wireless charging system for mobile devices - Preparation for digital key handover - Connectivity package navigation - Central Media Display 10.25" - Fully digital instrument display with high-resolution 10.25" display - MBUX Augmented Reality for navigation - Traffic sign assistant - Preparation for live traffic information)
- Package: Mirror package (Exterior mirrors electrically fold in and out via a button in the driver's door control panel - the menu allows you to set the exterior mirrors to fold in automatically when locking the vehicle and unfold again when unlocking - the exterior mirror on the driver's side and the interior mirror dim automatically and continuously depending on the incident glare and ambient light)
- Type designation removed from luggage compartment lid

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Tyre - right - does not meet manufacturer specifications - No deduction
2	Instrument panel	Centre console - rear - Damaged - Replace
3	Boot lid / rear door	Boot lid (Mit Kratzer) - dent(s) - Smooth repair work
4	Interior	Interior - Soiled - Clean
5	Side panel - rear left side	Sill - dent(s) - Smart repair
6	Front bumper	Spoiler - Scratch(es) - Paint
7	Misc.	Inspection / maintenance - Due - Perform
8	Body	Underbody - Broken / torn - Replace
9	Braking system	Brake discs and pads - rear - Corrosion - Replace
10	Braking system	Brake discs and brake pads - front - Corrosion - Replace
11	Door - rear right side	Door (Orangenhaut) - Unprofessionally repaired - Paint
12	Bonnet	Bonnet (Verätzung) - Paint defect - Lacquer
13	Roof	Roof - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	Vehicle glazing	Rear window - Scratch(es) - No deduction
3	Body	Underbody panelling - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 10 Mar 2025	2.189,86 €

Repainting

No.	Repainting
1	Mudguard - left side, Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
2	Door - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - left side	195 µm	Mudguard - right side	180 µm
Door - rear right side	250 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Winterradsatz gehört nicht zum Lieferumfang



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.

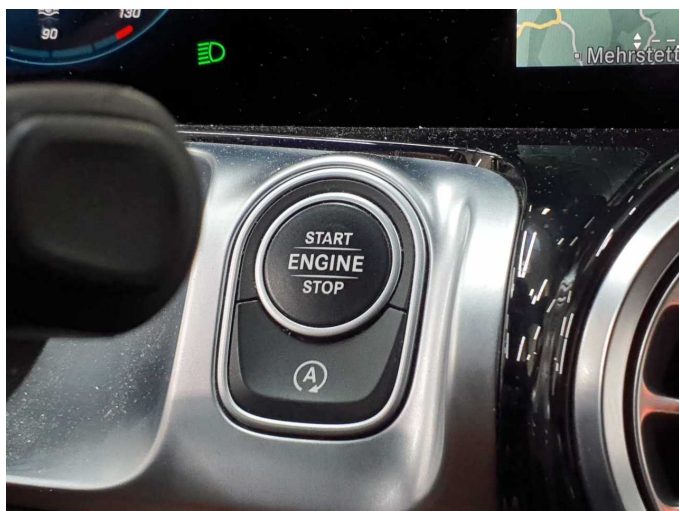


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

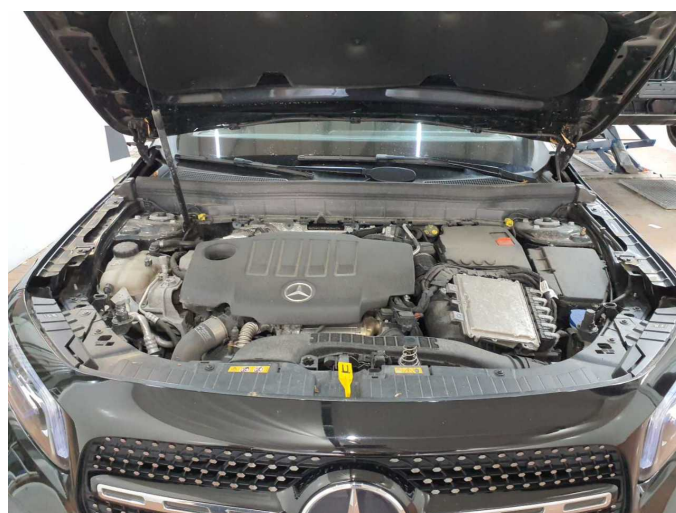


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

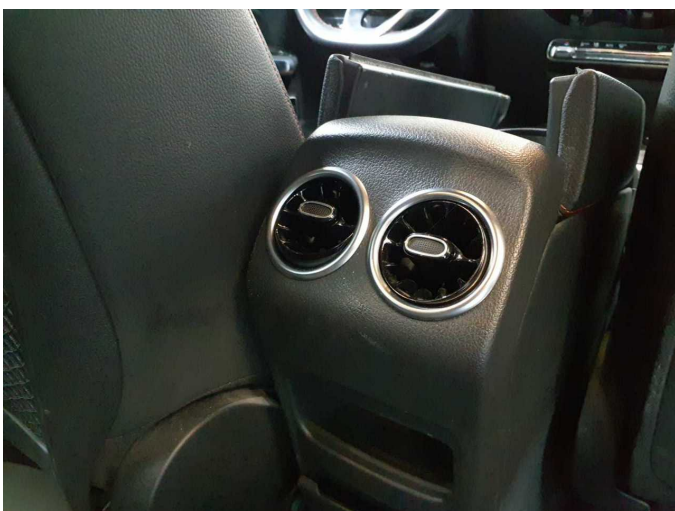


Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.




Figure 32: Misc.



Figure 33: Misc.

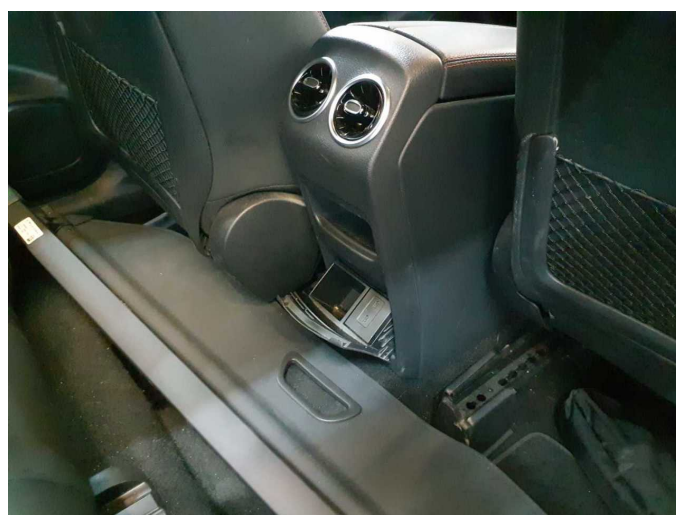


Damage 2: Instrument panel: Centre console - rear - Damaged - Replace

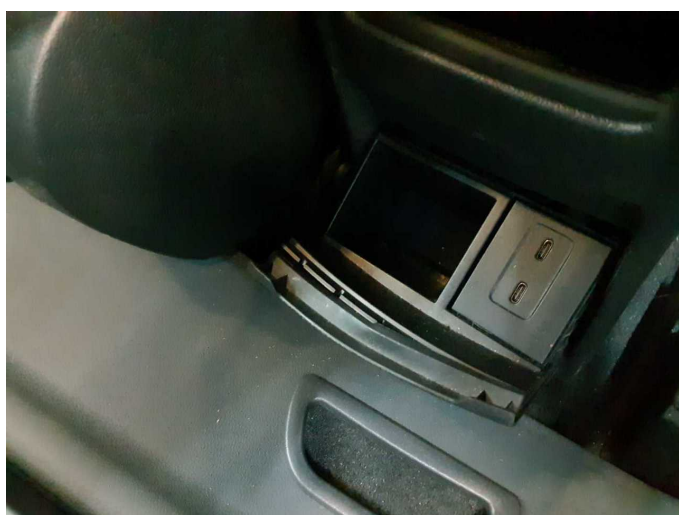


Damage 2: Instrument panel: Centre console - rear - Damaged - Replace




Damage 3: Boot lid / rear door: Boot lid (Mit Kratzer) - dent(s) - Smooth repair work

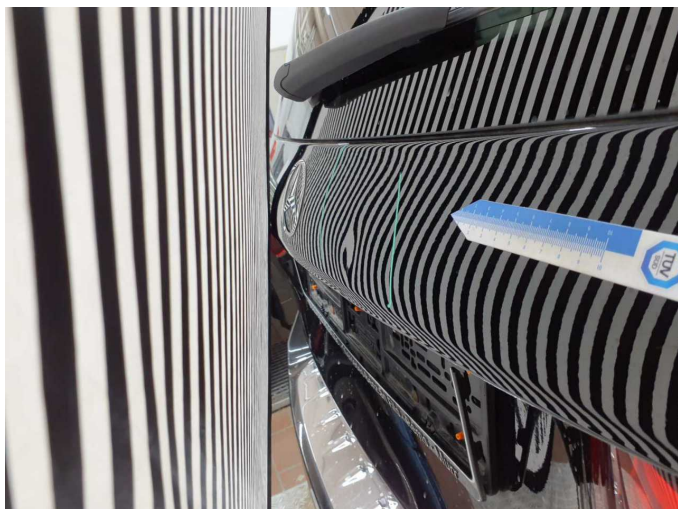


Damage 3: Boot lid / rear door: Boot lid (Mit Kratzer) - dent(s) - Smooth repair work

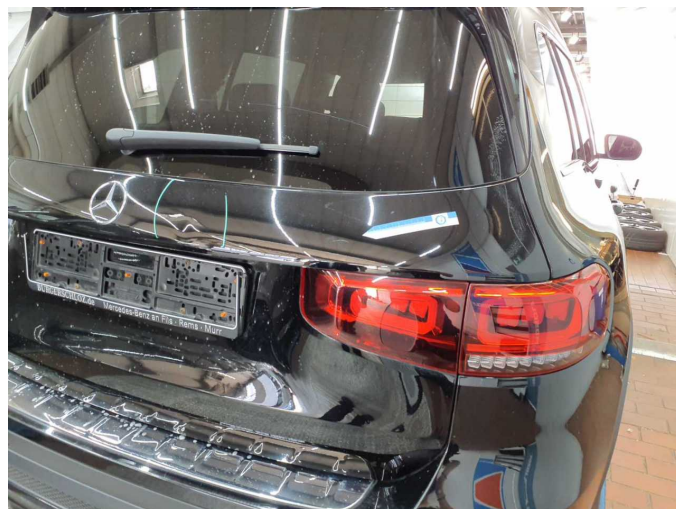


Damage 3: Boot lid / rear door: Boot lid (Mit Kratzer) - dent(s) - Smooth repair work

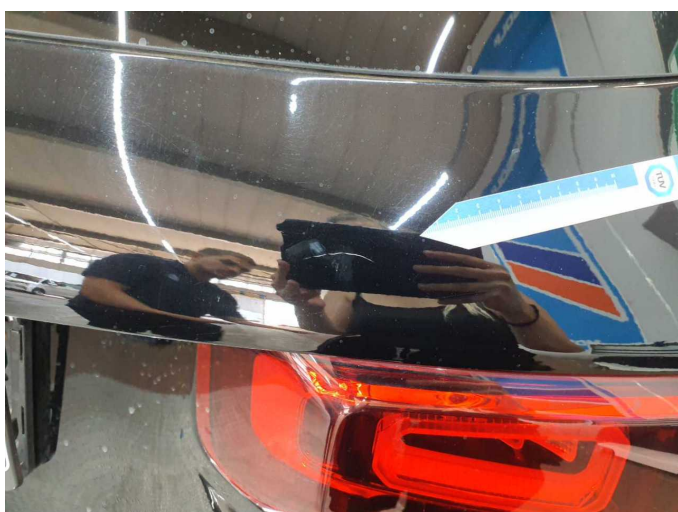


Damage 3: Boot lid / rear door: Boot lid (Mit Kratzer) - dent(s) - Smooth repair work

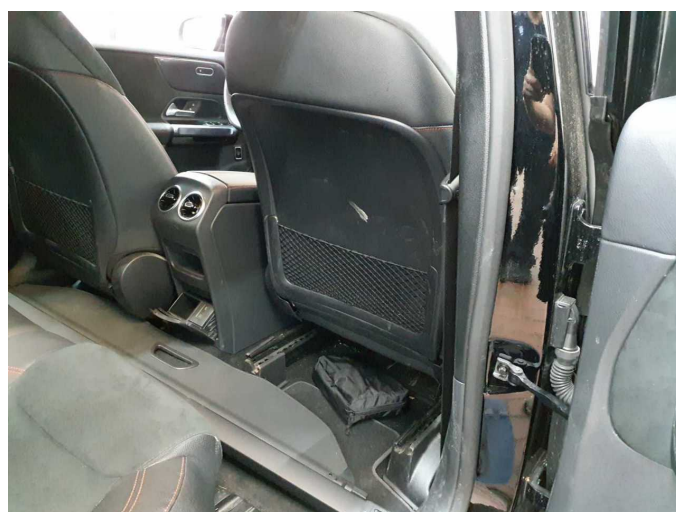


Damage 4: Interior: Interior - Soiled - Clean

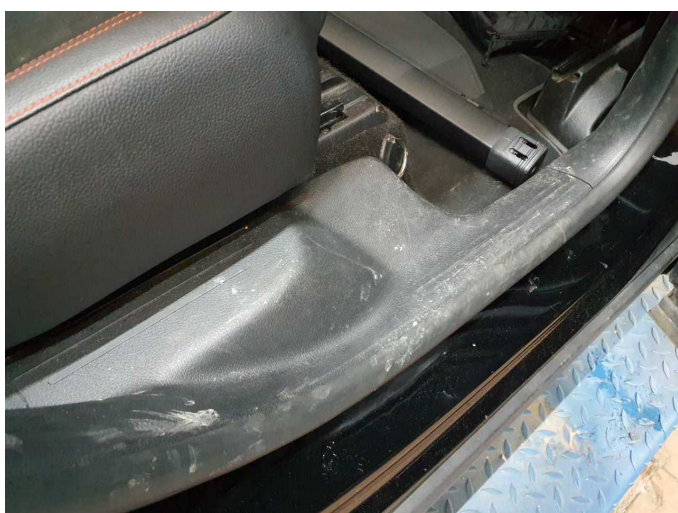


Damage 4: Interior: Interior - Soiled - Clean

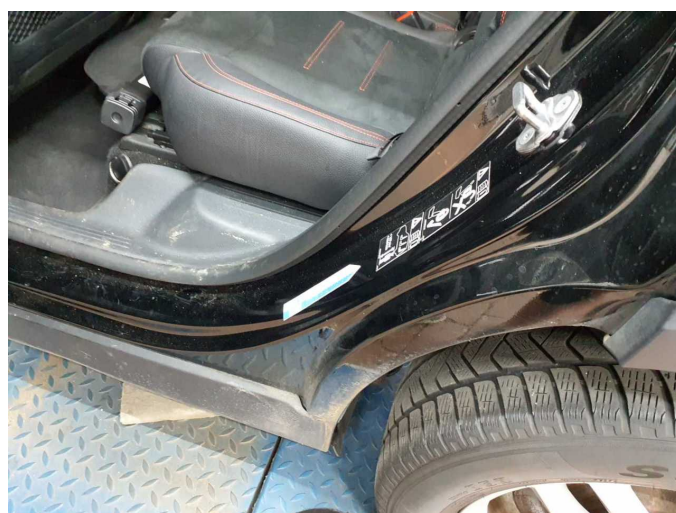

Damage 5: Side panel - rear left side: Sill - dent(s) - Smart repair

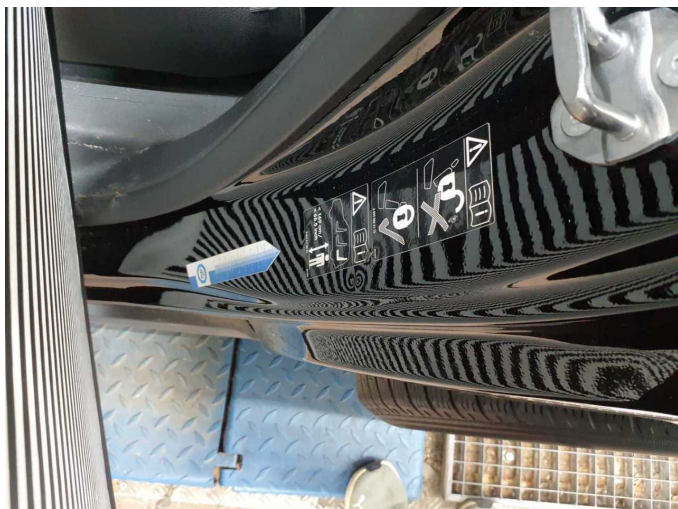

Damage 5: Side panel - rear left side: Sill - dent(s) - Smart repair

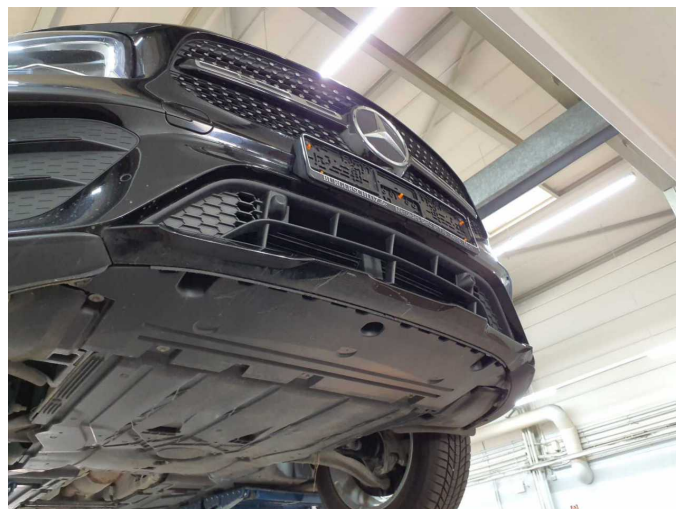


Damage 6: Front bumper: Spoiler - Scratch(es) - Paint



Damage 6: Front bumper: Spoiler - Scratch(es) - Paint



Damage 6: Front bumper: Spoiler - Scratch(es) - Paint

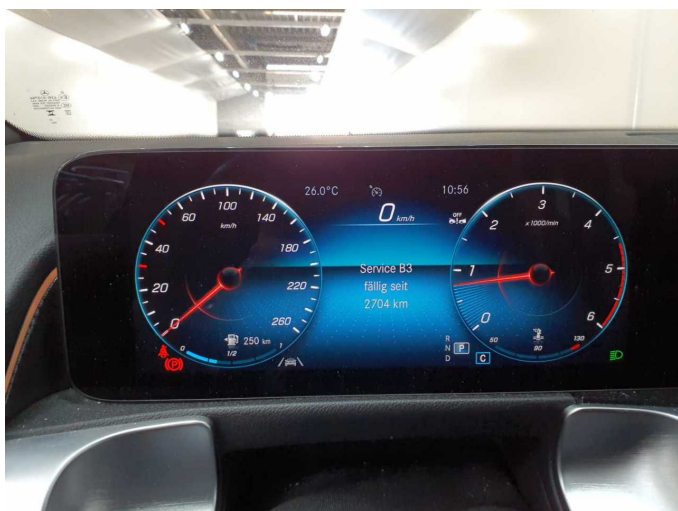

Damage 7: Misc.: Inspection / maintenance - Due - Perform



Damage 8: Body: Underbody - Broken / torn - Replace



Damage 8: Body: Underbody - Broken / torn - Replace



Damage 9: Braking system: Brake discs and pads - rear - Corrosion - Replace



Damage 9: Braking system: Brake discs and pads - rear - Corrosion - Replace




Damage 10: Braking system: Brake discs and brake pads - front - Corrosion - Replace




Damage 10: Braking system: Brake discs and brake pads - front - Corrosion - Replace




Damage 11: Door - rear right side: Door (Orangenhaut) - Unprofessionally repaired - Paint

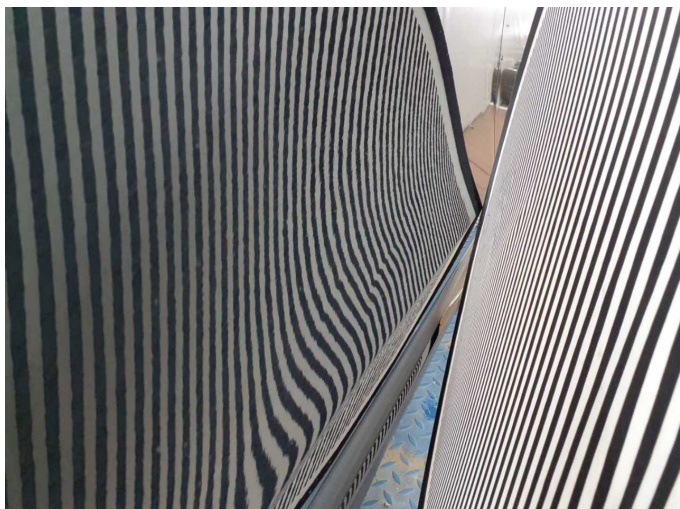


Damage 11: Door - rear right side: Door (Orangenhaut) - Unprofessionally repaired - Paint

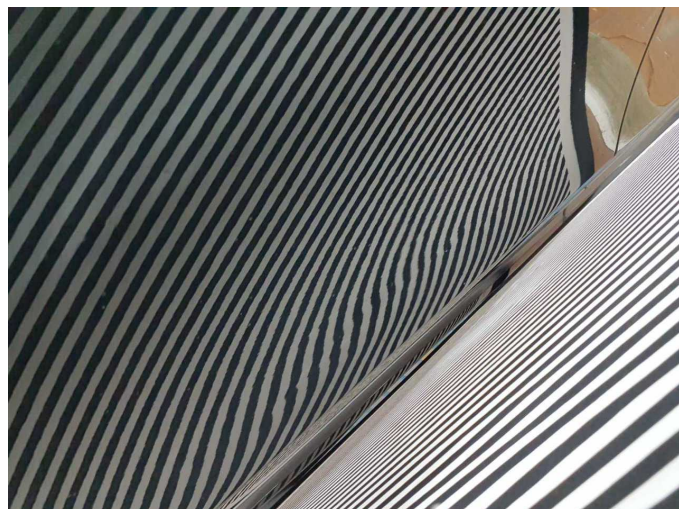

Damage 11: Door - rear right side: Door (Orangenhaut) - Unprofessionally repaired - Paint

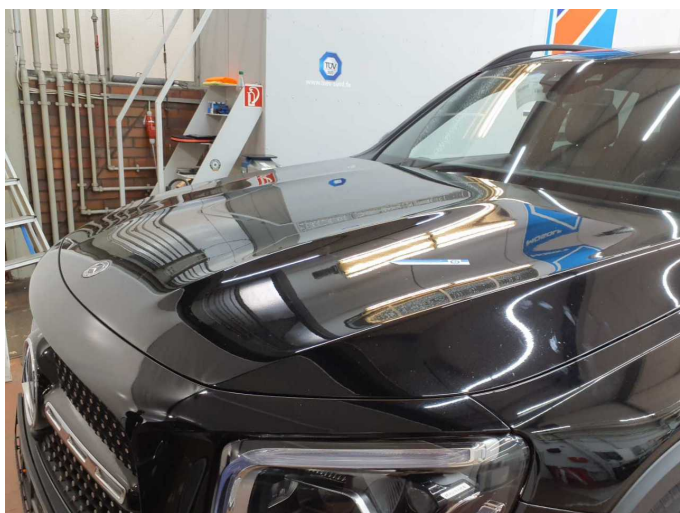

Damage 12: Bonnet: Bonnet (Verätzung) - Paint defect - Lacquer

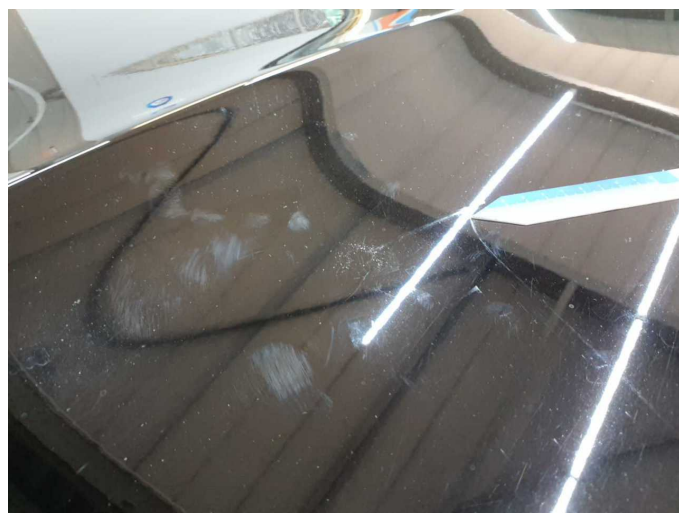


Damage 12: Bonnet: Bonnet (Verätzung) - Paint defect - Lacquer



Damage 13: Roof: Roof - Scratch(es) - Paint




Damage 13: Roof: Roof - Scratch(es) - Paint

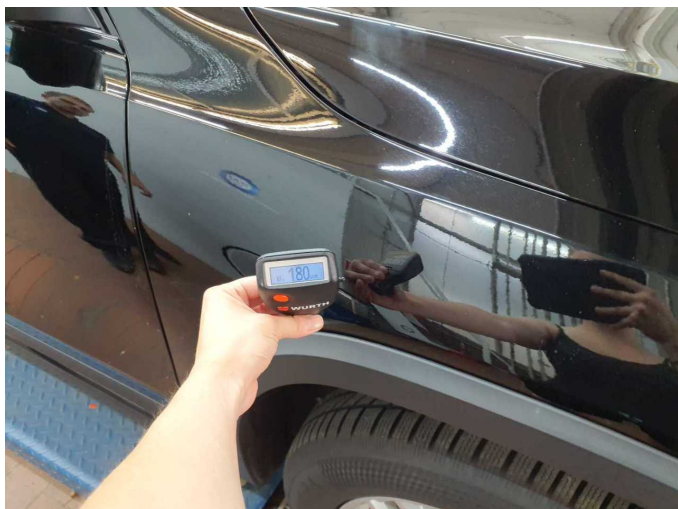

Repainting 1: Mudguard - left side, Mudguard - right side



Repainting 1: Mudguard - left side, Mudguard - right side

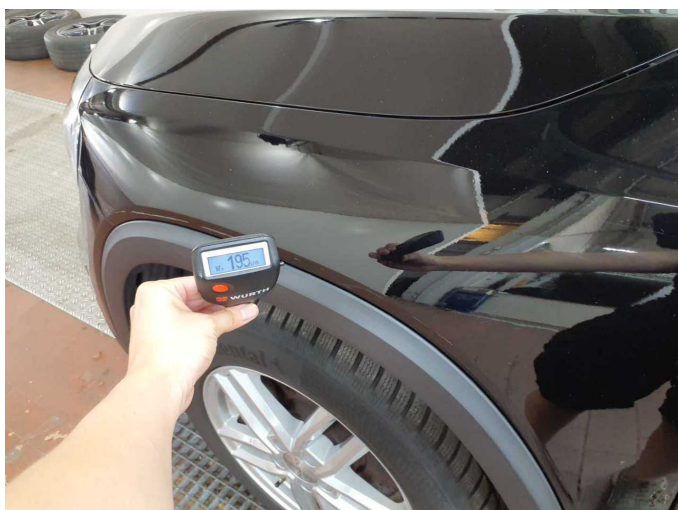

Repainting 1: Mudguard - left side, Mudguard - right side



Repainting 1: Mudguard - left side, Mudguard - right side



Repainting 2: Door - rear right side



Repainting 2: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N4M1CB8PW284437

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLB 200 d 8G-DCT
EDITION 2022

Datum	KM-Stand	Beschreibung
30.05.2025	125.857	Regelwartungsdienst
22.11.2024	100.628	Regelwartungsdienst
16.07.2024	75.611	Bremsscheiben vorne; Regelwartungsdienst
27.12.2023	48.184	Regelwartungsdienst
04.09.2023	24.519	Regelwartungsdienst