



Expertise

Protocol number: 46462388
Order No. / Reference: 26621543
Inspection date: 10 Jul 2026

Manufacturer: Ford

Model: Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. ST-LINE
VIGNALE

VIN: WF0PXXGCHPNR15351



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. ST-LINE VIGNALE	
Vehicle Identification number	WF0PXXGCHPNR15351
Mileage (Read)	148,763 km
First registration	12 Jan 2023
Number of holders	1
Next periodical technical inspection	02/2028
(Report on hand)	
Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Agate Black Metallic
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Anthracite-Black
Vehicle with smoke odor	Yes (not ozone-treated)
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	0 %
Last service on / at	10/2025 at 119,039 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP495930
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	With complaint
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8566 / BPV 00635		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,035 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R18 95Y	Summer tyres on Light alloy	Firestone	6mm / 6mm
2)	235/40 R18 95Y	Summer tyres on Light alloy	Firestone	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag: Passenger airbag deactivation
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Attachment points behind the second row of seats for mounting the safety partition net
- Hill start assist
- Body styling kit (radiator grille, ST-Line design - side skirts, painted in body color - front and rear bumpers, ST-Line design)
- Roof spoiler painted in car color
- Digital instrument panel 12.3" (31.2 cm screen diagonal)
- Electronic Shifter
- Lane keeping assist including lane keeping assist
- Chassis: Sport-tuned
- Electronic parking brake
- Ford Key Free system including Ford Power Start function (keyless unlocking/locking - keyless starting)
- Luggage compartment cover
- Speed limiter (Intelligent speed limiter with speed limit display)
- Cruise control
- Transmission: 8-speed automatic transmission
- Illuminated glove compartment
- Back window, heater
- rear window wiper
- Interior lighting with LED technology (front and rear and map reading lights at the front)
- Isofix mounting (including top tether anchor points on the outer seats of the 2nd row)
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Headrests: 2 front and 3 rear, height adjustable
- LED headlights (LED low beam - LED high beam - LED daytime running lights incl. integrated LED turn signals at the front - LED cornering lights, static, incl. integrated LED fog light function and maneuvering light)
- Steering wheel: Paddle shifters on the steering wheel
- Make-up mirrors in driver and passenger sun visors
- Rear center armrest (with 2 cup holders)
- MyKey key system (individually programmable second key)
- Navigation: Ford SYNC 4 including Ford navigation system with AppLink, 13.2" touchscreen and DAB/DAB+ (13.2" touchscreen (33 cm) - 6 speakers - Android Auto and Apple CarPlay - Steering wheel controls - Digital owner's manual - Bluetooth hands-free calling and audio streaming - USB ports - Voice control for audio and phone - Ford Power-Up software updates - Intelligent route suggestions - Customizable user profiles - Radio player - Audible and visual route guidance, dynamic and cloud-based navigation with advanced traffic information system, lane guidance and road map for Europe)
- Pre-Collision Assist (Forward Alert system with pedestrian and bicycle detection)
- Ambient lighting, front
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated turn signals and ambient lighting and electrically foldable)
- Tires: 8 J x 18 light alloy wheels (4) with 235/40 R 18 (in 5x3-spoke Y-design, in pearl grey premium paint finish, diamond-turned)
- Black woven fabric headliner
- Roof rails, black
- Diesel particulate filter (DPF)
- Tachometer
- Electronic Stability Program (ESP) (with Emergency Brake Assist (EBA) and Traction Control System (TCS))
- Electric front and rear windows (with all-around closing function)
- Ford Power Start function (keyless start)
- FordPass Connect including eCall, live traffic information (only with navigation) and Wi-Fi hotspot (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app - eCall emergency call system to send an emergency call in the event of an accident or when manually activated - Real-time traffic information (only in conjunction with navigation system) - Wi-Fi hotspot (up to 4G/LTE7, for up to 10 mobile devices))
- Interior mirror, automatically dimming
- Intelligent safety system (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts on all seats, height-adjustable in the front - safety pedal assembly)
- LED taillights
- Leather gearshift boot with red decorative stitching
- Steering wheel: ST-Line design steering wheel (flattened at the bottom, with "ST" logo and red decorative stitching - in Sensico leather look)
- Steering column, adjustable (adjustable in height and reach)
- Front center console "Premium" (sliding armrest - cup holders - storage compartments - 12-volt and USB connection)
- Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats)
- Front and rear parking pilot system
- Upholstery: Premium Sensico upholstery in leather look
- Post-Collision Assist (In the event of a severe collision, which would also deploy the airbag and in which the driver might be incapacitated, this system initiates the braking process. This reduces the risk of colliding with further obstacles and road users after the initial collision. The driver can intervene and operate the accelerator or brake pedal manually throughout the entire process.)
- Tire repair kit (for use at a maximum speed of 80 km/h)
- Rear view camera
- Headlight assistant with day/night sensor



- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor (sensitivity adjustable)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Passenger seat height-adjustable, manually (with adjustable lumbar support)
- Seats: Map grid on the driver's and front passenger's seat backrests
- Seats: Front sports seats with enhanced lateral support
- 12-volt power outlet in the luggage compartment
- Carpet floor mats front and rear, velour
- Lashing eyes in the luggage compartment
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats

- Electro-mechanical speed-dependent power steering (EPAS - Electric Power Assisted Steering)
- Seats: Driver's seat, 8-way electrically adjustable, with electrically adjustable lumbar support
- Seats: Rear seat backrest (foldable, 60:40 split with ski pass-through)
- Start-stop system
- Phone accessories: Inductive charging station for mobile devices (according to Qi standard, compatibility depends on the device)
- Electronic immobilizer
- Central locking with remote control and remote luggage compartment release

Extra equipment

- Swiveling towbar (incl. ESP trailer stabilization)
- Paint finish: Metallic
- Package: Family Package III (Touarege) (2 USB ports on the rear center console - electric tailgate, sensor-controlled (opens and closes via foot movement) - 60:40 split-folding rear seat backrest with ski pass-through - inductive charging station for mobile devices - rear center armrest with 2 cup holders - Ford Key Free system (keyless locking/unlocking) - electrically folding exterior mirrors with puddle lights)
- Radio: B&O Sound System (675 Watt premium sound system with 10 speakers, including subwoofer - based on the renowned sound and design expertise of Bang & Olufsen)

- Reversible luggage compartment mat
- Package: Driver Assistance Package II (Drive Assist Intelligent adaptive cruise control Lane keeping assist Traffic jam assist with Stop&Go Traffic sign recognition Wrong-way driver warning radio Evasive steering assist Distance display and distance warning Driver drowsiness detection High beam assist (in conjunction with adaptive LED matrix headlights with glare-free high beam assist) Blind spot assist with cross traffic alert including emergency braking function (when reversing out of parking spaces) and trailer recognition Rear view camera with split view Electrically folding exterior mirrors with surround view)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed, problem has been detected This is due to the following reason.: Motorkontrollleuchte leuchtet.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Letzter Service fehlt.) - No evidence - No deduction
2	Equipment	Vehicle key with remote control (Batterie) - Empty - Replace
3	Trim / covers	Carpet - Burn hole (cigarettes) - Smart repair
4	Interior	Interior (Rauch) - Odour - Ozone treatment
5	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace
6	Instrument panel	Indicator light (Motorkontrollleuchte) - on - Perform diagnosis
7	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Scratched - Replace
8	Wheel / tyres	Alloy rim - rear left side (Materialabtrag) - Scratched - Replace
9	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Replace
10	Misc.	Inspection / maintenance - Due - Perform
11	Body	Body - Damage by hail - repair according to calculation

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Tirefit complete

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Minderwerte höher als HEK



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

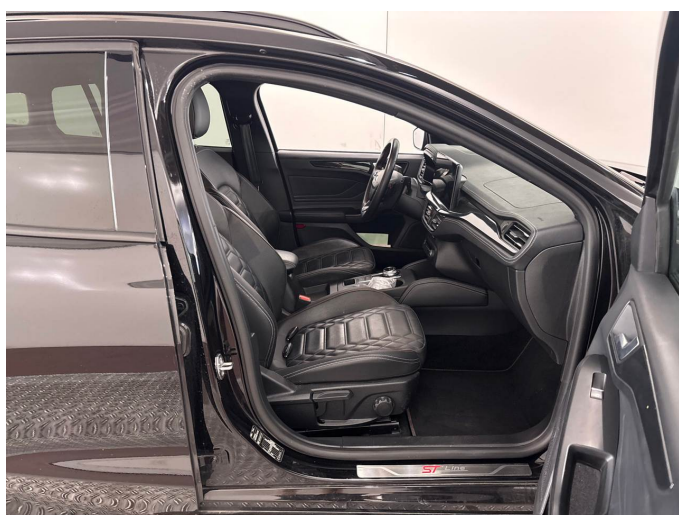


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

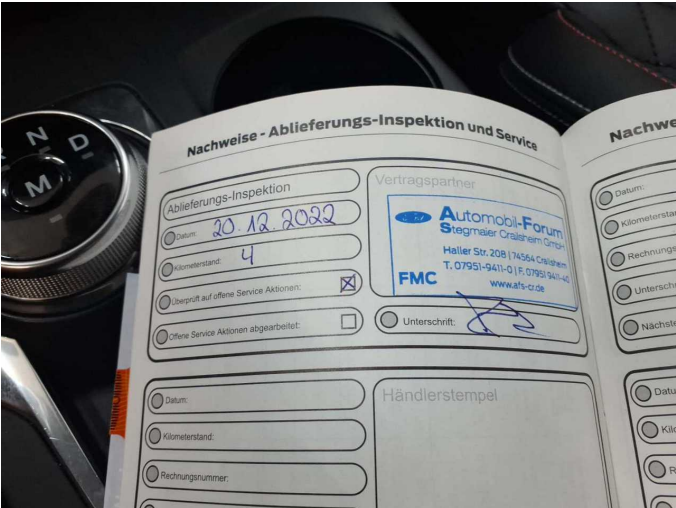


Figure 13: Documents

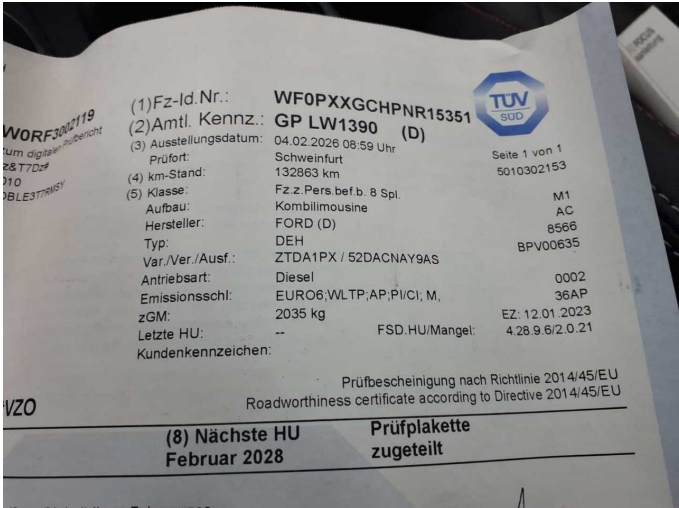


Figure 14: Documents

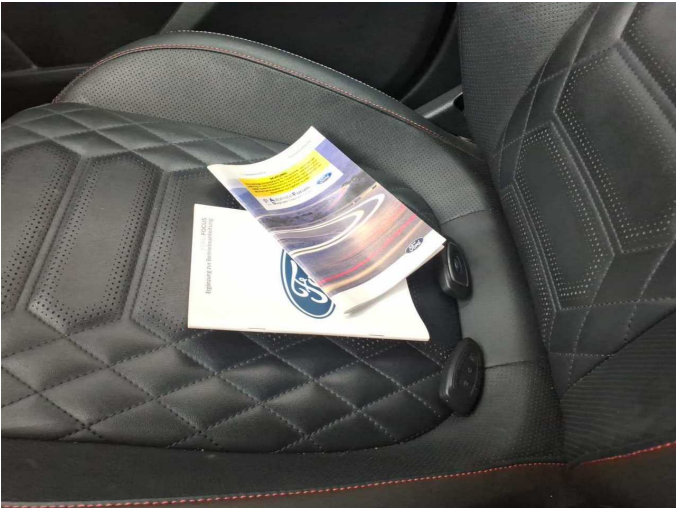


Figure 15: Documents

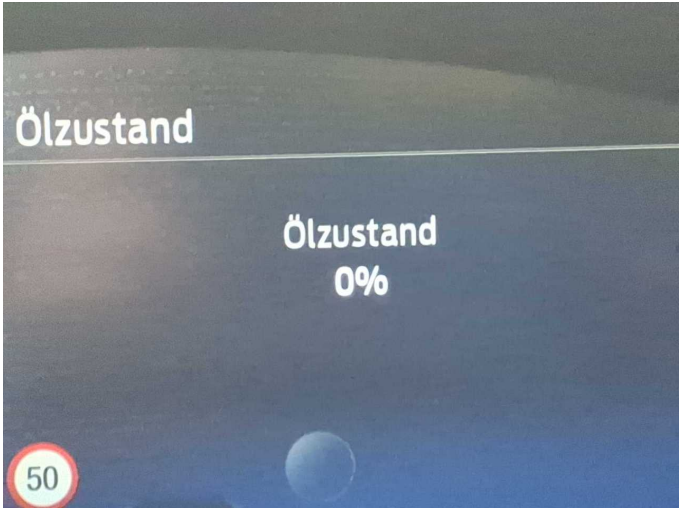


Figure 16: Documents

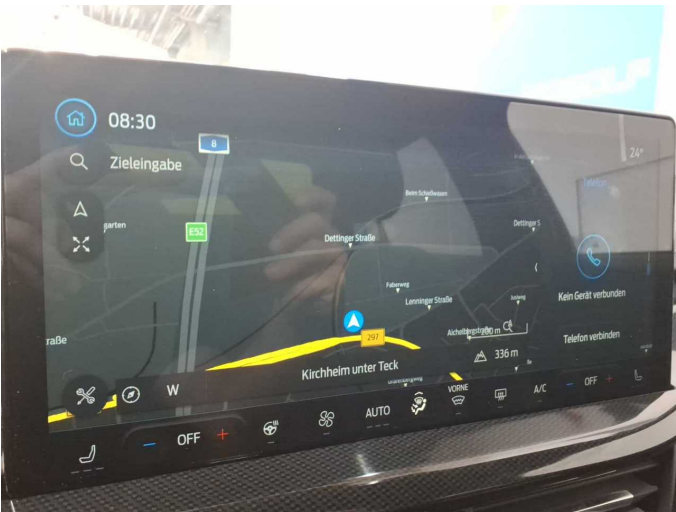


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

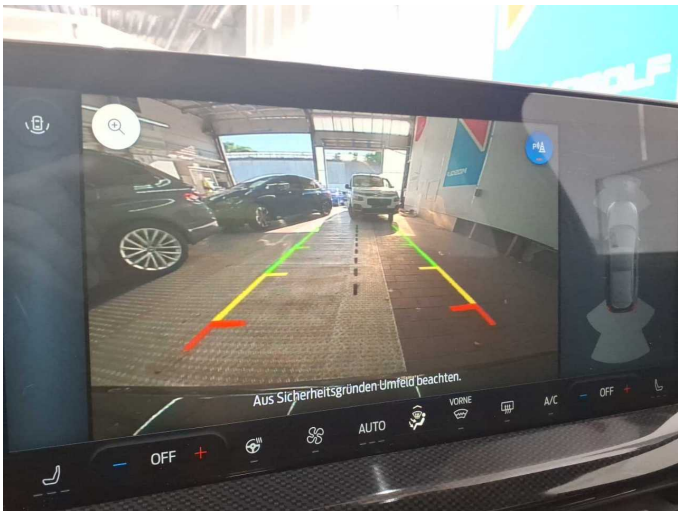


Figure 21: Misc.

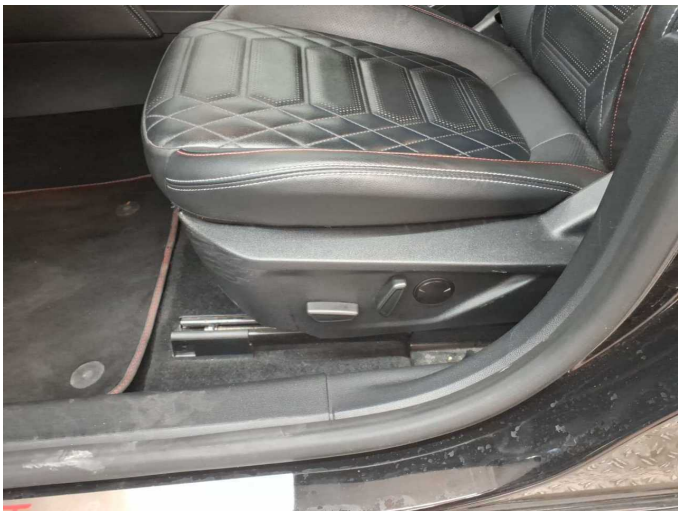


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

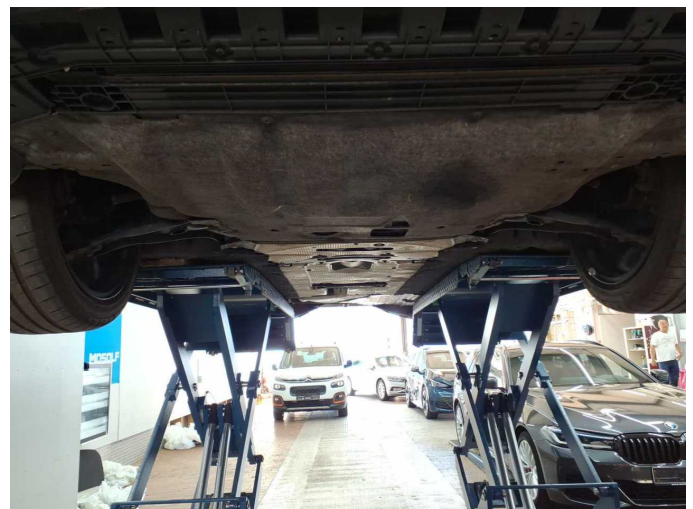


Figure 30: Misc.



Damage 3: Trim / covers: Carpet - Burn hole (cigarettes) - Smart repair



Damage 3: Trim / covers: Carpet - Burn hole (cigarettes) - Smart repair



Damage 5: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 5: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace




Damage 5: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 6: Instrument panel: Indicator light (Motorkontrolleuchte) - on - Perform diagnosis




Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace

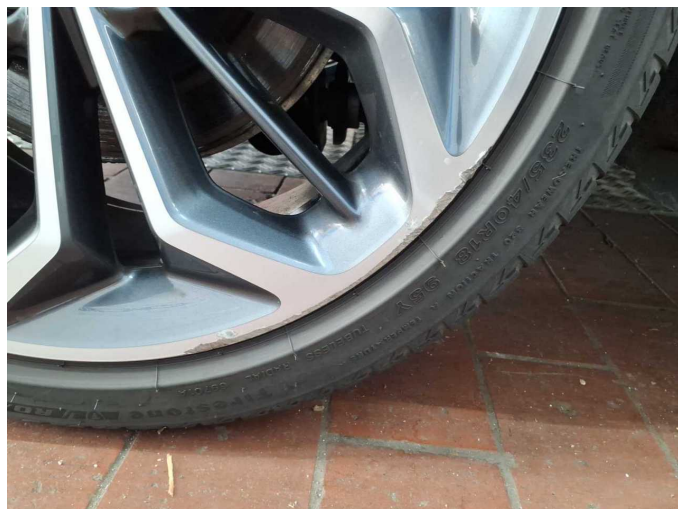


Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - Replace



Damage 8: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace

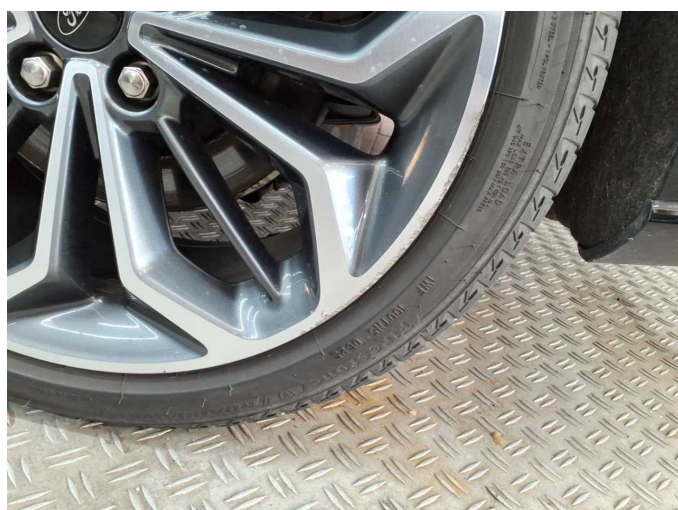

Damage 8: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace

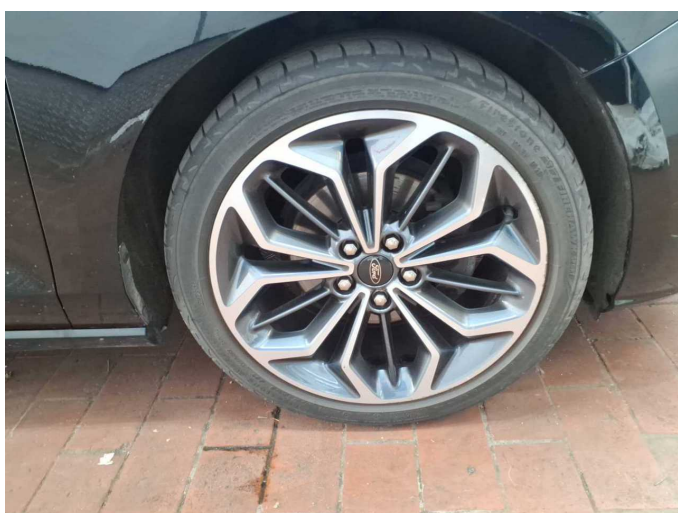

Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 9: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 10: Misc.: Inspection / maintenance - Due - Perform



Damage 11: Body: Body - Damage by hail - repair according to calculation




Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation

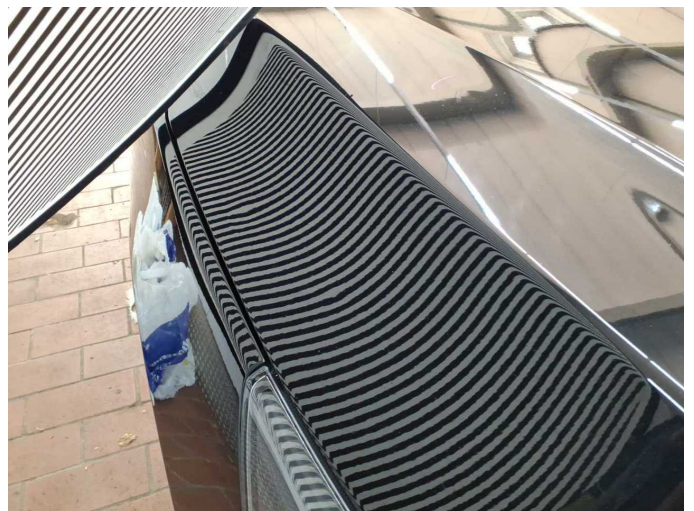

Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation




Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation

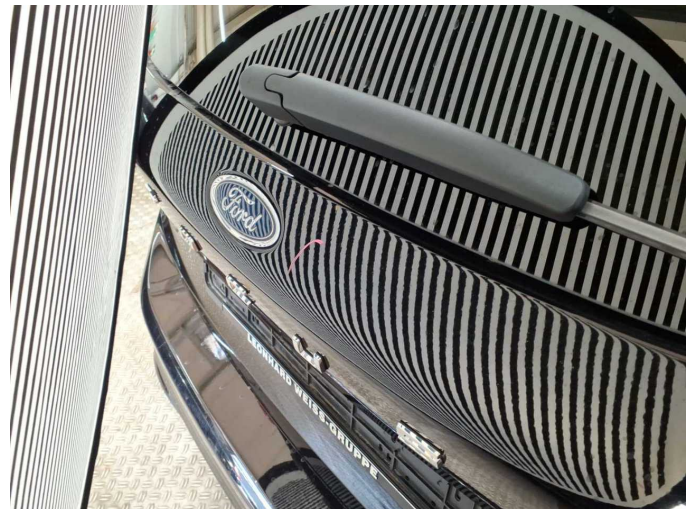


Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation




Damage 11: Body: Body - Damage by hail - repair according to calculation

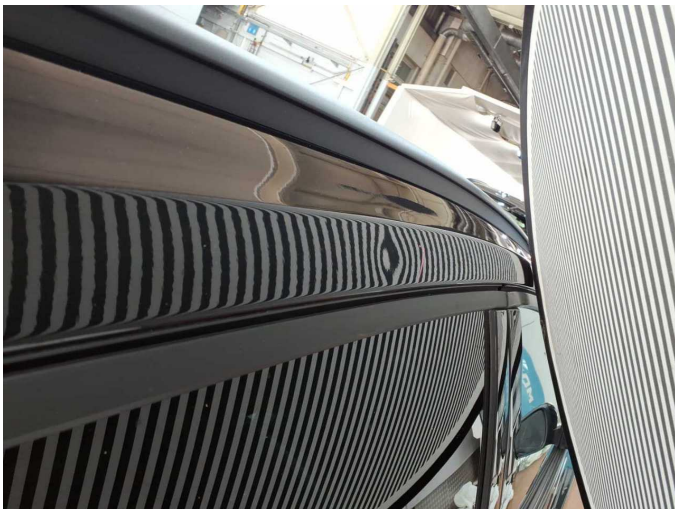


Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation

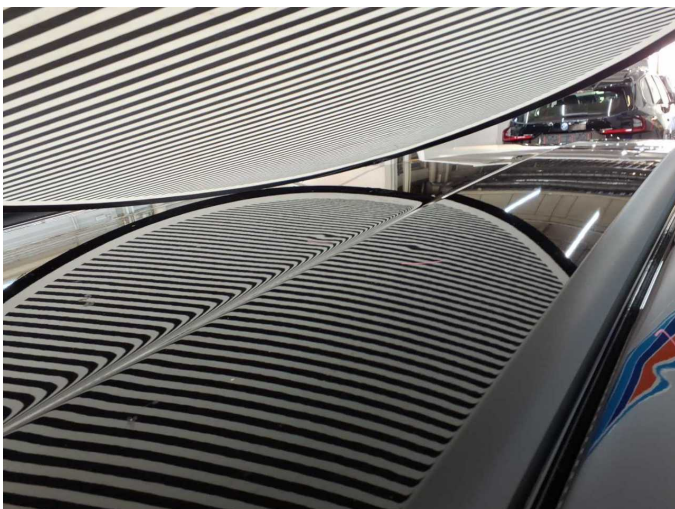


Damage 11: Body: Body - Damage by hail - repair according to calculation

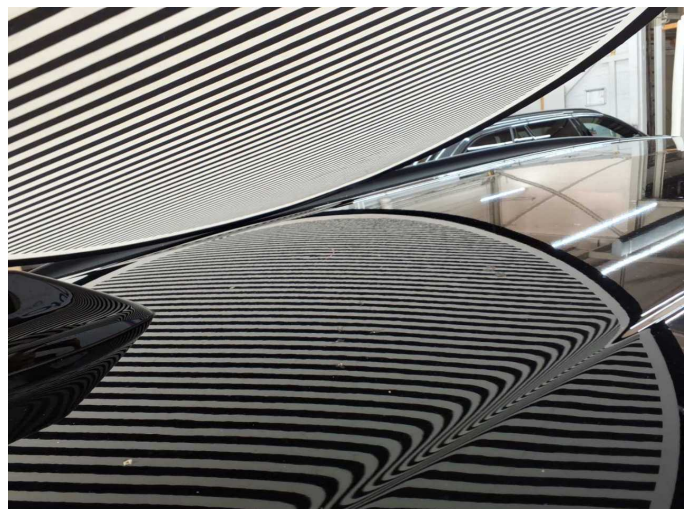

Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation

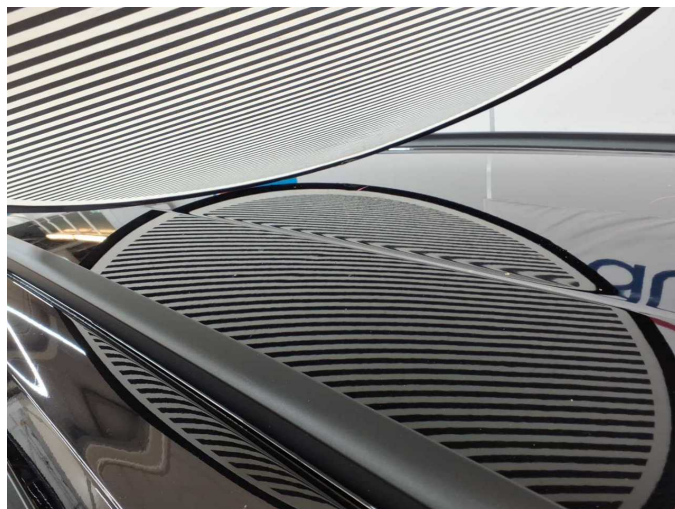


Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation



Damage 11: Body: Body - Damage by hail - repair according to calculation

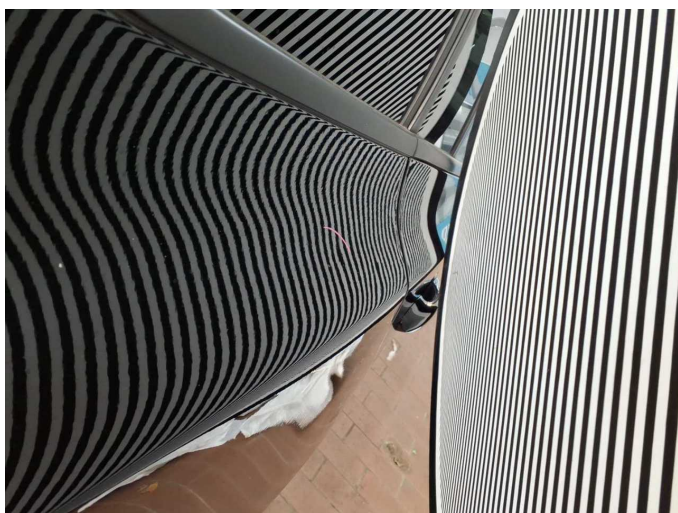

Damage 11: Body: Body - Damage by hail - repair according to calculation



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0PXXGCHPNR15351

Hersteller / Modell: FORD FORD Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut.
ST-LINE VIGNALE

Datum	KM-Stand	Beschreibung
04.02.2026	132.000	AU
10.11.2025	121.538	Batterie ern; Systemtest/Eigendiagnose
20.10.2025	119.039	Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.02.2025	90.142	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
23.05.2024	60.083	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.09.2023	30.877	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges