



Expertise

Protocol number: 45947973
Order No. / Reference: 26385912
Inspection date: 15 Jun 2026

Manufacturer: Volkswagen

Model: T-Roc 2.0 TDI SCR DSG Sport

VIN: WVGZZA1ZMV133205



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen T-Roc 2.0 TDI SCR DSG Sport	
Vehicle Identification number	WVGZZA1ZMV133205
Mileage (Read)	83,746 km
First registration	3 May 2021
Number of holders	2
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	uranograu (I7F)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Light grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,500 km
Last service on / at	09/2025 at 61,885 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC170250
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CFP 00141		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,970 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Steel	Michelin	5mm / 5mm
2)	205/60 R16 92H	Winter tyres on Steel	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Bridgestone	3mm / 3mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Bridgestone	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger, with front passenger airbag deactivation
- Ambient lighting red
- Hill start assist
- Decorative inlays "Shadow Steel"
- Tachometer
- Electronic Stability Program with counter-steering support
- Driving profile selection
- Chassis: Sport chassis
- Front windshield made of laminated safety glass, wirelessly heated and infrared-reflecting, noise-reducing
- Transmission: 7-speed DSG
- Rear window heated
- ISOFIX mounting points
- Rear headrests (3)
- Steering wheel: Multifunction sports steering wheel in leather, with paddle shifters
- Multifunction display "Plus"
- Fog lights and cornering lights
- Emergency braking assistant "Front Assist"
- Brushed stainless steel pedals
- Radio
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy (4) "Kulmbach" 7 J x 17, painted in sterling silver
- Windows: Rear side windows and rear window tinted
- electromechanical power steering
- Seats: Rear bench seat undivided, backrest asymmetrically split and foldable, with center armrest
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation
- Telephone interface
- Textile floor mats front and rear
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Electrically adjustable and heated exterior mirrors
- third brake light
- Diesel particulate filter
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights
- Electric windows front and rear
- Pedestrian detection
- Luggage compartment floor height-adjustable and removable
- Rear window wiper with intermittent function
- Air conditioning with active combination filter
- Front headrests
- Light in the front footwell
- Makeup mirrors in the sun visors
- Fatigue detection
- Non-smoking version
- Emergency call service
- Upholstery: Cloth
- Radio accessories: 6 speakers
- Tire pressure monitoring system
- Wheels: Tire Mobility Set
- LED taillights, dark red
- Drawer under the right front seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Front sports seats
- Lane keeping assistant "Lane Assist"
- Bumper with underride protection in silver metallic, air intake in honeycomb structure
- USB-C interface
- Prepared for "We Connect" and "We Connect Plus"
- Central locking without safe locking, with remote control and 2 remote keys



Extra equipment

- Adaptive Cruise Control (ACC) including City Emergency Braking function and "Front Assist", vehicle stop function (Adaptive Cruise Control ACC "stop & go", including speed limiter - "Front Assist" area monitoring system, City Emergency Braking function (for ACC up to 210 km/h))
- Navigation system "Discover Media" incl. "Streaming & Internet" (6 speakers - 20.3 cm touchscreen - dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface (Apple compatibility) - output power 4 x 20 watts - map with 2D display - points of interest - telephone interface - traffic sign recognition)
- Wheels: Winter wheels (4) (additional), steel, 6J x 16 (on-board tools and jack - wheel cover included - winter tires 205/60 R 16 H)
- Parking aid (warning signals for obstacles in the front and rear area)
- Air conditioning system "Air Care Climatronic" (with active combination filter and 2-zone temperature control)
- Paint finish: Solid
- Package: Seat Comfort Package (passenger seat backrest fully foldable - lumbar support in front - front seats with height adjustment)
- Package: Winter package in conjunction with auxiliary heating and ventilation (automatically heated front windshield washer nozzles - heated front seats - washer fluid level warning light)
- Rear View reversing camera
- Auxiliary heating and ventilation (with remote control and timer - heated front seats - fog lights omitted)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair
3	Boot lid / rear door	Boot lid - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Body	Body (Waschanlagen kratzer) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

2nd wheel set - Wheel cover set - complete (Winterräder)



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

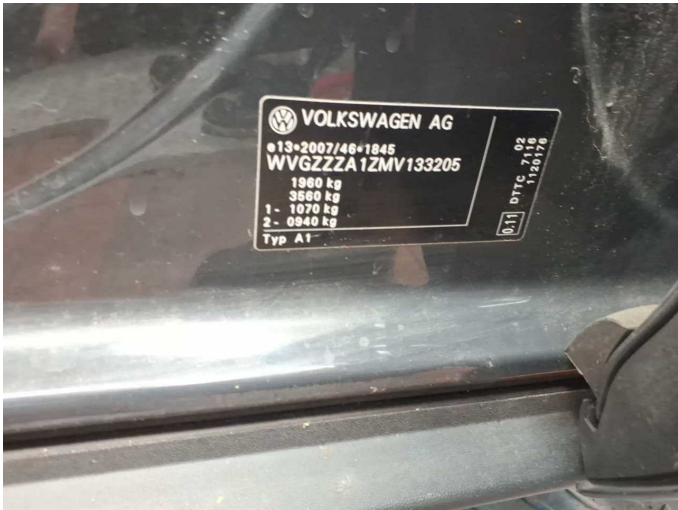


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

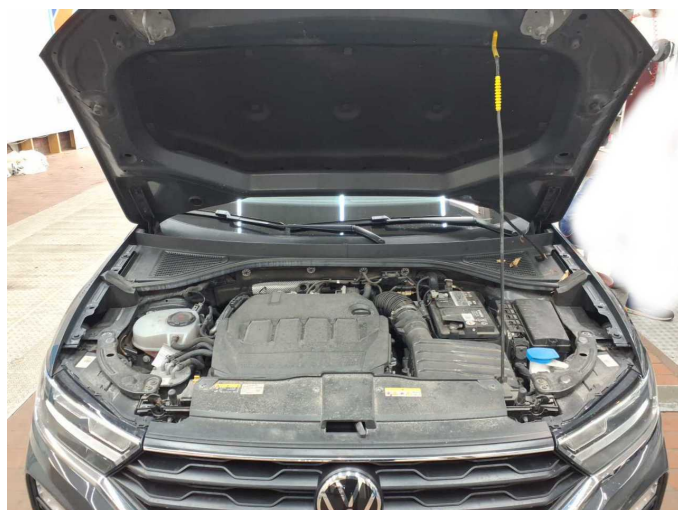


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZA1ZMV133205

Hersteller / Modell: VOLKSWAGEN VW T-Roc 2.0 TDI SCR DSG Sport

Datum	KM-Stand	Beschreibung
16.09.2025	61.885	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.06.2024	39.872	AU
18.09.2023	30.052	Systemtest/Eigendiagnose
07.07.2023	30.052	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges