



Expertise

Protocol number: 46521558
Order No. / Reference: 26638994
Inspection date: 15 Jul 2026

Manufacturer: Volvo

Model: XC60 T8 AWD Plug-in Hybrid Polestar Engineered

VIN: YV1UZH5V6P1346613



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC60 T8 AWD Plug-in Hybrid Polestar Engineered	
Vehicle Identification number	YV1UZH5V6P1346613
Mileage (Read)	65,623 km
First registration	23 May 2023
Number of holders	1
Power / Engine displacement	228 kw / 1,969 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Black Stone uni
Doors / Seats	5 / 5
Upholstery type	Part leather
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	0 km
Last service on / at	06/2025 at 44,883 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ219660
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BUP 00007		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,660 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R21 102V	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	255/40 R21 102V	Summer tyres on Light alloy	Pirelli	3mm / 3mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/40 R21 102V	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	255/40 R21 102V	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Airbag, side airbags for driver and front passenger and head/shoulder airbags for all occupants
- Active safety belts with belt tensioners
- Ambient lighting
- High-gloss black applications on the rear of the vehicle
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Hill Descent Control (HDC)
- Fog sensor for automatic activation of the defroster function
- On-board computer
- Roof edge spoiler
- Deactivating the high-voltage battery
- Digital Instrumentation 2nd Gen.
- Front and rear parking sensors with automatic braking intervention (rear)
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Electric windows front and rear
- Front grille with horizontal struts and grille surround in high-gloss black
- Front seat belt height adjustment
- Head-up display
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- Keyless Drive (electronic access system)
- Child safety lock for the rear doors (electric)
- Headrests (5) front and rear
- Headrests of the 2nd row of seats can be folded down (electrically)
- Charging cable Schuko/Type 2 (Mode 2)
- Cargo area roller blind
- Steering wheel adjustable for height and reach
- Steering wheel: Sports steering wheel, leather-free
- Illuminated makeup mirror for driver and front passenger
- Emergency brake lights
- One Pedal Drive
- Package: Light Package
- Package: Winter Package
- Electric parking brake
- POLESTAR ENGINEERED strut brace
- Radio: Premium Sound audio system by Harman/Kardon
- Radio accessories: Two USB-C ports on the back of the center console
- Run-off Road Protection
- Wheels: Tire sealant
- Rear view camera
- Safety Assistance
- Whiplash Protection System (WHIPS)
- Acoustic Vehicle Alerting System (AVAS)
- Passenger side airbag can be deactivated
- Airbag, driver's knee airbag
- Akebono 6-piston brake calipers and ventilated disc brakes (20" front brake system)
- All-wheel drive (AWD)
- Android infotainment system
- Dashboard in leather look with contrasting stitching
- Electrically adjustable exterior mirrors
- Outdoor temperature display
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- third brake light
- Roof rails in high-gloss black (integrated)
- Digital Services
- Drive Mode
- Electronic Stability Control (ESC)
- Electronic differential lock
- Chassis: Polestar Engineered chassis with Öhlins shock absorbers (adjustable)
- Automatic emergency braking
- Luggage compartment partition net
- Transmission: 8-speed automatic transmission
- Hooks for carrier bags in the luggage compartment
- Automatic tailgate
- Interior lighting
- ISOFIX mounting for the outer rear seats
- Keyless Start
- Automatic climate control with separate temperature control for driver and front passenger
- Paint finish: Solid
- Charging box under the cargo floor
- Stainless steel loading sill protector in the luggage compartment
- Steering wheel: Multifunction buttons on the steering wheel
- Air purification system with activated carbon filter
- Front center armrest with integrated storage compartment and cup holders
- Package: Driver Assistance Package
- Package: Seat Comfort Package
- Panoramic glass sunroof with lifting function (electric)
- Parking ticket holder
- Upholstery: Part-leather/mesh-textile sports seats
- Radio accessories: Smartphone integration Apple CarPlay
- Rain sensor
- Tire pressure monitoring system
- Wheels: 21" 5-Y-spoke Polestar Engineered alloy wheels, diamond-cut/gloss black
- Rear seats in a 40/60 split or completely foldable with pass-through function
- Speed-sensitive power steering



- Safety braking system with disc brakes all around (internally ventilated)
- Electric auxiliary heater with timer
- Start/Stop technology
- Phone: Inductive smartphone charging system (Qi standard)
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys

- Gold seat belts
- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Power socket
- Door sill area in car color
- Gold valve caps
- Glazing: Colored glazing
- Volvo On Call
- Warning tone/indicator when seat belts are not fastened (for all seats)

Extra equipment

- Towbar (semi-electric)
- Glazing: Side and rear windows tinted (from the B-pillar back)
- Parking camera with 360° surround view (including front, side and rear parking aid with automatic braking intervention (rear))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Mudguard - right side	Wheel arch - Scratch(es) - Smart repair
3	Roof	Roof - dent(s) - Smooth repair work
4	Front axle	Axles / undercarriage (wegen der beschädigten Felgen) - Specify findings - Measure
5	Bonnet	Bonnet (5 Dellen) - dent(s) - Smooth repair work
6	Misc.	Inspection / maintenance - Due - Perform
7	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
8	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
9	Door - rear right side	Door - Deformed - Repair and paint
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Front bumper	Front bumper - Scratch(es) - Paint
12	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Scratched - repair according to calculation

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 alloy rims - Scratched - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Missing parts

Description

Interior - Luggage net

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 24 Jan 2024	1.221,64 €
2	Side - left, Provided by user / customer, from 13 Jul 2023	2.132,36 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

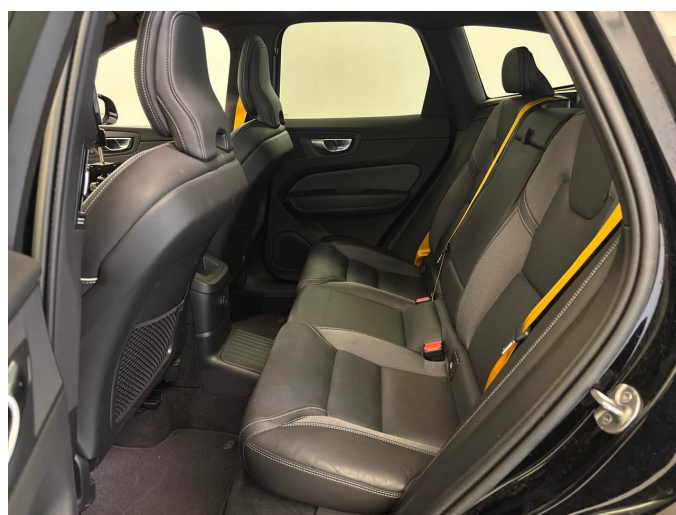


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

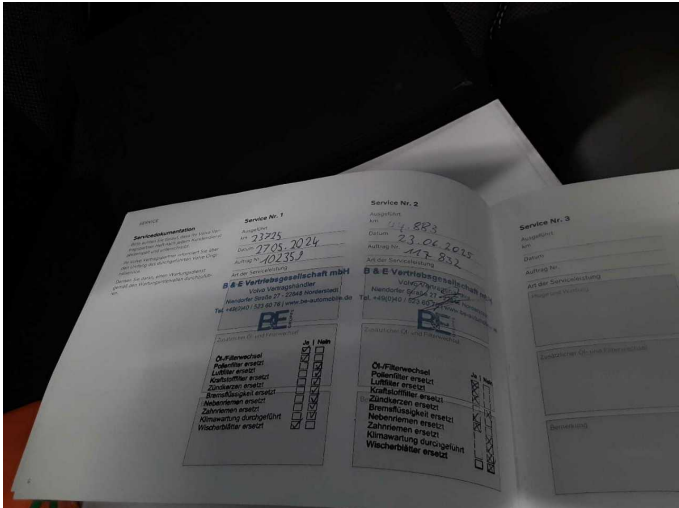


Figure 14: Documents



Figure 15: Additional tyres

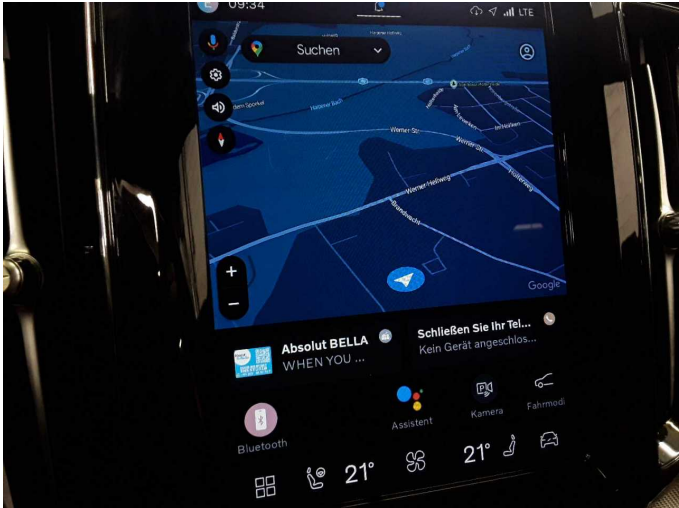


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

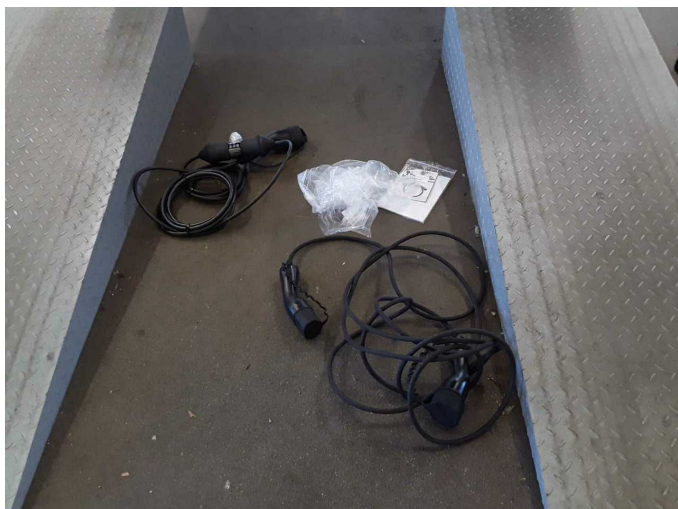


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

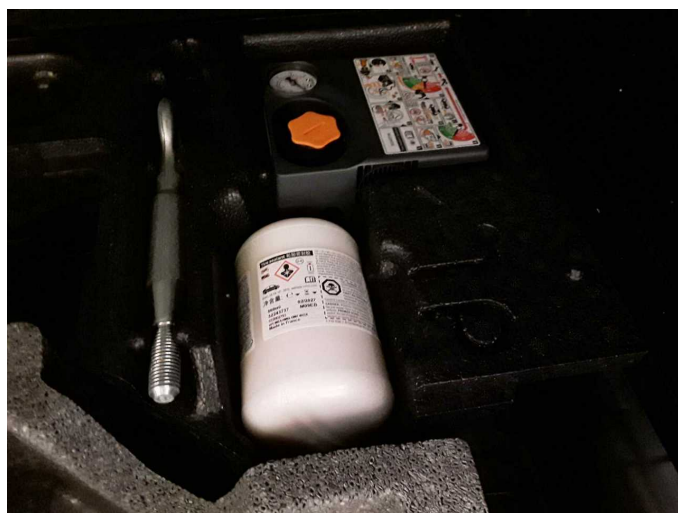


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

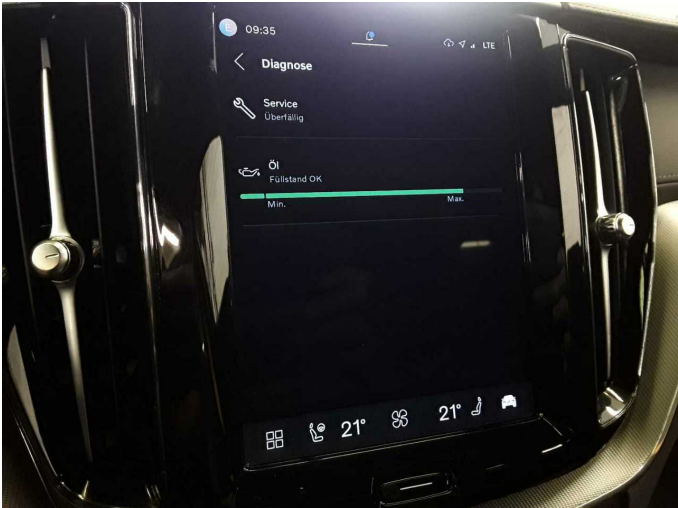


Figure 34: Misc.



Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair




Damage 2: Mudguard - right side: Wheel arch - Scratch(es) - Smart repair




Damage 2: Mudguard - right side: Wheel arch - Scratch(es) - Smart repair

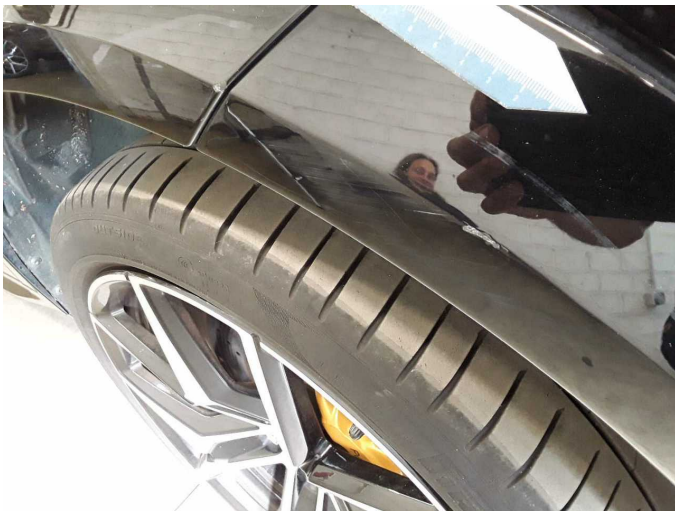


Damage 2: Mudguard - right side: Wheel arch - Scratch(es) - Smart repair

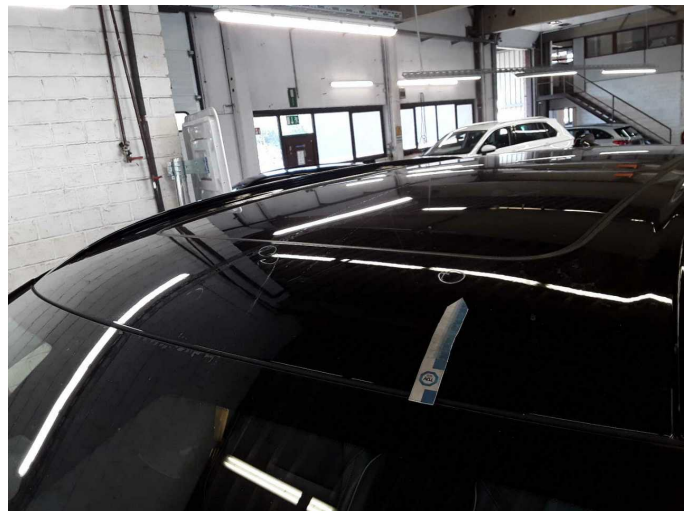


Damage 3: Roof: Roof - dent(s) - Smooth repair work

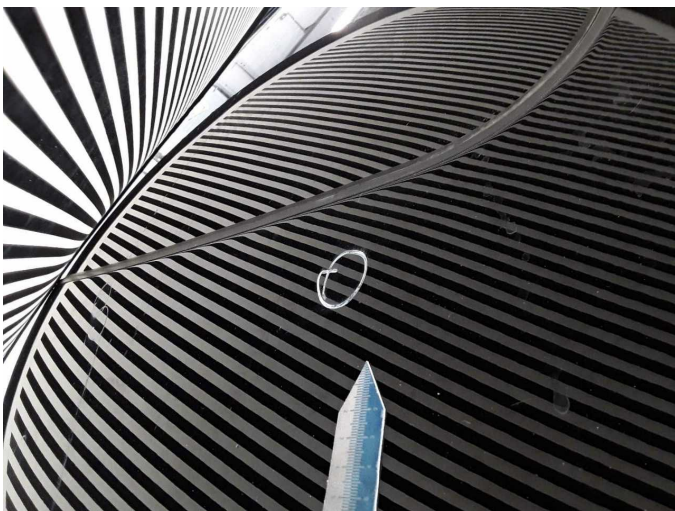

Damage 3: Roof: Roof - dent(s) - Smooth repair work

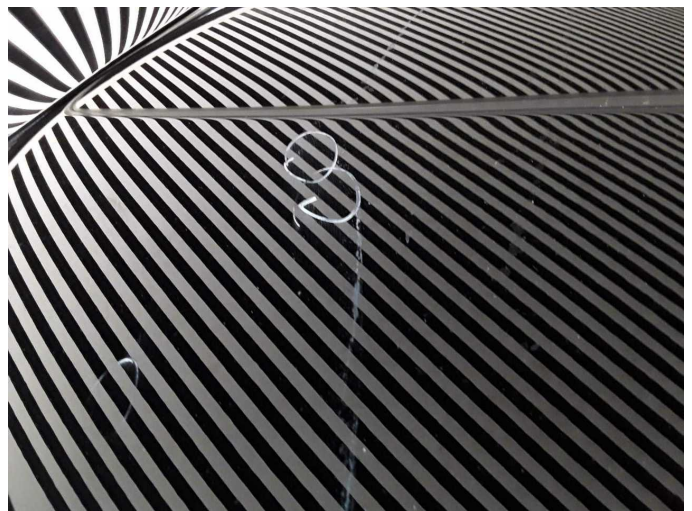


Damage 3: Roof: Roof - dent(s) - Smooth repair work

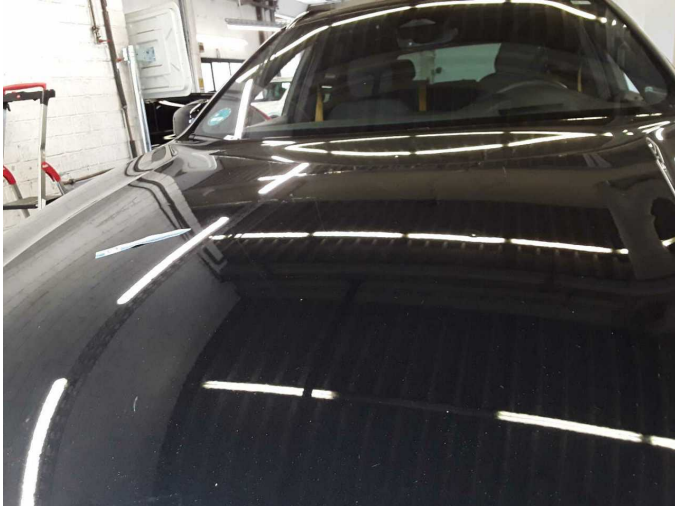


Damage 5: Bonnet: Bonnet (5 Dellen) - dent(s) - Smooth repair work



Damage 5: Bonnet: Bonnet (5 Dellen) - dent(s) - Smooth repair work

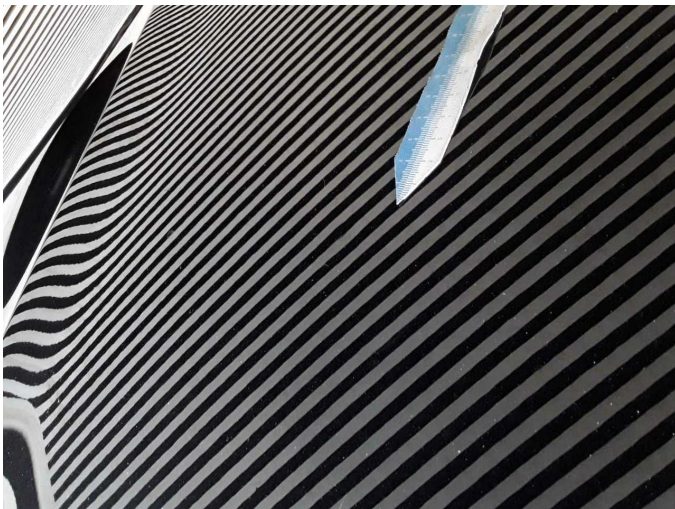

Damage 5: Bonnet: Bonnet (5 Dellen) - dent(s) - Smooth repair work

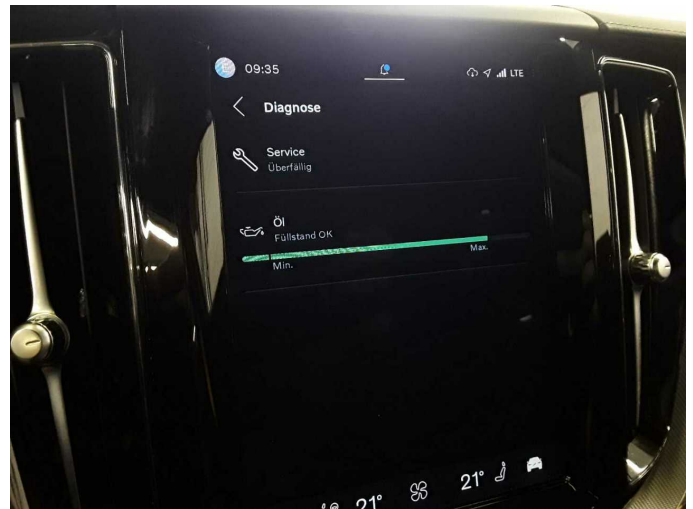

Damage 6: Misc.: Inspection / maintenance - Due - Perform



Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




Damage 7: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

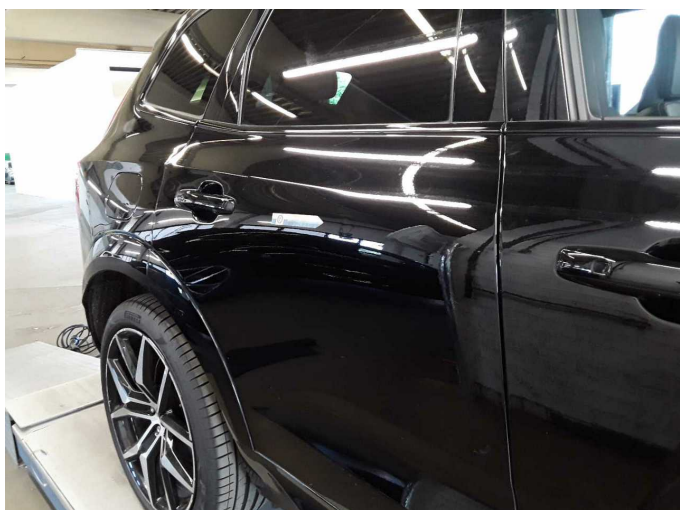

Damage 9: Door - rear right side: Door - Deformed - Repair and paint

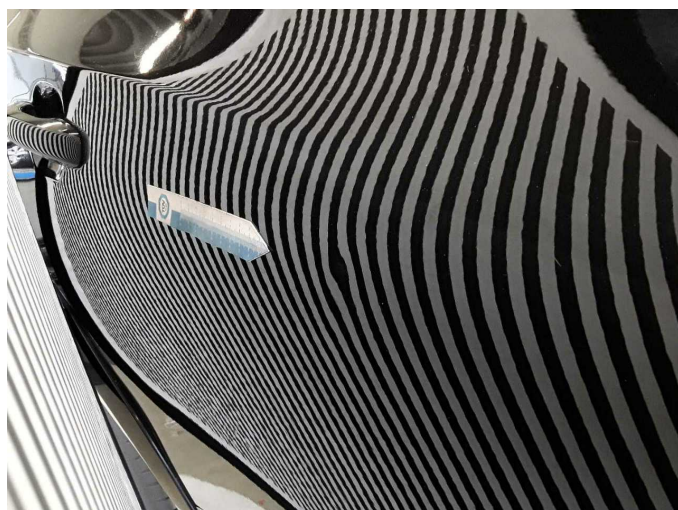


Damage 9: Door - rear right side: Door - Deformed - Repair and paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint

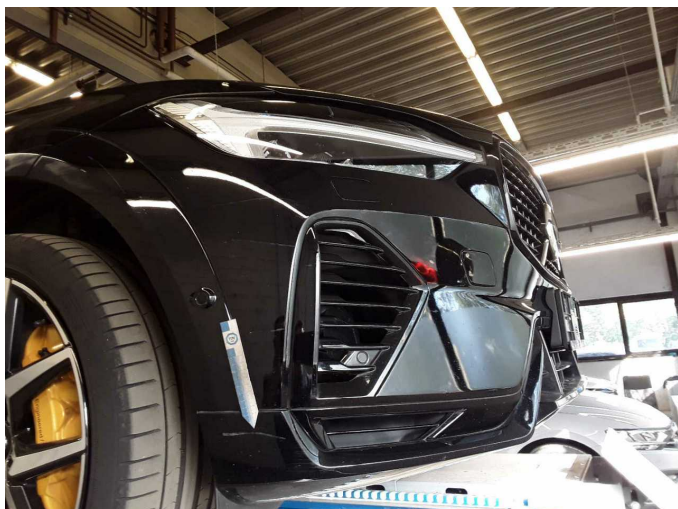

Damage 11: Front bumper: Front bumper - Scratch(es) - Paint



Damage 11: Front bumper: Front bumper - Scratch(es) - Paint



Damage 11: Front bumper: Front bumper - Scratch(es) - Paint



Damage 12: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - repair according to calculation



Damage 12: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratched - repair according to calculation



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1UZH5V6P1346613

Hersteller / Modell: VOLVO VOLVO XC60 T8 AWD Recharge Polestar Engineered

Datum	KM-Stand	Beschreibung
23.06.2025	44.883	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
27.05.2024	23.729	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges