



Expertise

Protocol number: 46315362
Order No. / Reference: 26349025
Inspection date: 3 Jul 2026

Manufacturer: Opel	Model: Astra Sports Tourer 1.5 D Automatik Business Edition
VIN: VXXKFCYHZ3R1017916	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra Sports Tourer 1.5 D Automatik Business Edition	
Vehicle Identification number	VXXKFCYHZ3R1017916
Mileage (Read)	59,552 km
First registration	5 Apr 2024
Number of holders	1
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Vulkan Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Light grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4 Monat(e)
Last service on / at	02/2025 at 38,124 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HB440848
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1889 / AEY 00109		
Emission standard	EURO6;WLTP;EA;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 94V	Winter tyres on Light alloy	Falken	0mm / 0mm
2)	205/55 R16 94V	Winter tyres on Light alloy	Falken	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments (storage compartment in the center console, in the front doors suitable for 1.5-liter beverage bottles, in the rear doors suitable for 0.5-liter beverage bottles, glove compartment with LED lighting)
- Airbag: Front and rear outer head airbags
- Anti-lock braking system (ABS) (including brake assist)
- Exterior mirrors, electrically adjustable, heated and manually foldable
- Exterior mirror housings in black
- On-board computer
- Roof design line, in black
- Tachometer
- Electronic brake force distribution (EBD)
- Electronic Stability Program (ESP) and Traction Control with engine and brake intervention (TCPlus)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Back window, heater
- Wiring harness for trailer hitch
- Front headrests and 3 rear headrests, height adjustable
- Paintwork: Roof in car color
- LED headlights (LED headlights - LED daytime running lights - LED taillights - LED turn signals - manual headlight range control - high beam assist - automatic low beam - rain sensor)
- Steering wheel heating
- Multimedia Infotainment System (with 10" color touchscreen display and 10" driver information display, automatic music recognition, Bluetooth audio streaming, hands-free calling, simultaneous pairing of 2 mobile phones, wireless smartphone integration via Apple CarPlay and Android Auto, personalization options, 4x20 watts, favorite station memory (24 per profile), speed-dependent volume control, FM/AM, DAB+, RDS-EON, 2 USB-C ports, breakdown and emergency call, vehicle status and information)
- Rear seat backrest folds forward in a 40:20:40 split
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Heated seats for driver and front passenger (multi-stage adjustable)
- Solar Protect heat-insulating glazing (in the rear, heavily tinted)
- 12V power outlet in the center console
- Pre-installation for ISOFIX child seat mounting system (incl. top tether attachment points, rear outer)
- Central locking with remote control (and interior switch)
- Airbag: Chest-pelvis side airbags, driver and front passenger (side airbag, front passenger can be manually deactivated)
- Airbag: Front airbags, driver and front passenger (front passenger airbag can be manually deactivated)
- Automatic activation of the hazard warning lights (and unlocking of the doors after deployment of the airbag or seatbelt pretensioner)
- Hill Start Assist
- third brake light
- Diesel particulate filter (DPF) maintenance-free (exhaust aftertreatment via SCR (Selective Catalytic Reduction) catalyst with AdBlue (urea injection). Vehicles with BlueInjection technology require refilling of the AdBlue fluid between regular service intervals. A display in the vehicle informs the driver in good time when refilling is necessary.)
- Transmission: 8-speed automatic transmission
- rear window wiper
- Automatic climate control (single-zone automatic climate control with particle and activated carbon filter)
- LED interior lighting (including reading lights, front and rear, and trunk lighting)
- Steering wheel: Leather steering wheel, flattened, perforated, with steering wheel remote control and paddle shifters
- Illuminated makeup mirrors in both sun visors
- Fog light
- Opel Vizor with frame in high-gloss black
- Electric parking brake
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Tire pressure monitoring system
- Wheels: Alloy wheels 7 J x 16 (5 double spokes) in silver (with low rolling resistance tires 205/55 R 16)
- 180-degree reversing camera (parking pilot, front and rear parking aid)
- Keyless Start system
- Seats: Ergonomic active driver's seat in Modene fabric (certified by the German Campaign for Healthy Backs (AGR) - adjustable length, height, tilt, backrest angle, and seat cushion angle - electro-pneumatically adjustable lumbar support in height and length - extendable thigh support - Modene fabric, black - heated front seats and heated steering wheel)
- Start/Stop system (Driving assistant - Reinforced starter - AGM high-performance battery - eco switch to deactivate the start/stop function - Brake energy recuperation)
- Electronic immobilizer



Extra equipment

- Navigation system (Multimedia infotainment system with 10" color touchscreen display and 10" driver information display; navigation system with integrated memory; 3D map display for Europe and Russia; dynamic route guidance via map and/or arrow display and voice prompts; TomTom Online Traffic; online POI search and route guidance; parking information; fuel price information; live weather; over-the-air map updates; intelligent voice control; "Hey Opel" shortcut button; 6 functions; active route suggestions)
- Comfort Package Enjoy
- Paint finish: Metallic
- safety net

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
2	Side panel - rear left side	Sill - Scratch(es) - Smart repair
3	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
4	Wheel / tyres	Tyre - front - Worn - Replace
5	Trim / covers	Door trim - rear left side - Broken / torn - Replace
6	Door - front left side	Door edge - Scratch(es) - Paint
7	Front bumper	Front bumper - Deformed - Replace

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Door - front left side	Door handle - outside - Scratch(es) - No deduction
3	Door - rear right side	Door - dent(s) - No deduction
4	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Luggage net



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

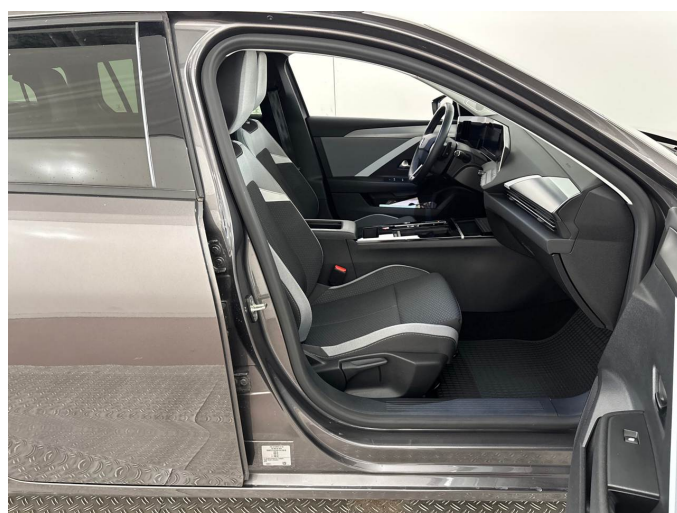


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

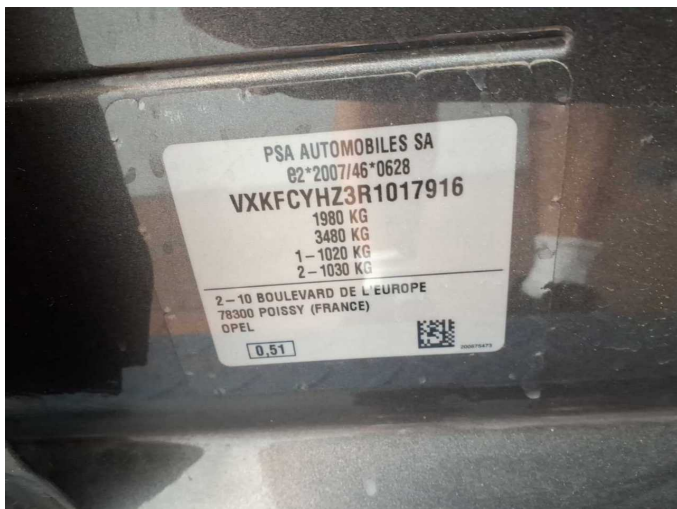


Figure 11: VIN

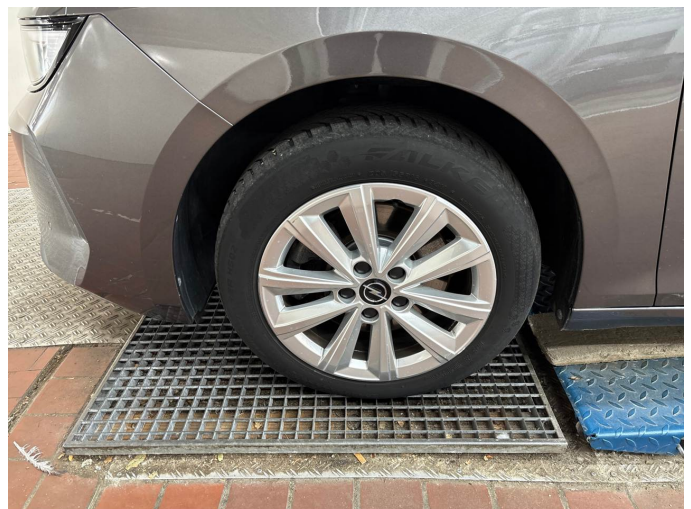


Figure 12: Mounted tyres



Figure 13: Documents

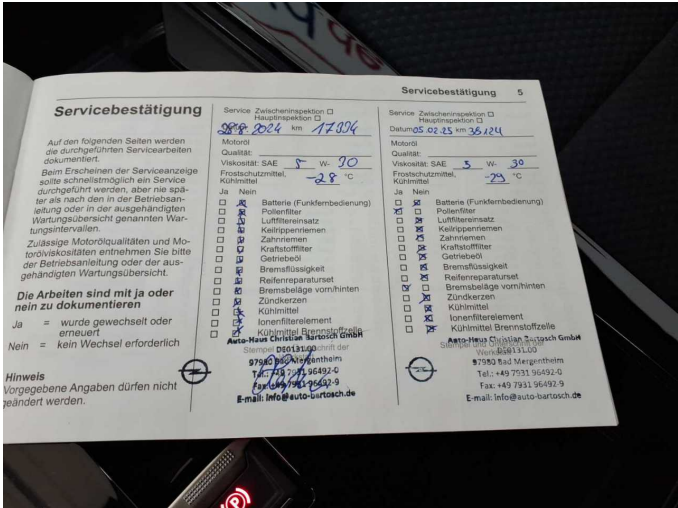


Figure 14: Documents

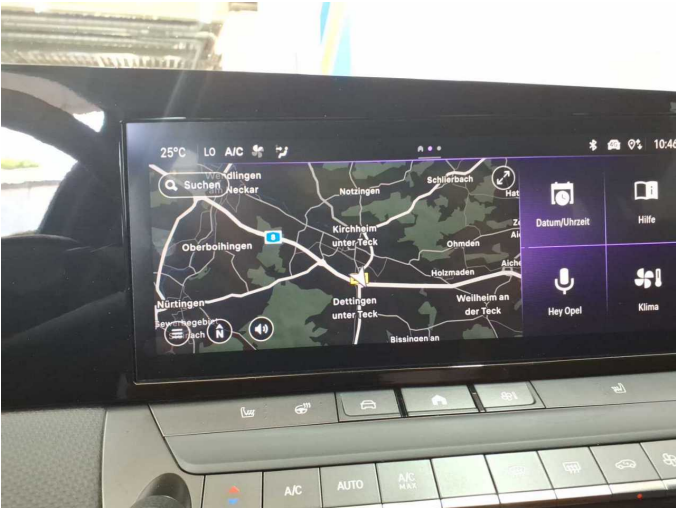


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

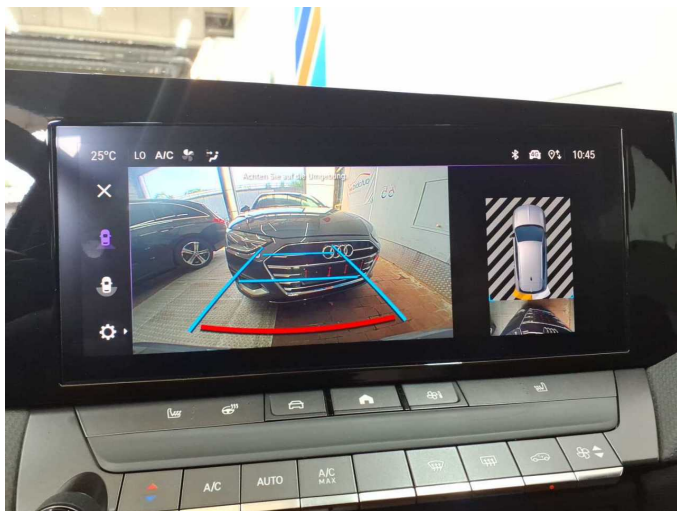


Figure 21: Misc.



Figure 22: Misc.


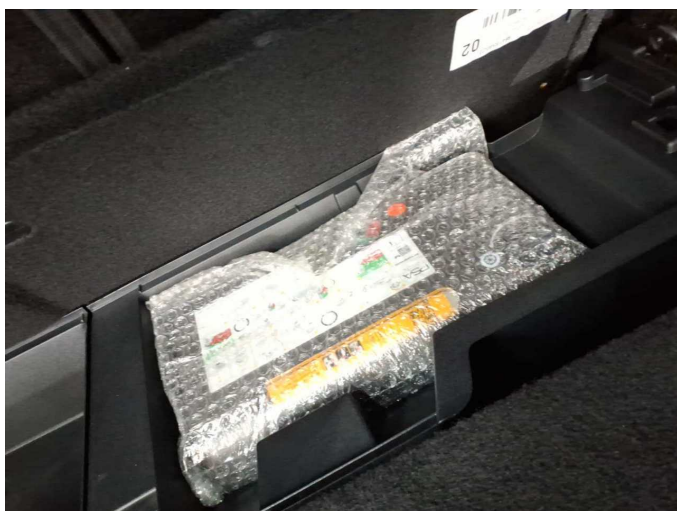


Figure 23: Misc.




Damage 1: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value

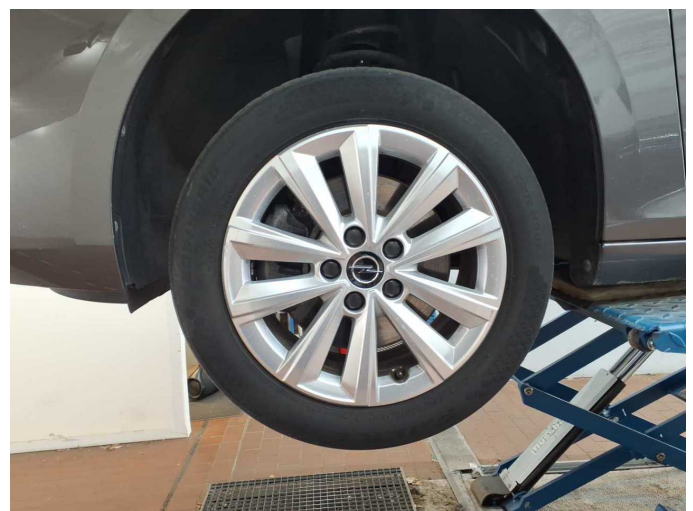


Damage 1: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair

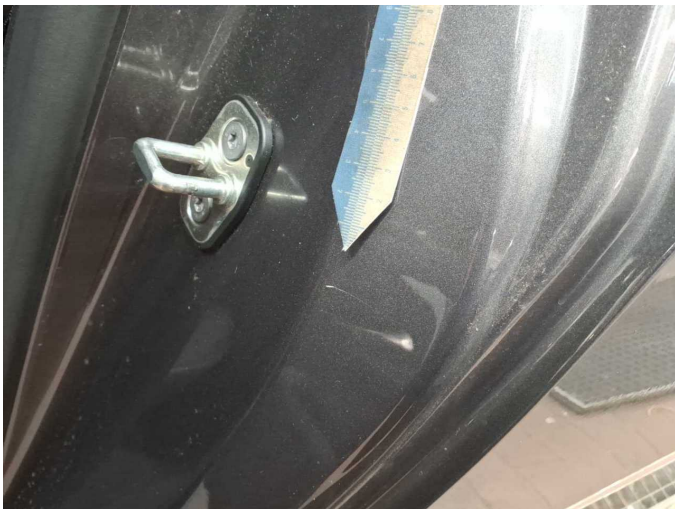

Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair

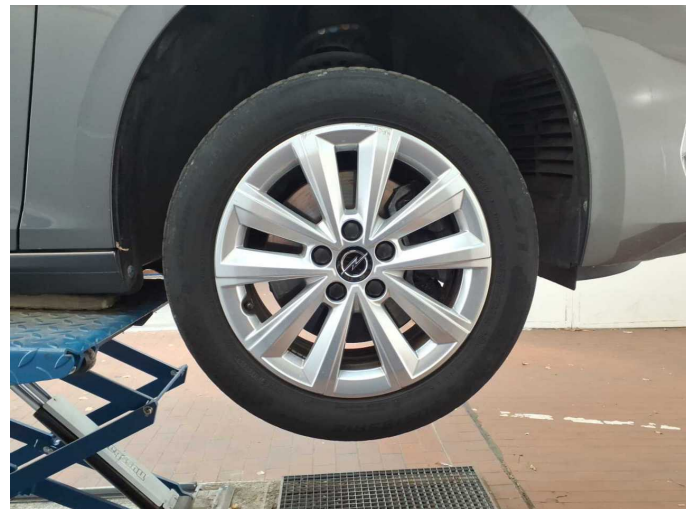

Damage 3: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Tyre - front - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front - Worn - Replace



Damage 5: Trim / covers: Door trim - rear left side - Broken / torn - Replace



Damage 5: Trim / covers: Door trim - rear left side - Broken / torn - Replace



Damage 6: Door - front left side: Door edge - Scratch(es) - Paint



Damage 6: Door - front left side: Door edge - Scratch(es) - Paint



Damage 6: Door - front left side: Door edge - Scratch(es) - Paint




Damage 6: Door - front left side: Door edge - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Deformed - Replace



Damage 7: Front bumper: Front bumper - Deformed - Replace

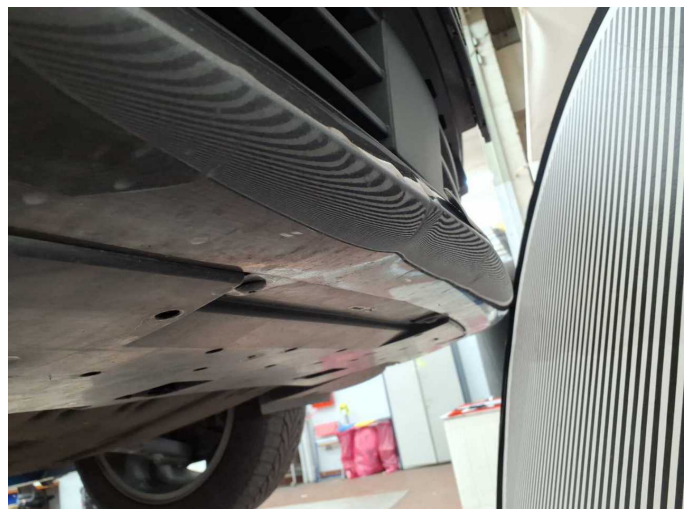

Damage 7: Front bumper: Front bumper - Deformed - Replace