



Expertise

Protocol number: 46545378
Order No. / Reference: 26570192
Inspection date: 14 Jul 2026

Manufacturer: Audi

Model: A6 40 TDI quattro S tronic sport

VIN: WAUZZZF20PN063717



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A6 40 TDI quattro S tronic sport	
Vehicle Identification number	WAUZZZF20PN063717
Mileage (Read)	131,641 km
First registration	24 Apr 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Power / Engine displacement	150 kw / 1,968 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Saloon car
Colour / colour code	Manhattangrau Metallic
Doors / Seats	4 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	17,500 km
Last service on / at	02/2026 at 119,120 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS542073
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BTO 02463		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,325 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R17 99H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/60 R17 99H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service m.connect remote & control
- Electrically adjustable and heated exterior mirrors
- third brake light
- Decorative inlays aluminum fragment
- Tachometer
- Door sills with aluminum inlay front and rear
- Driver information system with color display
- Automatically opening luggage compartment lid/manually opening luggage compartment lid
- Interior lighting
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- LED headlights
- Steering column, manually adjustable in height and axis
- front center armrest
- Package Gloss
- Progressive steering
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus with MMI touch response
- Seat covers in fabric
- Seats: Front sports seats
- Lane Departure Warning
- Glazing: Windscreen in heat-insulating glazing
- Electronic immobilizer
- Thermal insulation glazing on the sides and rear
- Airbag for driver and front passenger
- "quattro" all-wheel drive with ultra technology
- Audi connect navigation & infotainment
- Audi drive select
- Audi pre sense front
- Exterior mirror housings in body color
- Fabric headliner
- Diesel particulate filter (DPF) with nitrogen oxide catalyst and AdBlue tank
- Electronic Stability Control (ESC)
- key fob
- Cruise control system including speed limiter
- Transmission: S tronic 7-speed
- Interior mirror dimming
- 2-zone automatic climate control
- Headrests (4)
- Steering wheel: Leather steering wheel, 3-spoke, with multifunction and paddle shifters
- MMI navigation with MMI touch response
- Non-smoking package
- Wheel: Alloy wheels, 5-arm design
- Wheel: Tire repair kit
- Radio accessories: 8 speakers (passive) front and rear
- Seats: 4-way lumbar support
- Sun visor on driver and passenger side
- Start-stop system
- Glazing: Rear window, rear door and side windows in clear glass
- Central locking



Extra equipment

- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for the passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles, aspherical mirror glass. The curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, providing the driver with a better view of the curb.)
- High beam assist (within the system's limits, it automatically detects oncoming headlights, taillights of other road users, and built-up areas. Depending on the traffic situation, the high beam is automatically switched on or off.)
- Business Package (Assistance Package Tour: Adaptive Driving Assistant supports the driver with acceleration, braking, maintaining speed and distance, and lane keeping. Adaptive Cruise Control, Speed Limiter. Efficiency Assistant supports the driver with predictive driving. Parking Aid Plus, 4-zone automatic climate control, heated front seats, Audi phone box, automatically dimming interior mirror, automatically dimming exterior mirrors, adaptive windscreen wipers with integrated washer nozzles, high-beam assistant)
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and sport seats plus also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- Telephone: Audi Phone Box (Up to two smartphones can be paired with the vehicle simultaneously via Bluetooth, allowing you to play music through the vehicle or make phone calls from either smartphone. The universal smartphone holder connects to the vehicle's antenna, improving both reception and call quality. The smartphone can also be charged wirelessly using the Qi standard or via USB.)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Parking aid plus with surround view (acoustic and visual parking aid front, side and rear to assist with parking and maneuvering by measuring with 12 ultrasonic sensors. A selective visual display shows the distance to detected objects in the upper display, depending on the current steering angle and the direction of travel. Optionally, activation occurs automatically as soon as the vehicle approaches a detected obstacle at a speed of less than 10 km/h).
- Fuel tank (73 liters) (fuel tank for 73 liters of gasoline/diesel fuel)
- Paint finish: Metallic
- Tour Assistance Package (Adaptive Driving Assistant - Adaptive Cruise Control, Speed Limiter - Efficiency Assistant supports the driver in anticipatory and therefore fuel-saving driving - Evasive Steering Assist helps the driver to steer the vehicle around an obstacle in a critical situation - Turning Assist - Emergency Assist - High Beam Assist - Camera-based Traffic Sign Recognition)
- Seats: Split-folding rear seat backrest (pronounced outer rear seats, visually adapted to the front seats, and an additional central seat option - 3 L-shaped rear headrests, manually height-adjustable for good rear visibility - three 3-point seat belts - rear seat backrest split 40:20:40 or fully foldable - one-piece, foldable rear center armrest with storage compartment)
- Auxiliary heater/ventilation (The auxiliary heater warms the interior and defrosts the windows without starting the engine. The auxiliary ventilation system supplies fresh air and lowers the interior temperature. Both functions can be activated via a timer and separate remote control. An intelligent control system with timer and departure time programming calculates the heating duration efficiently in terms of time and energy. Separate remote control with illuminated display. 2 selectable heating modes: - defrost (defrost mode for the windows only) - warm)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Equipment	Vehicle key (Batterie) - Empty - Replace
2	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
3	Door - rear right side	Strip - outer (Anätzungen) - Paint defect - Replace
4	Rear bumper	Rear bumper - Scratch(es) - Smart repair
5	Body	B-pillar - right side - Dent / paintcoat damage - Smart repair
6	Door - rear left side	Door handle - inside - Deformed - Smart repair
7	Door - rear right side	Door handle - inside - Deformed - Smart repair
8	Door - rear left side	Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace
9	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
10	Door - front right side	Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace
11	Door - front left side	Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace
12	Trim / covers	Brightware / decorative strip (Dreieckfenster, Anätzungen) - Paint defect - Replace
13	Boot lid / rear door	Boot lid - Scratch(es) - Paint
14	Bonnet	Bonnet - Stone chips - Paint
15	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Wartungshistorie gemäß Auftraggeber Informationen.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

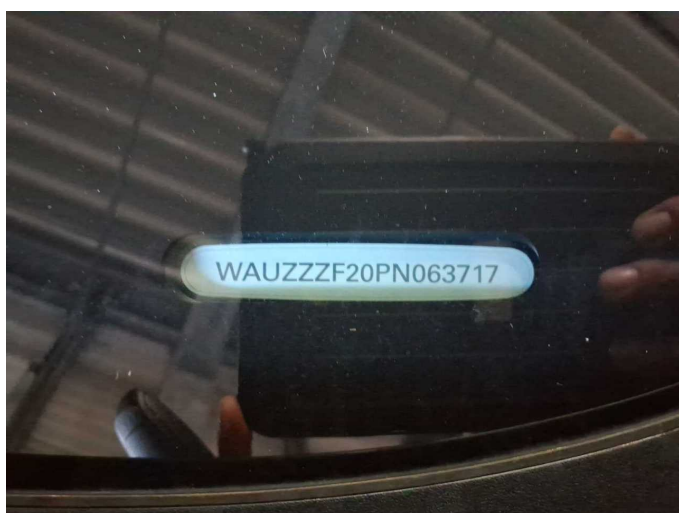


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

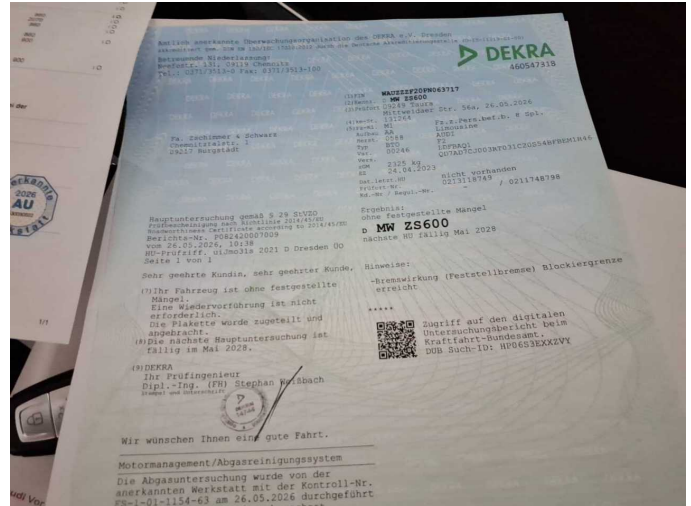


Figure 14: Documents



Figure 15: Additional tyres

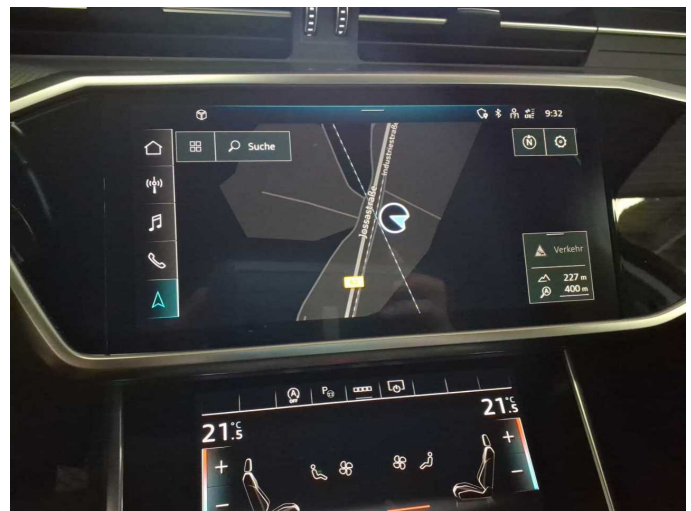


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

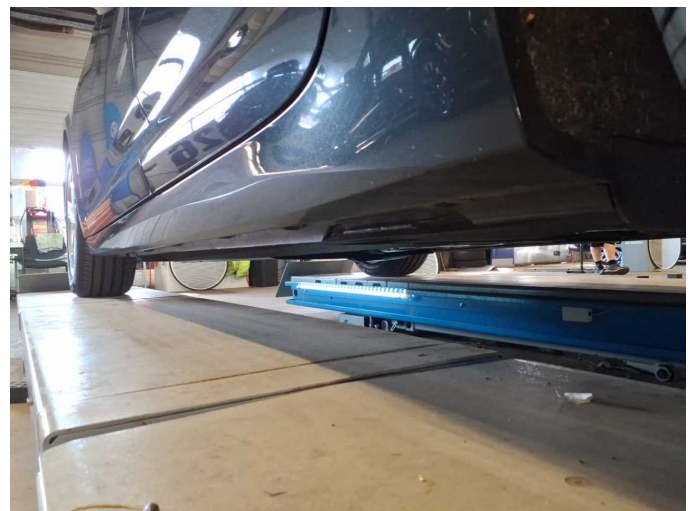


Figure 22: Misc.

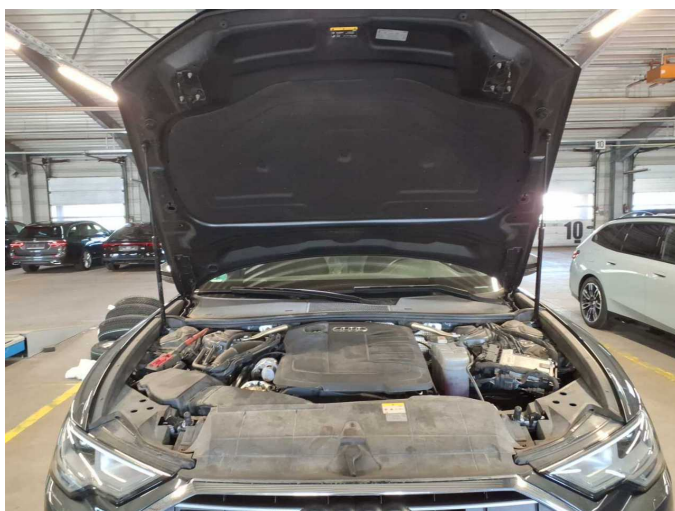


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Figure 27: Misc.



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

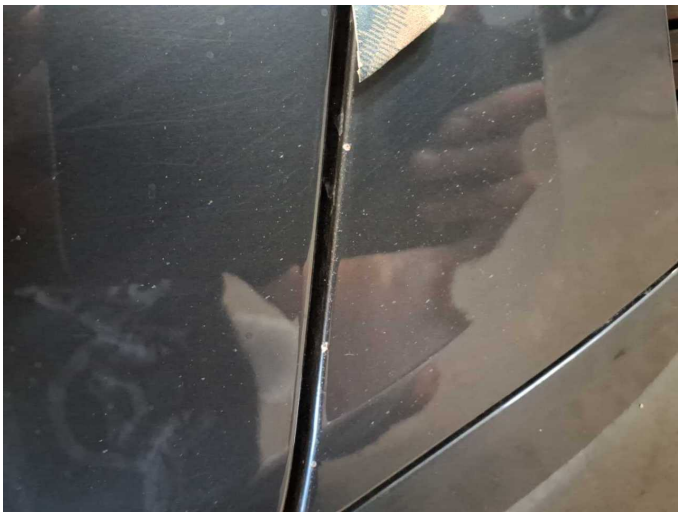


Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair




Damage 3: Door - rear right side: Strip - outer (Anätzungen) - Paint defect - Replace




Damage 3: Door - rear right side: Strip - outer (Anätzungen) - Paint defect - Replace

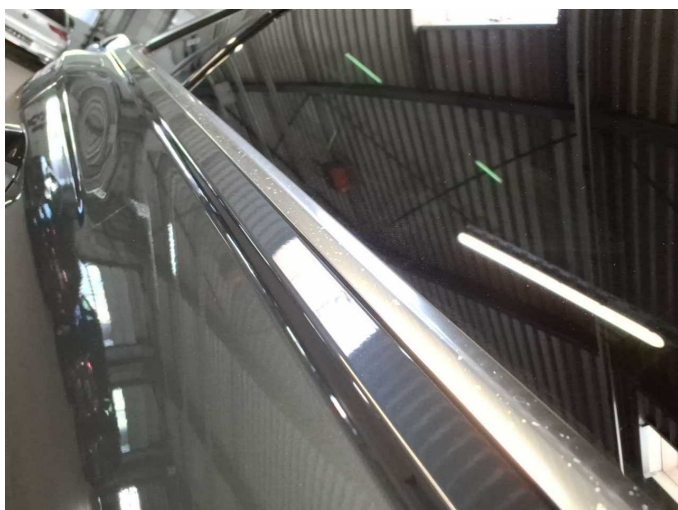

Damage 3: Door - rear right side: Strip - outer (Anätzungen) - Paint defect - Replace

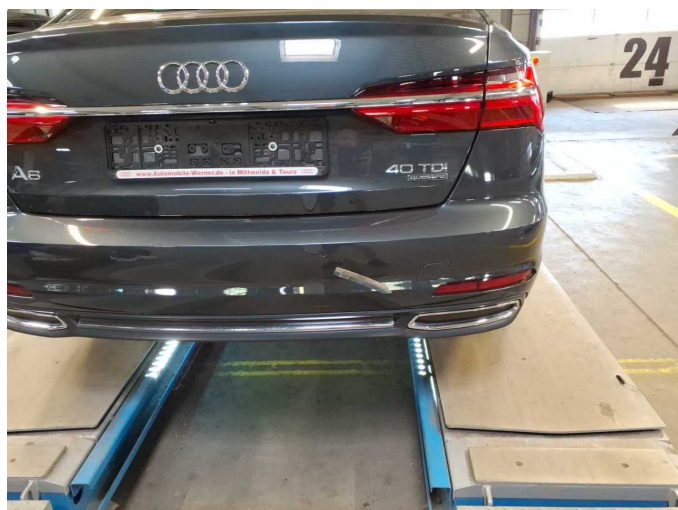

Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair

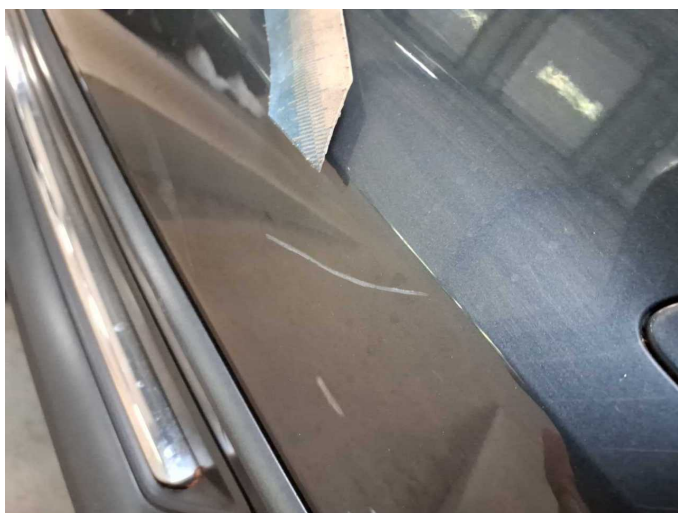


Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Body: B-pillar - right side - Dent / paintcoat damage - Smart repair



Damage 5: Body: B-pillar - right side - Dent / paintcoat damage - Smart repair

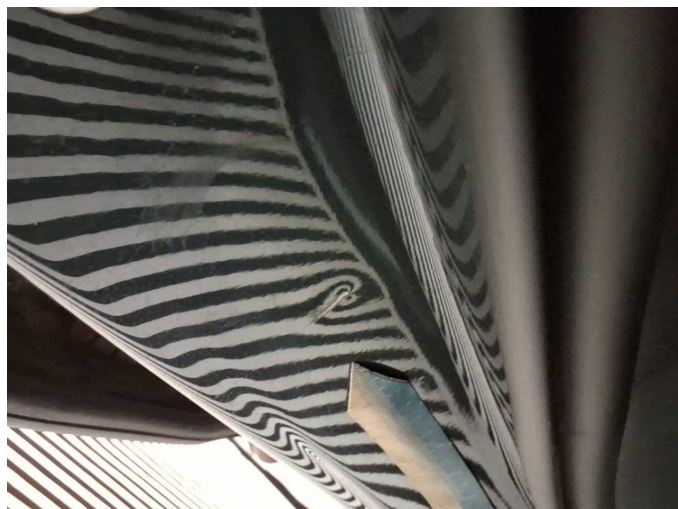

Damage 5: Body: B-pillar - right side - Dent / paintcoat damage - Smart repair



Damage 6: Door - rear left side: Door handle - inside - Deformed - Smart repair




Damage 6: Door - rear left side: Door handle - inside - Deformed - Smart repair



Damage 7: Door - rear right side: Door handle - inside - Deformed - Smart repair




Damage 7: Door - rear right side: Door handle - inside - Deformed - Smart repair

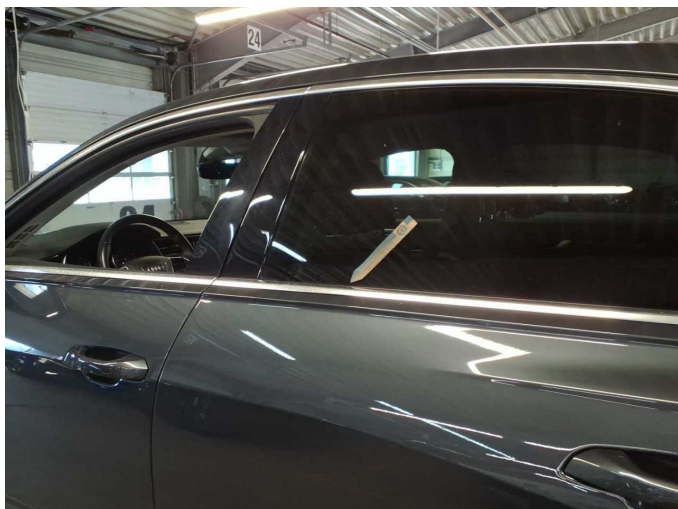


Damage 8: Door - rear left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace



Damage 8: Door - rear left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace

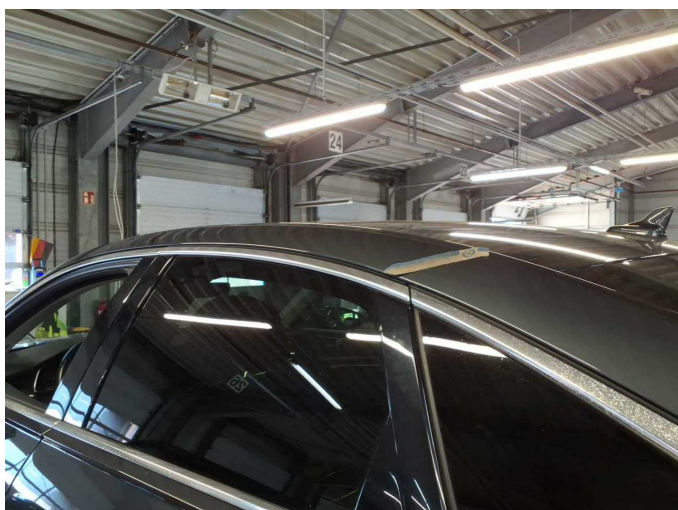

Damage 8: Door - rear left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace

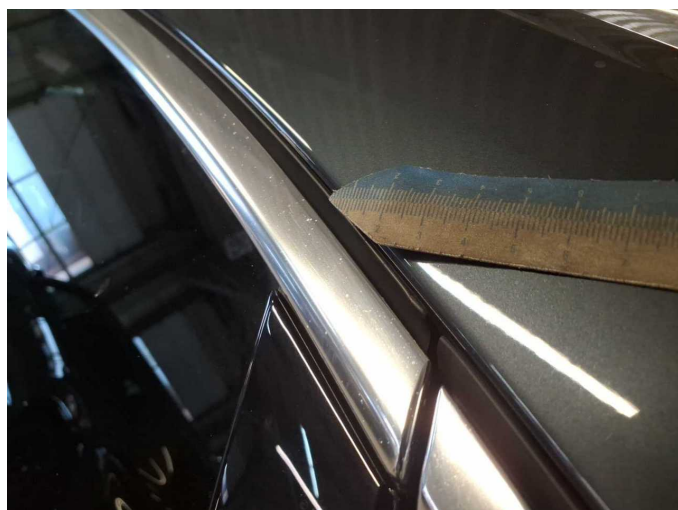

Damage 8: Door - rear left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace



Damage 9: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 9: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 10: Door - front right side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace




Damage 10: Door - front right side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace




Damage 10: Door - front right side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace



Damage 10: Door - front right side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace

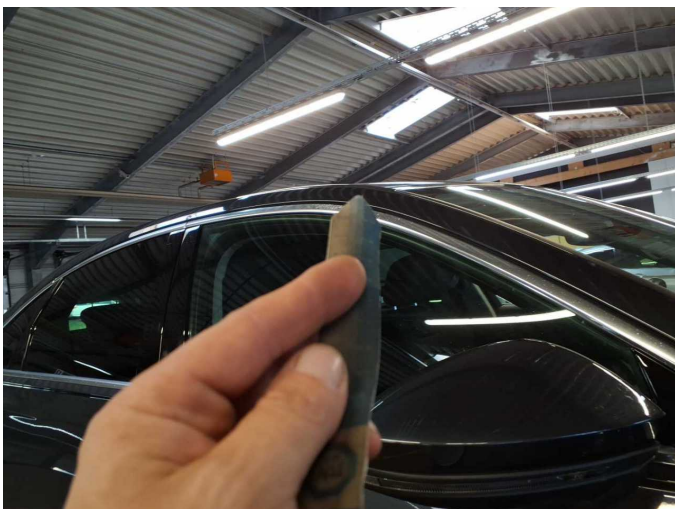

Damage 10: Door - front right side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace

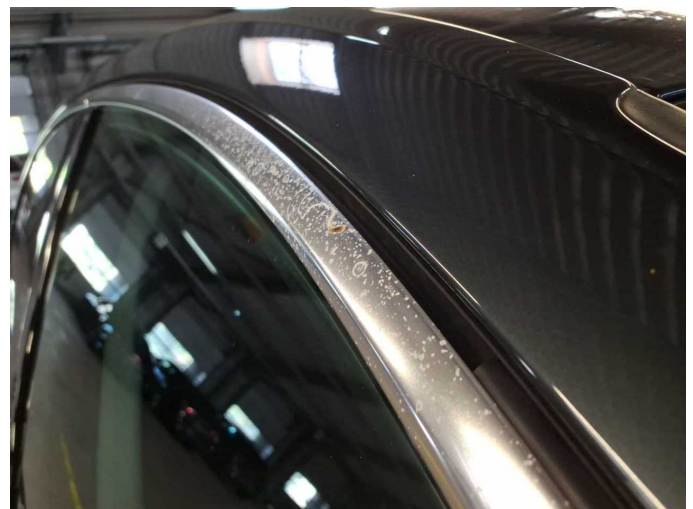

Damage 10: Door - front right side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace




Damage 11: Door - front left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace



Damage 11: Door - front left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace



Damage 11: Door - front left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace

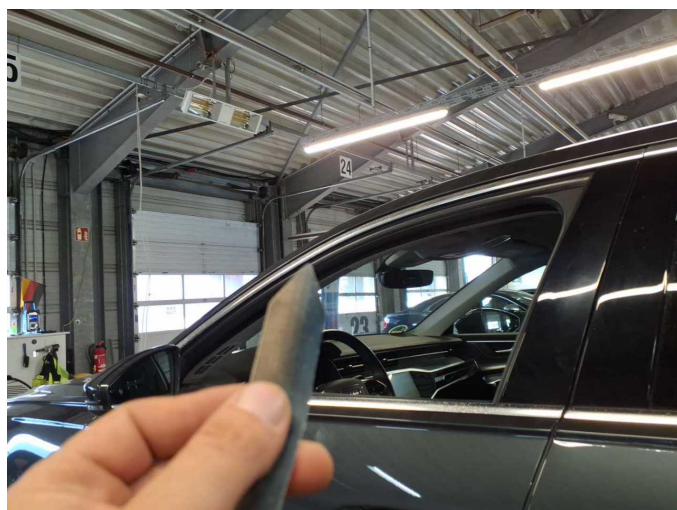


Damage 11: Door - front left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace




Damage 11: Door - front left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace



Damage 11: Door - front left side: Strip - outer (oben und unten, Anätzungen) - Paint defect - Replace

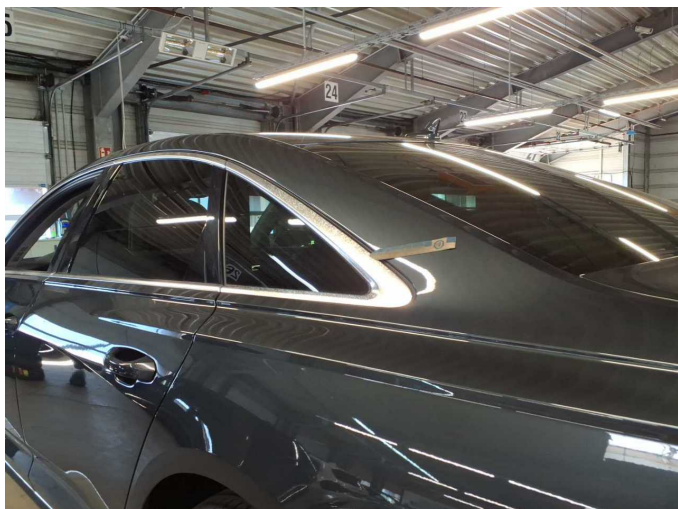

Damage 12: Trim / covers: Brightware / decorative strip (Dreieckfenster, Anätzungen) - Paint defect - Replace

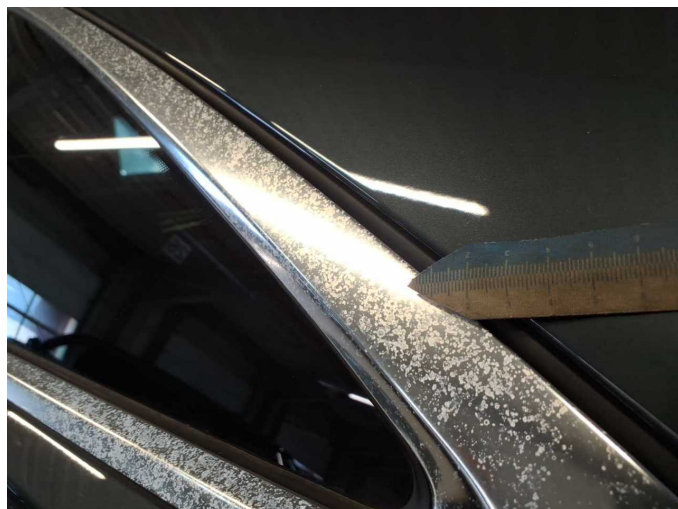

Damage 12: Trim / covers: Brightware / decorative strip (Dreieckfenster, Anätzungen) - Paint defect - Replace



Damage 12: Trim / covers: Brightware / decorative strip (Dreieckfenster, Anätzungen) - Paint defect - Replace



Damage 13: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 13: Boot lid / rear door: Boot lid - Scratch(es) - Paint




Damage 14: Bonnet: Bonnet - Stone chips - Paint



Damage 14: Bonnet: Bonnet - Stone chips - Paint




Damage 14: Bonnet: Bonnet - Stone chips - Paint

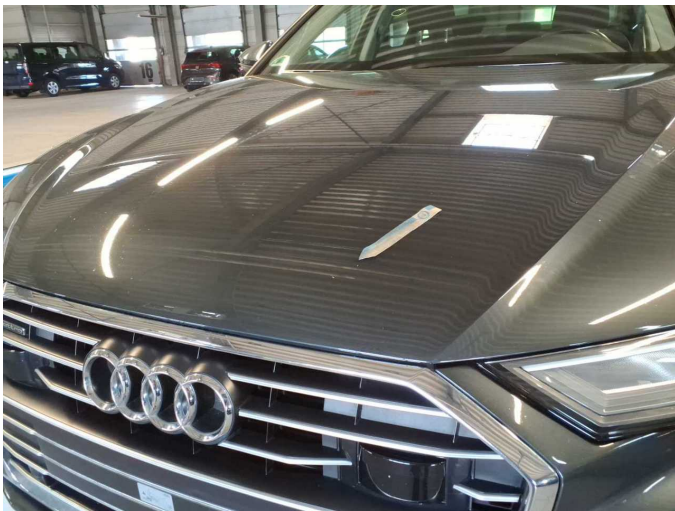


Damage 14: Bonnet: Bonnet - Stone chips - Paint



Damage 14: Bonnet: Bonnet - Stone chips - Paint

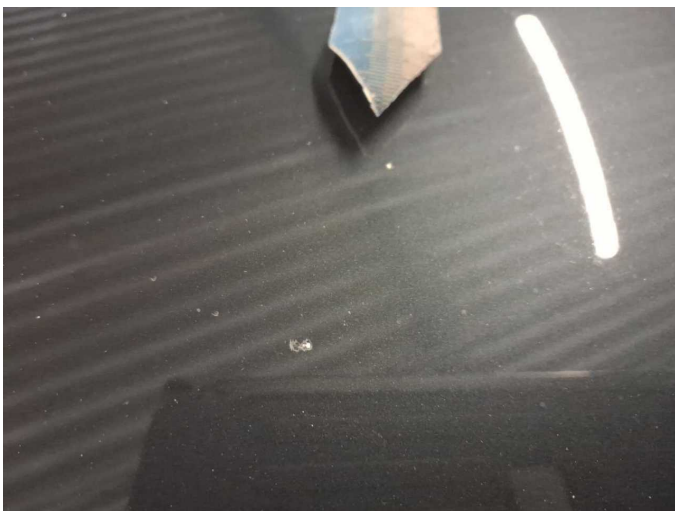

Damage 14: Bonnet: Bonnet - Stone chips - Paint

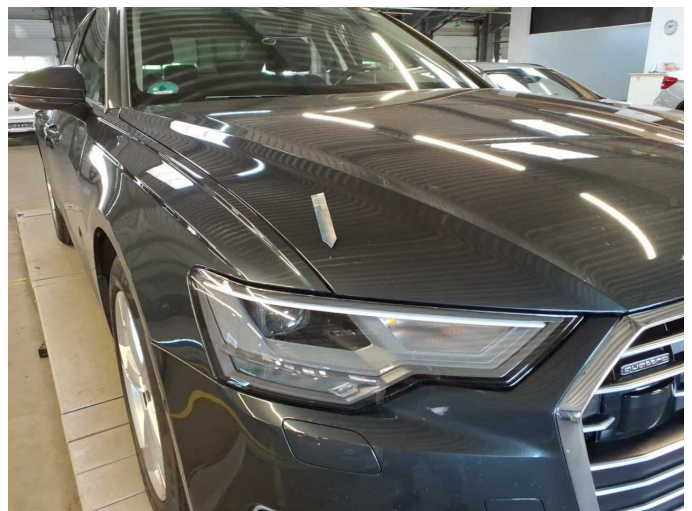

Damage 14: Bonnet: Bonnet - Stone chips - Paint




Damage 14: Bonnet: Bonnet - Stone chips - Paint




Damage 14: Bonnet: Bonnet - Stone chips - Paint



Damage 15: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

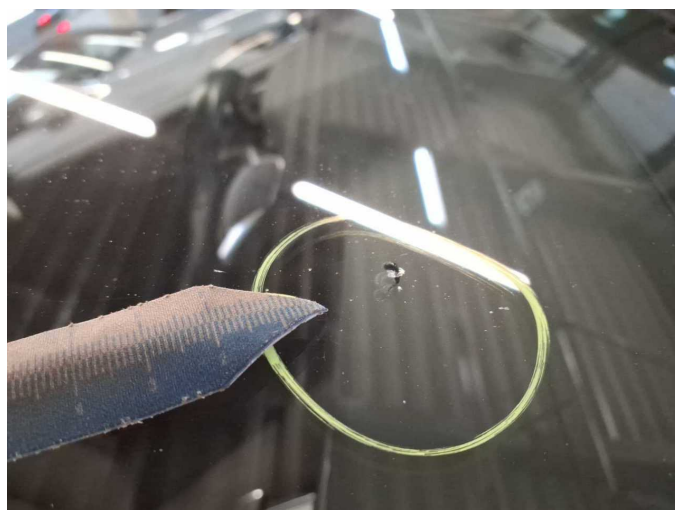

Damage 15: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

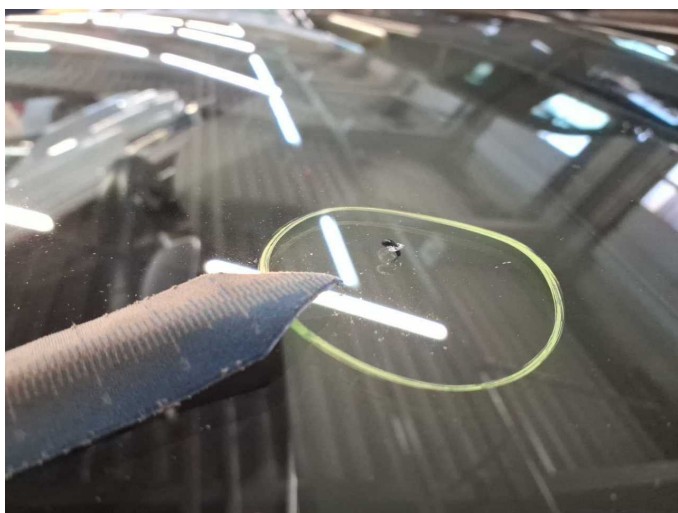

Damage 15: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 15: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 15: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF20PN063717
Hersteller / Modell: AUDI AUDI A6 40 TDI quattro S tronic sport

Datum	KM-Stand	Beschreibung
04.06.2026	131.264	AU; Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten
26.05.2026	131.264	Getriebeöl ern/prüfen
03.02.2026	119.120	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze vorne; Bremssscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
29.04.2025	88.995	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.09.2024	59.186	Getriebeöl ern/prüfen; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
18.01.2024	29.552	Motoröl b. Wartung; Regelwartungsdienst