



RENAULT CLIO: GF-673-DQ

Vinnumber:	VF1RJA00369054860	Versionname:	RENAULT CLIO Business TCe 90 -21N VP [5P] bvm 6-90CH-5cv (bi-corps)
First Registrationdate:	11/03/2022	Fiscalpower:	
Expertise Mileage:	60358	Power Kw:	66
Bodytype:	Berline	Body colour:	Light Grey
Gearbox:	MAN 6 VIT	Paint type:	Metalic
Transmission:	Front	Interior colour:	Anthracite
Fueltype:	Petrol	Type of rims (mounted):	Steel
Battery functioning:	No	Dashboard color:	Anthracite
Vehicle running:	No		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Seat cover lining	Lining Other
Steering wheel leather			
Type of climate control	Manual climate control		

Tyres

	195/55/16/87 H			
Summer tyres:	Fr.L.	Continental: 80%	Fr.R.	Continental: 90%
	Re.L.	Continental: 50%	Re.R.	Continental: 50%
Tyre profile depth FL				2.8
Tyre profile depth FR				2.2
Tyre profile depth RL				4.9
Tyre profile depth RR				5.0
Tyre size FL				195/55 R 16 87 H
Tyre size FR				195/55 R 16 87 H
Tyre size RL				195/55 R 16 87 H
Tyre size RR				195/55 R 16 87 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Remote ignition key, Missing, Repair/replace (lump sum)



Interior, Stain, Cleaning



Floor mat F, Tear, Replace



Tyre FL, Out of tolerance, Replace



Tyre FR, Out of tolerance, Replace



Wing FL, Scratch(es), Paint




Outside rear-view mirror housing L, Scratch(es), Acceptable



Outside rear-view mirror base L, Scratch(es), Replace



Door RL, Scratch(es), Paint

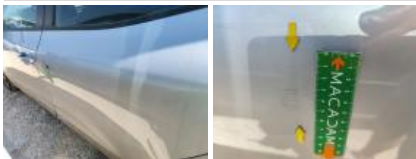

Bumper F, Deformed / Strained, Repair and paint (complete)



Bumper grille, Unclassed, Dismount/Mount



Wing RR, Scratch(es), Polish



Door FR, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Acceptable



Wing FR, Scratch(es), Polish



Bumper R, Scratch(es), Paint



Other exterior parts, Broken, Replace



Historique Maintenance

Immatriculation: GF-673-DQ Date de 1ère immatriculation: 11/03/2022

Modèle: Renault CLIO Business TCe 90 -21N VP [5P] bvm 6-90CH-5cv (bi-corps)

Date	Kilométrage	Fournisseur	Descriptif
20/03/2026	57.573	AGENCE GASTINOIS	REPARATION DE ROUE
20/03/2026	57.573	AGENCE GASTINOIS	LIQUIDE DE REFROIDISSEMENT RPLT
	0		COURROIE ACCESSOIRES RPLT
	0		POMPE A EAU RPLT
	0		COURROIE ACCESSOIRES RPLT
	0		LIQUIDE DE REFROIDISSEMENT RPLT
	0		DIVERS
	0		KIT ACCESSOIRES RPLT
	0		REVISION ET CLIM ET AIR ET BOUGIES
	0		BALAIS ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
	0		ESSAI
	0		POMPE A EAU RPLT
20/03/2026	57.573	AGENCE GASTINOIS	POMPE A EAU RPLT
	0		COURROIE ACCESSOIRES RPLT
	0		LIQUIDE DE REFROIDISSEMENT RPLT
	0		ESSAI
	0		REPARATION DE ROUE
	0		DIVERS
	0		KIT ACCESSOIRES RPLT
	0		REVISION ET CLIM ET AIR ET BOUGIES
	0		BALAIS ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
08/07/2025	48.799	TOULON SERVICES AUTOMOBILES	SERENITE
	0		LIQUIDE DE FREIN
	0		DISQUES PLAQUETTES AV RPLT
29/03/2024	31.100	AGENCE GASTINOIS	REVISION
	0		PLAQUETTES AV RPLT
	0		BALAIS ESSUIE GLACE AV
19/05/2023	19.622	AGENCE GASTINOIS	SERENITE