



Toyota Corolla:

Vinnumber:	SB1Z93BEX0E194227	Versionname:	
First Registrationdate:	8/06/2021	Fiscalpower:	
Expertise Mileage:	125611	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	3532
Fueltype:	Hybrid Petrol		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Registration Certificate Home (BE)	No		

Options

Number of keys total	2	Luggage cover	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Radio multimedia		Type of Tow bar	Tow bar removable
Type of headlighting	Headlighting LED		
Type of GPS	GPS big screen color		
Type of Lining	Lining fabrics		
Type of climate control	Autom climate control		

Limited Technical Inspection

Tyres

	205/55/16/91 V			
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/55 R 16 91 V
Tyre size FR				205/55 R 16 91 V
Tyre size RL				205/55 R 16 91 V
Tyre size RR				205/55 R 16 91 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Total cost ex VAT	2324,51
Interior, Worn, Acceptable	0,00



Bumper F, Dent(s) and scratch(es), Repair and paint (complete) 296,58



Alloy rim FL, Scratch(es), Repair and paint (complete) 133,03



Sill trim L, Scratch(es), Repair and paint (complete) 434,80




Wing RL, Scratch(es), Acceptable 0,00



Bumper R, Scratch(es), Acceptable 0,00



Rear window, Scratch(es), Replace 895,49

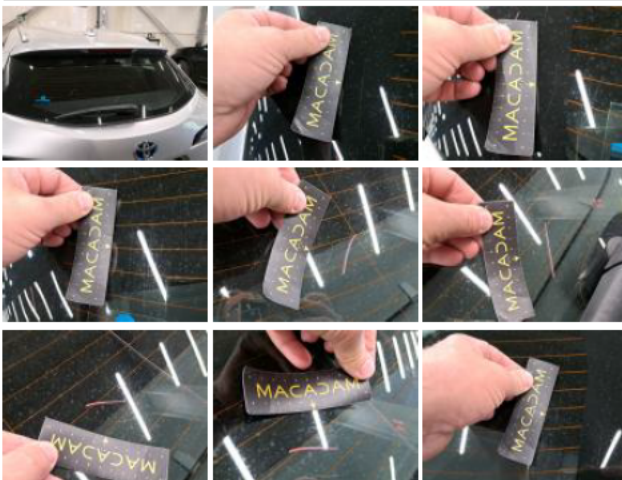

Alloy rim FR, Scratch(es), Repair and paint (complete) 133,03



Wing FR, Scratch(es), Acceptable	0,00
----------------------------------	------



Wing RR, Scratch(es), Repair and paint (complete)	431,58
---	--------



Alloy rim RR, Scratch(es), Acceptable	0,00
---------------------------------------	------



Roof, Dent(s), Acceptable	0,00
---------------------------	------

