



Expertise

Protocol number: 46870538
Order No. / Reference: 26716467
Inspection date: 4 Aug 2026

Manufacturer: Volkswagen
VIN: WVGZZAWZMU035297

Model: Polo 1.0 TSI DSG OPF Highline



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Polo 1.0 TSI DSG OPF Highline	
Vehicle Identification number	WVGZZAWZMU035297
Mileage (Read)	33,821 km
First registration	9 Jul 2021
Number of holders	1
Fuel type	Petrol
Engine displacement / Cylinder	999 ccm / 3
Power	81 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Car hatchback
Colour / colour code	Reflexsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	19,500 km
Last service on / at	07/2025 at 27,094 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC230390
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CNH 00098		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,650 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	185/65 R15 88T	Winter tyres on Steel	Dunlop	6mm / 6mm
2)	185/65 R15 88T	Winter tyres on Steel	Dunlop	6mm / 6mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	185/65 R15 88H	Summer tyres on Light alloy	Kumho	6mm / 6mm
2)	185/65 R15 88H	Summer tyres on Light alloy	Kumho	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2024		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Speed limiter
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points (for attaching 2 child seats to the rear seats, also for i-Size child seats)
- Air conditioning (with active combination filter)
- Rear headrests (3)
- Front headrests (safety-optimized, height-adjustable)
- Steering column adjustable in height and length
- Front center armrest, longitudinally adjustable, with storage box (2 USB-C ports in the front, 2 USB-C charging ports on the rear center console)
- Non-smoking version (storage compartment and 12V socket at the front)
- Otto particulate filter
- Package: Winter (heated front seats - washer fluid level warning light)
- Radio accessories: 4 speakers
- Radio accessories: Digital radio reception DAB+ (reception of digitally broadcast radio stations and traffic information in addition to the analog station offering - reception depends on the local availability of digital networks - expanded range of radio programs; improved reception performance)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Rear seat bench is undivided, backrest is asymmetrically split and foldable
- Seat belts: (Three-point automatic seat belts at the front with height adjustment and belt tensioner - Three-point automatic seat belts at the rear including belt tensioner for the outer rear seats)
- Bumpers in body color
- Textile floor mats (front and rear)
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing, sides and rear
- Storage pockets on the backs of the front seats
- Airbag for driver and front passenger (airbag deactivation switch on the passenger side)
- Ambient lighting (in the door trim and in the instrument panel)
- Exterior mirror housings and door handles in body color
- Hill start assist
- Chrome applications (on mirror adjustment and window regulator switches)
- Tachometer
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Automatic headlight control with daytime running lights ("Leaving home" function and manual "Coming home" function)
- Pedestrian detection
- Luggage compartment cover
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Interior lights with delayed shut-off and dimming function, 2 reading lights in the front and 2 in the rear
- LED license plate lighting
- Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer
- Radiator grille with chrome strip
- Illuminated makeup mirrors in the sun visors
- Multifunction display "Plus"
- Fatigue detection
- Fog lights and cornering lights
- Emergency braking assistant "Front Assist"
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Design "Tracks 2"
- Radio "Composition" (16.5 cm screen diagonal - touchscreen - FM radio reception - dual tuner with phase diversity for best possible radio reception - RDS - MP3 playback - USB interface Apple compatible - output power 4 x 20 watts - digital radio reception DAB+)
- Tire pressure monitoring system (passive)
- Wheels: 4 light alloy wheels 5.5 J x 15 "Salou" (painted in sterling silver - with tires 185/65 R 15, rolling resistance class A)
- Rear light dark red
- Gearshift knob in leather
- Power steering
- Seats: Sport comfort seats
- Seats: Front seats are height-adjustable
- Start-stop system (with brake energy recuperation)
- Storage compartment under the front seats
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys
- Airbag, head airbag system for front and rear passengers (including front side airbags)
- Electrically adjustable and heated exterior mirrors (driver's side aspherical)
- Outdoor temperature display
- third brake light
- Ceramic headliner
- Decorative inlays in Deep Iron Metallic (instrument panel and front door trim)
- Electronic Stability Program (ESP) (incl. ABS, ASR, EDS, MSR)
- Electric windows, front and rear
- Fresh air intake with activated carbon filter
- Windscreen made of laminated safety glass, heat-insulating
- Luggage compartment lighting



Extra equipment

- "Climatronic" air conditioning system (Air Care Climatronic air conditioning system with active combination filter and 2-zone temperature control)
- Radio accessories: 6 speakers
- Rear side windows and rear window tinted
- Seats: Lumbar support in the front
- Adaptive Cruise Control (ACC) stop & go up to 210 km/h and emergency braking assistant "Front Assist" (Adaptive Cruise Control ACC "stop&go" incl. speed limiter - "Front Assist" area monitoring system, city emergency braking function (for ACC cruise control up to 210 km/h))
- Paint finish: Metallic
- Package: Light and Sight (automatic headlight control with LED daytime running lights, "Leaving home" function and manual "Coming home" function - automatically dimming interior mirror - rain sensor)
- App-Connect (selected smartphone apps can be displayed and operated on the touchscreen of the radio or navigation system - MirrorLink, Android Auto, Apple CarPlay)
- Electrically adjustable, folding, and heated exterior mirrors, passenger-side mirror lowering function

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front left side	Door - dent(s) - Smart repair
3	Steering system	Steering wheel - Scratch(es) - Smart repair
4	Rear bumper	Rear bumper - Scratch(es) - Smart repair
5	Vehicle glazing	Windscreen - Scratch(es) - Replace

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer	425,22 €

Repainting

No.	Repainting
1	Bonnet, Professionally carried out

Paint coat thickness measurement

Bonnet	224 µm
--------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der montierte Winterradsatz ist nicht Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

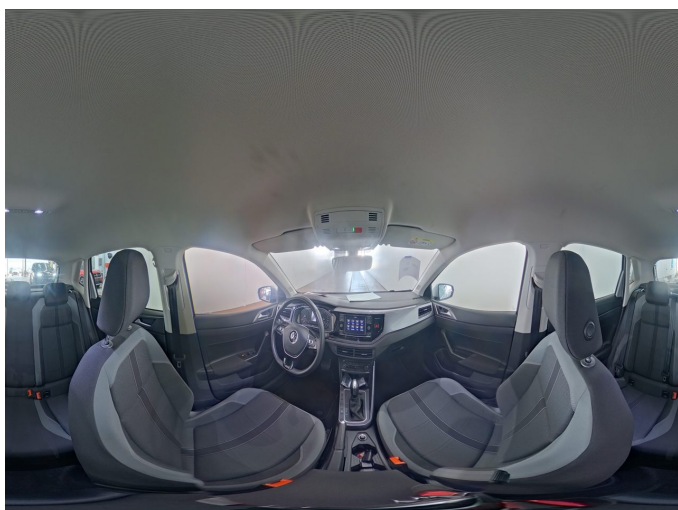


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

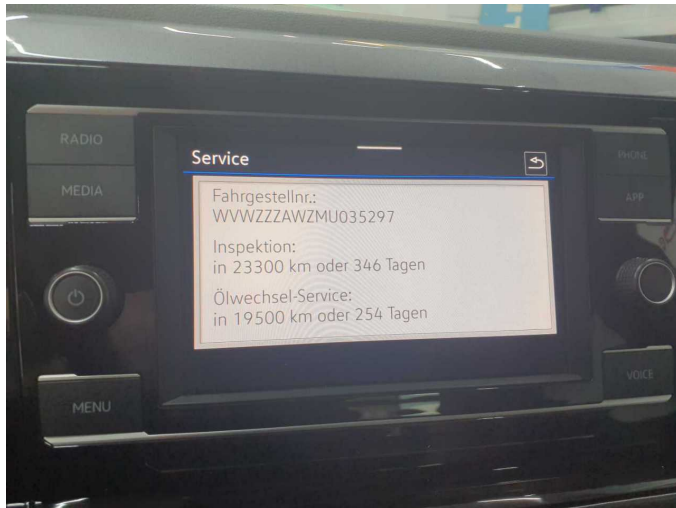


Figure 13: Documents

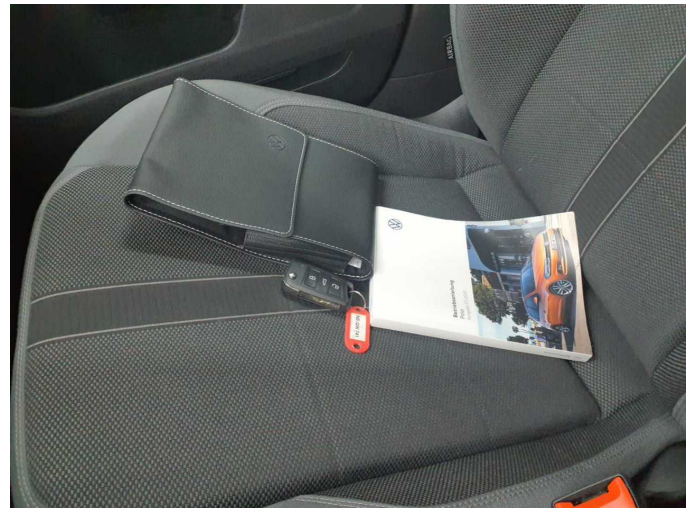


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Misc.

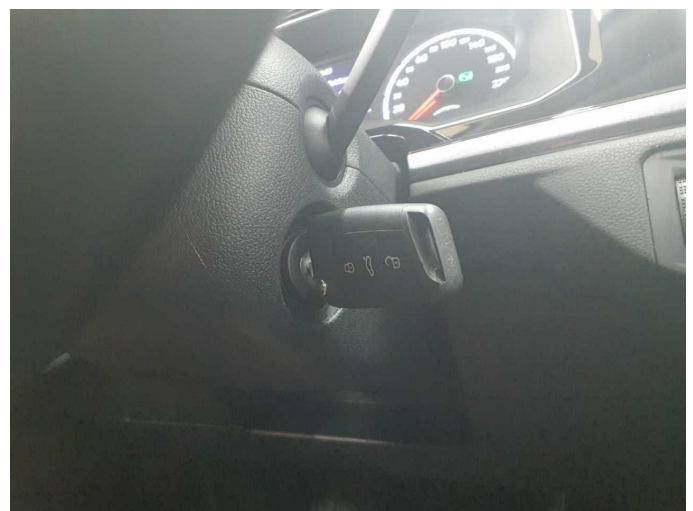


Figure 18: Misc.



Figure 19: Misc.

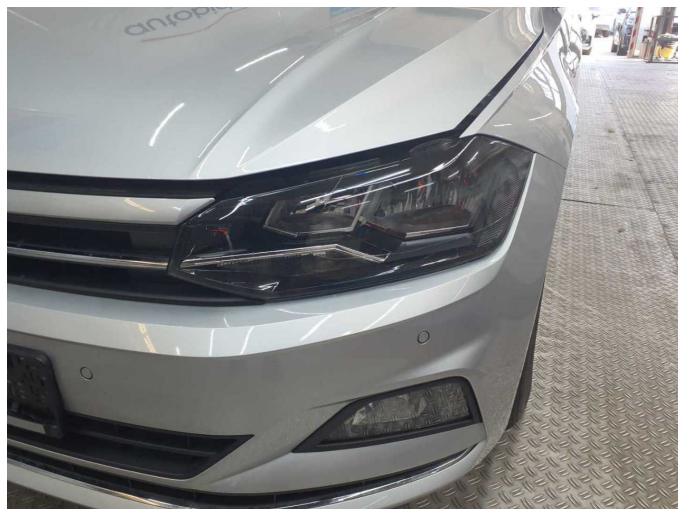


Figure 20: Misc.

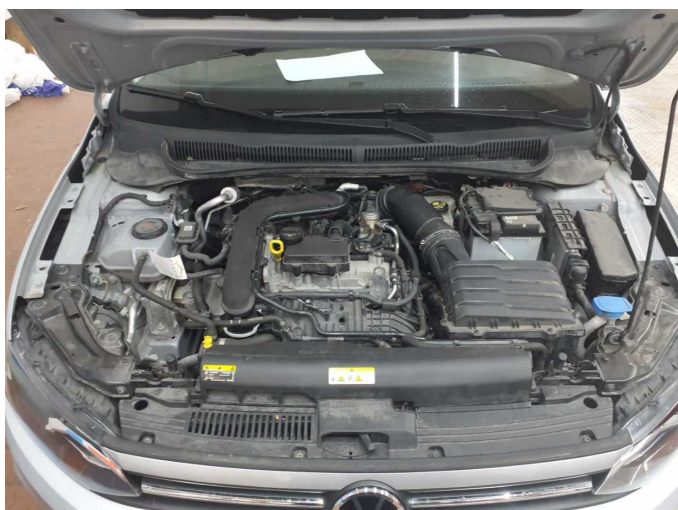


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.




Damage 2: Door - front left side: Door - dent(s) - Smart repair



Damage 2: Door - front left side: Door - dent(s) - Smart repair



Damage 3: Steering system: Steering wheel - Scratch(es) - Smart repair

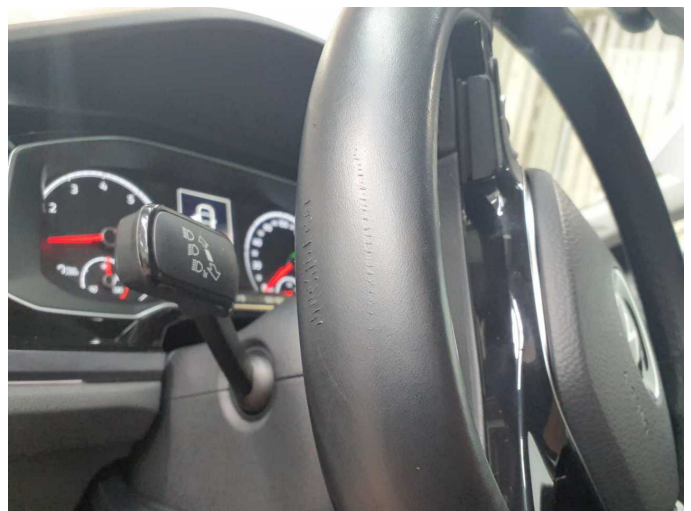

Damage 3: Steering system: Steering wheel - Scratch(es) - Smart repair



Damage 3: Steering system: Steering wheel - Scratch(es) - Smart repair



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 4: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 5: Vehicle glazing: Windscreen - Scratch(es) - Replace

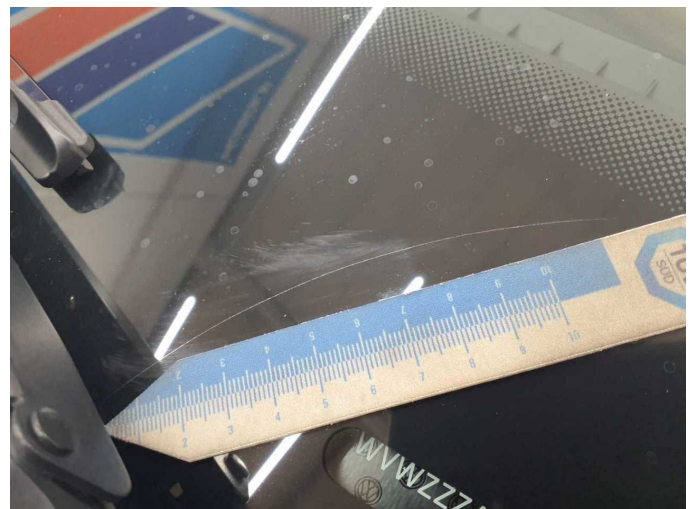

Damage 5: Vehicle glazing: Windscreen - Scratch(es) - Replace

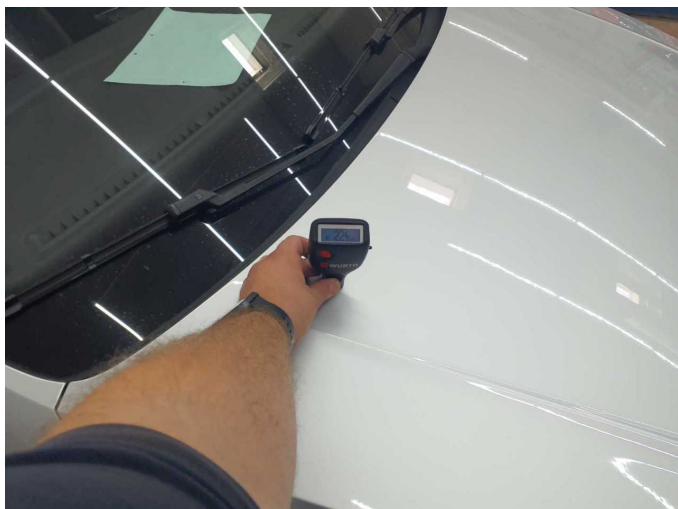

Repainting 1: Bonnet



Repainting 1: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZAWZMU035297

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Polo 1.0 TSI OPF DSG Highline

Datum	KM-Stand	Beschreibung
24.06.2026	33.594	Kraftstoffpumpe ern; Systemtest/Eigendiagnose
23.04.2026	33.552	Systemtest/Eigendiagnose
16.07.2025	27.094	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
04.09.2024	21.036	AU
11.09.2023	13.380	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges