



Expertise

Protocol number: 46054010
Order No. / Reference: 26488869
Inspection date: 19 Jun 2026

Manufacturer: Ford
VIN: WF0FXXWPMHPC28856

Model: Kuga 2.5 Duratec PHEV TITANIUM X



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 2.5 Duratec PHEV TITANIUM X	
Vehicle Identification number	WF0FXXWPMHPC28856
Mileage (Read)	127,883 km
First registration	11 May 2023
Number of holders	1
Power / Engine displacement	112 kw / 2,488 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Blazer Blue
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	83 %
Last service on / at	05/2025 at 79,544 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP515871
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BTM 00020		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,320 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 102V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/65 R17 102V	Summer tyres on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 102H	Winter tyres on Light alloy	Continental	3mm / 3mm
2)	225/65 R17 102H	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Acoustic Vehicle Alerting System (AVAS)
- Anti-lock braking system
- Passenger airbag deactivation
- Tires: Tire repair kit
- Fabric headliner
- Roof spoiler
- Tachometer
- Driving mode switch selective
- Electric front and rear windows with all-around closing function
- Ford EcoCoach
- FordPass Connect
- Luggage compartment cover, roller blind, removable
- Luggage compartment lighting
- Transmission: continuously variable automatic transmission
- Heated rear window
- rear window wiper
- Intelligent Protection System (IPS)
- Air conditioning with automatic temperature control
- Front and rear headrests (5) height adjustable
- Charging cable for household socket
- Steering wheel: Steering wheel, 3-spoke design, in Sensico synthetic leather
- Rear center armrest with two cup holders
- Front center console with integrated armrest
- Navigation system: Ford navigation system including Ford SYNC 3
- Front and rear parking pilot system
- Post-Collision Assist
- Pre-Collision Assist
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Driver's seat electrically adjustable, 10-way including electrically adjustable lumbar support
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front seats, individually and variably heated
- Carpet floor mats front and rear, velour
- Immobiliser
- Ambient lighting at the front
- Electrically adjustable, heated and folding exterior mirrors
- Tires: 7 J x 17 alloy wheels (4) in 5x2-spoke design
- third brake light
- Roof rails, silver-colored
- 12.3-inch digital instrument panel
- Electronic Safety and Stability Program (ESP)
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto hold function
- Ford Easy Fuel
- Ford Power Start Function & Ford Key Free System
- Geofencing - Display of emission zones with Euro 6 and higher in the SYNC navigation device
- Cruise control
- Illuminated glove compartment
- Electric tailgate, sensor-controlled (opens via foot movement)
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Paint finish: Solid
- LED taillights
- Steering column, adjustable in height and reach
- Illuminated makeup mirrors in the driver's and passenger's sun visors
- MyKey key system
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Upholstery: Premium Sensico upholstery in leather look/fabric
- Radio accessories: B&O Sound System
- Rear view camera
- Headlights with delayed shut-off
- Power steering
- Seats: Passenger seat, 8-way manually adjustable
- Seats: Map pockets on the driver's and front passenger's seat backrests
- Seats: Front sports seats with integrated headrests
- Static LED headlights
- Variable radiator air intake
- Central locking with remote control and remote luggage compartment release



Extra equipment

- Detachable towbar (including ESP trailer stabilization)
- Package: Technology (Adaptive LED headlights with glare-free high beam assist and dynamic cornering lights, automatic headlight range control and LED fog lights - Head-up display)
- Package: Winter II (Heated windscreen - Heated leather steering wheel - Heated outer rear seats)
- Safety partition net for attachment behind the 2nd row of seats (including attachment points behind the first and second rows of seats)
- Package: Driver Assistance Package (Automatic Transmission) (Intelligent Adaptive Cruise Control with Traffic Sign Recognition System - Traffic Jam Assist with Stop&Go Function and Lane Keeping Assist - Wrong-Way Driver Warning System - Evasive Steering Assist - Driver Drowsiness Detection - Pre-Collision Assist including Forward Collision Warning System with Cross Traffic Alert - Blind Spot Assist with Emergency Braking Function and Trailer Detection - Active Park Assist with Parking Assist and Semi-Autonomous Vehicle Steering - Front Camera with Split View - Door Edge Protectors - Intelligent Speed Limiter with Speed Limit Display)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Seat - front	Seat cover - left side - Soiled - Clean
2	Interior	Interior (Hundegeruch) - Odour - Ozone treatment
3	Seat - front	Seat cover - left side - Porous / cracked - Smart repair
4	Rear bumper	Rear bumper (inkl. Spoiler) - Scratch(es) - Paint
5	Boot lid / rear door	Boot lid - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 alloy rims - Scratched - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Body	Body (Waschanlagekratzer) - Scratch(es) - No deduction
5	Front bumper	Front bumper - Stone chips - No deduction
6	Mudguard - left side	Mudguard - left side - dent(s) - Smooth repair work

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 18 Dec 2025	9.401,41 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

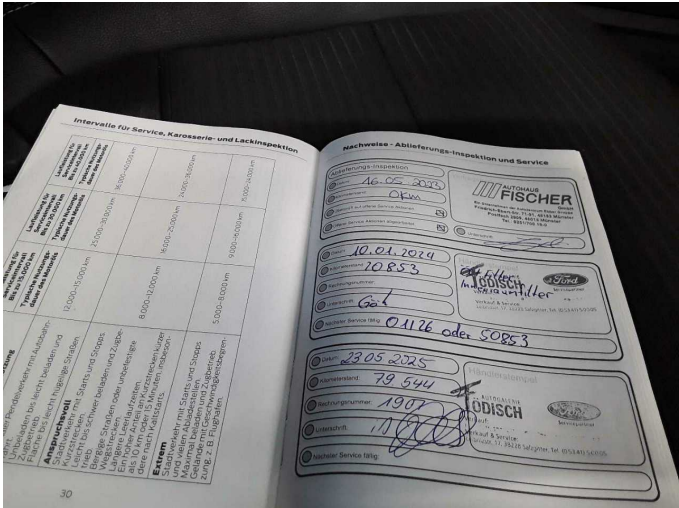


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

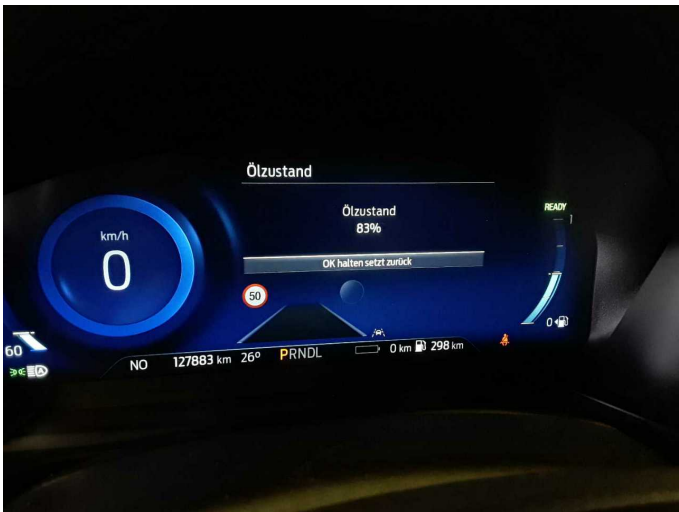



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

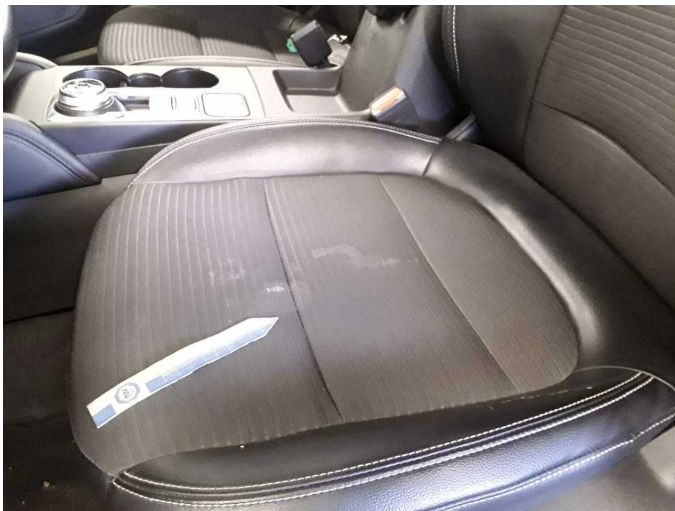

Damage 1: Seat - front: Seat cover - left side - Soiled - Clean



Damage 1: Seat - front: Seat cover - left side - Soiled - Clean



Damage 3: Seat - front: Seat cover - left side - Porous / cracked - Smart repair



Damage 3: Seat - front: Seat cover - left side - Porous / cracked - Smart repair




Damage 4: Rear bumper: Rear bumper (inkl. Spoiler) - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper (inkl. Spoiler) - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper (inkl. Spoiler) - Scratch(es) - Paint

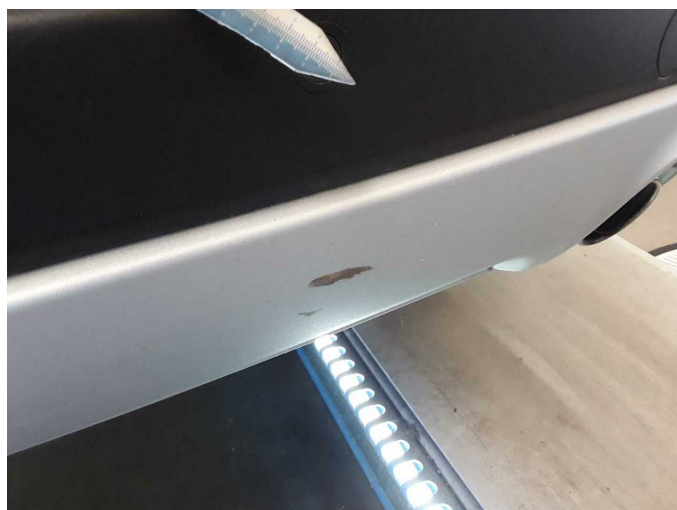

Damage 4: Rear bumper: Rear bumper (inkl. Spoiler) - Scratch(es) - Paint



Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Paint




Damage 5: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction

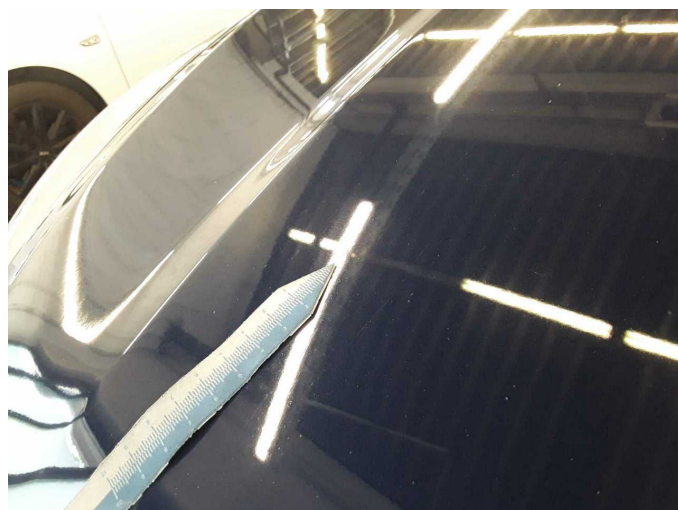

Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction

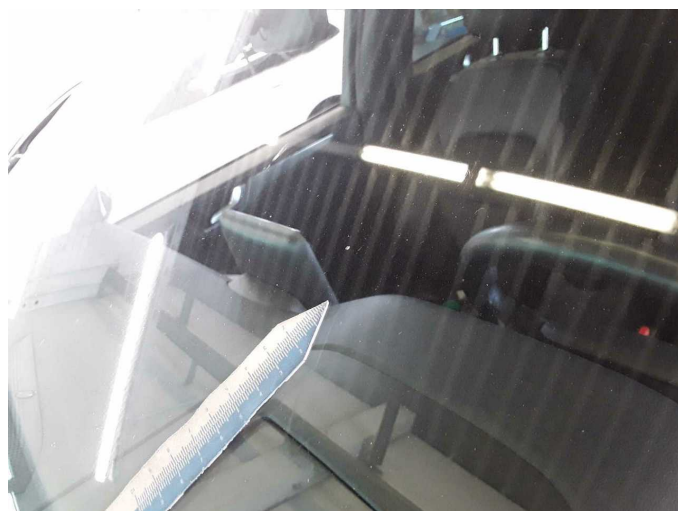

Wear and tear 3: Vehicle glazing: Windscreen - Stone chips - No deduction




Wear and tear 5: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 5: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 6: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work

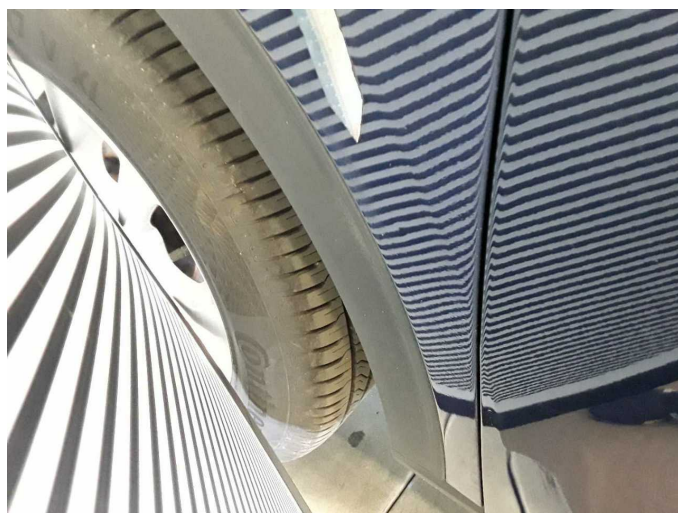

Wear and tear 6: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work