



Expertise

Protocol number: 46336293
Order No. / Reference: 26600628
Inspection date: 6 Jul 2026

Manufacturer: Ford
VIN: WF0JXXWPCJNY75883

Model: S-Max 2.0 EcoBlue Aut. VIGNALE



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford S-Max 2.0 EcoBlue Aut. VIGNALE	
Vehicle Identification number	WF0JXXWPCJNY75883
Mileage (Read)	156,436 km
First registration	12 May 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report on hand)	
Power / Engine displacement	140 kw / 1,998 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Obsidian-Schwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Beige



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	0 km
Last service on / at	01/2026 at 144,914 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK978312
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BQR 00323		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,555 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Winter tyres on Light alloy	Hankook	4mm / 4mm
2)	235/55 R17 103V	Winter tyres on Light alloy	Hankook	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R18 101Y	Summer tyres on Light alloy	Continental	3mm / 3mm
2)	235/50 R18 101Y	Summer tyres on Light alloy	Michelin	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (illuminated glove compartment - map pockets on the driver's and passenger's seat backrests)
- Ambient lighting in the front (including door storage, front door handle and footwell lighting)
- Anti-lock braking system (ABS) (with Electronic Stability Program (ESP), Roll Stability Control (RSC) and Traction Control System (TCS))
- Attachment points for safety partition grilles (attachment points 1st row of seats)
- Attachment points for safety partition grilles (attachment points 2nd row of seats)
- Hill start assist
- third brake light
- Roof rails "aluminum look"
- Diesel particulate filter (DPF)
- Tachometer
- Driver information system display 25.4 cm color (on-board computer with fuel consumption and mileage information as well as outside temperature display)
- Electric front and rear windows (with anti-pinch protection and automatic opening and closing function)
- High Beam Assist
- Ford Easy Fuel (The Ford Easy Fuel convenience refueling system eliminates the need for a separate internal fuel filler cap and prevents misfueling by detecting the size difference between petrol and diesel nozzles. The filler neck only opens when the correct fuel is used.)
- Luggage compartment cover (removable)
- Cruise control system with intelligent speed limiter (interior mirror, automatically dimming - traffic sign recognition system)
- rear window wiper
- Interior mirror, automatically dimming
- Isofix mounting (on all seats in the 2nd row)
- Electric child safety lock
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Radiator grille in special Vignale design with chrome surround
- Paint finish: Obsidian Black Metallic
- Steering wheel: Multifunction leather steering wheel
- Front and rear reading lights (with LED technology)
- MyKey key system (individually programmable second key) (setting options include: - Limiting the maximum speed and radio volume (to max. volume 15 out of 32) - Speed warning (when the set speed limit is exceeded) - Safety assistance systems cannot be deactivated - Extended warning system for unfastened seat belts)
- Fog light
- Emergency brake light (pulsating illumination of the brake lights during hard braking)
- Package: Winter (Heated windscreen - Heated leather steering wheel - Individually and variably heated front seats)
- Adaptive LED headlights (Ford Dynamic LED) (LED headlights with glare-free high beam - headlights, adaptive steering, with cornering lights - LED front headlights incl. automatic headlight range control - LED daytime running lights, front in the main headlight - headlights, automatically height-adjustable)
- Exterior mirrors painted in body color, electrically adjustable, heated and foldable (with integrated turn signals - ambient lighting - memory function - driver's side automatically dimming - automatic tilting towards the sidewalk when reversing)
- Tires: 7.5 J x 18 alloy wheels (4) with 235/50 R 18 tires (in 10x2-spoke design with luster nickel premium paint finish)
- Overhead console (with glasses storage compartment and fold-out additional mirror for eye contact with rear passengers)
- Electronic Shifter
- Lane Assist including Lane Keeping Assist and Driver Alert (warns the driver of an unintentional lane change via short steering wheel vibrations (without activation of the turn signal) - additionally, active steering support assists in returning to the lane)
- Electronic parking brake
- Ford EasyFold: 2nd row seat backrests fold down electrically at the touch of a button.
- Ford Power Start function (keyless start)
- Ford Power Start function with Ford Key Free system (keyless starting and locking/unlocking)
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission (with manual shift option)
- Back window, heater
- Interior lighting with delay circuit
- Intelligent Protection System (IPS): - Front headrests, 4-way height and tilt adjustable - Front airbag for driver and front passenger - Driver's knee airbag - Head and shoulder airbags, front and for 2nd row of seats - Side airbag for driver and front passenger - Side airbag for outer rear seats of the 2nd row - Seat belt tensioners and belt force limiters, front - 3-point seat belts on all seats, height adjustable in the front)
- Steering wheel: Steering column, adjustable in height and reach
- Front center console with padded armrest (storage compartment and 2 cup holders)
- Sony navigation system including Ford SYNC 3 with AppLink, touchscreen and DAB, as well as FordPass Connect (radio/CD player, MP3-compatible, 2 USB ports, 390-watt premium sound system, 12 premium speakers, subwoofer, steering wheel remote control, 20.3 cm screen diagonal), communication and entertainment system with extended voice control, supports Android Auto and Apple CarPlay, Bluetooth hands-free system and audio streaming, control of selected vehicle functions via smartphone with the FordPass app, live traffic information, eCall sends an emergency call in case of accident/manual activation, Wi-Fi hotspot up to 4G/LTE7, DAB/DAB+)



- Front and rear parking pilot system
- Pedal assembly with aluminum pads
- Tire repair kit (for use at a maximum speed of 80 km/h)
- Tire Pressure Monitoring System (TPMS)
- Reversing camera (with display on screen)
- LED taillights
- Windscreen wipers with rain sensor
- Headlight dipped beam with switch-off delay including "greeting function"
- Headlight assistant with day/night sensor
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seats: Flexible seating system "FoldFlatSystem (FFS)" (2nd row of seats with 3 individual seats - adjustable longitudinally - seat backrests adjustable for tilt and individually foldable - headrests retractable)
- Bumpers painted in body color
- Trays on the front seatbacks
- Traffic sign recognition system
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control (remote luggage compartment release - second folding vehicle key)

Extra equipment

- Electrically swiveling towbar
- Panoramic roof (non-opening) (sun protection blinds integrated into the rear side doors - windshield and panoramic roof with "Solar-Reflect" heat protection)

- Upholstery: Premium leather with massage function (multicontour front seats - leather center panels and leather-look seat back and side bolsters - driver's seat, 10-way electrically adjustable, with memory function - passenger seat, 10-way electrically adjustable - 11 variably adjustable air cushions - front seats, climate-controlled (individually and variably heated and cooled with multi-stage ventilation))
- Headlights washer / wiper system
- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Seats: Front seats can be heated individually and variably.
- Start-stop system
- 230 volt socket
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- Premium carpet floor mats front and rear (as well as in the 3rd row of seats if ordered as an optional extra)
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats (as well as the 3rd row of seats if ordered as an optional extra)
- Cigarette lighter (and ashtray in the center console)

- Package: Business III (Automatic) (Sony Navigation incl. Ford SYNC 3, AppLink, Touchscreen, Voice Control, Radio/CD Player, MP3-compatible, 2 USB ports, 390-watt premium sound system, 12 speakers, steering wheel remote control, Bluetooth hands-free system, FordPass Connect, eCall, DAB/DAB+, Adaptive LED headlights with glare-free high beam, ACC, Traffic Jam Assist, Pre-Collision Assist, Forward Collision Warning, Emergency Brake Assist, Front and Rear View Camera, Blind Spot Assist, Cross Traffic Alert, Dynamic Distance Control, Power Tailgate with Sensors, Ford Key Free System, Park Assist)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
3	Engine	Engine cover - Deformed - Replace
4	Misc.	Inspection / maintenance - Due - Perform
5	Bonnet	Bonnet (Harz) - Paint defect - Paint
6	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Interior	Interior - Scratch(es) - No deduction
3	Mudguard - right side	Mudguard - right side - Stone chips - No deduction
4	Mudguard - left side	Mudguard - left side - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 3 Jul 2025	976,57 €
2	Rear, Side - left, Provided by user / customer, from 24 Aug 2025	5.136,50 €
3	Rear, Side right, Provided by user / customer, from 1 Aug 2025	9.705,73 €

Repainting

No.	Repainting
1	Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Der Winterradsatz ist kein Bestandteil der Ausstattungsliste.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

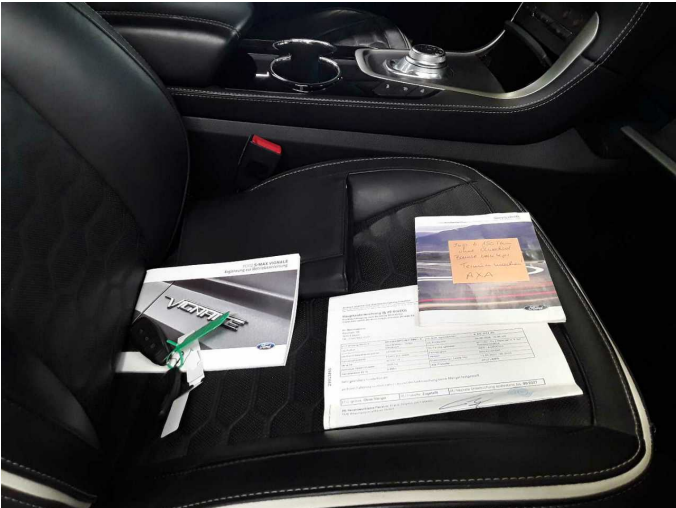


Figure 13: Documents

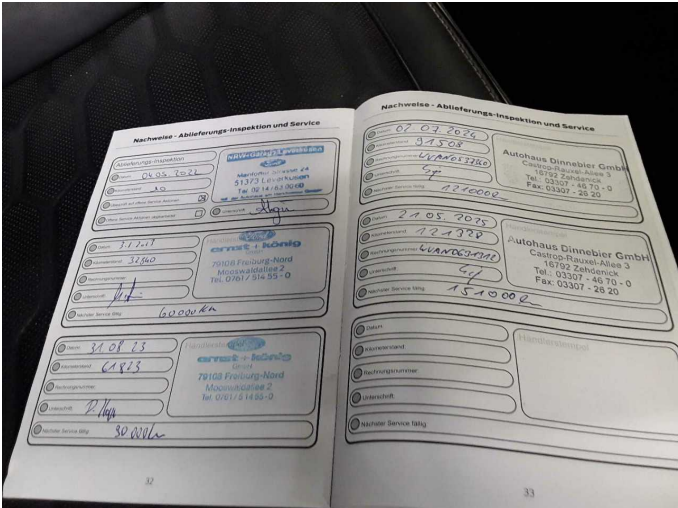


Figure 14: Documents

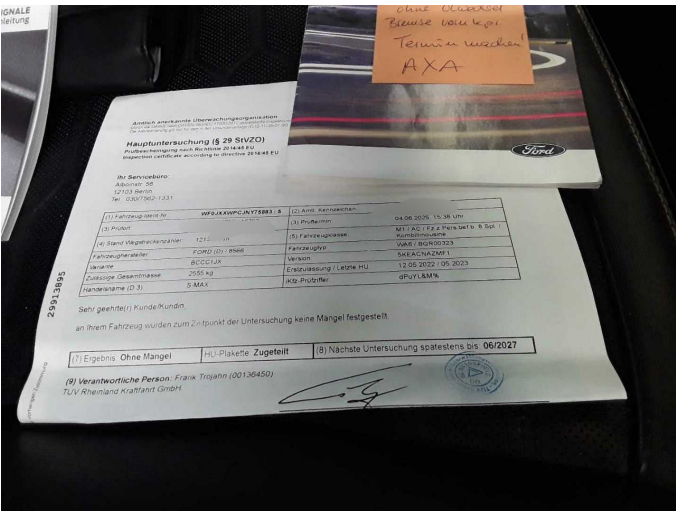


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres

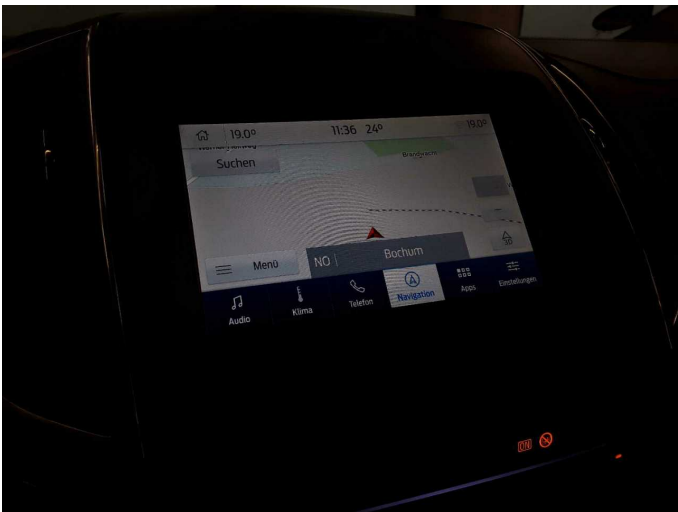


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.

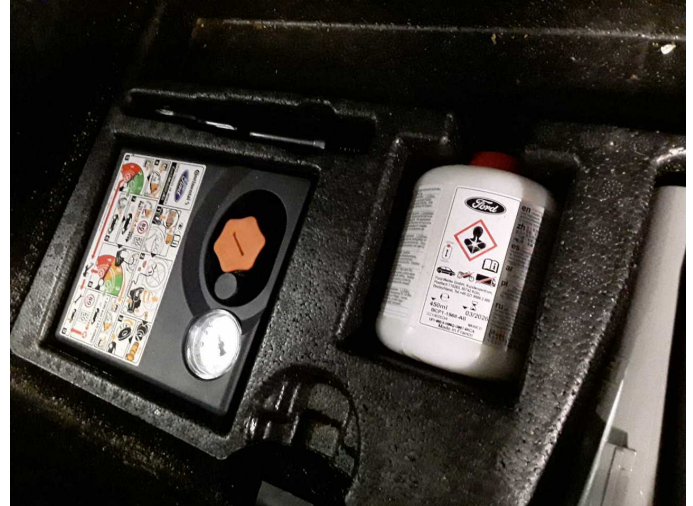


Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

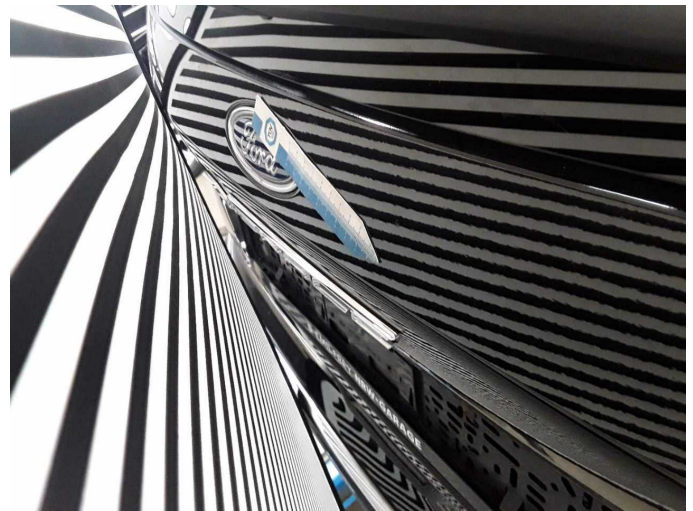

Damage 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

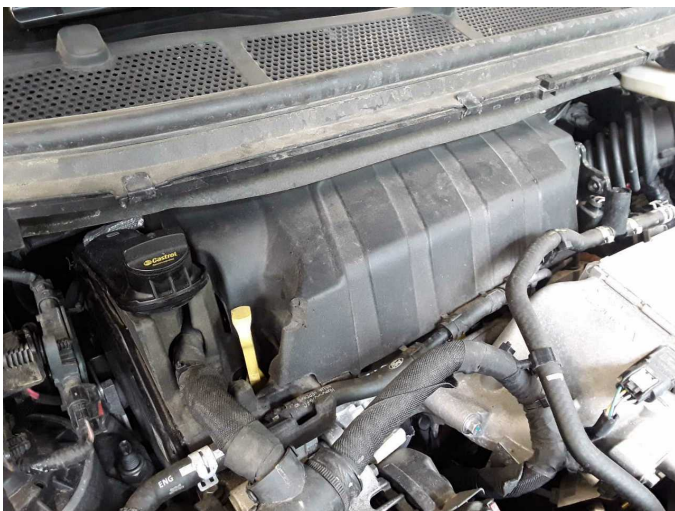

Damage 3: Engine: Engine cover - Deformed - Replace




Damage 4: Misc.: Inspection / maintenance - Due - Perform



Damage 5: Bonnet: Bonnet (Harz) - Paint defect - Paint



Damage 5: Bonnet: Bonnet (Harz) - Paint defect - Paint

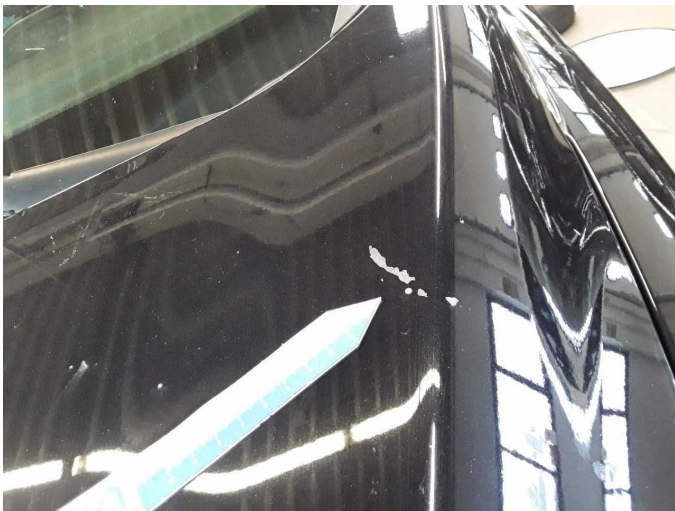


Damage 5: Bonnet: Bonnet (Harz) - Paint defect - Paint



Damage 5: Bonnet: Bonnet (Harz) - Paint defect - Paint



Damage 6: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

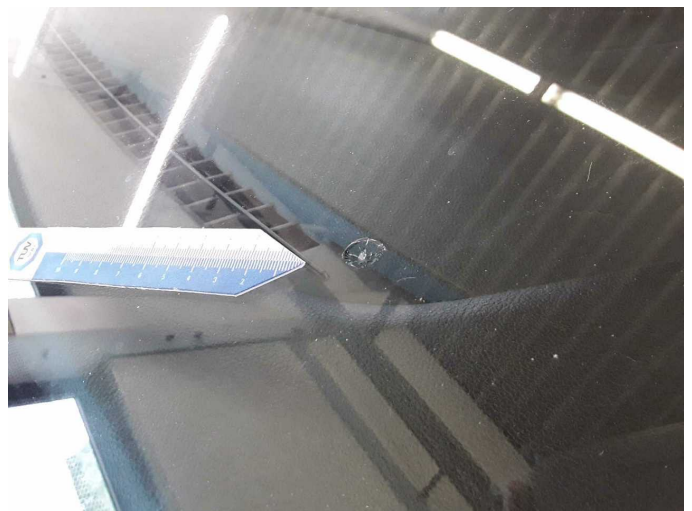

Damage 6: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side




Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side

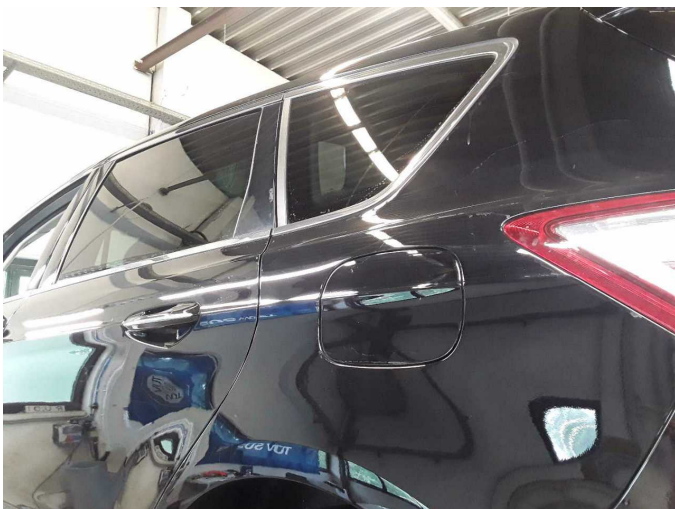

Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side




Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side

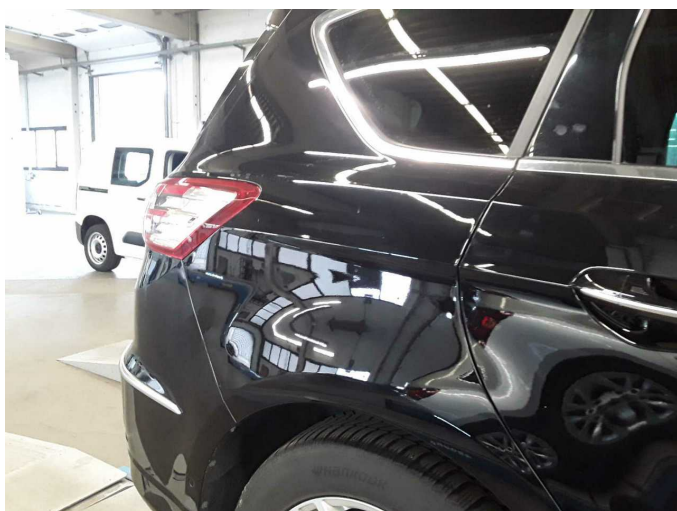

Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side



Repainting 1: Mudguard - right side, Side panel - rear left side, Side panel - rear right side, Door - rear right side, Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0JXXWPCJNY75883
Hersteller / Modell: FORD FORD S-Max 2.0 EcoBlue Aut. VIGNALE

Datum	KM-Stand	Beschreibung
20.01.2026	144.914	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
04.06.2025	121.328	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; HU + AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
23.01.2025	110.984	Batterie ern; Systemtest/Eigendiagnose
04.07.2024	91.508	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
31.08.2023	61.827	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.01.2023	32.840	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges