



Expertise

Protocol number: 46902173
Order No. / Reference: 26827307
Inspection date: 3 Aug 2026

Manufacturer: Opel

Model: Insignia Grand Sport 2.0 Diesel Automatik Business

VIN: W0VZT6EP1N1031515



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Grand Sport 2.0 Diesel Automatik Business	
Vehicle Identification number	W0VZT6EP1N1031515
Mileage (Read)	158,828 km
First registration	17 Oct 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	128 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	TYPE HABILLAGE EXTERIEUR METALLISEE VERNIS
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	73 %
Last service on / at	05/2026 at 150,637 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GN191099
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMB 00298		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	225/55 R17 101Y	Summer tyres on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments (storage compartment in the center console, pockets in the front doors suitable for 1.5-liter beverage bottles, pockets in the rear doors suitable for 1-liter beverage bottles, cup holder in the center console, illuminated glove compartment)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- Glasses compartment in the headliner
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Pedestrian protection including active hood
- Speed controller
- Back window, heater
- Automatic climate control, two zones
- Rear headrests (3 pieces) (height adjustable)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Winter 1 (Heated seats, multi-stage, driver and front passenger - Heated leather steering wheel - Heated ThermoTec windshield)
- Quickheat rapid heating system
- Radio: Multimedia Navi Pro with 8" color touchscreen display (voice control for audio, telephone and navigation, USB port, Bluetooth audio streaming, navigation system with SD card storage, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, steering wheel controls, Apple CarPlay and Android Auto)
- Power steering (speed-dependent)
- Visibility equipment (rain sensor, front)
- Seats: Ergonomic active seat (AGR) driver (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electropneumatically adjustable in height and length - extendable thigh support, manually adjustable - headrest, height and tilt adjustable)
- Start/Stop system (reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function)
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Pre-installation for child seat mounting system "ISOFIX" (rear)
- Immobiliser
- Thermal insulation glazing, green tinted
- Central locking with remote control (and interior switches)
- Adaptive brake light
- Airbag: Front and side airbags, driver and front passenger (front and side airbag, passenger, deactivatable)
- Airbag: Front and rear outer head airbags
- Ambient lighting (dashboard and doors (front))
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable)
- third brake light
- Decorative strip hexagon
- Tachometer
- Electronic Stability Program (ESP Plus)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Noise-reducing, laminated front side windows
- Transmission: 8-speed automatic transmission
- Child safety lock in the rear doors, manual
- Front headrests (height adjustable)
- LED headlights (automatic headlight range control)
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Electric parking brake (including 12-volt socket)
- Parkpilot, front and rear parking aid
- Upholstery: Billy fabric, black
- Radio: Digital radio reception DAB+
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Tire pressure display (with tire pressure warning - direct system with automatic calibration after wheel change)
- Wheels: Alloy wheels 7.5 J x 17 in 5 twin-spoke design (tires 225/55 R 17)
- Rear seat backrest folds forward in a 60:40 split
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)
- Lane Keeping Assist (warning in case of unintentional lane departure (between 60 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Bumpers painted in body color
- Traffic sign assistant (recognition of speed limits, no-overtaking zones and their cancellation, additional information signs (e.g., for wet conditions, slippery surfaces, left/right directions) on standard traffic signs, beginning and end of motorways, expressways and traffic-calmed areas, display of the recognized sign in the driver information display (depending on traffic sign quality, visibility and weather conditions).)



Extra equipment

- Package: Business Premium (Easy Access Package: Keyless locking and starting system, sensor-controlled tailgate, electric loading sill protection, stainless steel - Charging Package: Wireless charging, 2 USB ports, rear center console - Park & Go: Digital reversing camera, reversing assistant, lane change assistant, blind spot warning in both exterior mirrors - Innovation Package 1: IntelliLux LED Pixel headlights, traffic sign assistant - Solar Protect heat-insulating glass, heavily tinted, in the rear)
- Upholstery: Siena leather interior, perforated, black, including Winter Package 4 (Ergonomic active seats (AGR), driver and front passenger leather upholstery (leather seat contact surfaces; 2nd row center seat, headrests, door panels and outer seat bolsters in leatherette) - Heated seats front/rear - Rear center armrest with cupholder and pass-through from the luggage compartment - Rear seat backrest with FlexFold function, 40:20:40 split-folding - Door sill trims with OPEL lettering, front - Heated leather steering wheel - Heated ThermoTec windshield - Seat Comfort Package 2 - Charging Package)
- Keyless locking and starting system Keyless Open & Start
- Package: Innovations 2 (automatic transmission) (Head-up display - Adaptive cruise control (Generation 3), Stop & Go function - Forward collision warning with pedestrian detection and automatic emergency braking, active from 4 km/h, range 150 m. In case of risk of collision, the braking system is prepared and, if necessary, emergency braking / automatic emergency braking is initiated - Traffic sign recognition)
- Package: Sound (Bose sound system)
- Paint finish: Metallic
- Swiveling trailer hitch (including trailer stability program)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Trim / covers - Broken / torn - Replace
2	Seat - front	Seat cover - left side - Scratch(es) - Smart repair
3	Sill - left side	Sill - Scratch(es) - Smart repair
4	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
5	Vehicle glazing	Windscreen - Stone chips - Smart repair
6	Body	Body (Matt) - Paint defect - Smart repair
7	Door - rear right side	Door (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning
8	Wing mirror - right side	Cap (tiefer) - Scratch(es) - Replace
9	Side panel - rear left side	Side panel - Dent / paintcoat damage - Repair and paint
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Front bumper	Front bumper (+ Blende) - Scratched - Repair and paint
12	Door - rear left side	Door (Anätzung) - Scratched - Paint
13	Roof	Roof (+Anätzung) - Dent / paintcoat damage - Repair and paint



Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
2	Door - front left side	Door - Scratch(es) - No deduction
3	Body	A-pillar - left side - Scratch(es) - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

- 1 Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
- 2 Door - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	162 µm	Door - rear right side	163 µm
-----------------------	--------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

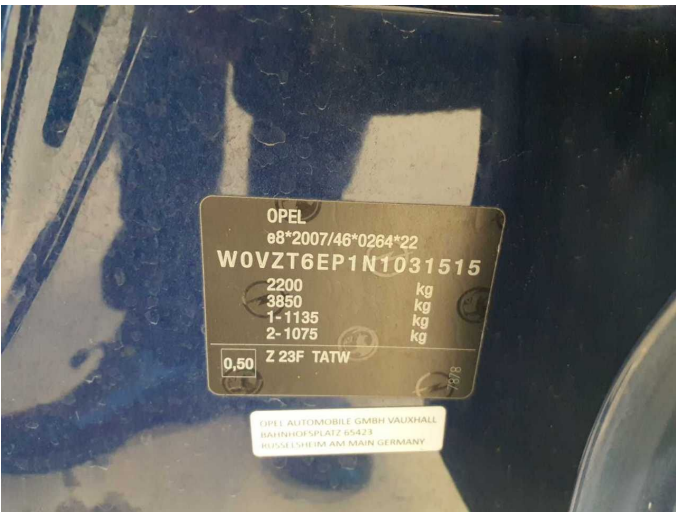


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

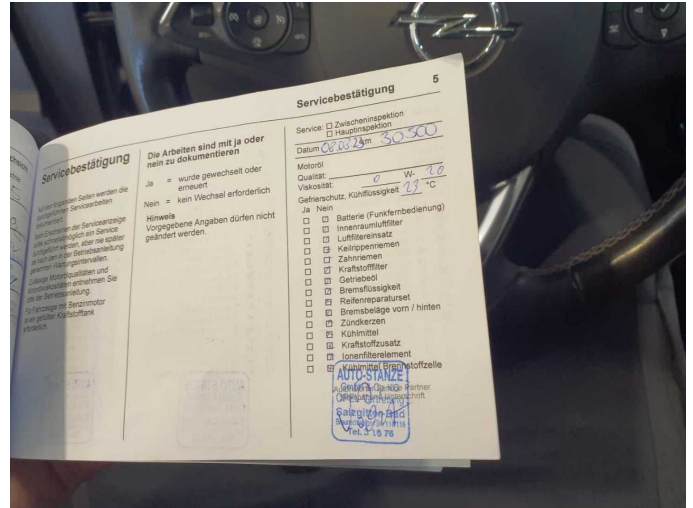


Figure 14: Documents

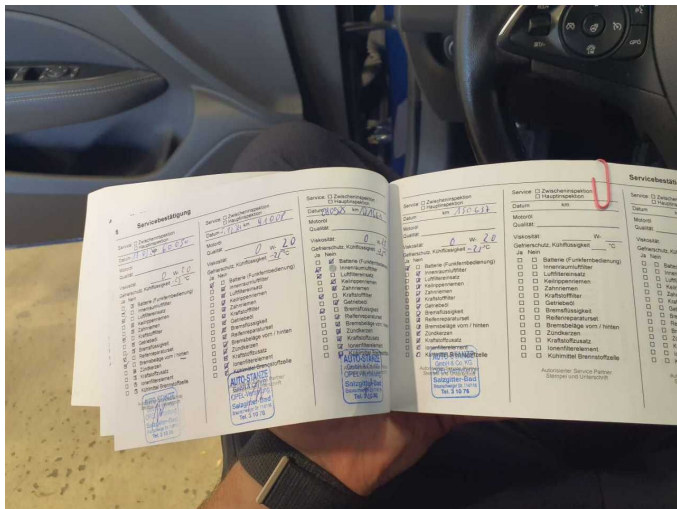


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres

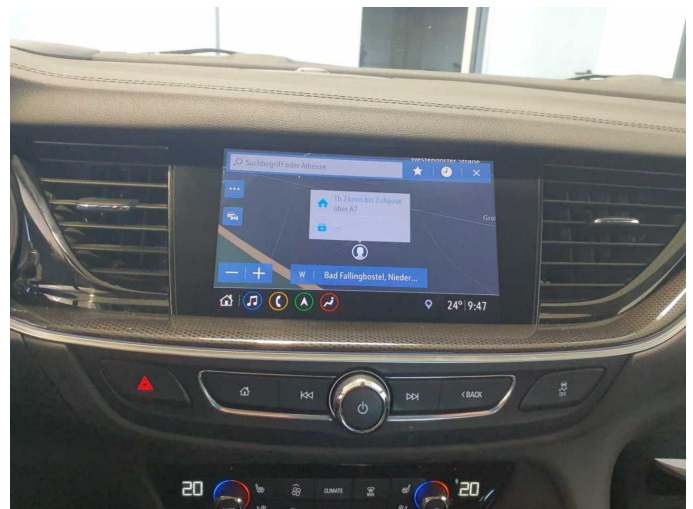


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

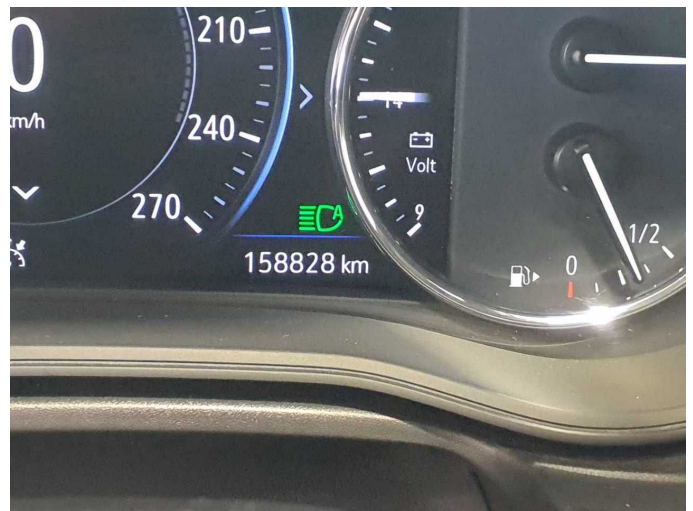


Figure 22: Misc.

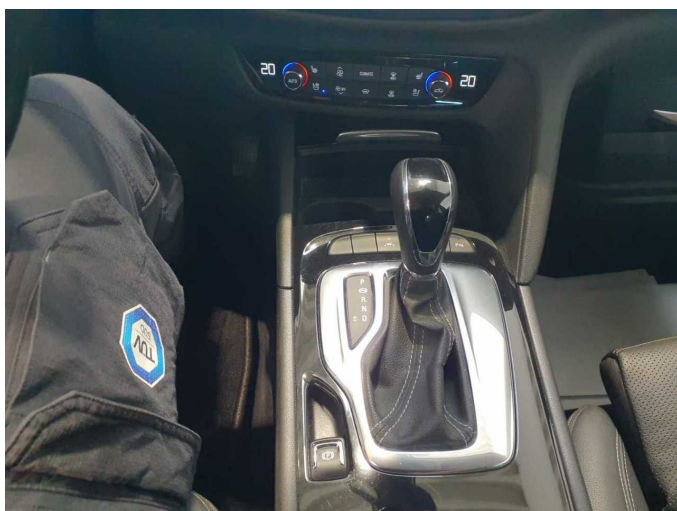


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

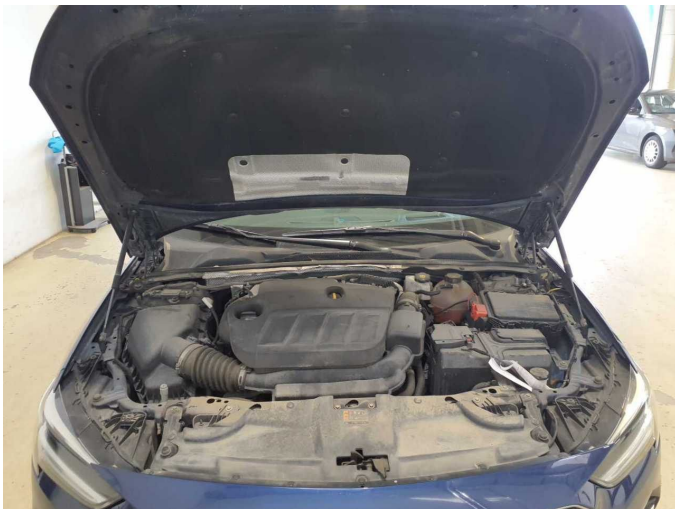


Figure 27: Misc.

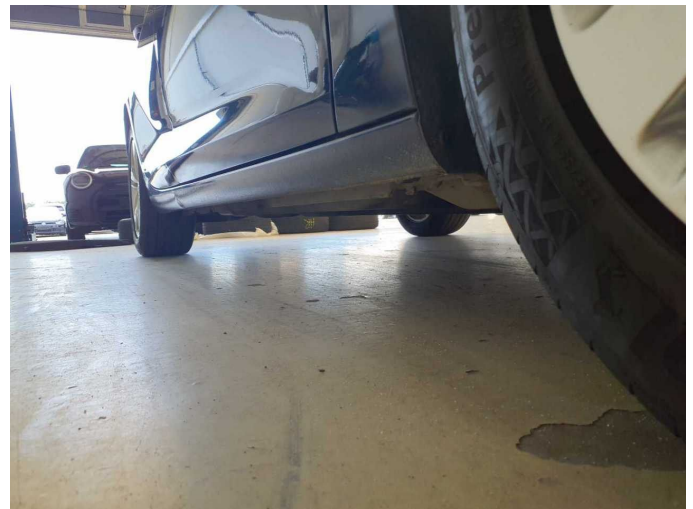


Figure 28: Misc.

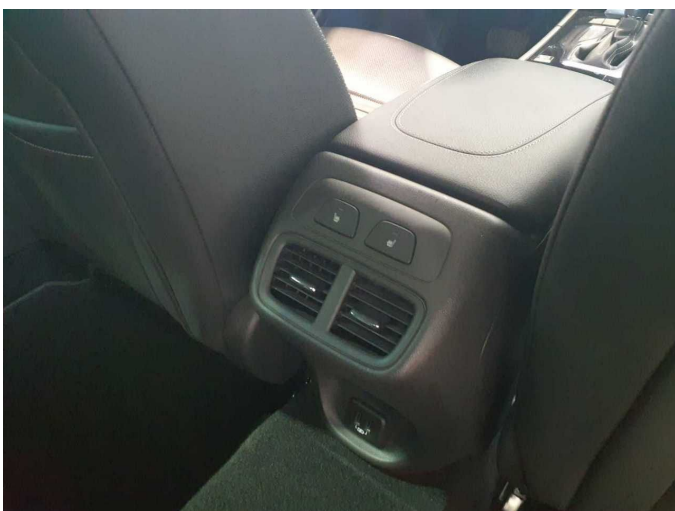


Figure 29: Misc.

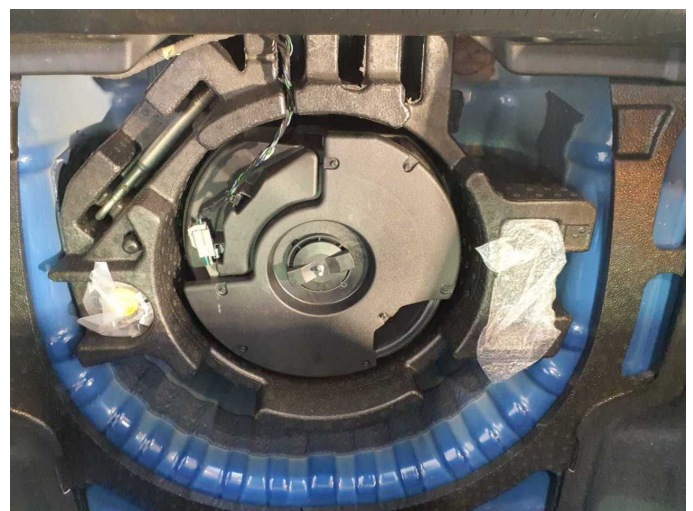


Figure 30: Misc.



Figure 31: Misc.




Damage 1: Trim / covers: Trim / covers - Broken / torn - Replace




Damage 1: Trim / covers: Trim / covers - Broken / torn - Replace



Damage 1: Trim / covers: Trim / covers - Broken / torn - Replace

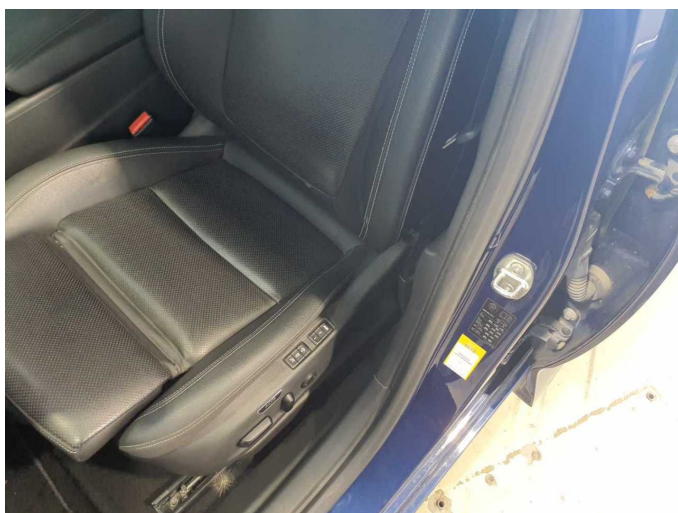

Damage 2: Seat - front: Seat cover - left side - Scratch(es) - Smart repair

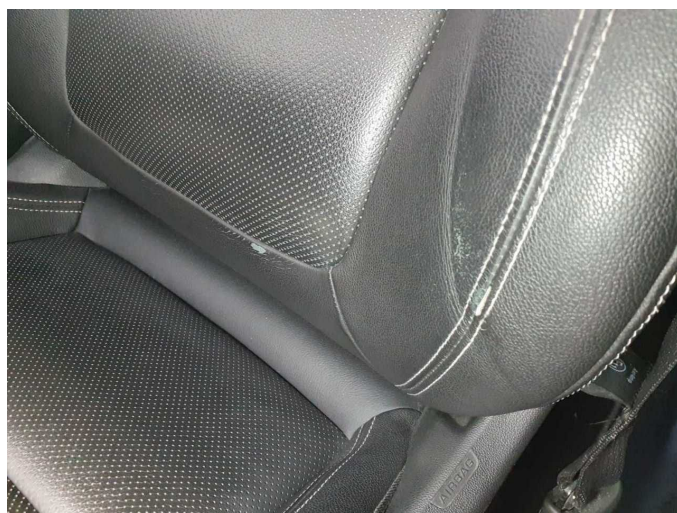

Damage 2: Seat - front: Seat cover - left side - Scratch(es) - Smart repair



Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

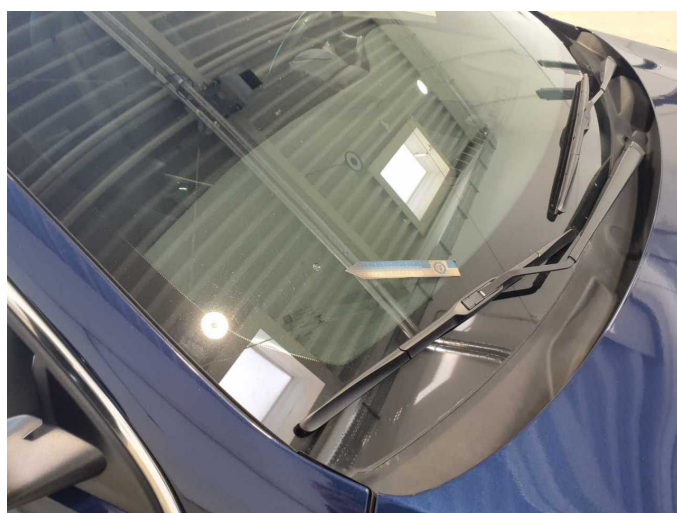

Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair




Damage 5: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 6: Body: Body (Matt) - Paint defect - Smart repair



Damage 6: Body: Body (Matt) - Paint defect - Smart repair

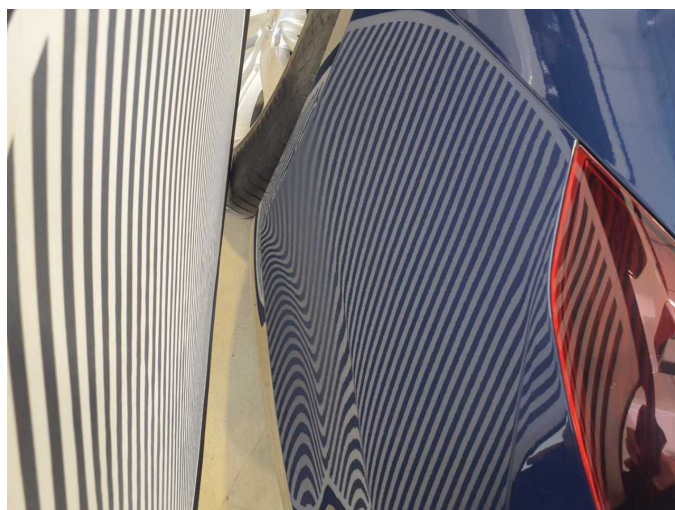

Damage 6: Body: Body (Matt) - Paint defect - Smart repair



Damage 7: Door - rear right side: Door (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning



Damage 7: Door - rear right side: Door (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning



Damage 7: Door - rear right side: Door (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning



Damage 7: Door - rear right side: Door (Einschlüsse-Mehrkosten möglich) - Unprofessionally repaired - Conditioning




Damage 8: Wing mirror - right side: Cap (tiefer) - Scratch(es) - Replace




Damage 8: Wing mirror - right side: Cap (tiefer) - Scratch(es) - Replace



Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

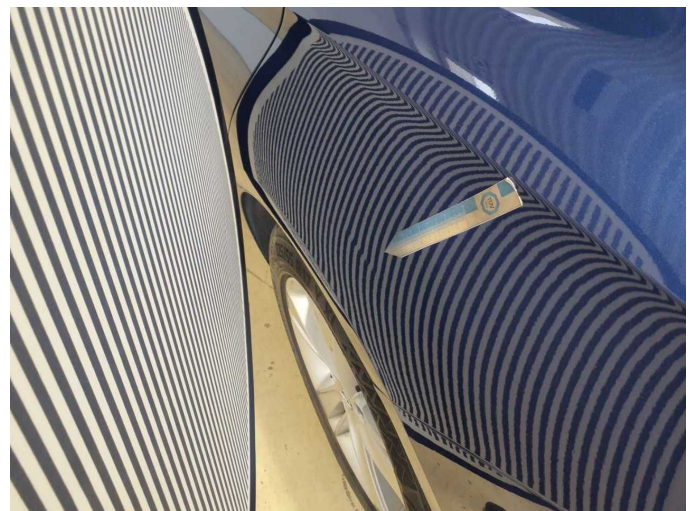

Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

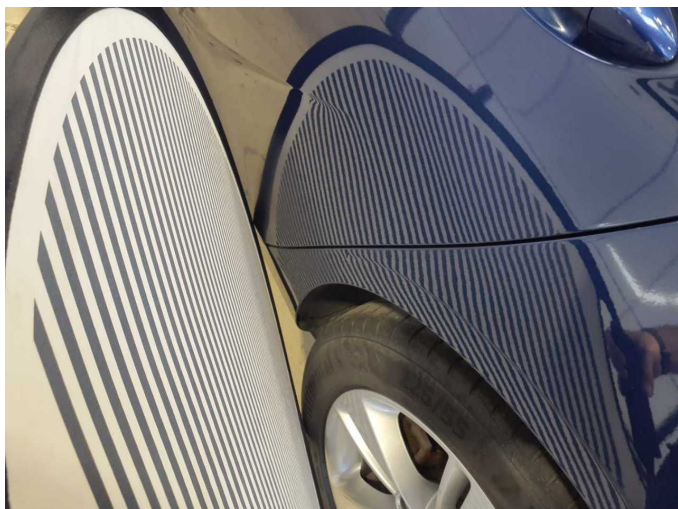


Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 9: Side panel - rear left side: Side panel - Dent / paintcoat damage - Repair and paint

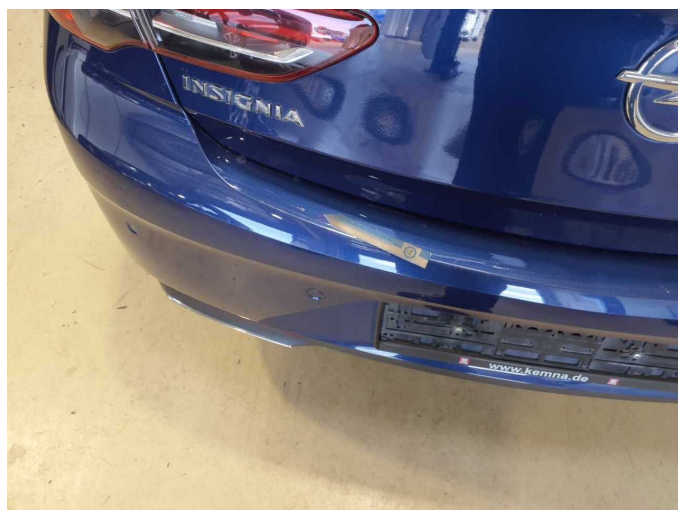

Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint

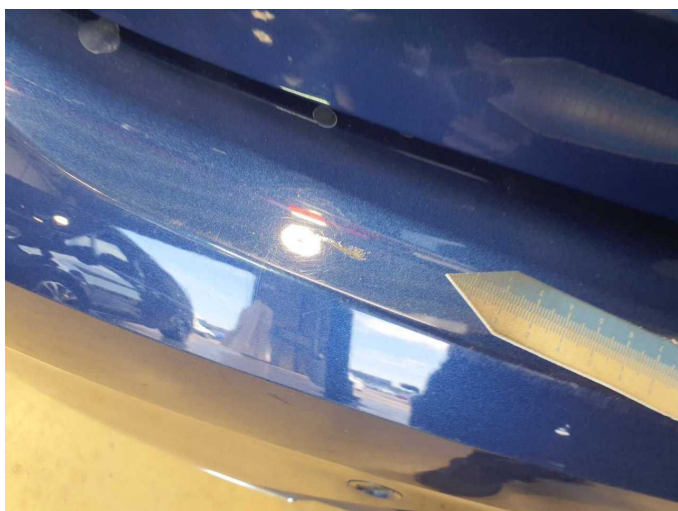


Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint

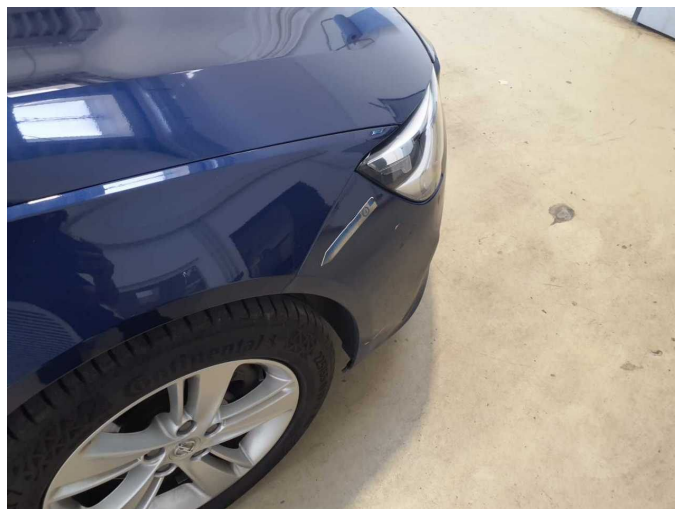


Damage 11: Front bumper: Front bumper (+ Blende) - Scratched - Repair and paint




Damage 11: Front bumper: Front bumper (+ Blende) - Scratched - Repair and paint



Damage 11: Front bumper: Front bumper (+ Blende) - Scratched - Repair and paint

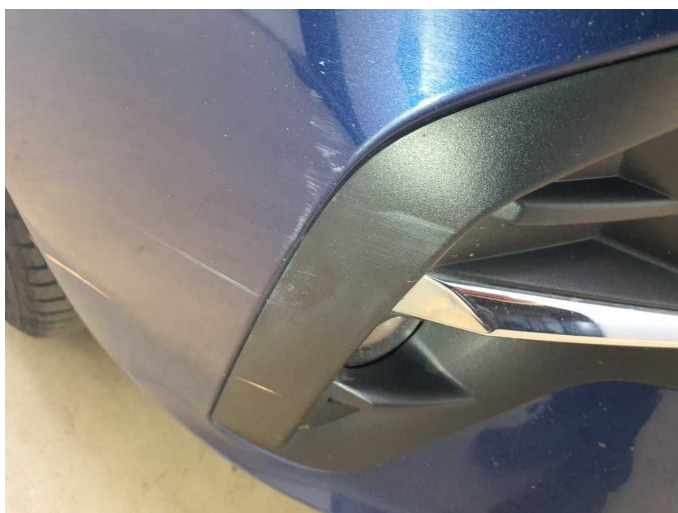

Damage 11: Front bumper: Front bumper (+ Blende) - Scratched - Repair and paint

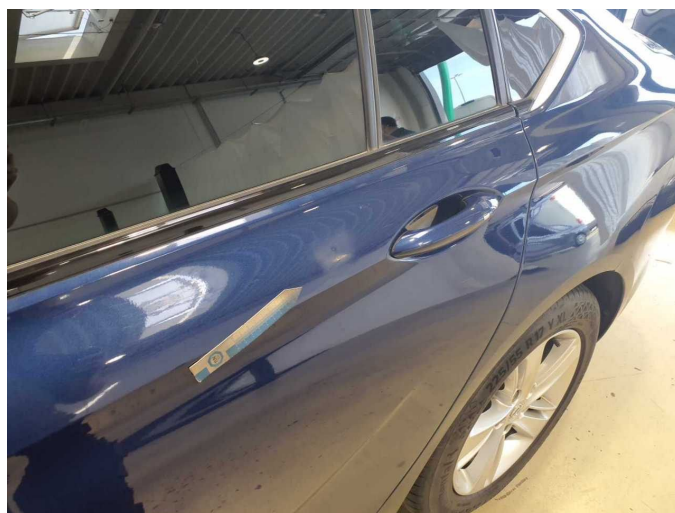

Damage 12: Door - rear left side: Door (Anätzung) - Scratched - Paint




Damage 12: Door - rear left side: Door (Anätzung) - Scratched - Paint



Damage 12: Door - rear left side: Door (Anätzung) - Scratched - Paint




Damage 13: Roof: Roof (+Anätzung) - Dent / paintcoat damage - Repair and paint

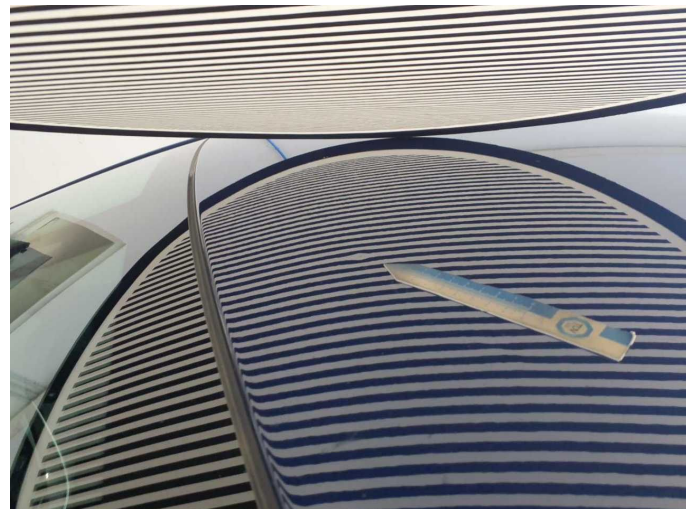

Damage 13: Roof: Roof (+Anätzung) - Dent / paintcoat damage - Repair and paint




Damage 13: Roof: Roof (+Anätzung) - Dent / paintcoat damage - Repair and paint

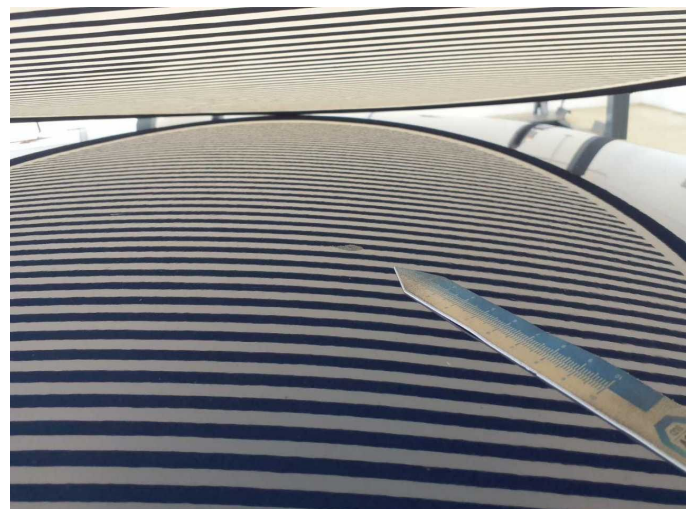

Damage 13: Roof: Roof (+Anätzung) - Dent / paintcoat damage - Repair and paint




Damage 13: Roof: Roof (+Anätzung) - Dent / paintcoat damage - Repair and paint

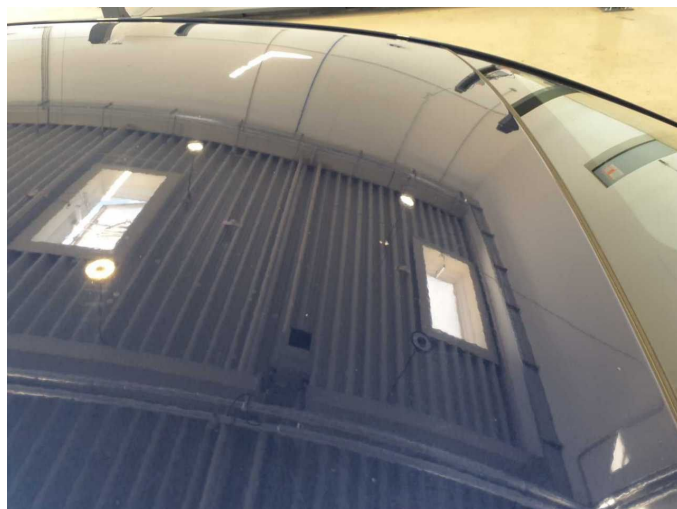

Damage 13: Roof: Roof (+Anätzung) - Dent / paintcoat damage - Repair and paint




Wear and tear 1: 2nd wheel set: 1 alloy rim - Scratch(es) - No deduction

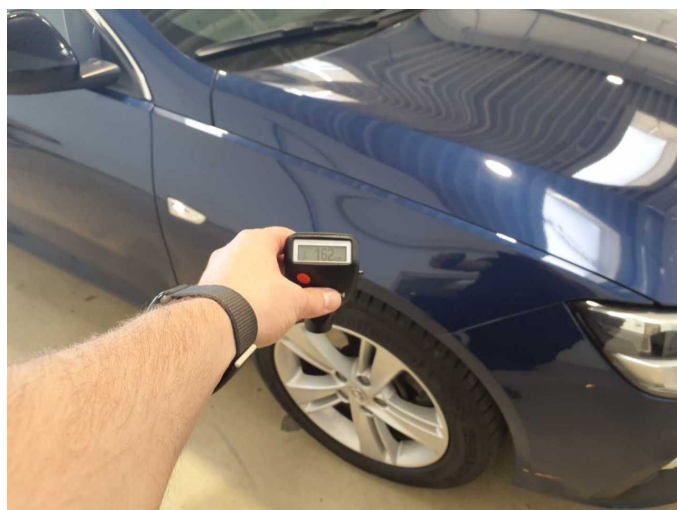

Repainting 1: Mudguard - right side



Repainting 1: Mudguard - right side

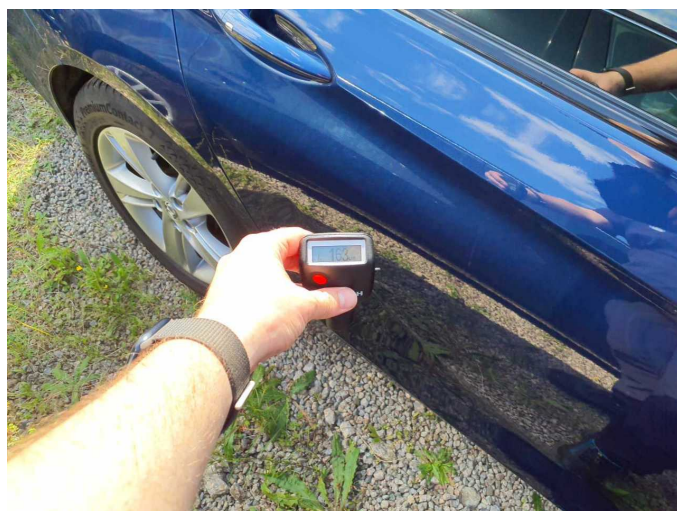

Repainting 2: Door - rear right side



Repainting 2: Door - rear right side