



Expertise

Protocol number: 46689886
Order No. / Reference: 26685131
Inspection date: 22 Jul 2026

Manufacturer: Volkswagen

Model: Multivan 2,0 TDI SCR Kurz Edition

VIN: WV2ZZZST2PH008302



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Multivan 2,0 TDI SCR Kurz Edition	
Vehicle Identification number	WV2ZZZST2PH008302
Mileage (Read)	52,841 km
First registration	16 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Candy-Weiß/Deep Black Perleffekt
Doors / Seats	5 / 6
Upholstery type	Cloth
Colour of upholstery	Grey-Light grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	8,400 km
Last service on / at	02/2025 at 31,152 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS422363
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CQJ 00222		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,850 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R18 101V	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/50 R18 101H	Summer tyres on Light alloy	Hankook	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 102H	Winter tyres on Light alloy	Pirelli	6mm / 6mm
2)	215/65 R16 102H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 12V system
- Storage compartments: Various shelves and storage compartments
- Evasive steering assist and turn assist
- Exterior mirrors, electrically adjustable, heated and folding
- Exterior mirror housings in high-gloss black
- LED turn signals, integrated into the side of the exterior mirrors
- On-board tools and tire mobility set (in the storage compartments in the luggage compartment)
- Roof rails/roof load carrier: Mounting points for roof rack system (6 pieces)
- Tachometer
- Electronic Stability Program, ABS, ASR (with deactivation button), EDS
- Chassis: Suspension and damping, standard
- Windows: Front pane made of laminated safety glass, heat and sound insulating
- Floor mats: Textile floor mats in the driver's cab
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Tailgate: Tailgate with soft-close mechanism
- Rear window with wiper/washer system, heated
- Instrument usage (km/h)
- Air conditioning with manual control in the driver's cab, with additional heating for the cargo/passenger compartment
- LED taillights, tinted
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Multifunction display: Digital Cockpit
- Multi-collision brake
- Fatigue detection
- Non-smoking version
- Emergency braking assistant "Front Assist"
- Without Mode 3 charging cable
- Radio: "Ready 2 Discover" with 25.4 cm (10 inch) color touchscreen including "Streaming & Internet"
- Radio: Digital radio reception (DAB+)
- Radio accessories: Voice control
- Wheels, tires: Covers for alloy wheels
- Wheels/Tires: Tire pressure monitoring system
- Wheels/Tire Accessories: Lockable wheel bolts
- Windscreen wiper intermittent control with rain sensor for the front windscreen wipers
- Sliding door: Closing aid on both sides for sliding doors
- Drawers under the outer seats in the passenger compartment and 2 waste bins
- Automatically dimming interior safety mirror
- Seats in the passenger compartment: 3 individual seats in the 3rd row.
- Seats: Armrests for driver and front passenger seats, on both sides
- Lane keeping assistant "Lane Assist"
- Daytime running light activation with cornering lights
- Euro 6d ISC-FCM emissions standard
- Airbag for driver and front passenger
- Airbag: Side and head airbags for driver and front passenger
- Exterior mirrors, left and right convex
- Reinforced battery (68 Ah/ 380 A)
- Floor coverings: Textile floor mats in the driver's cab
- Floor coverings: Reinforced velour carpet in the passenger compartment
- third brake light
- Decorative inlays: Decorative inlays "Dark Silver Brushed"
- Three-phase generator 160-250 A
- Parking assistance in the front and rear areas
- Chassis: 16" chassis with 16" disc brakes at the front and 16" disc brakes at the rear
- Windows (glass type in the cargo/passenger compartment) - rear windows tinted
- Electric windows, front
- Cruise control system with speed limiter
- Glove compartment with light
- Glove compartment with flap
- Tailgate: Power closing tailgate
- Rear spoiler
- Child seat anchorage ISOFIX and Top Tether
- Fuel-powered auxiliary heater
- Cargo space divider (load capacity 20 kg) with bag hooks and luggage net
- Strip between the headlights painted in glossy black
- Light and visibility: IQ.Light - LED matrix headlights (Dynamic Light Assist high beam control for LED matrix headlights - IQ.Light LED matrix headlights with LED daytime running lights - Dynamic headlight range control with dynamic cornering lights - Bad weather lights including turning lights)
- eCall emergency call system
- Particulate filter: Soot particle filter for diesel engines
- Radio: App-Connect incl. App-Connect Wireless (for Apple CarPlay and Android Auto)
- Radio accessories: 8 speakers (passive)
- Radio accessories: USB interface
- Wheels/Tires: "Toshima" 7.5 J x 18 alloy wheels in glossy black (4 "Toshima" 7.5 J x 18 alloy wheels in glossy black - 235/50 R 18 101 H xl tires, optimized for low rolling resistance - wheel center cover for alloy wheels - lockable wheel bolts)
- Keys for locking system: 2 vehicle keys
- Power steering
- Seatbelt check
- Seat covers: Bi-color seat covers in fabric, design "Ribella"
- Seats: Armrest(s) inside the seats (removable and repositionable)
- Seats: Seat left and right, in the 1st row
- Sun visors with mirrors, illuminated, ticket holder on the driver's side
- Telephone: Mobile phone interface



- Ambient lighting in the door area with logo projection of the Multivan silhouette
- Lashing eyes (4 pieces)
- Central locking with keyless start system "Keyless Start" without safe locking

- First aid kit, warning triangle and high-visibility vest
- Traffic sign recognition
- Electronic immobilizer

Extra equipment

- Adaptive Cruise Control (ACC) "stop & go" with speed limiter (including Car2X)
- Paint finish: Solid/Pearl effect (two-tone)
- Seats: Armrests on both sides of the seats (removable and repositionable) (and folding tables on the back of the seats in the 2nd row)

- Heated seats for the driver's cab, left and right, separately adjustable
- Multifunctional display: Digital Cockpit Pro
- Seating configuration - 1. Seat packages: 6-seater package = 2-1-3 (Approval for a maximum of 6 seats - 1 individual seat facing forward in the 2nd row - 3 individual seats in the 3rd row)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Door edge - Scratch(es) - Smart repair
2	Body	Body - Glued / labelled - De-glue / neutralise
3	Seat - rear	Back seat (Sitzverstellung hinten Links klemmt) - Functional / admissibility - Perform diagnosis
4	Trim / covers	Door trim - rear left side - Scratch(es) - Loss in value

Wear and tear

No.	Component group	Description
1	Rear bumper	Rear bumper - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Luggage net

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 27 Apr 2025	11.146,89 €



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Die beiliegenden Winterräder sind kein Bestandteil der Ausstattung.

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

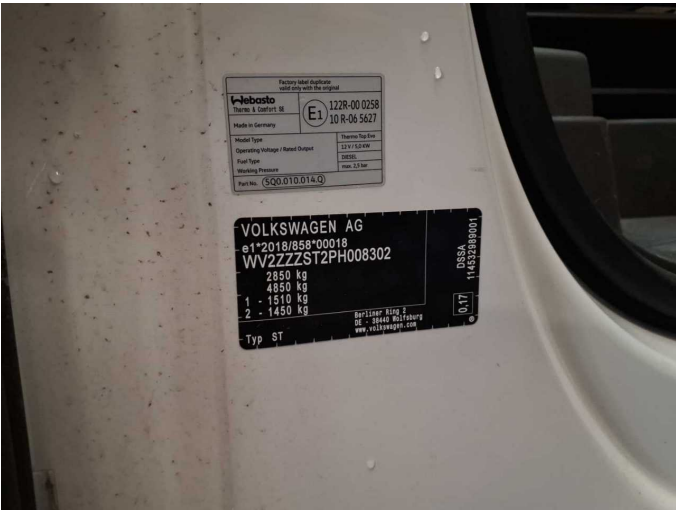


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

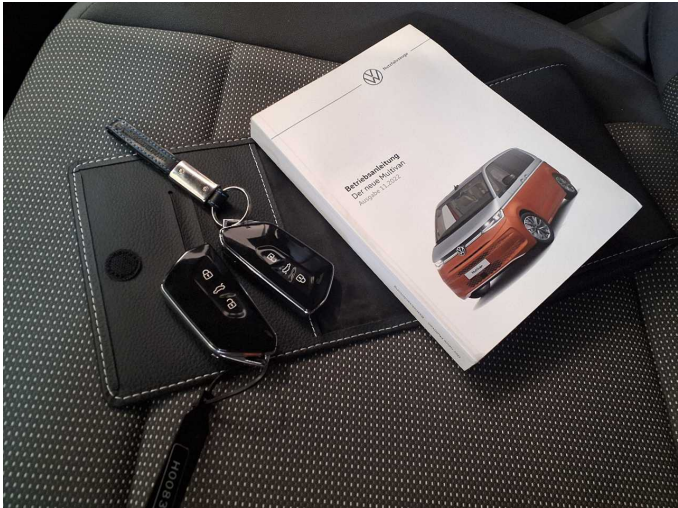


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

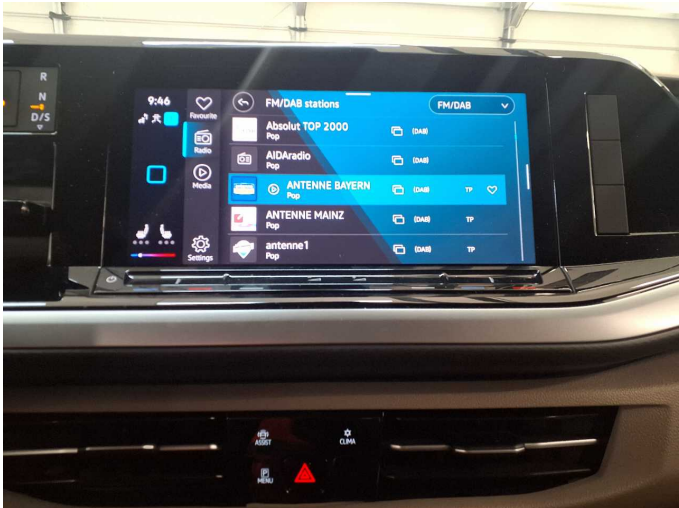


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

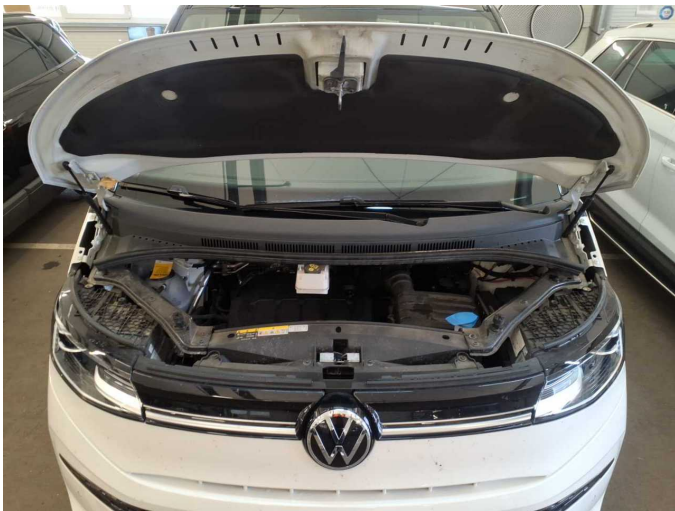


Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.




Damage 1: Door - front right side: Door edge - Scratch(es) - Smart repair



Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 3: Seat - rear: Back seat (Sitzverstellung hinten Links klemmt) - Functional / admissibility - Perform diagnosis

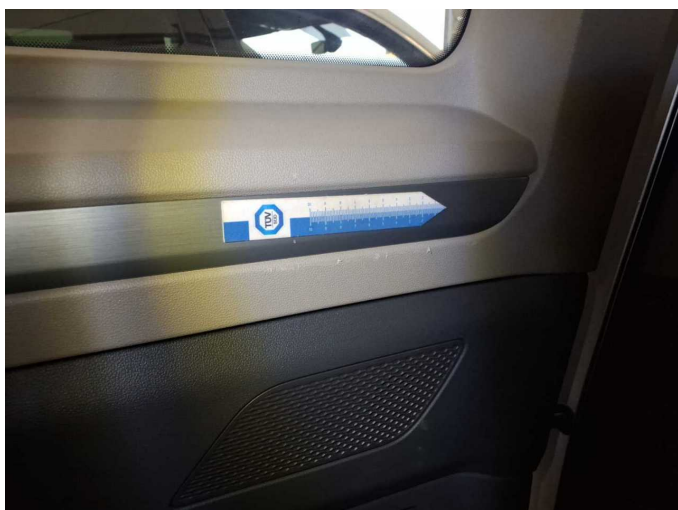

Damage 4: Trim / covers: Door trim - rear left side - Scratch(es) - Loss in value



Damage 4: Trim / covers: Door trim - rear left side - Scratch(es) - Loss in value



Wear and tear 1: Rear bumper: Rear bumper - Scratch(es) - No deduction



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 3: Bonnet: Bonnet - Stone chips - No deduction



Missing part 1: Interior: Luggage net - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV2ZZZST2PH008302

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Multivan T7 Kurz Edition

Datum	KM-Stand	Beschreibung
24.06.2026	52.751	AU
26.11.2025	45.350	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Systemtest/ Eigendiagnose
26.02.2025	31.152	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges