



Expertise

Protocol number: 46276553
Order No. / Reference: 26681683
Inspection date: 2 Jul 2026

Manufacturer: Ford	Model: Transit Custom 340 L1H1 LKW VA Aut. Trend
VIN: WF0YXXTTGYPE25695	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Custom 340 L1H1 LKW VA Aut. Trend	
Vehicle Identification number	WF0YXXTTGYPE25695
Mileage (Read)	73,807 km
First registration	15 Jun 2023
Number of holders	1
Next periodical technical inspection	10/2027
(Report on hand)	
Power / Engine displacement	125 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic /
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frozen White
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	40,000 km
Last service on / at	06/2026 at 73,611 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT903410
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BMV 07548		
Emission standard	EURO6;WLTP;AR;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,400 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Goodyear	3mm / 3mm
2)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Goodyear	7mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109R	Winter tyres on Steel	Semperit	7mm / 7mm
2)	215/65 R16 109R	Winter tyres on Steel	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T C	Summer tyres on Steel	Goodyear	9 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- roof, flat
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- FordPass Connect (including live traffic information, information about the current status or location of the vehicle, and control of selected vehicle functions via smartphone with the FordPass app. Real-time traffic information (in conjunction with audio systems 24 and 25). Further information about FordPass Connect can be found at <https://www.ford.de/fordpass-connect>.)
- Front air conditioning
- Paint finish: Solid color paint
- Steering column, adjustable in height and reach
- Package: Style color package (front and rear bumpers and exterior mirror caps painted in body color)
- Wheel trims
- Wheels: Steel wheels 6.5 J x 16 with 215/65 R 16 R tires (6.5 J x 16 with 215/65 R 16 R tires)
- Sliding door entry light automatically illuminates when the door is opened
- Mud flaps front and rear
- Half-height side wall cladding
- Seat belts
- Power outlet: 12-volt connection
- Immobiliser
- Central locking with remote control
- Driver's side airbag
- Exterior mirrors, electrically adjustable and heated
- On-board computer
- Headliner in driver's cab
- Third brake light
- Front electric windows
- Ford Easy Fuel
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Generator, 240 A
- Cruise control including imitation leather steering wheel
- Transmission: 6-speed automatic
- Lockable glove compartment with lid
- Interior lighting with delay circuit
- Fuel tank 70 l
- Cargo area lighting with activatable switch-off delay
- Emergency brake assist including emergency brake light
- Front and rear parking pilot system including fog lights
- Particulate filter: diesel particulate filter
- Wheels/Tires: Spare wheel, steel wheel
- Headlights: Halogen projector headlights (with LED daytime running lights and fog lights with static cornering lights)
- Sliding door: Sliding door, right
- Side protection strips
- Power steering
- Start-stop system
- Lashing eyes 8
- Heat-insulating glazing, lightly tinted
- Auxiliary heater, electric



Extra equipment

- BOTT: acc. Rg. 350456654
- BOTT: Installation as per invoice 350476275
- Package: Visibility Package II (Trend) (Heated windscreen - Electrically folding exterior mirrors - Adjustable instrument lighting - Windscreen wipers with rain sensor - Headlight assistant with day/night sensor)
- Rear swing door without window (without interior mirror)
- Reversing camera (reversing camera with image transmission of the rear driving path in the multifunction display and coupling aid)
- Seats: Seat Package 15 - Partition (load-through hatch), without window (Custom Truck Trend) (Driver's seat, 4-way adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Integrated tray in the double passenger seat (fold-out) - Heated driver's seat - Heated passenger seat (outer seat) - Inner armrest for driver - Manual lumbar support (driver's seat) - TREND seat cover: fabric - Partition without window with load-through hatch)
- Tire Pressure Monitoring System (TPMS)
- Airbag (passenger side)
- Blind spot assist including cross traffic alert and trailer function (electrically adjustable and heated exterior mirrors, also electrically foldable)
- Cargo area floor: Vinyl floor covering omitted
- Radio: Audio system 25: Ford audio system including Ford SYNC 3 with AppLink, DAB/DAB+, navigation (Radio (FM/AM) 8" touchscreen multifunction display, FordPass Connect integrated control panel and audio remote control, Ford SYNC 3 with touchscreen (hands-free system with voice control, SMS readout/sending function, Bluetooth, Emergency Assistance...), AppLink (advanced voice control, privacy mode, support for Android Auto and Apple CarPlay, capacitive touchscreens...), lane guidance, adaptive cruise control, lane keeping assist, traffic sign recognition, Park Pilot front/rear)
- Rubber, third-hand protective cover
- Towing device (fixed, 13-pin socket - incl. trailer stability control (TSC))

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Body	Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise
2	Side panel - rear right side	Side panel (Ablebekante) - Unprofessionally repaired - Paint
3	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - Replace

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Roof, Front, Rear, Side - left, Side right, Provided by user / customer, from 13 Aug 2025	14.676,76 €

Repainting

No.	Repainting
1	Roof, Roof rail - left side, Roof rail - right side, Bonnet, Side panel - rear left side, Professionally carried out
2	Side panel - rear right side, Unprofessionally carried out



Paint coat thickness measurement

Roof	146 µm	Roof rail - left side	152 µm
Roof rail - right side	208 µm	Bonnet	135 µm
Side panel - rear left side	198 µm	Side panel - rear right side	150 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

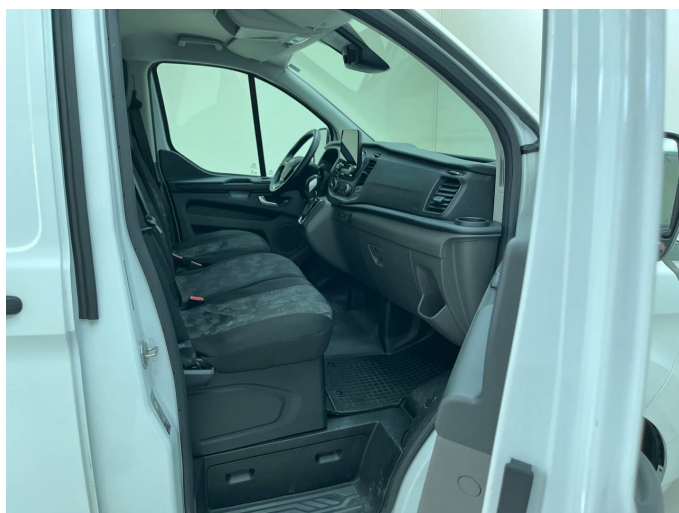


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

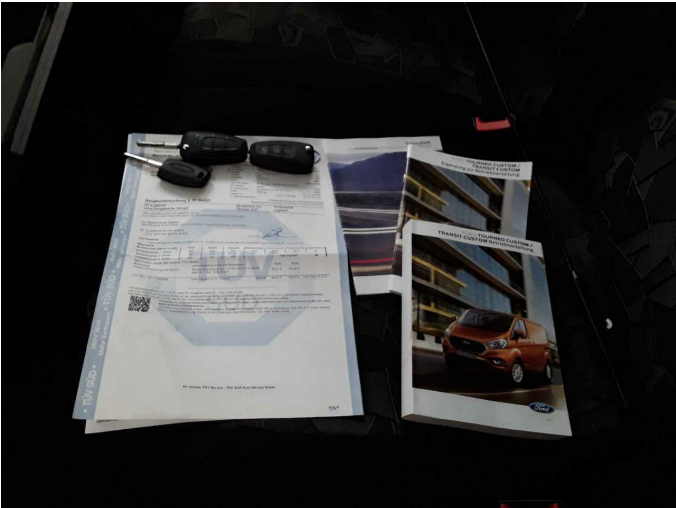


Figure 13: Documents

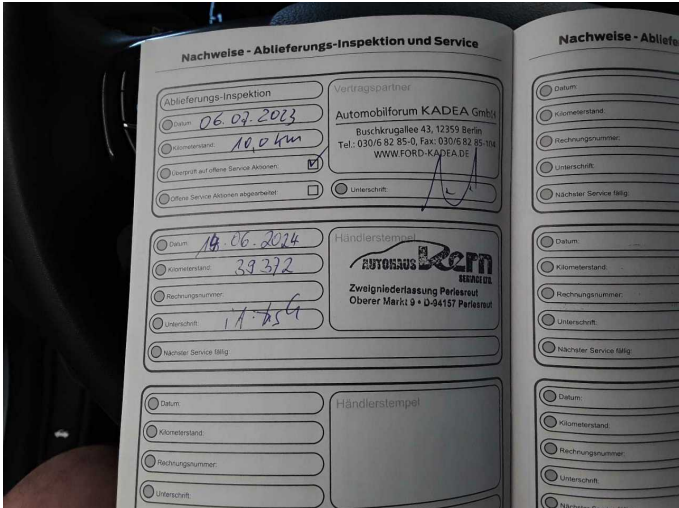


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

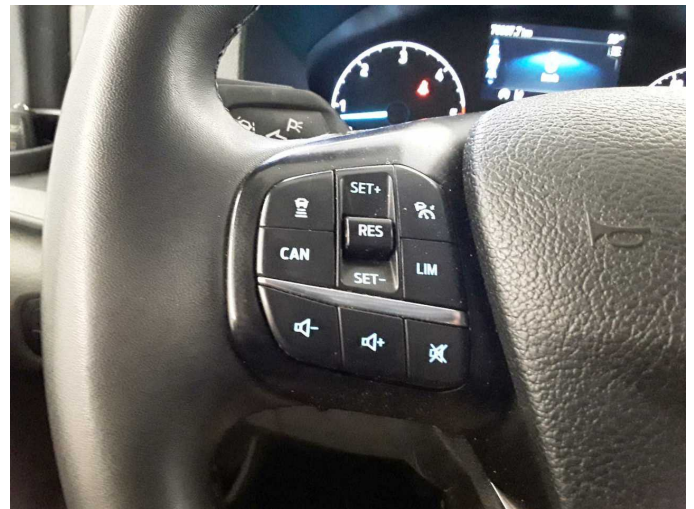


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Damage 1: Body: Body (Zusatzkosten können entstehen) - Glued / labelled - De-glue / neutralise



Damage 2: Side panel - rear right side: Side panel (Abklebekante) - Unprofessionally repaired - Paint



Damage 2: Side panel - rear right side: Side panel (Abklebekante) - Unprofessionally repaired - Paint



Damage 2: Side panel - rear right side: Side panel (Abklebekante) - Unprofessionally repaired - Paint




Damage 3: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace




Damage 3: Vehicle glazing: Windscreen with lane departure assistant - Stone chips - Replace



Roof: 146 µm

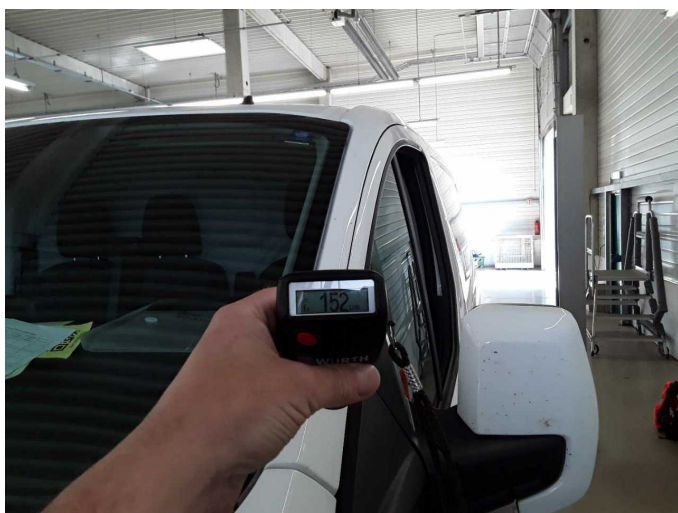

Roof rail - left side: 152 µm

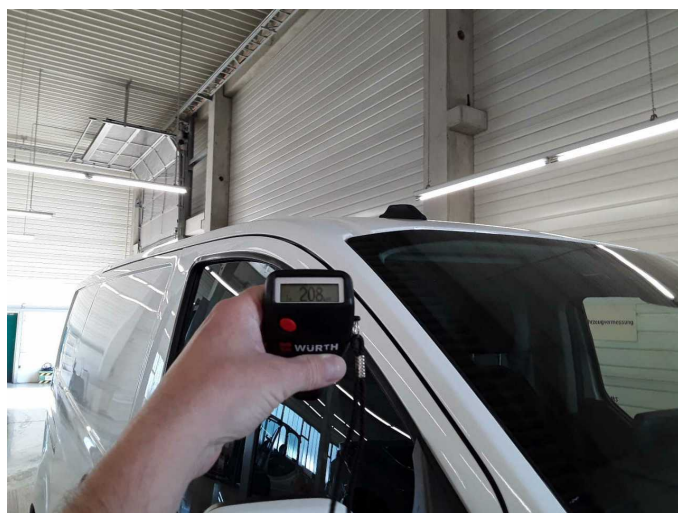

Roof rail - right side: 208 µm



Bonnet: 135 μm



Side panel - rear left side: 198 μm



Side panel - rear right side: 150 μm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0YXXTTGYPE25695

Hersteller / Modell: FORD FORD Transit Custom 340 L1H1 LKW VA Autm. Trend

Datum	KM-Stand	Beschreibung
02.06.2026	73.611	Batterie ern; Bremsbelagfühler ern; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose
01.10.2025	72.589	AU
30.08.2024	50.643	Bremsklötze vorne
14.06.2024	39.372	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges