



Expertise

Protocol number: 46896234
Order No. / Reference: 26498107
Inspection date: 3 Aug 2026

Manufacturer: Audi
VIN: WAUZZZGY8RA103670

Model: A3 30 TDI Limousine S tronic



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A3 30 TDI Limousine S tronic	
Vehicle Identification number	WAUZZZGY8RA103670
Mileage (Read)	130,824 km
First registration	19 Apr 2024
Number of holders	1
Next periodical technical inspection	04/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	85 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Manhattangrau Metallic
Doors / Seats	4 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	-4 Monat(e)
Last service on / at	12/2025 at 112,907 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HA913549
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BZN 01252		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,925 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Fulda	6mm / 6mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Fulda	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres (Without wheel rim)	Fulda	7mm / 7mm
2)	205/55 R16 91V	Summer tyres (Without wheel rim)	Fulda	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Traction control ASR
- Audi pre sense front
- Evasive steering assist and turning assist
- third brake light
- Additive-free diesel particulate filter (DPF)
- Electromechanical parking brake
- Electronic Differential Lock (EDS)
- Chassis: Standard chassis
- Remote key (without Safe-Lock)
- Speed limiter
- Heated rear window
- Electrically operated child safety lock
- Rear headrests (3)
- Front headrests
- Light and rain sensor
- Non-smoking version
- Radio: MMI Radio plus
- Tire repair kit
- Electromechanical power steering
- Seats: Standard front seats
- Lane Departure Warning
- 12-volt power outlet in the rear
- Glazing: Front window in acoustic glazing
- Electronic immobilizer
- Airbag: Front side airbags with head airbag system and front interaction airbag
- Audi connect emergency call & service m.connect remote & control
- Exterior mirror housings in body color
- Decorative strips in black glass look
- Digital instrument cluster - fully digital instrument cluster in 10.25 inches
- Electronic Stability Control (ESC)
- Electric windows front and rear
- front and rear floor mats
- Transmission: S tronic 7-speed
- Interior lighting
- i-Size child seat attachment and top tether for the outer rear seats
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction and paddle shifters
- Wheel: Alloy wheels - 16 inch - 5-double arm
- Tire pressure monitoring system
- Headlight
- 3-point automatic seat belts
- Seats: Rear seat backrest foldable
- Start-stop system
- 12V socket
- Glazing: Green tinted thermal insulation glazing
- Central locking with remote control



Extra equipment

- Audi pre sense basic (within the system's limits, it initiates preventive safety measures for the occupants by networking and coordinating different vehicle systems. In unstable driving conditions, the front seat belts are electrically tightened. Depending on the situation, the windows close. The hazard warning lights are activated to warn following traffic.)
- Business package (USB ports with charging function in the rear - Audi connect Navigation & Infotainment plus - Audi phone box - Audi virtual cockpit plus - Smartphone interface (Android Auto and Apple CarPlay) - MMI Navigation plus with MMI touch - Cruise control)
- Cruise control with preparation for adaptive cruise control (maintains the individually set speed between 20 and 250 km/h, provided the engine power allows. Operation is via a separate steering column stalk. The set speed is displayed in the digital instrument cluster. The system does not react to vehicles ahead with distance control. Includes adjustable speed limiter.)
- Deletion of model designation and performance/technology lettering
- Front seat heating (heats seat and backrest center section (standard seats in fabric), otherwise seat and backrest center section as well as seat side bolsters - individually adjustable in 3 stages for driver and front passenger via direct selection button on the climate control unit)
- Interior mirror, automatically dimming, frameless
- Paint finish: Metallic
- Parking assistant with parking aid plus (Using ultrasonic sensors, the system searches for suitable parallel or perpendicular parking spaces. For perpendicular spaces, the system calculates the parking path (forwards and backwards); for parallel spaces, it calculates the entry and exit paths. The driver must accelerate, shift gears, and brake, as well as monitor the parking process. The system handles the steering. Within the system's limits, the surround view displays warnings of obstacles around the vehicle, depending on the driving path. Multi-stage parking maneuvers are supported.)
- Phone: LTE support for Audi phone box
- Seats: 4-way lumbar support (electrically adjustable, horizontally and vertically)
- Seats: Rear seat backrest foldable (three-part), with center armrest (split in a 40:20:40 ratio or fully foldable; with center armrest and cupholders)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus and shift paddles (The steering wheel's height and reach are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with twelve multifunction buttons. Shift paddles allow manual gear changes.)
- 2-zone automatic climate control (electronically regulates air temperature, volume and distribution - separate temperature distribution for driver and front passenger side - with sun position-dependent control - automatic recirculation control - dust and odor separating allergen filter - air vents in the rear center console - separate defroster button for faster defrosting of the front and side windows)
- Ambient Lighting Package Plus (Glove box lighting (incandescent bulb), LED trunk lighting (right side), front/rear roof module including reading lights (LED), illuminated vanity mirrors (LED), entry lights on the underside of front doors (LED), front footwell lighting (LED), entry lights on the underside of rear doors (white), dashboard contour lighting (multicolor), ambient door lighting (front/rear, multicolor), door contour lighting (front/rear, multicolor), center console storage compartment (multicolor))
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (with integrated LED turn signal and curb view function for the passenger-side exterior mirror - mirror glass left aspherical, right convex - including heated windshield washer nozzles)
- Lane change warning with exit warning and rear cross-traffic alert (The lane change warning system uses two radar sensors to measure the distance and speed difference of vehicles approaching from behind. The system warns the driver of a potential hazard when changing lanes by displaying an indicator on the respective exterior mirror. If the driver activates the turn signal to initiate a lane change, the indicator flashes as an additional warning. The system operates at speeds between approximately 15 km/h and 250 km/h and can be activated via the MMI car menu.)
- S line interior package (S tronic) (front sport seats with manual adjustment of seat height, seat fore/aft position, seat tilt, backrest tilt and seat belt height, as well as headrests; fabric Puls/mono.pur 550-K synthetic leather; 3-spoke leather steering wheel with multifunction plus and shift paddles including leather steering wheel grips; front and rear door armrests in synthetic leather; aluminum spectrum dark decorative inlays; illuminated front door sill trims with aluminum inlays and S lettering; black fabric headliner; front center armrest; stainless steel floor mats, pedals and footrest)
- Seat covers in microfiber Dinamica/mono.pur 550 synthetic leather combination with S embossing (for front sport seats: - Seat center panels of the front seats and the two outer rear seats in microfiber Dinamica - Seat side bolsters, headrests, middle rear seat and front center armrest (if ordered) in mono.pur 550 synthetic leather - Contrast stitching and diamond quilting - S embossing in the backrests of the front seats)



- Telephone: Audi Phone Box (universal Bluetooth interface - convenient, integrated hands-free system - coupling antenna for connecting the mobile phone to the external antenna for improved reception quality - reduced radiation in the vehicle interior - LTE support - charging option via USB port or wireless charging (Qi standard) - forget-to-use warning - charging status indicator in the MMI touch display - connection of a second mobile phone)
- Telephone: Smartphone interface in conjunction with MMI Navigation plus with MMI touch (The smartphone interface (Android Auto and Apple CarPlay) connects your smartphone to your Audi and seamlessly displays your smartphone content directly on the MMI display. Navigation, telephony, music, and selected third-party apps can be conveniently controlled via the MMI touch display and voice control. The connection can be established either using a suitable USB cable or wirelessly.)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Interior	Interior (Zierleiste) - Glued / labelled - De-glue / neutralise
2	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Smart repair
3	Front bumper	Cover bumper - front - Stone chips - Smart repair
4	Vehicle glazing	Side window - rear right side - Scratch(es) - Loss in value
5	Misc.	Inspection / maintenance - Due - Perform
6	Front bumper	Front bumper - Paint defect - Paint
7	Bonnet	Bonnet (Sandstrahleffekt) - Dent / paintcoat damage - Repair and paint

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 6 Oct 2024	2.049,68 €
2	Rear, Side - left, Provided by user / customer, from 18 Feb 2025	8.970,63 €

Repainting

No.	Repainting
1	Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	226 µm
----------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterreifensatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

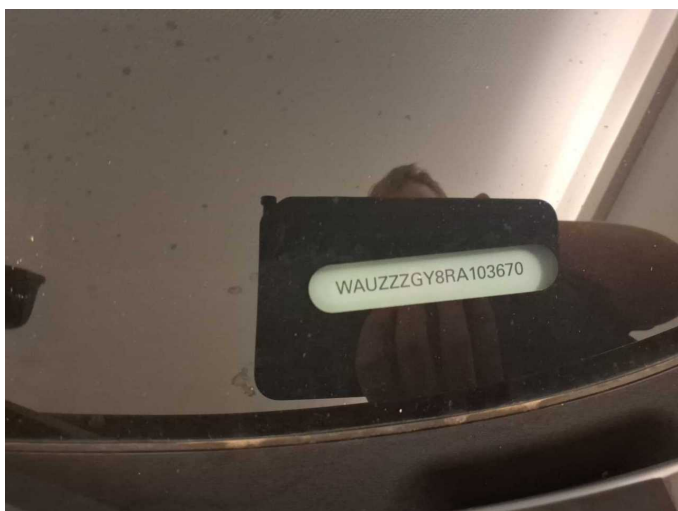


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

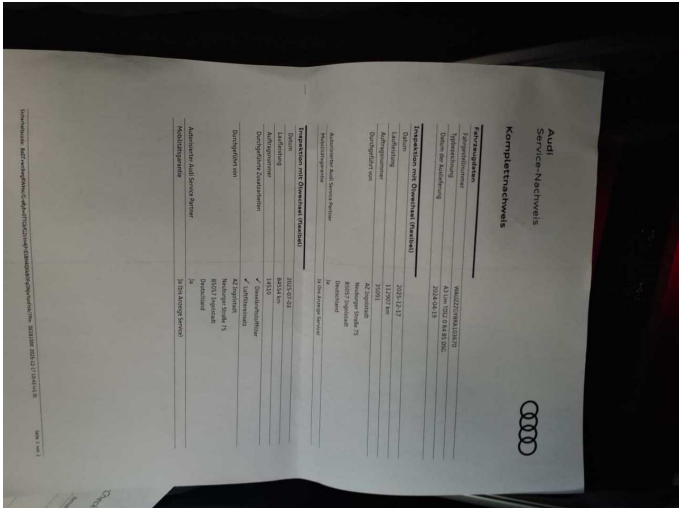


Figure 14: Documents

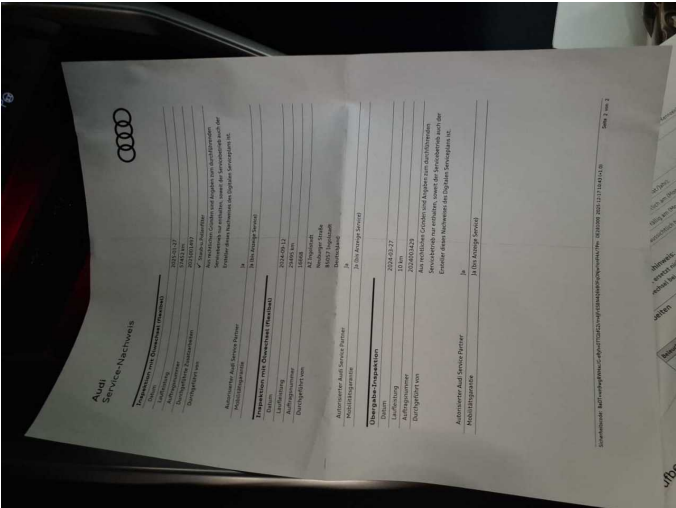


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Additional tyres

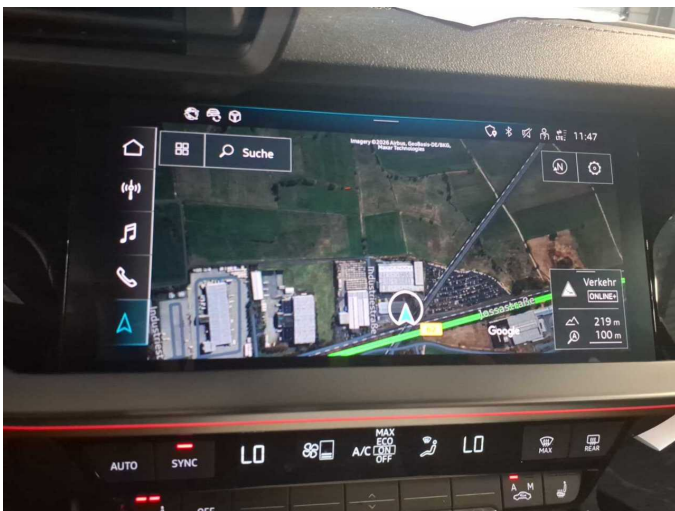


Figure 21: Navigation

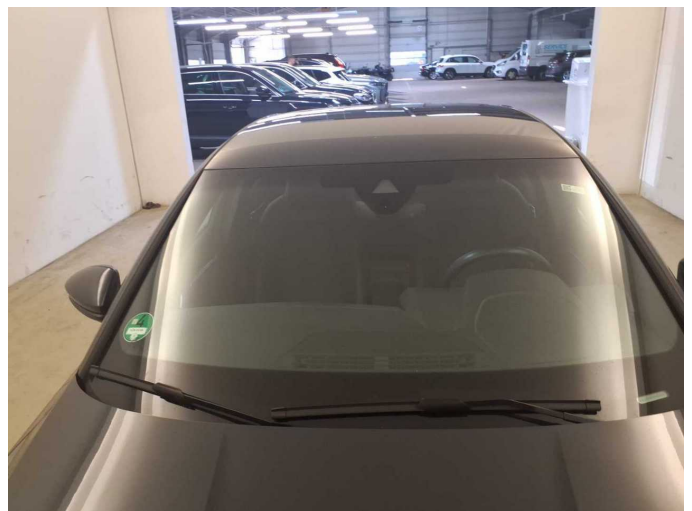


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

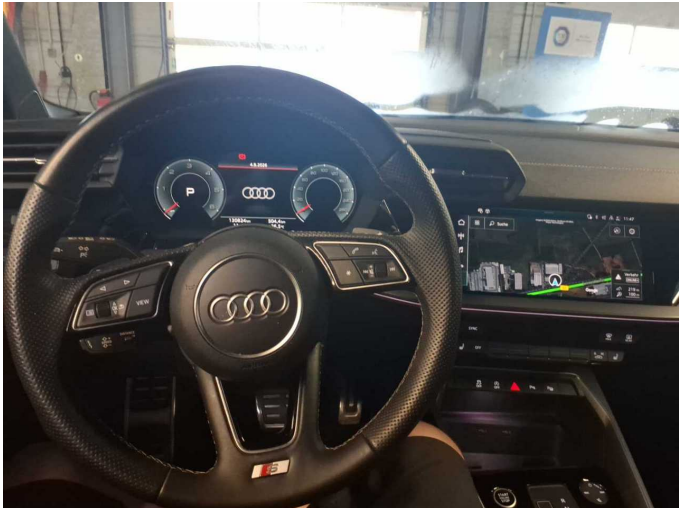


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

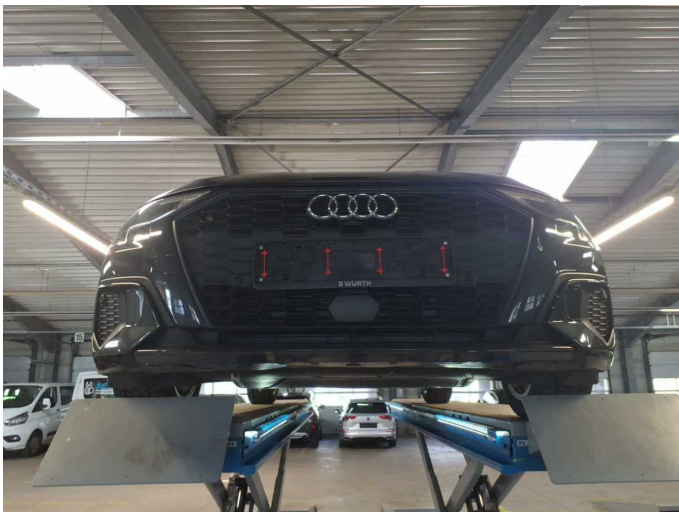


Figure 30: Misc.



Figure 31: Misc.

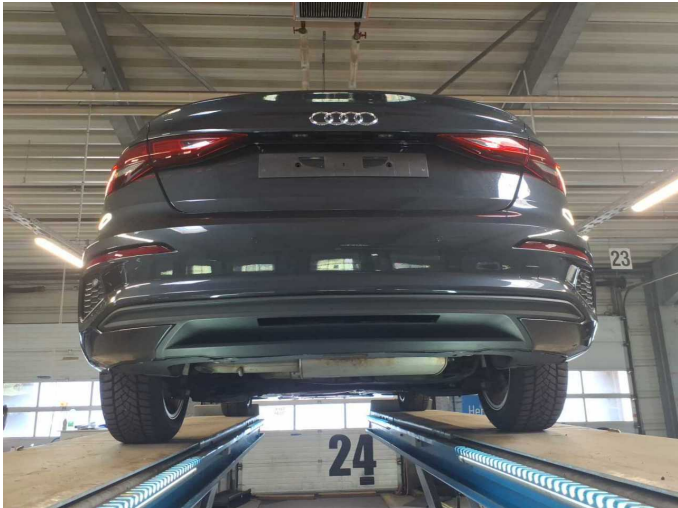



Figure 32: Misc.



Damage 1: Interior: Interior (Zierleiste) - Glued / labelled - De-glue / neutralise



Damage 1: Interior: Interior (Zierleiste) - Glued / labelled - De-glue / neutralise

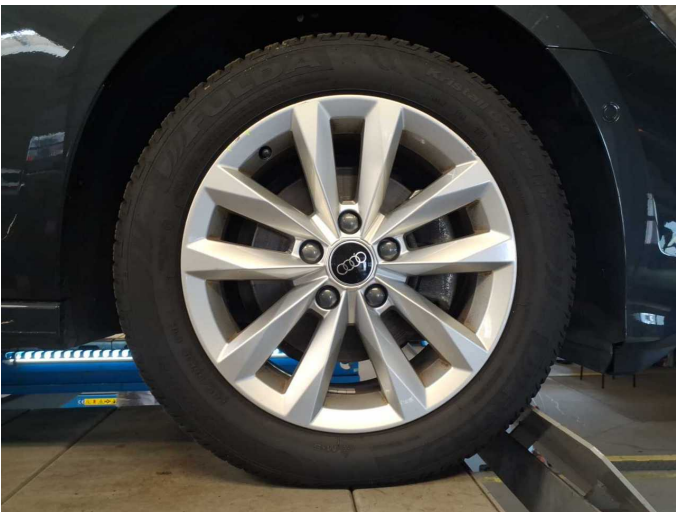

Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Smart repair




Damage 2: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Smart repair



Damage 3: Front bumper: Cover bumper - front - Stone chips - Smart repair




Damage 3: Front bumper: Cover bumper - front - Stone chips - Smart repair

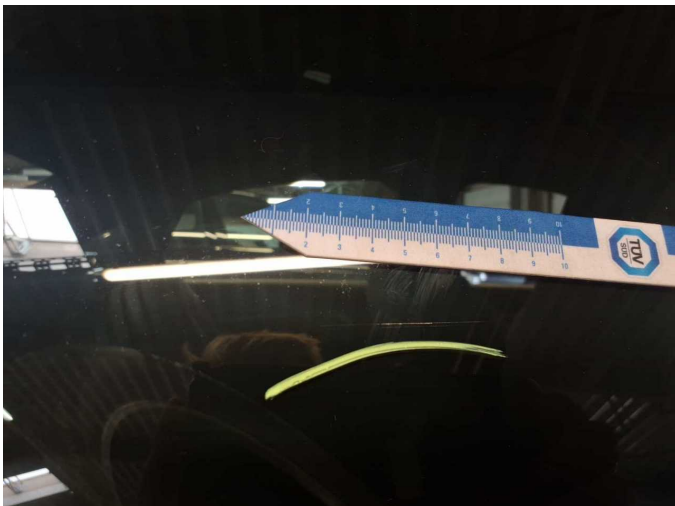


Damage 4: Vehicle glazing: Side window - rear right side - Scratch(es) - Loss in value



Damage 4: Vehicle glazing: Side window - rear right side - Scratch(es) - Loss in value

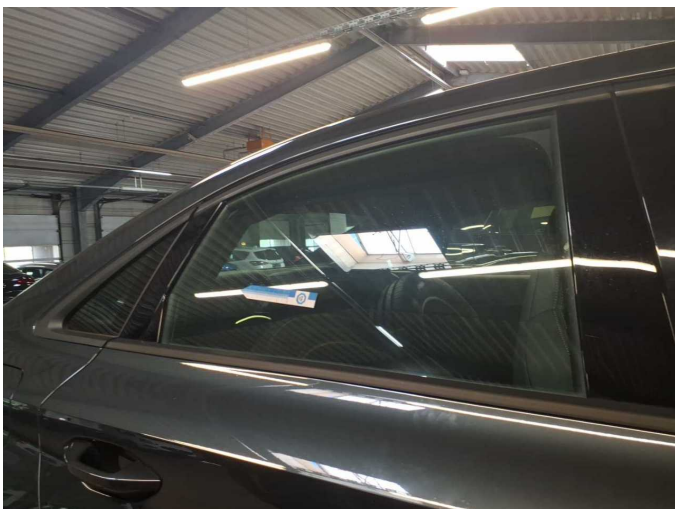


Damage 4: Vehicle glazing: Side window - rear right side - Scratch(es) - Loss in value

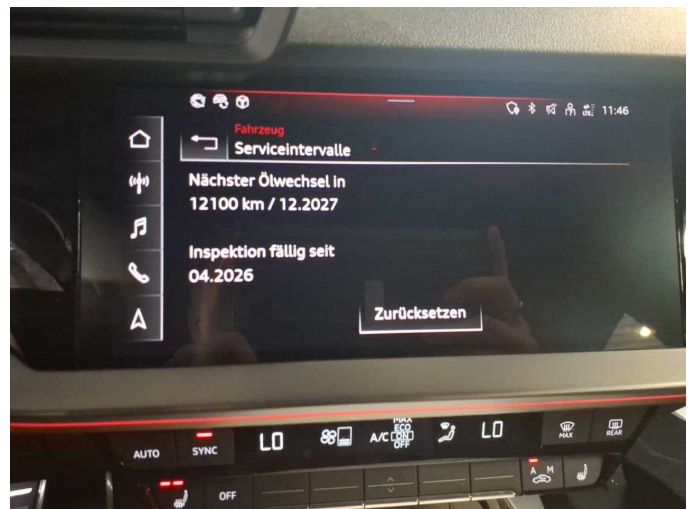


Damage 5: Misc.: Inspection / maintenance - Due - Perform




Damage 6: Front bumper: Front bumper - Paint defect - Paint

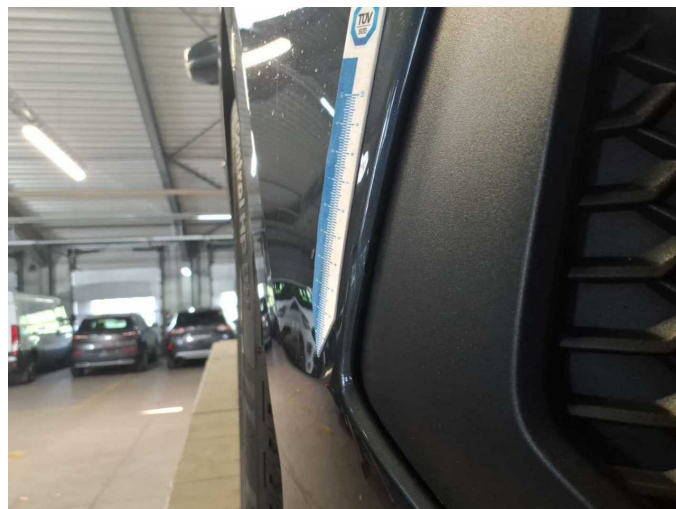

Damage 6: Front bumper: Front bumper - Paint defect - Paint

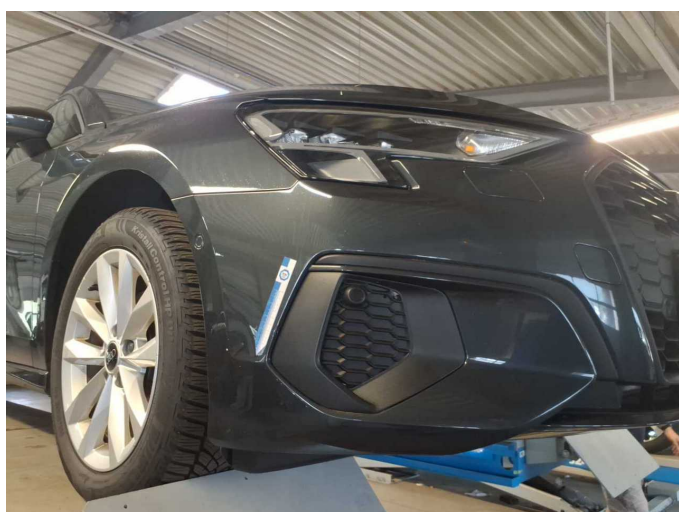

Damage 6: Front bumper: Front bumper - Paint defect - Paint

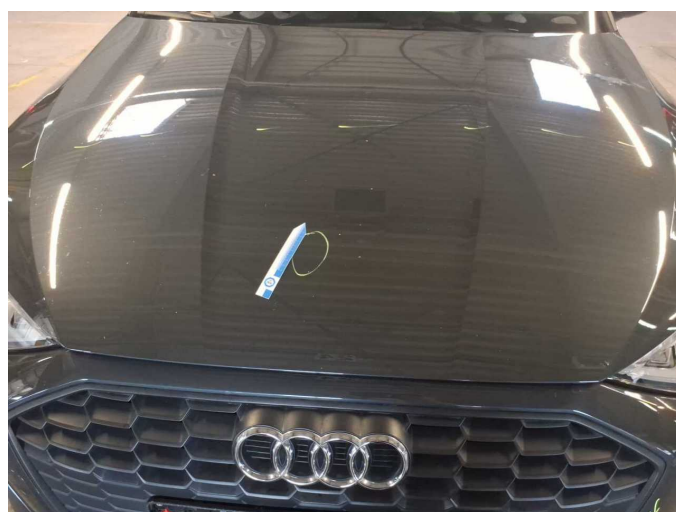

Damage 7: Bonnet: Bonnet (Sandstrahleffekt) - Dent / paintcoat damage
- Repair and paint



Damage 7: Bonnet: Bonnet (Sandstrahleffekt) - Dent / paintcoat damage
- Repair and paint




Damage 7: Bonnet: Bonnet (Sandstrahleffekt) - Dent / paintcoat damage
- Repair and paint



Damage 7: Bonnet: Bonnet (Sandstrahleffekt) - Dent / paintcoat damage
- Repair and paint




Damage 7: Bonnet: Bonnet (Sandstrahleffekt) - Dent / paintcoat damage
- Repair and paint

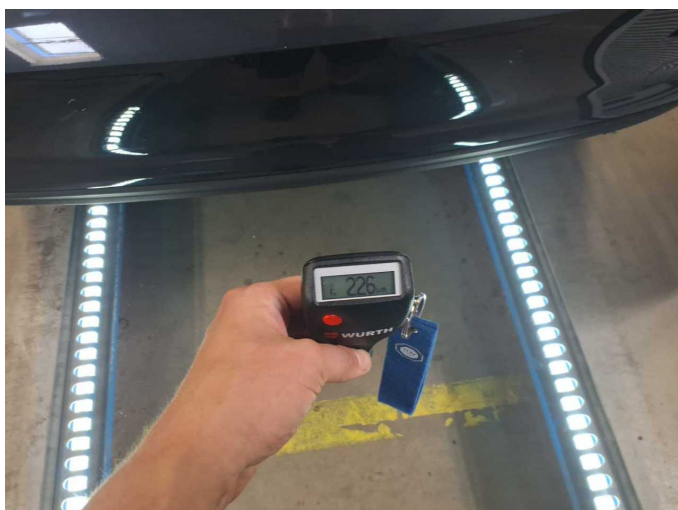


Repainting 1: Boot lid / rear door



Repainting 1: Boot lid / rear door

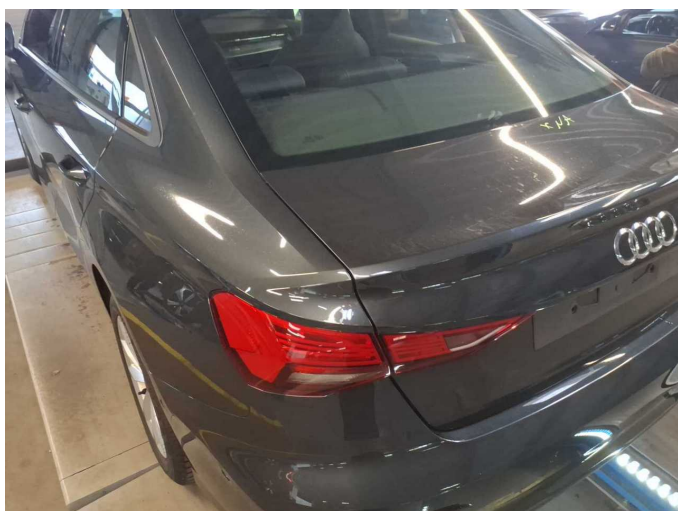

Repainting 1: Boot lid / rear door

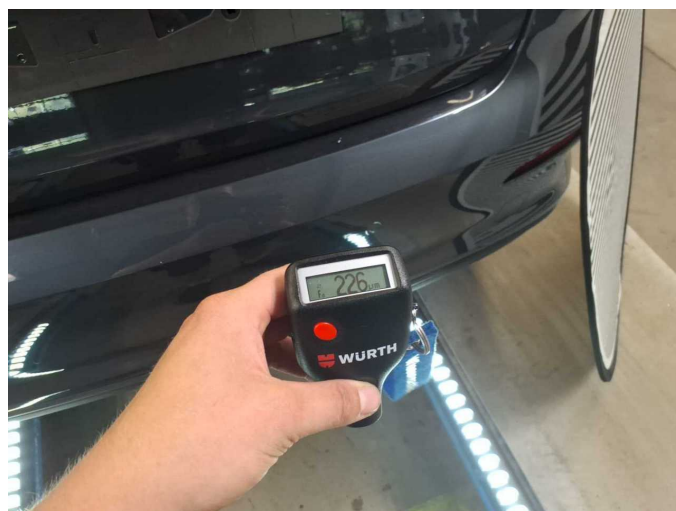

Boot lid / rear door: 226 µm