



Expertise

Protocol number: 46775602
Order No. / Reference: 26570053
Inspection date: 28 Jul 2026

Manufacturer: Mercedes-Benz

Model: A 250 e 8G-DCT Style

VIN: W1K3F8GB0PN300836



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz A 250 e 8G-DCT Style	
Vehicle Identification number	W1K3F8GB0PN300836
Mileage (Read)	44,869 km
First registration	13 Dec 2022
Number of holders	1
Fuel type	Hybr.B/E ext.aufll
Engine displacement / Cylinder	1,332 ccm / 4
Power	118 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Polarweiß uni
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	-130 Tag(e)
Last service on / at	03/2025 at 28,963 km		
Key is / should be	1 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	GM996732
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / AJP 00069		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,155 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	Summer tyres on Light alloy	Barum	7mm / 7mm
2)	205/55 R17 95V	Summer tyres on Light alloy	Barum	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	Winter tyres on Light alloy	Continental	8mm / 8mm
2)	205/55 R17 95V	Winter tyres on Light alloy	Continental	7mm / 7mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • ABS - Anti-lock Braking System • Airbag: Automatic passenger airbag deactivation • Airbag: Kneebag for driver • Airbag: Windowbag for driver and front passenger • Traction control (ASR) • ATTENTION ASSIST • Heated exterior mirrors (left and right), electrically adjustable from inside • Double cup holder at the front • DYNAMIC SELECT • Door sills with the lettering "Mercedes-Benz" • Driving light assistant • Vehicle key with chrome decorative frame • Velour floor mats • Speed Limit Assistant • Halogen headlights with integrated LED daytime running lights • KEYLESS-GO start function • THERMATIC automatic climate control • Rear headrests (3) • Front headrests are height-adjustable • Charging cable for household socket, 5m, smooth • Steering wheel: Multifunction sports steering wheel • Mercedes-Benz emergency call system • Otto particulate filter • Package: Seating comfort • Radio accessories: Digital radio (DAB) • Radio: Extended MBUX functions • Radio: MBUX multimedia system • Remote Services Plus • Windscreen wipers with rain sensor • Power steering • Seats: Rear seat backrests foldable 40/20/40 split • Lane Keeping Assist, active • Cruise control • High-visibility vest for drivers • Heat-insulating glass, green all around • Decorative elements Style | <ul style="list-style-type: none"> • Adaptive brake light flashing • Airbag: Driver and front passenger • Airbag: Side airbag for driver and front passenger • Acoustic environmental protection • Foldable armrest in the center console for driver and front passenger • Outdoor temperature display • Brake assist, active • Third brake light • ECO start/stop function • Electronic Stability Program (ESP) • Chassis: Comfort chassis • Electric windows (4-way) • Luggage net on driver and passenger seatbacks • Transmission: 8G-DCT automatic • rear window wiper • Heated rear window • Mechanical child safety lock • Communication module (LTE) for the use of Mercedes me connect services • Radiator grille with diamond pins in black • Charging system: Alternating current charging system (AC charging) 3.7 kW • Net in the passenger footwell • Package: Light and Visibility Package • Upholstery: ARTICO leatherette/Bertrix fabric • Radio accessories: USB interface in the storage compartment & 2 USB interfaces in the rear center console • Tire pressure monitoring system • Gearshift lever with additional chrome elements • Crosswind Assist • Seat belts A-Class • Seats: Comfort seats • Power outlet: 12V connection • Touchpad • Electronic immobilizer • Central locking |
|--|--|



Extra equipment

- Charging cable for wallbox and public charging station, 5m, smooth 11kW (This charging cable, also called Mode 3 cable, allows you to charge the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A).)
- Package: Business for €250 (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Active parking assistant with PARKTRONIC - Public charging package - Charging cable for wallbox and public charging stations, 5m, smooth - Remote and Charging Services Plus)
- Package: Public Charging (charging cable for wallbox and public charging stations, 5m, smooth (charging the vehicle battery at the wallbox or at public charging stations with up to 11 kW (Type 2, 3-phase, 16 A)) - Remote and Charging Services Plus)
- Seats: Heated seats for driver and front passenger (The intensity can be selected in three levels. Intelligent and comfortable: The seat heating switches off automatically.)
- Black fabric headliner
- LED High Performance headlights (The LED High Performance headlights offer greater safety at night and a distinctive, striking look. Thanks to LED technology, they illuminate the road better than conventional headlights – with lower energy consumption.)
- Package: MBUX Advanced Package (Hard drive navigation - Preparation for Live Traffic Information - Traffic Sign Assist - Connectivity Package Navigation: Hard drive navigation, Extended navigation services - Smartphone integration: Mobile phone via Apple CarPlay and Android Auto with the media system - Preparation for digital key handover)
- Package: Parking package with reversing camera (including Active Parking Assist with PARKTRONIC - reversing camera)
- Paint finish: Solid special paint
- Wheels: 43.2 cm (17") alloy wheels, 4-piece set in a 5-twin-spoke design (aerodynamically optimized, painted matte black and polished with 205/55 R 17 tires on 6.5 J x 17 ET 44 rims)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door handle - outside - Scratch(es) - Smart repair
2	Door - rear left side	Door - dent(s) - Smooth repair work
3	Vehicle glazing	Windscreen (Mehrkosten möglich) - Stone chips - Smart repair
4	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
5	Misc.	Inspection / maintenance - Due - Perform
6	Rear bumper	Rear bumper - Scratch(es) - Paint
7	Front bumper	Front bumper - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Door - front left side	Door - Abrasion - No deduction
2	Door - rear left side	Door - Abrasion - No deduction
3	Side panel - rear left side	Side panel - Abrasion - No deduction
4	Misc.	Main inspection - No evidence - No deduction
5	Misc.	Main inspection - No evidence - No deduction
6	2nd wheel set	1 alloy rim - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key with remote control

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

- Wartungshistorie gemäß Auftraggeber Informationen.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

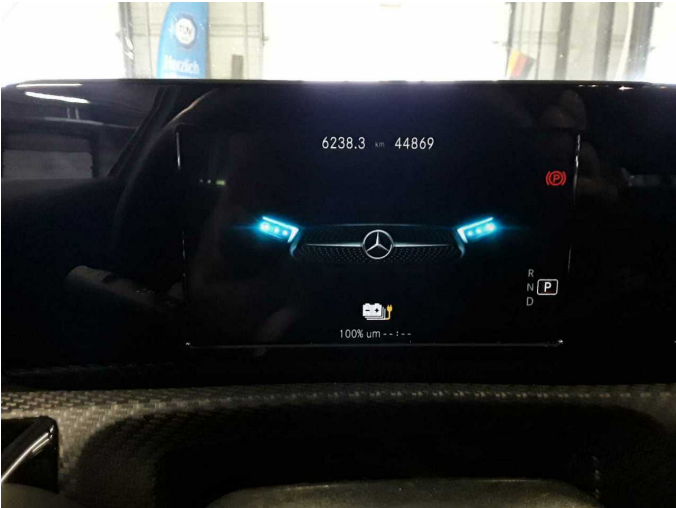


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

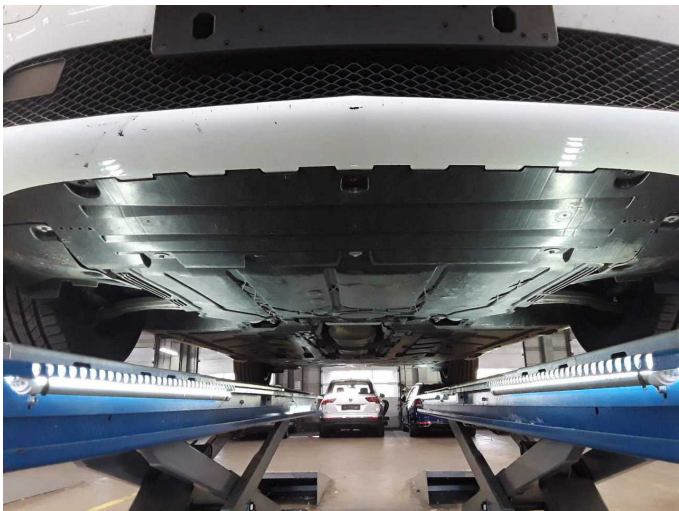


Figure 28: Misc.

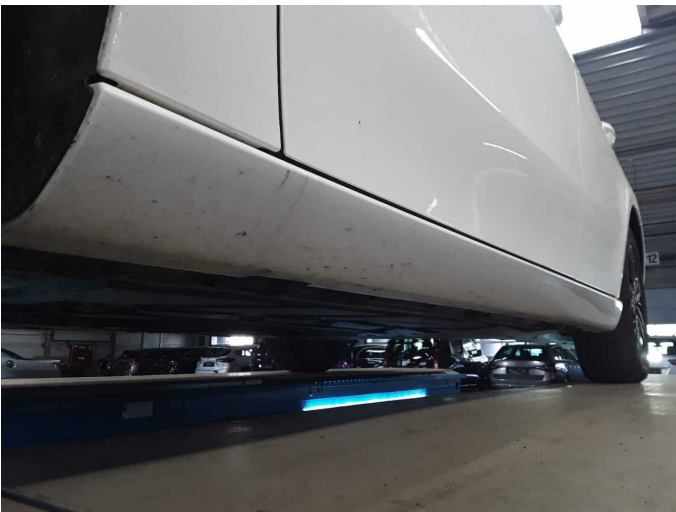


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

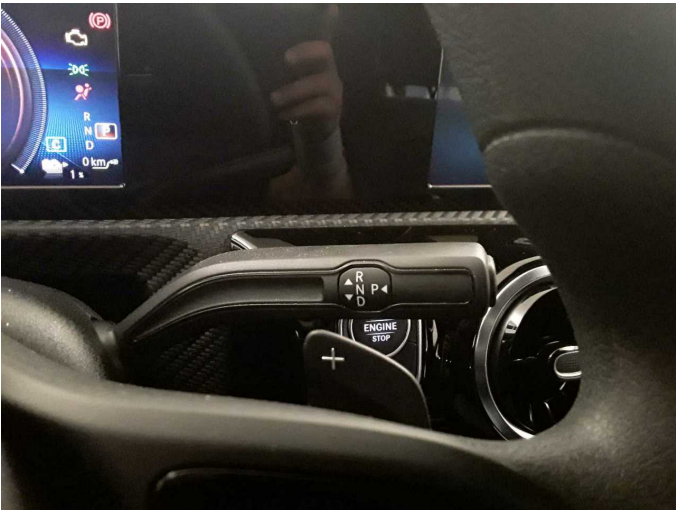


Figure 35: Misc.



Damage 1: Door - front left side: Door handle - outside - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door handle - outside - Scratch(es) - Smart repair




Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 2: Door - rear left side: Door - dent(s) - Smooth repair work



Damage 3: Vehicle glazing: Windscreen (Mehrkosten möglich) - Stone chips - Smart repair

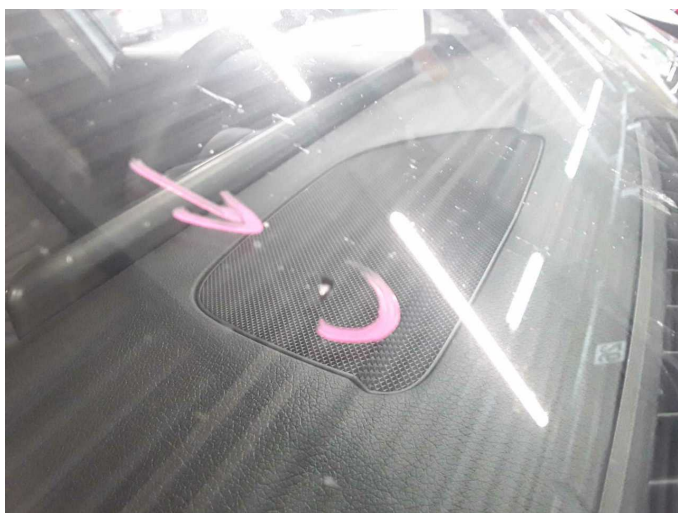

Damage 3: Vehicle glazing: Windscreen (Mehrkosten möglich) - Stone chips - Smart repair



Damage 3: Vehicle glazing: Windscreen (Mehrkosten möglich) - Stone chips - Smart repair



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value




Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 5: Misc.: Inspection / maintenance - Due - Perform

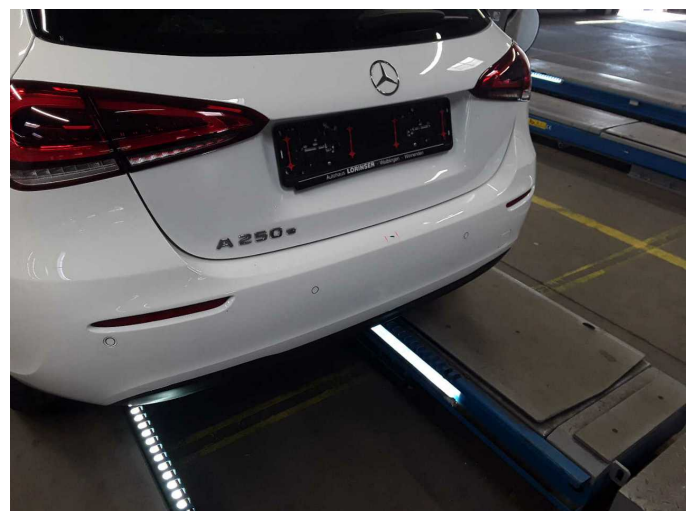

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Wear and tear 6: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 6: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 6: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Missing part 1: Equipment: Vehicle key with remote control - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K3F8GB0PN300836

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ A 250 e 8G-DCT Style

Datum	KM-Stand	Beschreibung
14.03.2025	28.963	Regelwartungsdienst
16.01.2024	12.952	Regelwartungsdienst