



Expertise

Protocol number: 46480104
Order No. / Reference: 26617504
Inspection date: 10 Jul 2026

Manufacturer: Ford

Model: Mustang Mach-E

VIN: WF0TK1E71MMA66638



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Mustang Mach-E	
Vehicle Identification number	WF0TK1E71MMA66638
Mileage (Read)	113,267 km
First registration	29 Mar 2022
Number of holders	1
Power / Engine displacement	100 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Dark Matter Gray PC
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	09/2024 at 69,771 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH430712
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BVE 00006		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,605 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R18 104V	Summer tyres on Light alloy	Michelin	6mm / 6mm
2)	225/60 R18 104V	Summer tyres on Light alloy	Michelin	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R18 104V	Winter tyres on Light alloy	Falken	7mm / 7mm
2)	225/60 R18 104H	Winter tyres on Light alloy	Michelin	6mm / 6mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Acoustic Vehicle Alerting System (AVAS)
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD))
- Exterior mirrors painted in car color
- Tires: 7 J x 18 light alloy wheels (4) in 5-spoke design (with tires 225/60 R 18)
- Tires: Tire repair kit (maximum speed 80 km/h when used)
- Light-colored woven fabric headliner
- Electronic Stability Program (ESP)
- Electric front and rear windows with all-around closing function
- High Beam Assist
- Ford Co-Pilot360 including Ford Intelligent Drive Assist (Intelligent speed limiter with speed limit display - Pre-Collision Assist, Evasive Steering Assist - Blind Spot Assist with Cross Traffic Alert - Lane Keeping Assist - Traffic Jam Assist with Stop&Go function - Intelligent Adaptive Cruise Control (iACC))
- Front trunk with Ford MegaBox
- Heated windshield
- Transmission: 1-speed direct drive (Electronic Shifter (rotary switch for automatic transmission))
- rear window wiper
- Interior decor with grey decorative stitching (for seat upholstery, steering wheel, door interiors, carpet floor mats, center console and instrument panel)
- Intelligent Protection System (IPS) (Front airbag for driver and front passenger - Airbag between driver and front passenger - Knee airbag, driver's side - Head and shoulder airbags front and rear - Side airbags front and rear - 3-point seat belts at all seats, height-adjustable - Seat belt tensioners and force limiters front and outer rear seat row - Warning system for unfastened front seat belts)
- Rear headrests (3) height adjustable
- Paint finish: Solid
- LED headlights in projection lens design (automatically height-adjustable, with integrated daytime running lights)
- Steering wheel: Multifunction leather steering wheel, heated (in Sensico synthetic leather)
- Media console with two USB ports
- Rear center armrest with two cup holders
- MyKey key system (individually programmable second key)
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Front and rear parking pilot system
- Pollen and dust filter
- Upholstery: Premium Sensico upholstery in leather look in black with grey decorative stitching
- Tire Pressure Monitoring System (TPMS)
- Reversing camera with reversing parking assistant
- Windscreen wipers with rain sensor (sensitivity adjustable)
- Towbar preparation kit (ESP trailer stabilization function)
- Electrically adjustable and heated exterior mirrors (with integrated turn signals, ambient lighting and blind spot information system including cross traffic alert) with emergency braking function when reversing out of parking spaces)
- third brake light
- Theft alarm system
- Driver information system with digital instrument panel, 10.2" screen diagonal (25.9 cm) (with range and speed display)
- Electric parking brake with auto hold function
- Ford EcoCoach (shows the efficiency of current driving behavior)
- FordPass Connect including eCall, live traffic information and Wi-Fi hotspot (real-time traffic information - Wi-Fi hotspot - eCall emergency call system: in the event of an accident, an emergency call is triggered and important data is transmitted)
- Flexible luggage compartment cover and luggage compartment lighting
- Heated rear window
- Rear spoiler
- Interior mirror, automatically dimming
- Intelligent Range (Intelligent Range provides a very precise and realistic estimate of battery range)
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Map reading light at the rear
- Map pocket on the driver's and passenger's seat backrest
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Front headrests are height-adjustable
- Charging cables: 2 charging cables for charging the high-voltage battery (Mode 3 charging cable (length 6 m) and home charging cable for standard household socket (length 6.7 m))
- Illuminated makeup mirrors in the driver's and passenger's sun visors
- Mustang LED taillights
- Fatigue warning
- One Pedal Drive (Pressing the pedal accelerates the vehicle, releasing it decelerates it. (Engine braking effect) The strength of the deceleration can be influenced by the selected driving mode.)
- Post-Collision Assist
- Radio accessories: Ford SYNC 4 (audio system with digital radio reception DAB/DAB+ (Digital Audio Broadcasting) - navigation system - Bluetooth hands-free system - sound system with 6 speakers - 15.5" touchscreen in center console (39.3 cm screen diagonal))
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Servotronic
- Seats: Front seats, individually and variably heated
- Seats: Comfort seats, front



- Keys: Classic car key and up to 4 digital keys (Phone as a Key) (Keyless Entry - also possible via door code or smartphone via FordPass App, Keyless Start via smartphone via FordPass App, start button or code)
- Seat: Rear seat backrests, foldable, 60:40 split
- Seats: Driver and front passenger seats, 6-way manually adjustable
- Power outlet: 12-volt connection at the front
- Phone: Inductive charging station for mobile devices (according to Qi standard, compatibility depends on the device)
- Lashing eyes in the luggage compartment
- Central locking system with overall locking function

- Power outlet: 12-volt connection in the luggage compartment
- Carpet floor mats front and rear, velour
- Electric door child safety lock
- Traffic sign recognition system
- Immobiliser

Extra equipment

- Paint finish: Metallic
- Package: Technology Package 2 (as Technology Package 1, additionally with: - Panoramic roof - Electrically folding exterior mirrors with Mustang pony projection onto the ground - Premium Sensico upholstery in leather look, perforated, in black with grey decorative stitching - Front seats, 8-way electrically adjustable, with adjustable lumbar support and memory function)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Misc.	Inspection / maintenance - No evidence - No deduction
3	Door - front left side	Door - dent(s) - Smart repair
4	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
5	Door - rear left side	Door handle - outside - Broken / torn - Replace
6	Roof	Sun roof / glass - Stone chips - repair according to calculation

Wear and tear

No.	Component group	Description
1	Mudguard - left side	Wheel well extension - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Boot lid / rear door	Rear spoiler - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

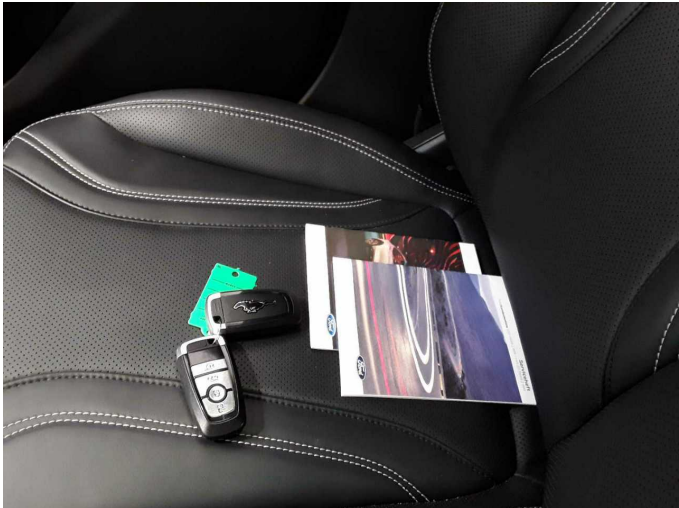


Figure 14: Documents



Figure 15: Additional tyres

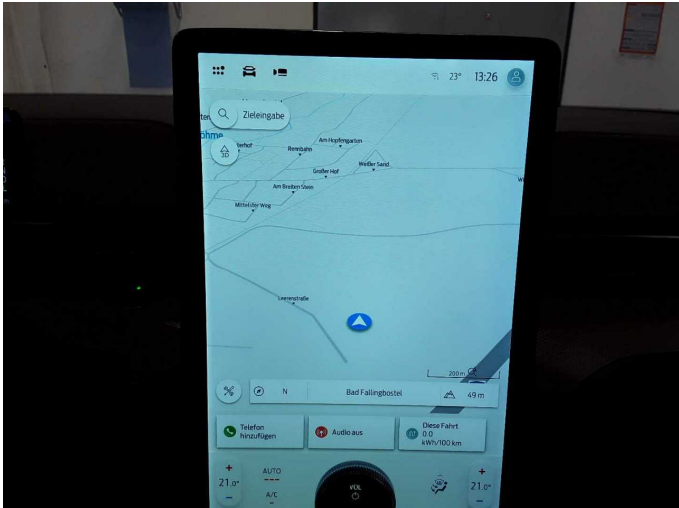


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.

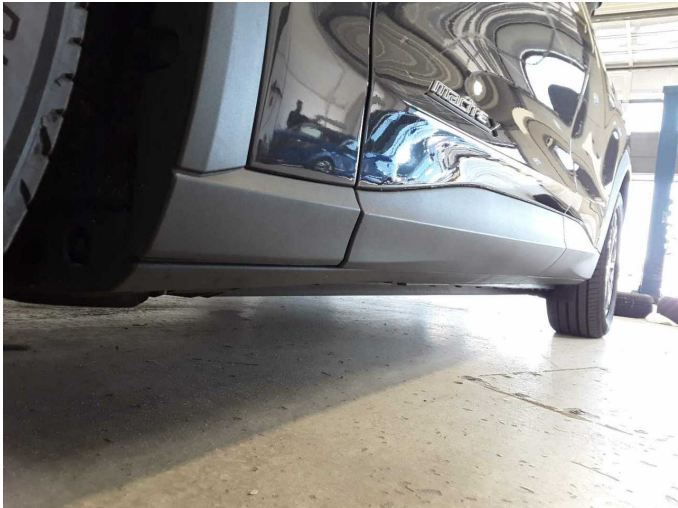


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

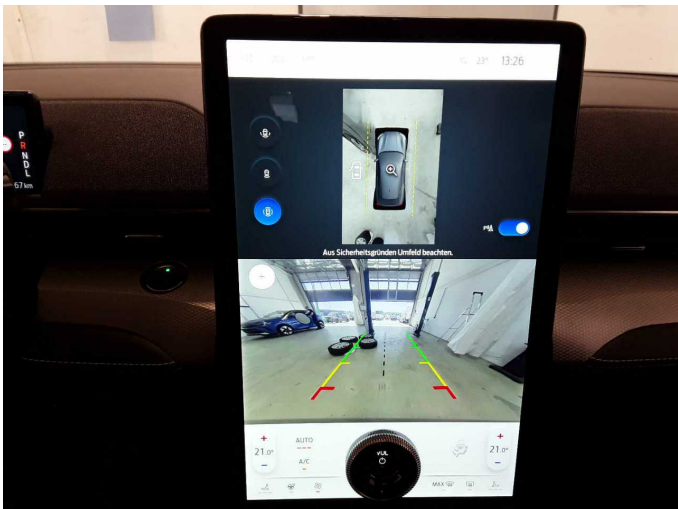



Figure 24: Misc.



Damage 3: Door - front left side: Door - dent(s) - Smart repair



Damage 3: Door - front left side: Door - dent(s) - Smart repair

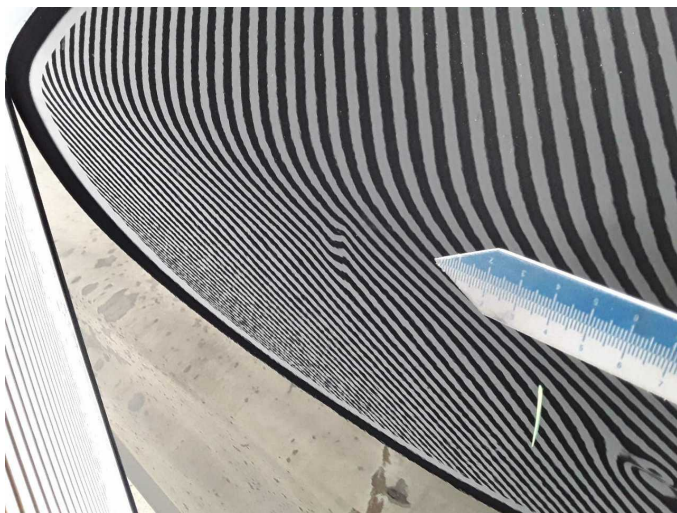

Damage 3: Door - front left side: Door - dent(s) - Smart repair



Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 5: Door - rear left side: Door handle - outside - Broken / torn - Replace




Damage 5: Door - rear left side: Door handle - outside - Broken / torn - Replace



Damage 6: Roof: Sun roof / glass - Stone chips - repair according to calculation



Damage 6: Roof: Sun roof / glass - Stone chips - repair according to calculation

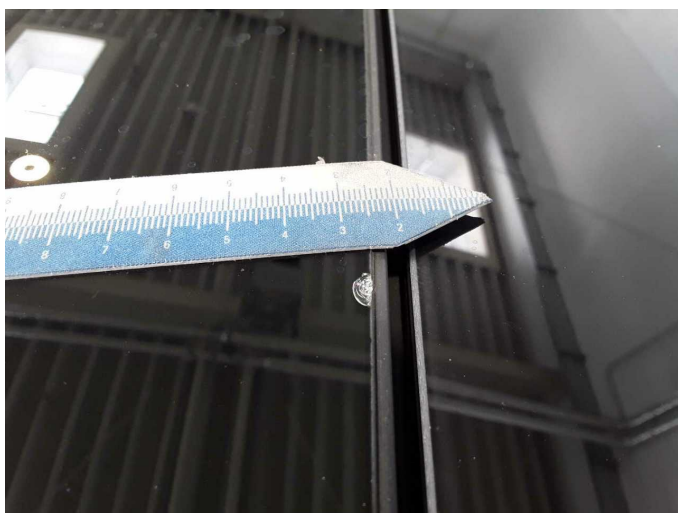

Damage 6: Roof: Sun roof / glass - Stone chips - repair according to calculation



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0TK1E71MMA66638

Hersteller / Modell: FORD FORD Mustang Mach-E

Datum	KM-Stand	Beschreibung
12.02.2026	104.112	Bremse Sonstiges; Reparatur Sonstiges; Systemtest/Eigendiagnose
19.09.2024	69.771	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst