



BMW 1 Reeks (UKL): 2ATX897

Vinnnumber:	WBA7K110707J74861	Versionname:	116i (F40) 1.5i 109pk/cv 5p Aut.
First Registrationdate:	15/07/2021	Fiscalpower:	
Expertise Mileage:	124124	Power Kw:	80
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:	Petrol		
Maintenance	OK		
Maintenance	plus 4800 km		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

205/55/16/91 W				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 5 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Bridgestone: 5 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				5.0
Tyre profile depth RL				4.0
Tyre profile depth RR				5.0
Tyre size FL				205/55 R 16 91 W
Tyre size FR				205/55 R 16 91 W
Tyre size RL				205/55 R 16 91 W
Tyre size RR				205/55 R 16 91 W
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Floor covering FL, Burned, Smart repair



Interior, Stain, Cleaning



Floor covering R, Burned, Smart repair



Air vent RM, Broken, Replace




Interior, Smell, Ozone treatment



Bumper F, Dent(s) and scratch(es), Spot repair



Bonnet, Chemical polution, Acceptable

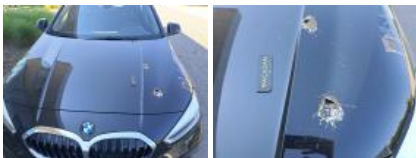

Alloy rim FL, Scratch(es), Repair and paint (complete)



Door FL, Scratch(es), Acceptable



Outer door handle FL, Scratch(es), Acceptable




Step L, Scratch(es), Acceptable




Door RL, Scratch(es), Acceptable



Wing RL, Repaired, Check

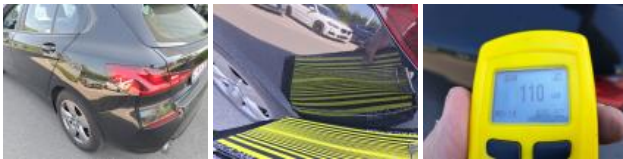

Door RL, Repaired, Check

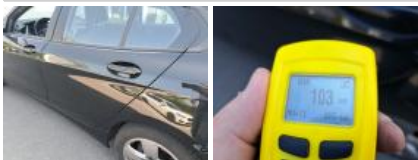

Luggage compartment cover, Broken, Replace



Tailgate / Boot, Dent(s) and scratch(es), Acceptable



Bumper R, Scratch(es), Repair and paint (complete)



Step R, Scratch(es), Repair and paint (complete)



Wing RR, Dent(s) and scratch(es), Acceptable



Alloy rim RR, Scratch(es), Acceptable



Door RR, Dent(s) and scratch(es), Acceptable



Outside rear-view mirror base R, Scratch(es), Acceptable



Alloy rim FR, Scratch(es), Repair and paint (complete)



Bodywork, Paint measurement, Check



Kenteken	2ATX897
Merk Model	BMW 116i (F40) 1.5i 109pk/cv 5p Aut.
Brandstofsoort	Benzine
Datum deel1	7/15/21

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
5/19/26	122,430	BMW/MINI service standaard omvang	Uitvoeren
5/19/26	122,430	remvloeistof	Vervangen
1/6/26	115,177	BMW/MINI service standaard omvang	Uitvoeren
1/6/26	115,177	klein materiaal	
1/6/26	115,177	remblokken vooraan	Vervangen
10/31/25	112,820	batterij	Vervangen
10/31/25	112,820	klein materiaal	
9/18/25	110,781	BMW/MINI service standaard omvang	Uitvoeren
9/18/25	110,781	BMW/MINI service voertuig-check	Uitvoeren
9/18/25	110,781	bougie	Vervangen
9/18/25	110,781	service luchtfilter	Uitvoeren
9/18/25	110,781	service microfilter	Uitvoeren
9/18/25	110,781	service motorolie	Uitvoeren
9/18/25	110,781	versnellingsbakolie	Vervangen
5/6/25	101,517	betaling technische controle	Uitvoeren
3/18/25	99,913	controle niveaus	Uitvoeren
10/2/24	90,991	BMW/MINI service standaard omvang	Uitvoeren
10/2/24	90,991	portierrubber	Vervangen
10/2/24	90,991	remblokken achter	Vervangen
4/3/24	83,311	BMW/MINI service standaard omvang	Uitvoeren
4/3/24	83,311	BMW/MINI voertuigcontrole	Uitvoeren
4/3/24	83,311	klein materiaal	
4/3/24	83,311	remvloeistof	Vervangen
4/3/24	83,311	service microfilter	Uitvoeren
4/3/24	83,311	service motorolie	Uitvoeren
9/15/23	72,256	batterij	Vervangen
9/15/23	72,256	controle niveaus	Uitvoeren
5/12/23	61,327	remblokken vooraan	Uitvoeren
5/12/23	61,327	ruitenwisserrubber achter	Uitvoeren
5/12/23	61,327	ruitenwisserrubber vooraan	Uitvoeren
4/4/23	53,101	batterij	Vervangen
4/4/23	53,101	bougie	Vervangen
4/4/23	53,101	remblokken achter	Vervangen
4/4/23	53,101	service luchtfilter	Uitvoeren
4/4/23	53,101	service microfilter	Uitvoeren
4/4/23	53,101	service motorolie	Uitvoeren
9/12/22	33,698	ruitenwisserrubber achter	Vervangen
9/12/22	33,698	ruitenwisserrubber vooraan	Vervangen
9/12/22	33,698	service microfilter	Uitvoeren
9/12/22	33,698	service motorolie	Uitvoeren