



Expertise

Protocol number: 46633642
Order No. / Reference: 26660923
Inspection date: 21 Jul 2026

Manufacturer: Volvo

Model: V60 B4 D Geartronic Inscription

VIN: YV1ZWK5VDN2482282



Vehicle details

Manufacturer / Type / Model / Equipment

Volvo V60 B4 D Geartronic Inscription

Vehicle Identification number	YV1ZWK5VDN2482282
Mileage (Read)	94,141 km
First registration	9 Feb 2022
Number of holders	1
Next periodical technical inspection	02/2027
(Report on hand)	

Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,969 ccm / 4
Power	145 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Pine Grey Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	14 Tag(e)
Last service on / at	08/2025 at 77,691 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC695122
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BTH 00009		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,280 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 98Y	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	235/45 R18 98W	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	225/50 R17 94H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS - Anti-lock Braking System
- Driver and passenger side airbags with two-stage deployment system
- Electrically adjustable exterior mirrors
- Outdoor temperature display
- Hill Start Assist (HSA)
- fog sensor
- On-board computer with vehicle control functions
- City Safety
- Colored glazing
- Roof edge spoiler
- Digital instrumentation with a 12.3" full-graphic display (31.2 cm diagonal, high resolution)
- Inserts: Drift Wood
- Aluminum door sill plates with Volvo lettering at the front
- Electronic differential lock
- Chrome window surround
- Front grille in waterfall design in chrome
- Cruise control system with variable speed limiter
- Front seat belt height adjustment
- rear window wiper
- Interior lighting
- Intelligent driver information system
- Keyless Drive (electronic access system)
- Automatic air conditioning
- Rear headrests foldable, electrically
- Stainless steel loading sill protector in the luggage compartment
- LED headlights "Thor's Hammer"
- Steering wheel: Multifunction buttons on the steering wheel
- Illuminated makeup mirror for driver and front passenger
- Front center armrest with integrated storage compartment and cup holders
- Oncoming Lane Mitigation
- Parking ticket holder
- Upholstery: Leather/leatherette comfort seats
- Radio: Sensus Connect infotainment system
- Radio accessories: Digital radio reception (DAB+)
- Rain sensor
- Road Edge Detection
- Run-off Road Protection
- Wheels: Tire pressure monitoring system (passive)
- Wheel accessories: Tire sealant
- Speed-sensitive power steering
- Seat belts
- Safety steering column (adaptive)
- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Seats: Rear seats in a 40/60 split or fully foldable with pass-through function
- Start/Stop technology
- Front passenger airbag can be deactivated
- Ambient lighting
- Electrically folding exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Attachment system for carrier bags in the luggage compartment
- LED turn signals integrated into the exterior mirrors
- third brake light
- CleanZone air quality system
- Connected Safety
- Aluminum roof rails (integrated)
- Drive Mode
- Driver Alert - Attention Warning
- Rear parking assist
- Electronic Stability Control (ESC)
- Electric windows front and rear
- Automatic emergency braking
- Luggage compartment partition net
- Transmission: 8-speed Geartronic
- Automatic tailgate (electric)
- Interior and exterior mirrors with automatic dimming function
- ISOFIX anchors for the outer rear seats
- Child safety lock (manual, rear doors)
- Headrests (5) front and rear,
- Charging box under the cargo floor
- Cargo area roller blind
- Lane Keeping Aid (LKA) - Active lane keeping assistant
- Steering wheel adjustable for height and reach
- Steering wheel heating
- Rear center armrest (foldable) with cup holders
- Sensus navigation system
- Emergency brake lights
- Electric parking brake
- Particulate filter: Soot particle filter for diesel engines
- Radio: High Performance Sound audio system
- Radio accessories: Apple CarPlay and Android Auto
- Radio accessories: Two USB-C ports on the back of the center console
- Road Sign Information (RSI)
- Wheels: 18" alloy wheels, 10-spoke design, diamond cut/graphite look
- Gearshift lever made of Swedish crystal glass by Orrefors
- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Adjustable leg rest for driver and passenger seats
- Seats: Driver's seat electrically adjustable
- Seats: Lumbar support (4-way electrically adjustable) for driver and front passenger seats
- Front seat heating
- Power socket
- Lashing eyes in the luggage compartment (foldable)



- Fuel filler neck with misfuelling protection
- Volvo On Call with WiFi hotspot
- Immobiliser
- Central locking system with two remote controls and integrated emergency keys

- Preparation for Trailer Stability Assist (TSA)
- WHIPS whiplash protection system

Extra equipment

- Dashboard in leather look with contrasting stitching
- Paint finish: Metallic paint
- Package: Parking Assistance Package (front and rear parking aid - reversing camera)
- Package: Seat Comfort Package (Electrically adjustable passenger seat - memory function for passenger seat)
- Panoramic glass sliding roof with lifting function (with integrated, continuously adjustable sunshade (electric))
- Pilot Assist (Adaptive cruise control with distance warning - Lane keeping assist up to 130 km/h - Curve Speed Assist (CSA) - Adjustment of vehicle speed before curves based on map data)
- Windscreen, heater
- Package: Lighting Package (LED fog lights - headlight cleaning system - full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assist with adaptive headlight range control and integrated LED daytime running lights - ambient lighting, extended interior lighting: multi-colored ambient lighting front/rear, exit lights front/rear, illuminated door pockets and door handles front/rear, illuminated cup holders front, footwell lighting rear, reading lights rear, work light on the tailgate.)
- Side and rear windows tinted (from the B-pillar back)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Door - front left side	Door edge - Scratch(es) - Smart repair
3	Sill - right side	Trim - Scratch(es) - Smart repair
4	Door - front left side	Door handle - inside (Beschichtung) - Paint defect - Replace
5	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
6	Rear bumper	Rear bumper - Scratch(es) - Paint

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

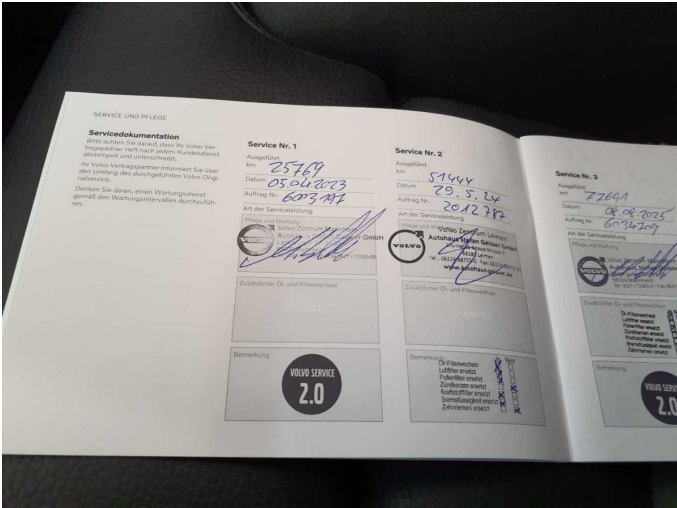


Figure 14: Documents

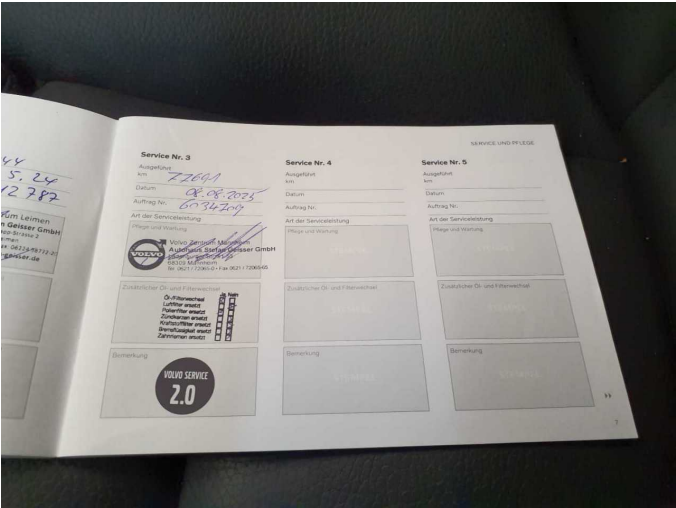


Figure 15: Documents



Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

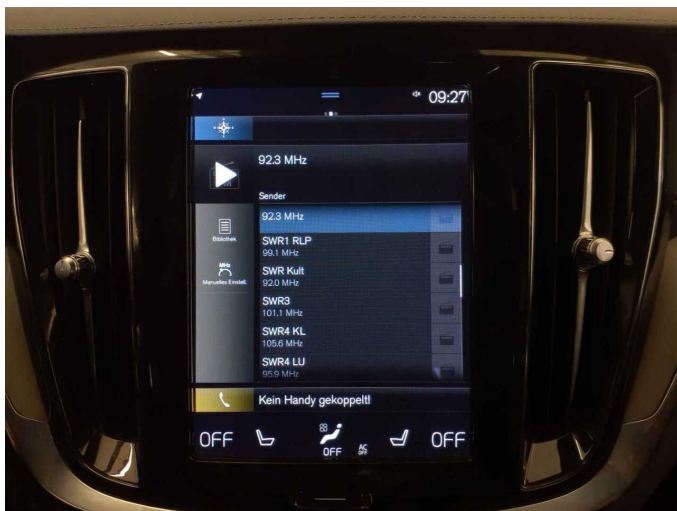


Figure 27: Misc.



Figure 28: Misc.

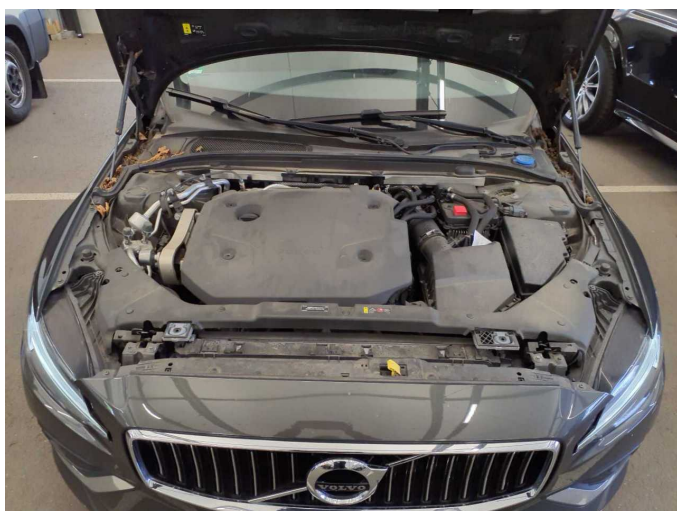


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 3: Sill - right side: Trim - Scratch(es) - Smart repair



Damage 3: Sill - right side: Trim - Scratch(es) - Smart repair



Damage 4: Door - front left side: Door handle - inside (Beschichtung) - Paint defect - Replace



Damage 4: Door - front left side: Door handle - inside (Beschichtung) - Paint defect - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint

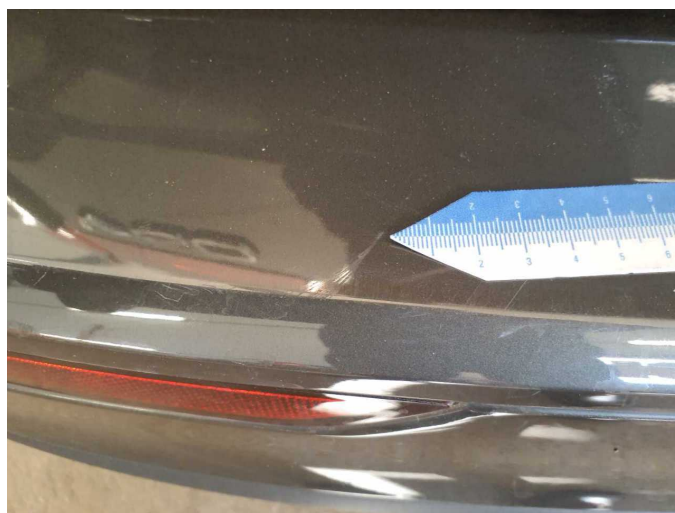

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint

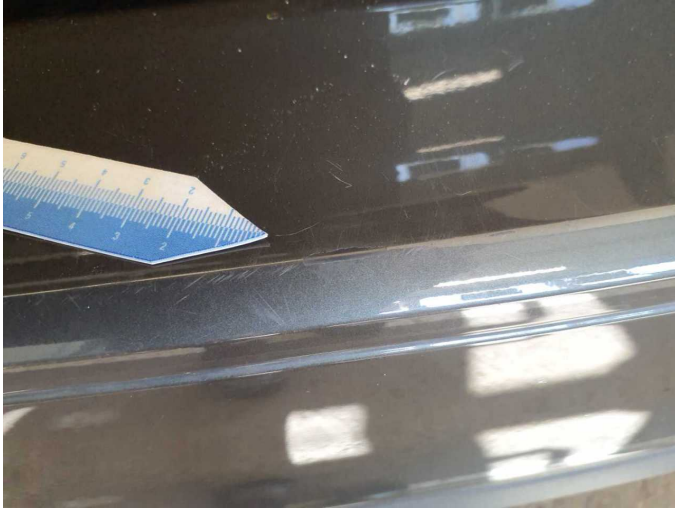

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1ZWK5VDN2482282

Hersteller / Modell: VOLVO VOLVO V60 B4 D Geartronic Inscription

Datum	KM-Stand	Beschreibung
08.08.2025	77.691	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.02.2025	66.842	AU
29.05.2024	51.449	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges; Wartung Sonstiges
05.04.2023	25.774	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges