



Expertise

Protocol number: 46909945
Order No. / Reference: 26712766
Inspection date: 5 Aug 2026

Manufacturer: Skoda
VIN: TMBLN7NS5P8052043

Model: Kodiahq 2.0 TDI 4x4 DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiahq 2.0 TDI 4x4 DSG Style	
Vehicle Identification number	TMBLN7NS5P8052043
Mileage (Read)	128,933 km
First registration	2 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	147 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	25,800 km
Last service on / at	04/2026 at 124,647 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT102246
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AVW 00617		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,410 kg	Empty weight	
Dimensions	4697 x 1882 x 1675		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	235/55 R18 100V	Summer tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 103V	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	215/65 R17 103H	Winter tyres on Light alloy	Bridgestone	5 mm
	215/65 R17 103V	Winter tyres on Light alloy	Goodyear	6 mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment on the left wheel arch
- Storage compartments (ticket holder on the windshield, closed storage compartment on the driver's side, 4 roof grab handles, rear with coat hooks, coat hooks on the B-pillar, high-visibility vest compartment in the front doors, sunglasses compartment in the headliner, storage compartments in the door panels (front and rear) with bottle holders (1.5l front, 1l rear), cup holder in the front center console with "Easy-Open" bottle opening, storage pockets on the front seatbacks)
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist
- Cargo elements in the trunk
- Roof rails, anodized
- Diesel particulate filter
- Third brake light (in the rear spoiler (LED))
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor ((tunnel light, coming and leaving home function))
- Front radar assistant including city emergency braking function with pedestrian detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (Start/Stop automatic including brake energy recuperation)
- Aero rear window wiper including windshield washer system
- Kessy - keyless entry and start-stop system
- Boot cover, roll-up and removable
- Front and rear headrests are height-adjustable.
- LED headlights with LED daytime running lights (incl. adaptive front headlights (AFS): lighting system with fully automatic and situation-dependent light control (city, country road, motorway and bad weather mode), cornering lights, automatic headlight range control)
- Steering wheel: 2-spoke leather steering wheel (height and length adjustable 3-spoke leather steering wheel - gearshift lever with leather elements)
- MSR (Motor drag torque control)
- Network program in the trunk
- Front and rear parking sensors
- Upholstery: Cloth
- Radio: Bolero infotainment system (Bolero music system - 8" capacitive color display - SmartLink - Wireless SmartLink for Apple CarPlay (from Ambition trim level) - Voice control)
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink (Apple CarPlay) (MirrorLink, Apple CarPlay, Android Auto)
- Tire pressure monitoring
- Storage compartments behind the wheel arches in the trunk
- front aero windshield wipers
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Allergen filter
- Permanent all-wheel drive
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming.
- Hill start assist
- Care Connect: Proactive services (10-year term) (Remote Access (1-year term))
- Decorative inlay Waves
- Tachometer
- eCall (automatic emergency call function in case of an accident with airbag deployment)
- ESC Electronic Stability Control
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Front footwell lighting
- Cruise control
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- ISOFIX preparation on the outer rear seats (including top tether)
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger, including humidity sensor, odor and allergen filter and air-conditioned glove compartment)
- LED taillights in crystal glass look & LED license plate lights
- Steering wheel with multifunction buttons (steering wheel with radio controls)
- Rear center armrest with cup holders and pass-through option
- Front center armrest, including storage compartment
- Multifunction display with Maxi-Dot display, color (on-board computer) (with, among other functions: time, outside temperature, current consumption, average consumption, distance traveled, driving time, average speed, fuel range, service interval indicator, door and trunk lid warning, display of information from radio, navigation system and telephone (if available))
- Radio: Bolero 8" music system (incl. SD card slot, voice control)
- Radio accessories: SmartLink+ (Smartgate, MirrorLink, Android Auto and Apple CarPlay)
- Tire mobility kit (tire repair spray incl. compressor)
- Wheels: 18" Elbrus alloy wheels (7Jx18 tires 235/55 R18 100V ET43)
- Heated windshield washer nozzles
- Electromechanical power steering



- Rear seat backrest split 60:40, foldable, longitudinally adjustable, backrest angle adjustable
- Headlights washer / wiper system
- Kodiah safety belts (Height-adjustable three-point seat belts in the front, with belt tensioners - Three three-point seat belts in the rear - Belt fastening indicator in the front and in the second row of seats)
- Seats: Remote release of the rear seat backrests (2nd row) in the boot
- 12V socket - in the center console and in the trunk
- Bumpers painted in body color (exterior mirrors and door handles painted in body color)
- Telephone: Comfort hands-free telephone system including phone box (with inductive charging function (connection via external antenna))
- Front door sill trims
- Variable fastening concept in the boot (only for 5-seaters)
- Immobiliser

Extra equipment

- Swiveling trailer hitch (with electric release, including trailer stabilization)
- Digital instrument cluster (Virtual Cockpit) (with, among other functions: time, outside temperature, current fuel consumption, average fuel consumption, distance traveled, driving time, average speed, fuel range, service interval indicator, door and trunk lid warning, display of information from radio, navigation system and telephone (if available))
- Steering wheel: Heated 2-spoke steering wheel (including paddle shifters)
- Package: Business Amundsen (Amundsen dynamic radio navigation system - 8" capacitive color display - Color multifunction display in the instrument cluster - SmartLink - Wireless SmartLink for Apple CarPlay - Voice control - Phonebox with inductive charging function (connection via external antenna) - Wi-Fi hotspot (use of the data connection of the paired mobile phone) - Driver fatigue detection - 230 V socket and USB port - Sunset - Luggage net partition - Infotainment Online (3-year subscription))

- Seats: Heated front seats
- Seats: Electrically adjustable front seats with memory function
- Seats: Driver and front passenger seats are height-adjustable (including adjustable lumbar support)
- Skoda Care Connect (SOS emergency call function (Emergency Call including automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions regarding vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone)
- Lashing eyes in the trunk
- Central locking with remote control

- Traveller assistance system (DSG) (Adaptive Cruise Control ACC (control range up to 210 km/h) - Lane Assist - Adaptive Lane Guidance - Traffic Jam and Emergency Assist)
- Electric tailgate operation
- Paint finish: Pearl effect
- LED ambient lighting including Glossy Black trim strip (decorative strips in the door panels with selectable color climate, LED reading lights at the front, LED lighting for the make-up mirrors in the sun visors including Glossy Black trim strip)
- Package: Family (Removable waste bin for the door panel - Sunshades for the rear side windows - Door edge protectors - Electric child safety lock adjustment)
- Reversing camera with washer nozzle
- Variable loading floor in the trunk
- Windscreen, wirelessly heated

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Side panel - rear left side	Sill - Scratch(es) - Smart repair
3	Trim / covers	Door trim - rear left side - Broken / torn - Smart repair
4	Interior	Cargo area floor - Broken / torn - Replace
5	Interior	Interior - Scratch(es) - Loss in value
6	Door - rear right side	Door - Scratch(es) - Paint
7	Door - rear left side	Door - Scratch(es) - Paint
8	Bonnet	Bonnet - dent(s) - Repair and paint
9	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratched - No deduction
2	Body	Body - Scratch(es) - No deduction
3	Side panel - rear right side	Sill - Scratch(es) - No deduction
4	Door - front left side	Door edge - Scratch(es) - No deduction
5	Roof	Roof rail - left side - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Luggage net

Repainting

No. Repainting

- 1 Sill - right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side 158 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Winter - Radsatz ist kein Bestandteil des Lieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

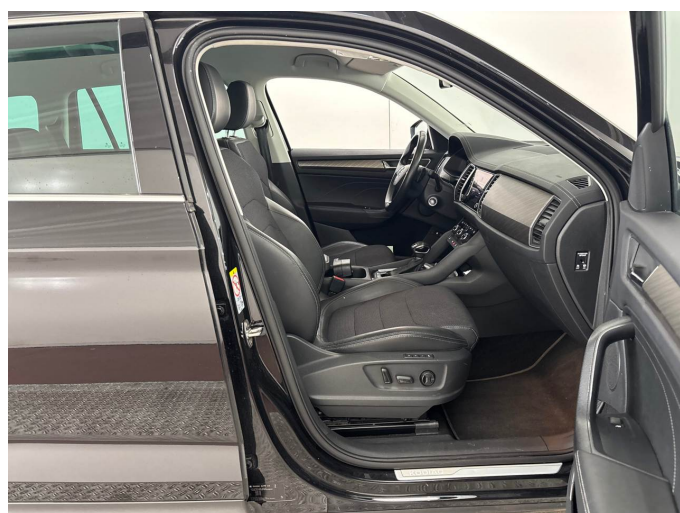


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

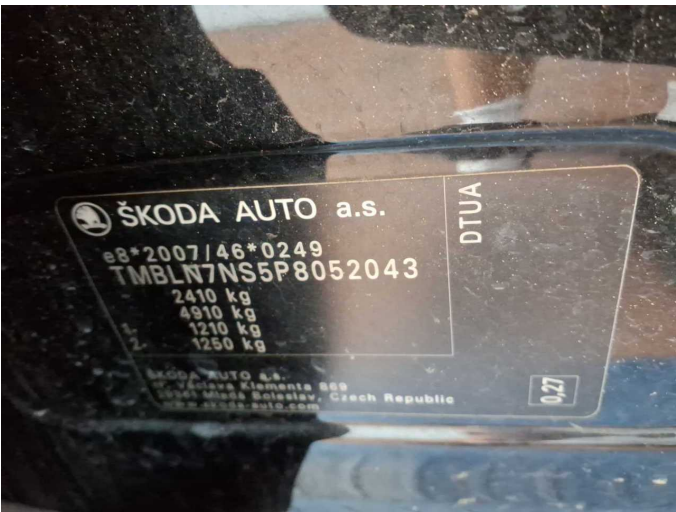


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

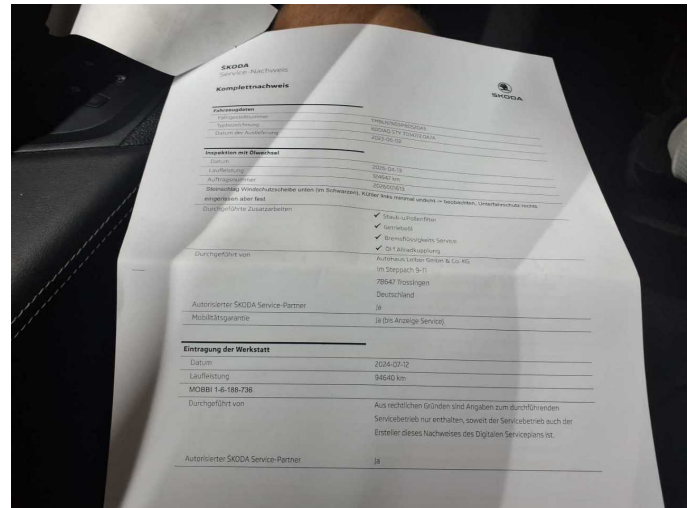


Figure 14: Documents

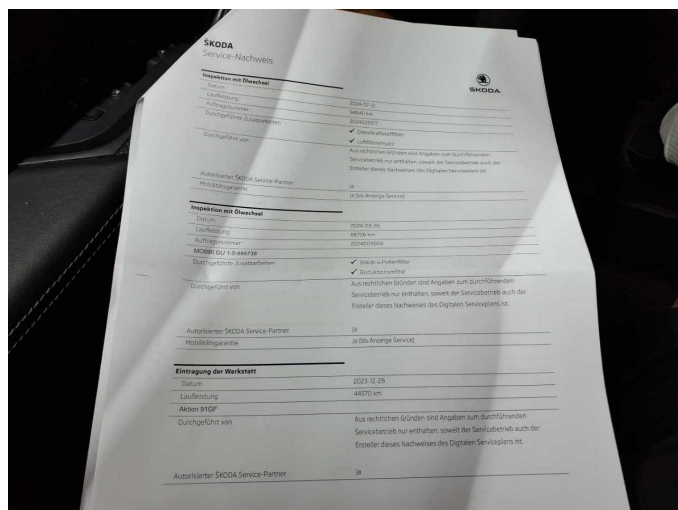


Figure 15: Documents

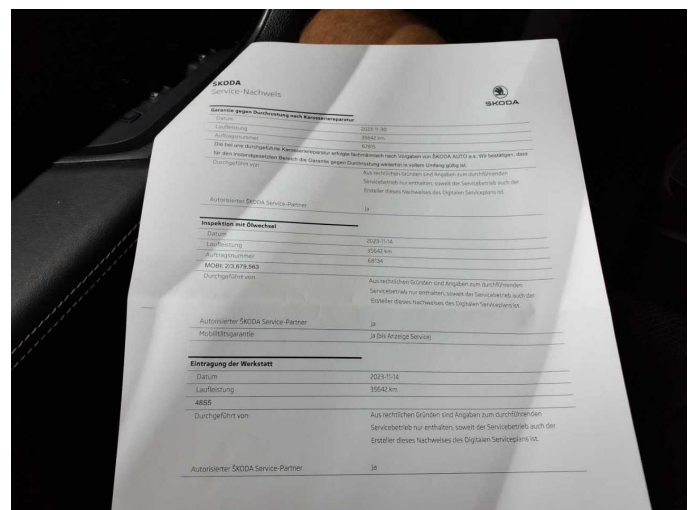


Figure 16: Documents

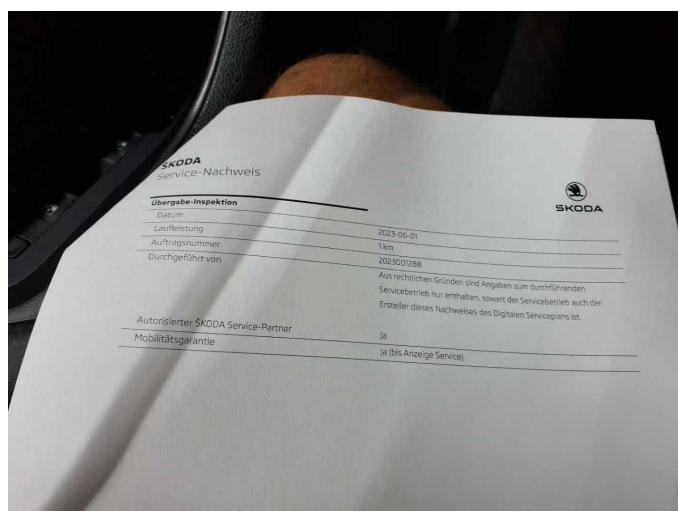


Figure 17: Documents



Figure 18: Documents



Figure 19: Documents



Figure 20: Additional tyres

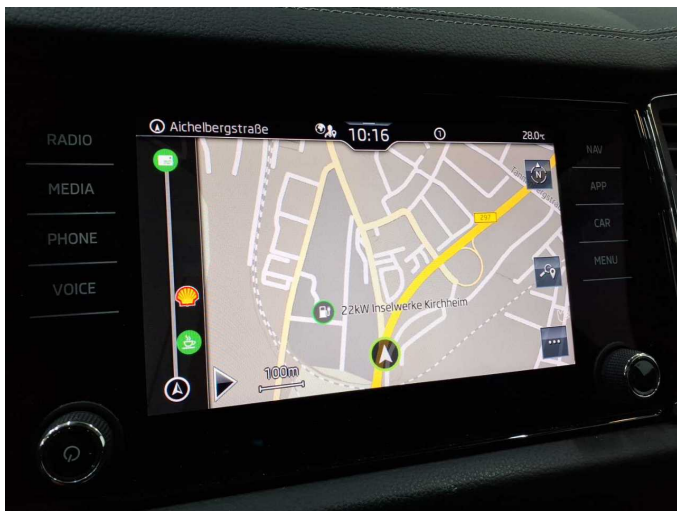


Figure 21: Navigation



Figure 22: Misc.



Figure 23: Misc.

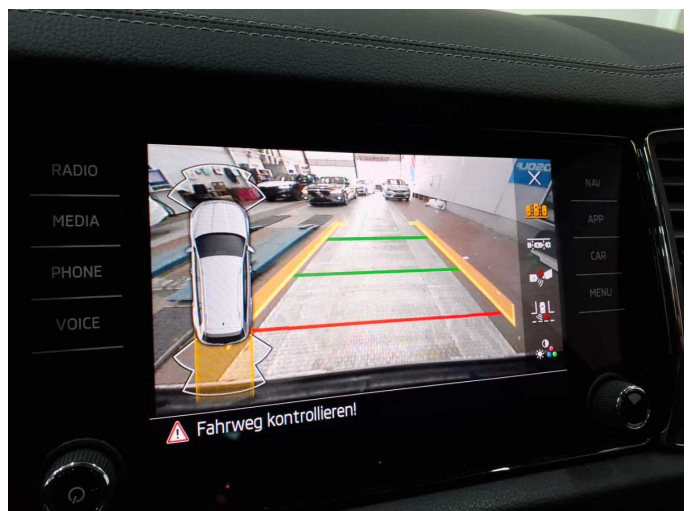


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

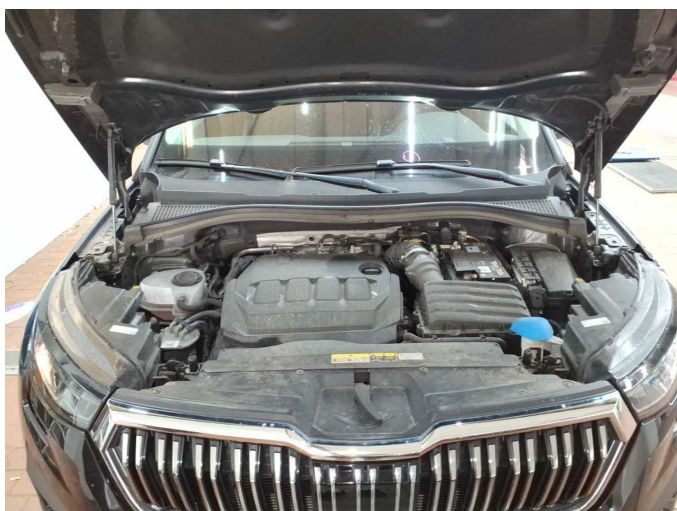


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.

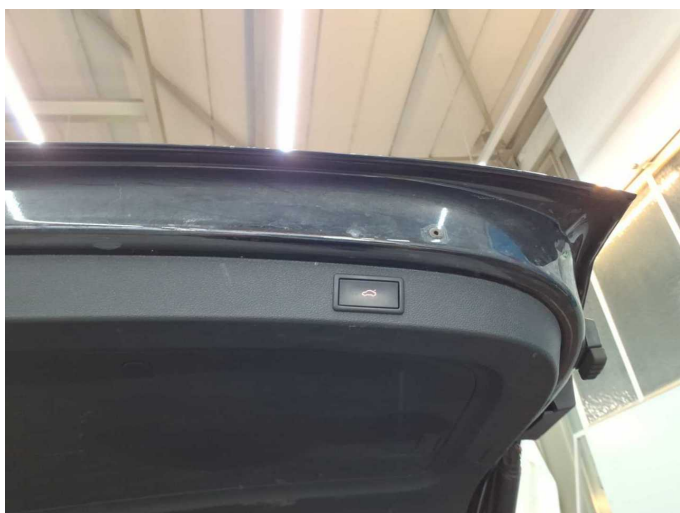


Figure 39: Misc.



Figure 40: Misc.



Figure 41: Misc.



Figure 42: Misc.

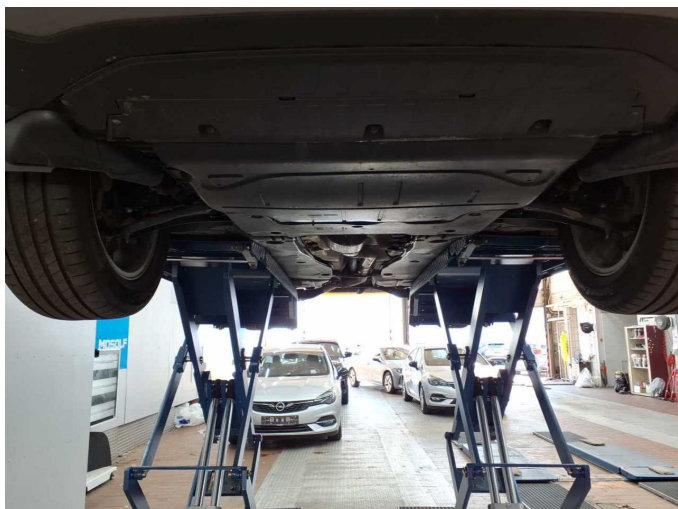



Figure 43: Misc.



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise

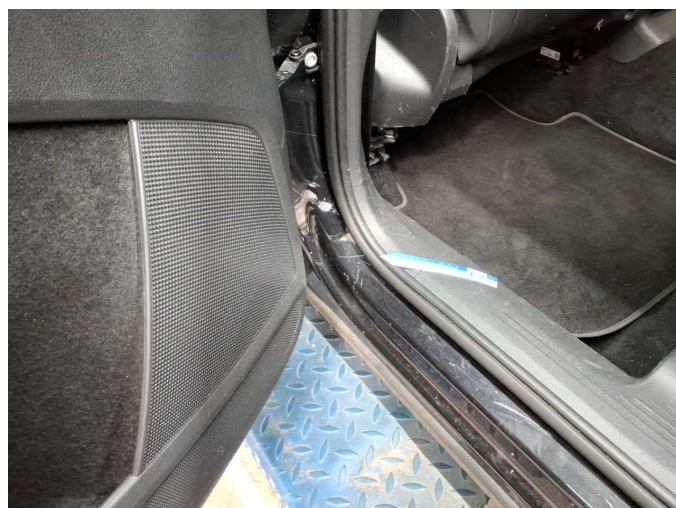

Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 3: Trim / covers: Door trim - rear left side - Broken / torn - Smart repair



Damage 3: Trim / covers: Door trim - rear left side - Broken / torn - Smart repair



Damage 4: Interior: Cargo area floor - Broken / torn - Replace



Damage 4: Interior: Cargo area floor - Broken / torn - Replace



Damage 5: Interior: Interior - Scratch(es) - Loss in value



Damage 5: Interior: Interior - Scratch(es) - Loss in value



Damage 5: Interior: Interior - Scratch(es) - Loss in value




Damage 5: Interior: Interior - Scratch(es) - Loss in value



Damage 5: Interior: Interior - Scratch(es) - Loss in value




Damage 5: Interior: Interior - Scratch(es) - Loss in value

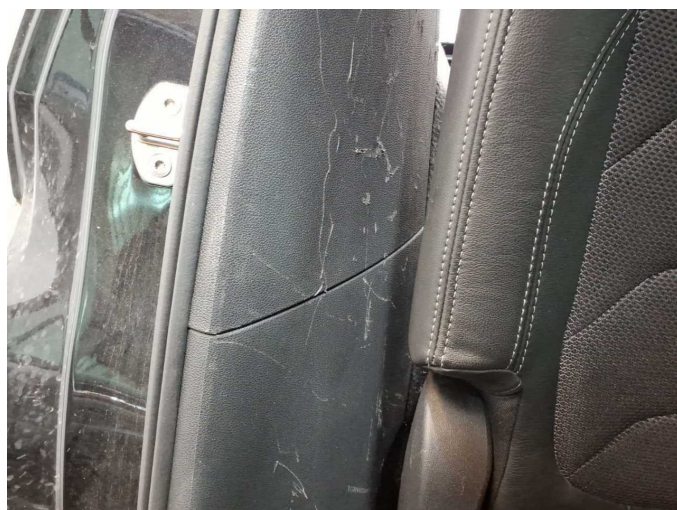

Damage 5: Interior: Interior - Scratch(es) - Loss in value



Damage 5: Interior: Interior - Scratch(es) - Loss in value

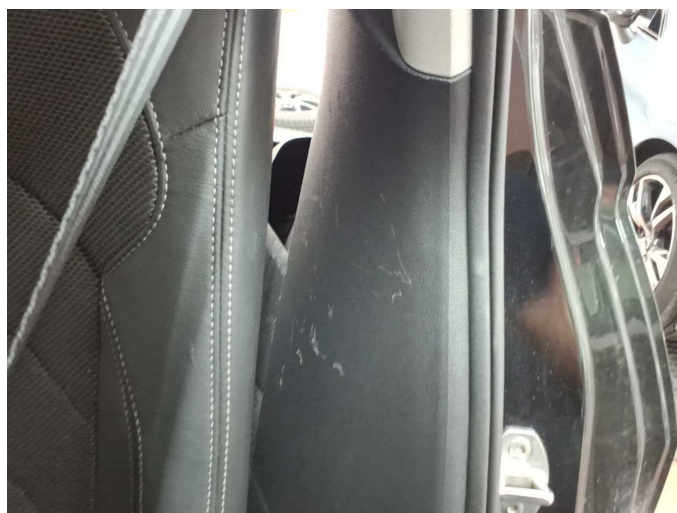

Damage 5: Interior: Interior - Scratch(es) - Loss in value



Damage 5: Interior: Interior - Scratch(es) - Loss in value




Damage 5: Interior: Interior - Scratch(es) - Loss in value



Damage 5: Interior: Interior - Scratch(es) - Loss in value



Damage 5: Interior: Interior - Scratch(es) - Loss in value

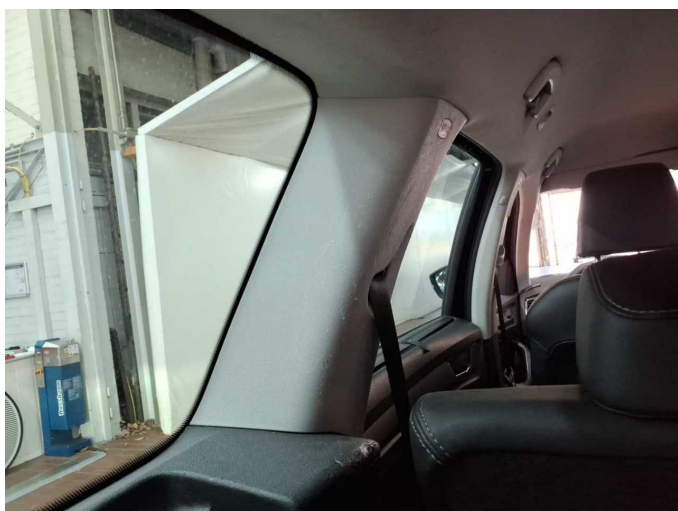

Damage 5: Interior: Interior - Scratch(es) - Loss in value



Damage 6: Door - rear right side: Door - Scratch(es) - Paint



Damage 6: Door - rear right side: Door - Scratch(es) - Paint




Damage 7: Door - rear left side: Door - Scratch(es) - Paint



Damage 7: Door - rear left side: Door - Scratch(es) - Paint




Damage 7: Door - rear left side: Door - Scratch(es) - Paint

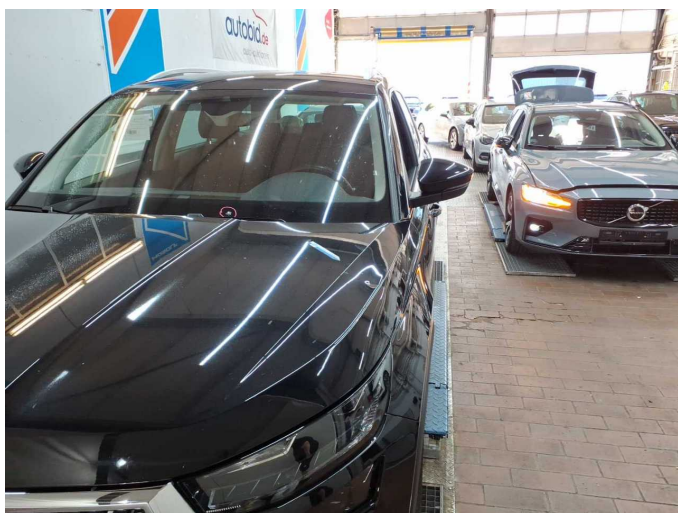


Damage 8: Bonnet: Bonnet - dent(s) - Repair and paint




Damage 8: Bonnet: Bonnet - dent(s) - Repair and paint

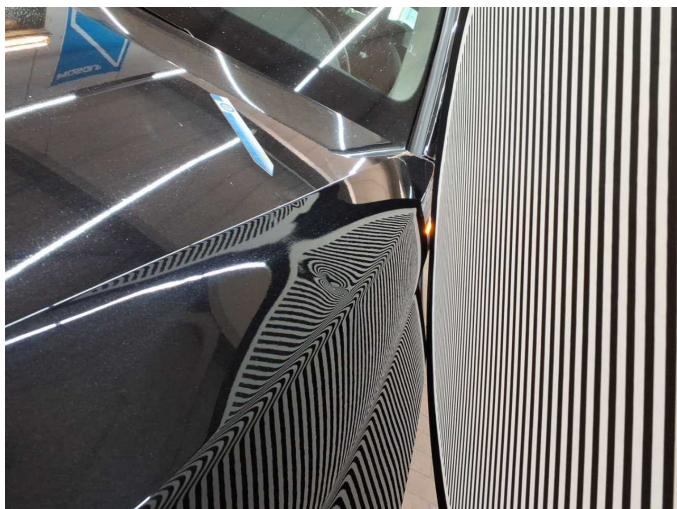

Damage 8: Bonnet: Bonnet - dent(s) - Repair and paint

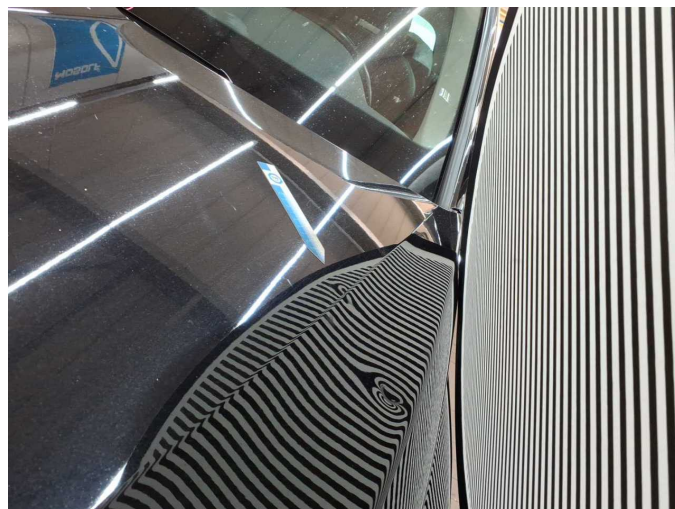

Damage 8: Bonnet: Bonnet - dent(s) - Repair and paint

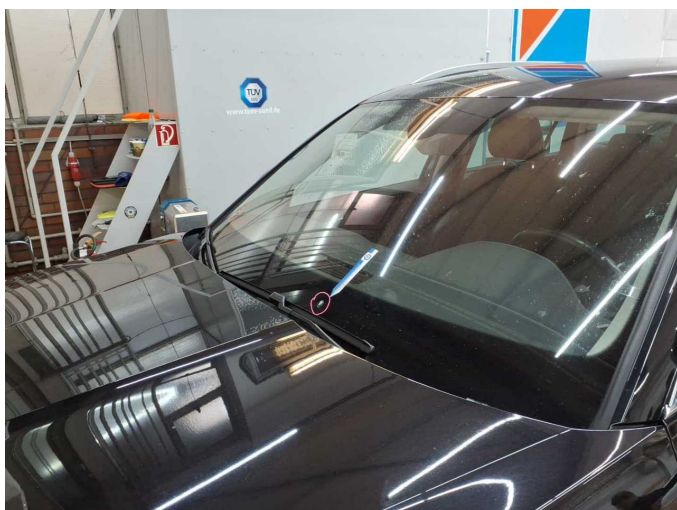


Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace




Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 5: Roof: Roof rail - left side - dent(s) - No deduction

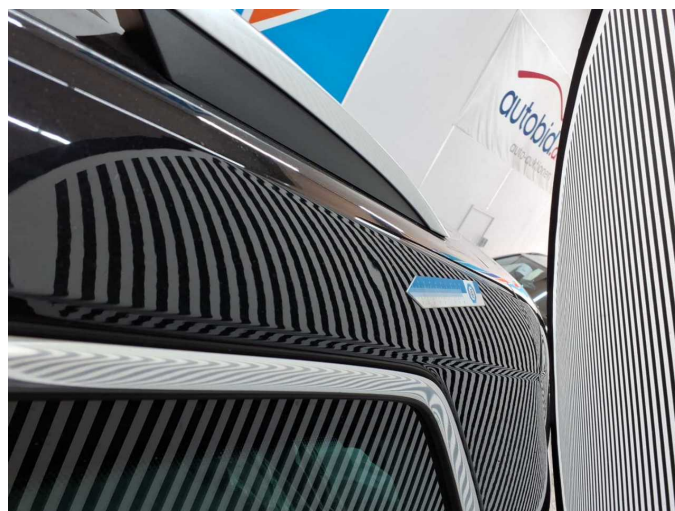

Wear and tear 5: Roof: Roof rail - left side - dent(s) - No deduction

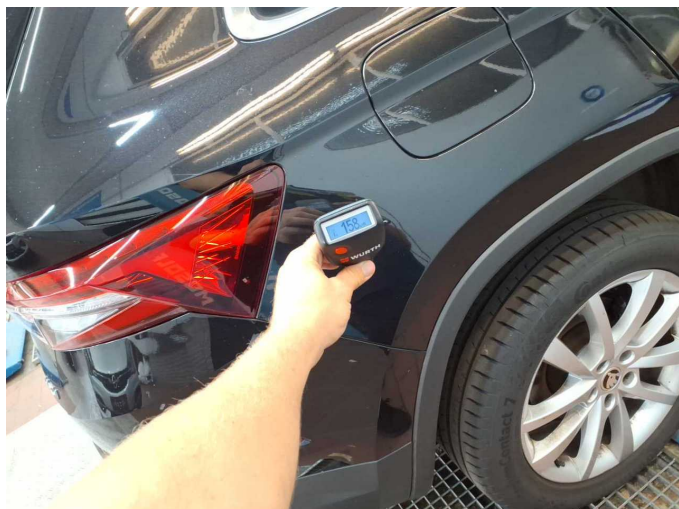

Repainting 1: Sill - right side



Repainting 1: Sill - right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLN7NS5P8052043
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI 4x4 DSG Style

Datum	KM-Stand	Beschreibung
11.06.2026	128.156	AU
13.04.2026	124.647	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
10.12.2025	114.129	Batterie ern; Systemtest/Eigendiagnose
12.07.2024	94.640	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.03.2024	66.726	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.12.2023	44.570	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne
17.11.2023	35.647	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges