



Expertise

Protocol number: 46293212
Order No. / Reference: 26588322
Inspection date: 30 Jun 2026

Manufacturer: Ford

Model: Transit Custom 300 L1H1 LKW VA Trail

VIN: WF0YXXTTGYLL42331



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit Custom 300 L1H1 LKW VA Trail	
Vehicle Identification number	WF0YXXTTGYLL42331
Mileage (Read)	136,810 km
First registration	25 Jan 2021
Number of holders	1
Next periodical technical inspection	02/2027
(Report on hand)	
Power / Engine displacement	96 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frost-Weiß
Doors / Seats	4 / 3
Upholstery type	Leather
Colour of upholstery	Black
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	30,000 km
Last service on / at	09/2025 at 127,903 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FY027318
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BMU 05721		
Emission standard	EURO6;WLTP;CI;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,000 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R16 109R	Winter tyres on Light alloy	Michelin	6mm / 6mm
2)	215/50 R16 109R	Winter tyres on Light alloy	Michelin	9mm / 9mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T C	Summer tyres on Steel	Goodyear	8 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- roof, flat
- Headliner in driver's cab (up to the partition wall to the cargo area)
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS) (Hill Start Assist - Crosswind Assist - Emergency Brake Assist - Rollover Protection)
- FordPass Connect (including live traffic information and Wi-Fi hotspot: Information about the current status or location of the vehicle, as well as control of selected vehicle functions via smartphone with the FordPass app. Real-time traffic information (in conjunction with audio systems 24 and 25). Wi-Fi hotspot (up to 4G/LTE, for up to 10 mobile devices). Further information about FordPass Connect can be found at <https://www.ford.de/fordpass-connect>.)
- Front air conditioning (including dust and pollen filter)
- Paint finish: Solid color paint
- Cargo area floor: Vinyl floor covering, sealed, "Easy Clean"
- Steering column, adjustable in height and reach
- Package: Visibility Package 2 (Heated windscreen - Electrically adjustable, heated and folding exterior mirrors - Exterior mirrors with integrated turn signals - Windscreen wipers with rain sensor - Headlight assistant with day/night sensor - Windscreen washer fluid sensor)
- Front and rear parking pilot system
- Radio: Audio system 13 additionally with DAB/DAB+ (Radio (FM/AM) - Four speakers, antenna - Audio remote control on the steering wheel - Bluetooth, USB port and hands-free system - MyFord Dock - additionally with digital radio reception DAB/DAB+ (Digital Audio Broadcasting))
- Sliding door entry light automatically illuminates when the door is opened
- Mud flaps front and rear
- Half-height side wall cladding
- Seat belts (front seat belt tensioners and force limiters - warning system for unfastened driver's seat belt)
- Mechanical limited-slip differential
- Start-stop system
- Power outlet: 12-volt connection
- Lashing eyes 8
- Immobiliser
- Heat-insulating glazing, lightly tinted
- Central locking with remote control
- Auxiliary heater, electric
- Driver's side airbag
- On-board computer (with consumption and mileage information (e.g. remaining range) and outside temperature display)
- Double-leaf rear door with 180° opening angle (without window)
- Third brake light
- Front electric windows (with quickdown/up function for driver's side)
- Ford Easy Fuel (comfortable fuel filler cap and misfuelling protection)
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Generator, 240 A
- Cruise control including leather steering wheel (with adjustable speed limiter)
- Transmission: 6-speed transmission
- Lockable glove compartment with lid
- Interior lighting with delay function (with reading lights at the front)
- Cargo area lighting with activatable switch-off delay (after 30 minutes)
- Emergency brake assist including emergency brake light (pulsating illumination of the brake lights during hard braking)
- Package: Style Colour Package Trail (Exterior mirrors, door handles and tailgate handles painted in body colour - front and rear bumpers in accent colour)
- Particulate filter: diesel particulate filter
- Wheels/Tires: Spare wheel, steel wheel
- Wheels: Alloy wheels 6.5 J x 16, 10-spoke design (with 215/65 R 16 tires in trail design)
- Headlights: Halogen projector headlights (with LED daytime running lights and fog lights with static cornering lights)
- Sliding door: Sliding door, right
- Side protection strips
- Power steering
- Seats: Seat Package 18A - Partition (load-through hatch), without window (Custom Truck Trail) (Driver's seat, 4-way adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Interior armrest for driver - Fold-out tray on double passenger seat - Lumbar support (driver's seat) - Seat cover: Partial leather upholstery - Partition without window)
- Second key with remote control



Extra equipment

- Airbag (passenger side)
- Blind spot assist including cross traffic alert and trailer function
- Cargo area floor: Vinyl floor covering omitted
- LED lights in the cargo area
- Radio: Audio system 21: Ford audio system with 8" multifunction display plus DAB/DAB+ (Connected Radio - FordPass Connect Wi-Fi hotspot (up to 4G/LTE, for up to 10 mobile devices) - 8" touchscreen multifunction display (20.32 cm screen diagonal) - Four speakers, antenna - Integrated control panel and audio remote control on the steering wheel - Support for Android Auto and Apple CarPlay)
- Rear window wiper (including windshield washer nozzle and automatic activation when reverse gear is engaged)
- Double-wing rear doors with 180° opening angle (with window) (with heated rear windows)
- Package: Visibility Package 3 (Lane Assist with Driver Alert and High Beam Assist - Rearview camera with image transmission of the rear driving path in the multifunction display)
- Seats: Seat Package 18A - Partition (load-through hatch), with window (Custom Truck Trail) (Driver's seat, 4-way manually adjustable (forward/backward, backrest, seat cushion tilt, height) - Double passenger seat with storage compartment under individually foldable seat cushions - Height-adjustable headrests - Fold-out tray on the double passenger seat - Interior armrest for driver - Seat cover: Partial leather upholstery - Lumbar support (driver's seat) - Partition with window and load-through hatch)
- Sliding door: Sliding door, right (also with window, fixed)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Rear door - left side (Öffnet sehr schwergängig) - Perform diagnosis
2	Rear bumper	Rear bumper - Scratch(es) - Loss in value
3	Rear bumper	Rear bumper - Loose - Repair
4	Seat - front	Seat cover - left side - Abrasion - Loss in value
5	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace
6	Body	Body - Glued / labelled - De-glue / neutralise

Wear and tear

No.	Component group	Description
1	Interior	Interior - Dent / paintcoat damage - No deduction
2	Body	Body - Dent / paintcoat damage - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Front bumper	Spoiler - Scratch(es) - No deduction
5	Body	Underbody - Corrosion - No deduction
6	Wheel / tyres	Tyres - complete set - Differs from the original configuration - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 19 Jan 2022	2.323,55 €

Repainting

No.	Repainting
1	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	302 µm
------------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN

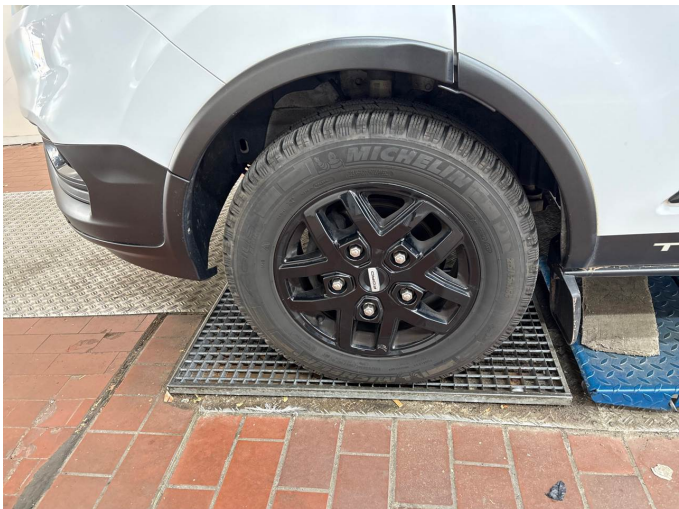


Figure 12: Mounted tyres

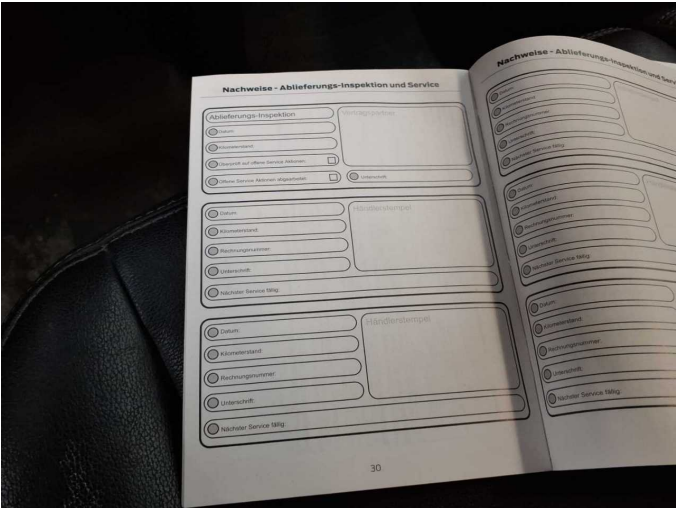


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

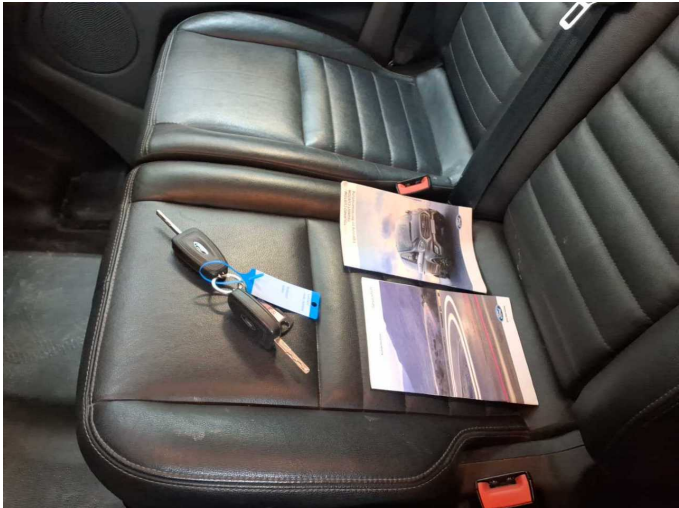


Figure 16: Documents



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

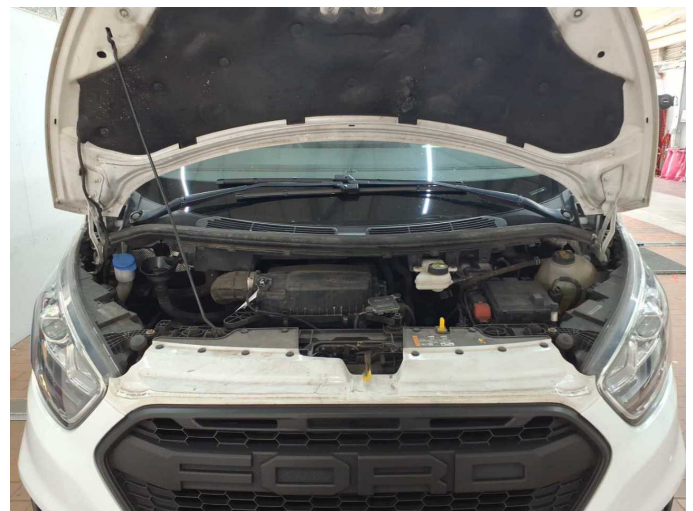


Figure 22: Misc.



Figure 23: Misc.

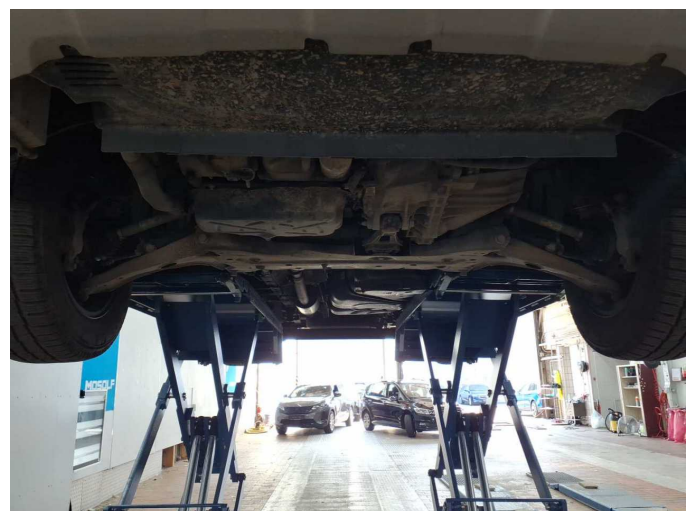


Figure 24: Misc.



Figure 25: Misc.



Damage 1: Boot lid / rear door: Rear door - left side (Öffnet sehr schwergängig) - Perform diagnosis



Damage 1: Boot lid / rear door: Rear door - left side (Öffnet sehr schwergängig) - Perform diagnosis



Damage 1: Boot lid / rear door: Rear door - left side (Öffnet sehr schwergängig) - Perform diagnosis



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 3: Rear bumper: Rear bumper - Loose - Repair



Damage 3: Rear bumper: Rear bumper - Loose - Repair



Damage 3: Rear bumper: Rear bumper - Loose - Repair



Damage 3: Rear bumper: Rear bumper - Loose - Repair



Damage 3: Rear bumper: Rear bumper - Loose - Repair




Damage 3: Rear bumper: Rear bumper - Loose - Repair



Damage 4: Seat - front: Seat cover - left side - Abrasion - Loss in value



Damage 4: Seat - front: Seat cover - left side - Abrasion - Loss in value

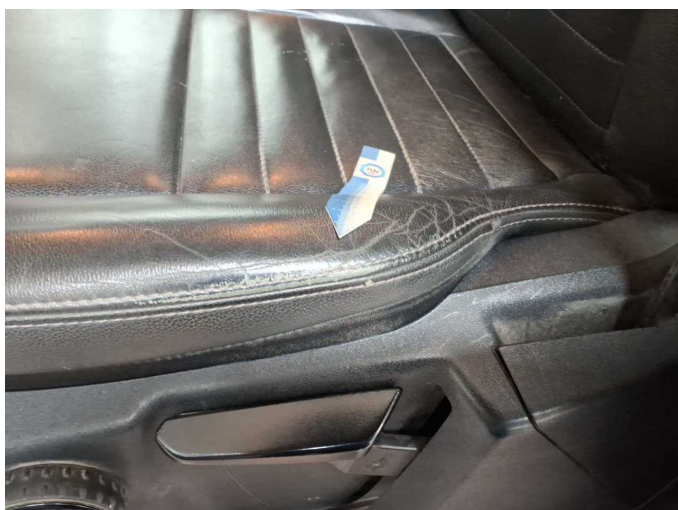

Damage 4: Seat - front: Seat cover - left side - Abrasion - Loss in value



Damage 5: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



Damage 5: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise




Damage 6: Body: Body - Glued / labelled - De-glue / neutralise




Damage 6: Body: Body - Glued / labelled - De-glue / neutralise



Damage 6: Body: Body - Glued / labelled - De-glue / neutralise

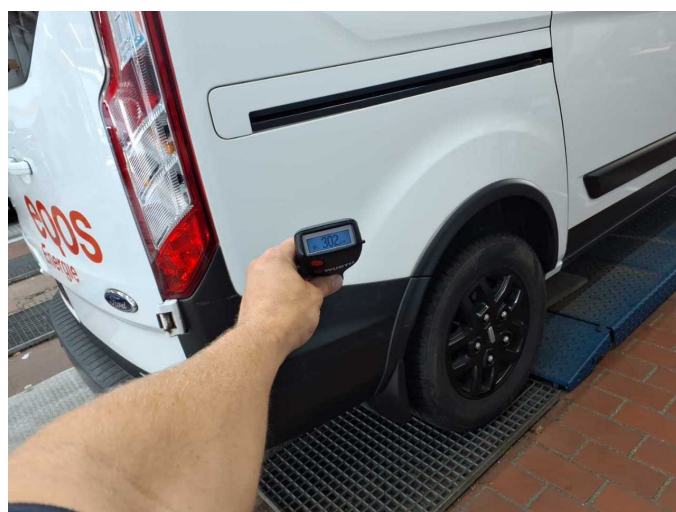

Repainting 1: Side panel - rear right side

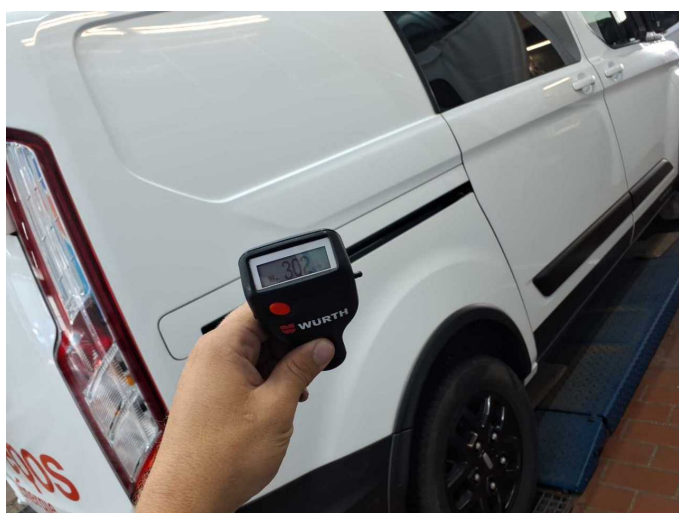

Repainting 1: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0YXXTTGYLL42331

Hersteller / Modell: FORD FORD Transit Custom 300 L1H1 LKW VA Trail

Datum	KM-Stand	Beschreibung
30.09.2025	127.903	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.11.2024	97.743	Bremsinspektion vo + hi; Bremsbelagfühler ern; Bremsklötze hinten; Bremsklötze vorne; Systemtest/Eigendiagnose
16.05.2024	86.067	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.07.2022	42.667	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges