



**CITROËN BERLINGO: FV-769-FN**

Vinnumber:	<b>VR7EFYHWCLN539982</b>	Versionname:	<b>CITROËN BERLINGO M 650kg BlueHDi 75 S&amp;S BVM Club VU [4P] bvm 5-75CH-5cv (fourgonnettesimple cabine)</b>
First Registrationdate:	<b>20/11/2020</b>	Fiscalpower:	
Expertise Mileage:	<b>111122</b>	Power Kw:	<b>55</b>
Bodytype:	<b>Transporter</b>	Body colour:	<b>White</b>
Gearbox:	<b>MAN 5 VIT</b>	Paint type:	<b>Opaque</b>
Transmission:	<b>Front</b>	Interior colour:	<b>Black</b>
Fueltype:	<b>Diesel</b>	Type of rims (mounted):	<b>Steel</b>
Engine functioning:	<b>Yes</b>	Dashboard color:	<b>Black</b>
Battery functioning:	<b>Yes</b>		
Vehicle running:	<b>Yes</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>2</b>		
Number head rests:	<b>2</b>		
Type of rims (mounted):	<b>Steel</b>		
Category:	<b>Light Commercial Vehicle</b>		

**Options**

Number of keys total:	<b>2</b>	Radio:	
Number keys remote:	<b>1</b>	Rear parking sensors:	
Windows electric F:		Sliding door right-side:	
Cruise Control:		Seat cover lining:	<b>Lining Other</b>
Type of climate control:	<b>Manual climate control</b>		

**Tyres**

<b>195/65/15/95 V</b>				
Summer tyres:	Fr.L.	<b>Bridgestone: 25%</b>	Fr.R.	<b>Bridgestone: 30%</b>
	Re.L.	<b>Bridgestone: 20%</b>	Re.R.	<b>Bridgestone: 25%</b>

Tyre profile depth FL	<b>6.6</b>
Tyre profile depth FR	<b>6.2</b>
Tyre profile depth RL	<b>7.0</b>
Tyre profile depth RR	<b>6.5</b>
Tyre size FL	<b>195/65 R 15 95 V</b>
Tyre size FR	<b>195/65 R 15 95 V</b>
Tyre size RL	<b>195/65 R 15 95 V</b>
Tyre size RR	<b>195/65 R 15 95 V</b>
Tyre type FL	<b>All seasons</b>
Tyre type FR	<b>All Seasons</b>
Tyre type RL	<b>All seasons</b>
Tyre type RR	<b>All Seasons</b>
Tyre make FL	<b>255</b>
Tyre make FR	<b>255</b>
Tyre make RL	<b>255</b>
Tyre make RR	<b>255</b>

**Assistance equipment**

Spare wheel:	<b>Yes</b>	Jack:	<b>Yes</b>
--------------	------------	-------	------------

Steering wheel, Worn, Repair/replace (lump sum)



Interior, Dirty, Cleaning




Wheel cover RR, Missing, Replace



Door FL, Scratch(es), Paint



Bumper F, Scratch(es), Repair and paint (complete)

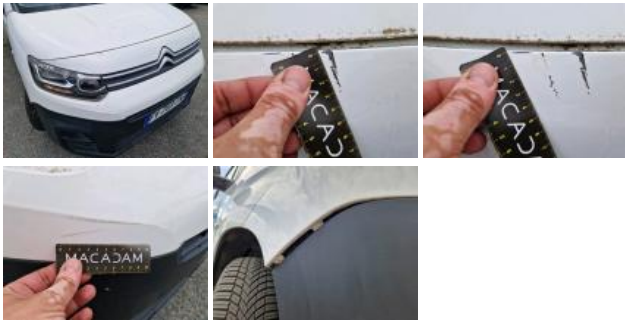

Door FR, Scratch(es), Paint



Side wall RR, Scratch(es), Paint



Boot door panel RR, Dent(s) and scratch(es), Repair and paint (complete)



Boot door panel RL, Scratch(es), Polish



Bumper R, Broken, Replace



# Historique Maintenance

Immatriculation: **FV-769-FN**Date de 1ère immatriculation: **20/11/2020**Modèle: **Citroen BERLINGO M 650kg BlueHDi 75 S&S BVM Club VU [4P] bvm 5-75CH-5cv  
(fourgonnettesimple cabine)**

Date	Kilométrage	Fournisseur	Descriptif
15/06/2026	111.090	THOMAS AUTOMOBILES	INJECTEURS RPLT FAP RPLT
12/11/2025	104.996	THOMAS AUTOMOBILES	REVISION ET CLIM ET AIR ET CARBURANT
07/11/2025	104.810	CONTROLE TECHNIQUE PALOIS	ANTIPOLLUTION
23/10/2025	103.010	THOMAS AUTOMOBILES	BALAIS ESSUIE GLACE AV
01/07/2025	90.284	THOMAS AUTOMOBILES	DIVERS CARROSSERIE
30/06/2025	90.230	THOMAS AUTOMOBILES	LAMPE CODE AVD RPLT LAMPE AR RPLT
17/02/2025	82.407	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS ETE
30/01/2025	80.820	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS ETE
27/11/2024	75.872	CONTROLE TECHNIQUE PALOIS	CONTROLE TECHNIQUE
28/10/2024	74.680	DAVANT***	POMPE DE LAVE GLACE RPLT DIVERS ECHAPPEMENT
07/10/2024	74.207	DAVANT***	LIQUIDE DE FREIN BALAIS ESSUIE GLACE AV DIVERS REVISION ET CLIM
07/06/2024	68.772	DAVANT***	DISQUES PLAQUETTES AV RPLT DISQUES PLAQUETTES AR RPLT
04/09/2023	60.007	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS ETE
22/03/2023	51.743	DAVANT***	LAMPE AR RPLT REVISION ET CLIM ET AIR ET CARBURANT
15/12/2022	44.790	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS ETE REPLACEMENT PNEUS ETE
25/08/2022	37.150	EUROFLEET TYRES AND SERVICES	REPARATION DE ROUE
19/04/2022	31.068	GARAGE DOS SANTOS	PLAQUETTES AV RPLT REVISION DIAG
26/01/2022	24.800	EUROFLEET TYRES AND SERVICES	REPLACEMENT PNEUS ETE