



Expertise

Protocol number: 46455532
Order No. / Reference: 26383516
Inspection date: 10 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1NFB0GB9SB431626

Model: GLE 350 de 4Matic 9G-TRONIC Advanced



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLE 350 de 4Matic 9G-TRONIC Advanced	
Vehicle Identification number	W1NFB0GB9SB431626
Mileage (Read)	30,857 km
First registration	21 May 2025
Number of holders	1
Next periodical technical inspection	05/2028
(Report not on hand)	
Power / Engine displacement	145 kw / 1,993 ccm
Fuel type / Cylinder	Hybr.D/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Selenitgrau metallic
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Brown



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	196 Tag(e)
Last service on / at	01/2026 at 23,573 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HM245972
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BMJ 00305		
Emission standard	EURO6;WLTP;EA;PI/CI;M, N1, N2	fine dust sticker	
Permitted total weight	3,290 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/50 R20 113W	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	275/50 R20 113W	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/50 R20 113V	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	275/50 R20 113V	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ADAPTIVE BRAKE
- Airbag: Driver and front passenger
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Active Lane Keeping Assist
- Ambient lighting
- ATTENTION ASSIST
- Electrically adjustable and heated exterior mirrors
- Digital extra: Hard drive navigation
- Downhill Speed Regulation (DSR)
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Chassis with steel springs
- electric parking brake
- Velour floor mats
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Headrests (5)
- Paint finish: Solid
- Charging cable for wallbox and public charging station, 5m, smooth
- Steering wheel: Multifunction steering wheel in Nappa leather
- MBUX multimedia system
- MULTIBEAM LED
- Navigation accessories: Extended MBUX functions
- Navigation accessories: Pre-installation for remote and navigation services
- Package: Advanced
- Package: Customization Package
- Package: Mirror Package
- PRE-SAFE system as preventive occupant protection
- Radio accessories: Pre-installation for digital radio
- Tire pressure monitoring system (TPMS)
- Remote and Charging Services Plus
- Wheels: Summer tires
- Wheel accessories: TIREFIT with tire inflator compressor
- Power steering
- Seat belts: Rear seat belt indicator in the instrument cluster
- Seats: Heated seats for driver and front passenger seats
- Seats: Front seats electrically adjustable
- Phone accessories: Apple CarPlay
- Phone accessories: Smartphone integration
- Cruise control with variable speed limiter
- Ambient lighting with projection of the brand logo
- Traffic Sign Assistant
- Immobiliser
- Heat-insulating dark tinted glass
- Adaptive Highbeam Assist Plus
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Active Brake Assist
- 4MATIC permanent all-wheel drive
- Armrest for driver and front passenger
- Automatic passenger airbag deactivation
- Diesel particulate filter
- Digital extra: MBUX Live Traffic Information
- Third brake light
- EASY-Pack: Cargo area cover
- Driver observation camera
- Electric windows, front and rear
- Fingerprint scanner
- Transmission: 9G-TRONIC
- Rear window wiper with intermittent function
- Mechanical child safety lock in the rear doors
- Communication module (LTE) for the use of Mercedes me connect services
- Charging cable for household socket, 5m, smooth
- Charging system: Alternating current charging system (AC charging) up to 11 kW
- Steering column mechanically adjustable lengthwise and heightwise.
- Mercedes-Benz emergency call system
- Navigation accessories: 7 years of free map updates
- Navigation accessories: Pre-installation for navigation services
- Navigation: MBUX Navigation Premium
- Package: Chrome Interior Package
- Package: Parking package with 360° camera
- Upholstery: ARTICO black leatherette
- Radio accessories: Digital radio (DAB)
- Radio accessories: Additional USB ports
- Remote Services Premium
- Wheels: 50.8 cm (20") light alloy wheels in a 5-twin-spoke design
- Windscreen wipers with rain sensor
- 3-point seat belts
- Seats: 4-way lumbar support for driver and front passenger
- Seats: i-Size child seat attachment in the rear
- Seats: Rear seat backrests foldable
- Phone accessory: Android Auto
- Phone accessories: Wireless charging system for mobile devices
- Transparent hood
- Accident and breakdown management
- High-visibility vest for drivers
- Widescreen Cockpit
- Decorative elements: Brushed aluminum with light longitudinal grain



Extra equipment

- Trailer hitch with ESP trailer stabilization (fully electrically retractable trailer hitch - operating button with LED lighting in the tailgate, in the cargo area or in the driver's door (depending on the model) - ESP trailer stabilization)
- MAGIC VISION CONTROL in conjunction with Winter Package (highly efficient windscreen wiper system consisting of control unit, position sensor, electric pump and distribution rail - heating for wiper blades, washer fluid reservoir and washer fluid hoses - automatic interval switching with rain sensor - practical tap wash function)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Speed Limit Assist - Extended Automatic Restart on Motorways - Route-Based Speed Adaptation - Active Steering Assist - Active Emergency Stop Assist with SOS Function - Active Brake Assist - Turning Function with Vehicle, Pedestrian and Bicycle Detection - Evasive Steering Assist - Active Lane Keeping Assist - Blind Spot Assist - Exit Warning Function - Traffic Sign Assist)
- Electric sunshades in the rear doors, left and right (sunshades in the rear doors, left and right - roller blind made of perforated film - electrically retractable roller mechanism - discreet storage of the blinds in the door recess of the rear doors - conveniently controlled via buttons in the door control panels of the rear doors and the driver's door)
- Decorative elements: open-pored brown walnut wood
- Black fabric headliner
- Paint finish: Metallic
- Charging system: Direct current charging system (DC charging) up to 60 kW (For optimal charging speed with a maximum of 60 kW and therefore high convenience. Fast charging stations such as IONITY supply the direct current required for your high-voltage battery. Thus, the DC charging system provides the best possible electric range in the shortest possible time.)
- Package: Advanced Plus (Memory Package - Parking Package with 360° camera - KEYLESS-GO Comfort Package - Blind Spot Assist - Burmester Surround Sound System - Digital Extra: MBUX Augmented Reality for Navigation)
- Package: Winter Package (heated steering wheel - heated windshield washer system)
- Radio accessories: 2 USB ports in the rear
- Seats: Seat climate control for driver and front passenger seats (seat heating and ventilation)
- Telephone: Multifunctional telephony (wireless connection of a compatible mobile phone to the external antenna - wireless charging for compatible mobile phones - Bluetooth and WLAN pairing wirelessly via NFC (Near Field Communication) technology)
- Partition net for luggage compartment separation and occupant protection

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Door trim - front right side - Scratch(es) - Smart repair
2	Tail light	Tail lamp - right side - Scratch(es) - Replace
3	Front bumper	Spoiler - Scratch(es) - Replace

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Engine	Engine cowling - lower - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Fahrzeug weist rundum hohe Lackwerte



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

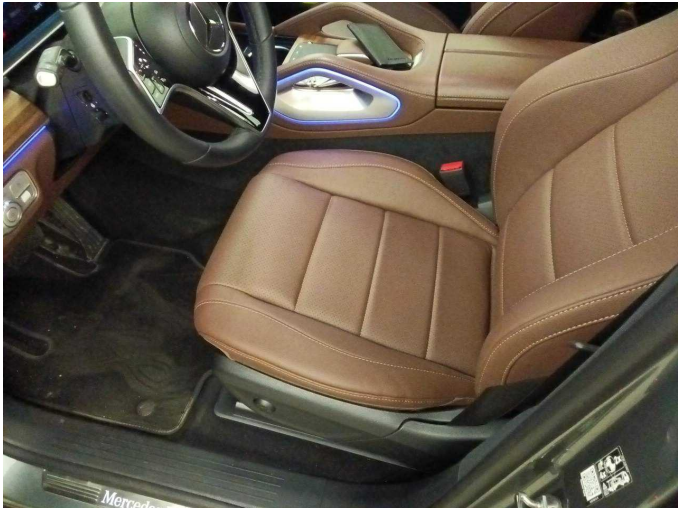


Figure 16: Misc.



Figure 17: Misc.

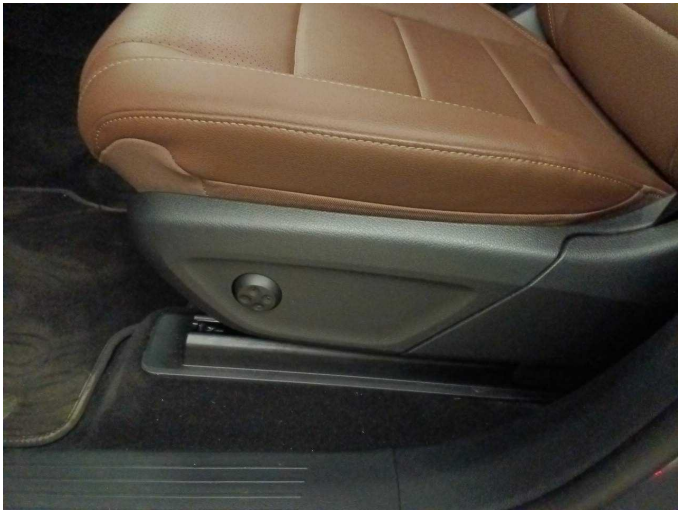


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

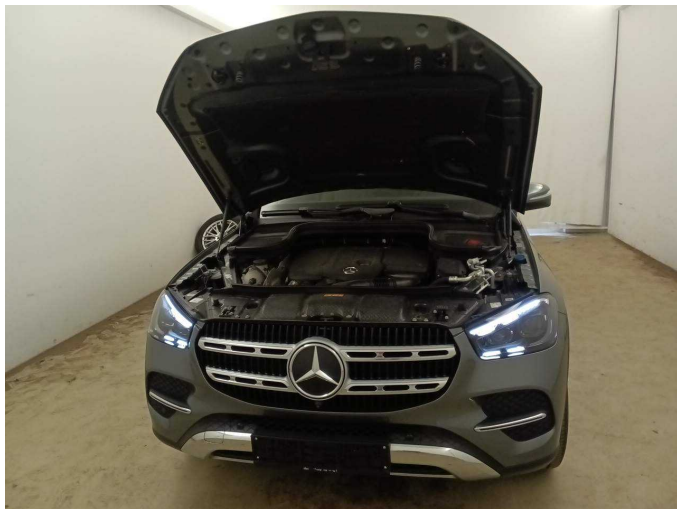


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

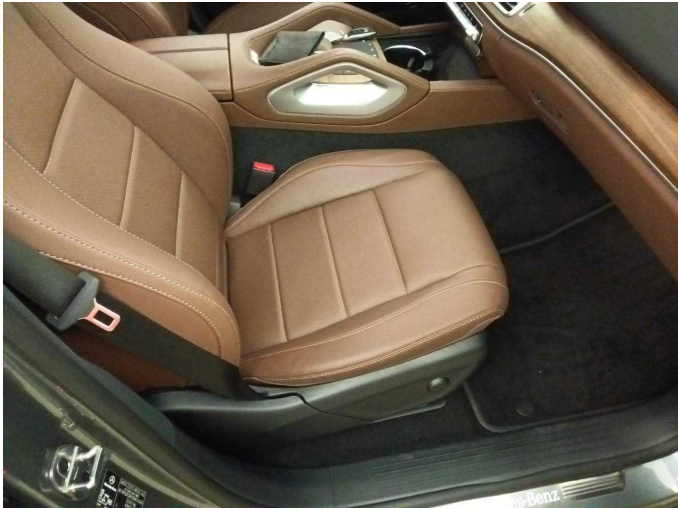


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

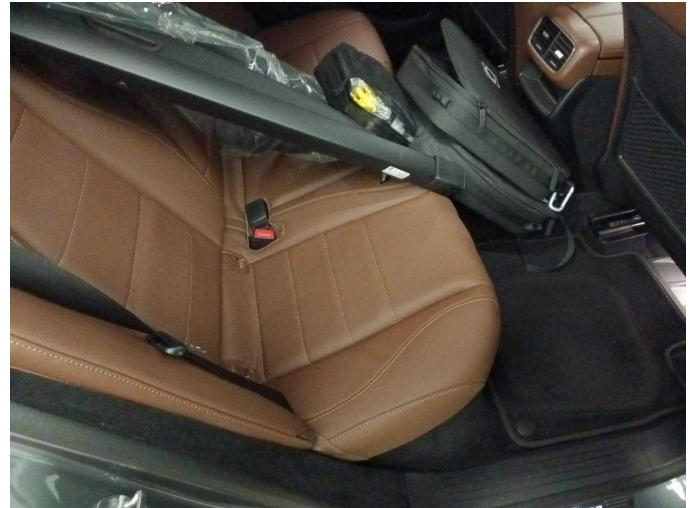


Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.

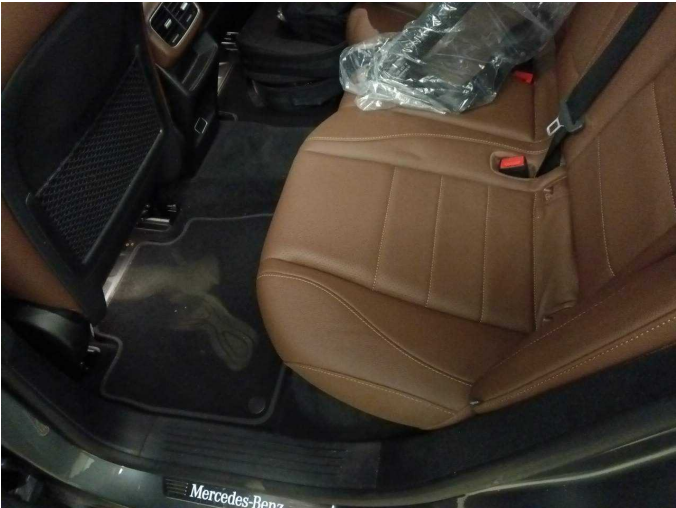


Figure 39: Misc.



Figure 40: Misc.




Figure 41: Misc.



Figure 42: Misc.



Figure 43: Misc.

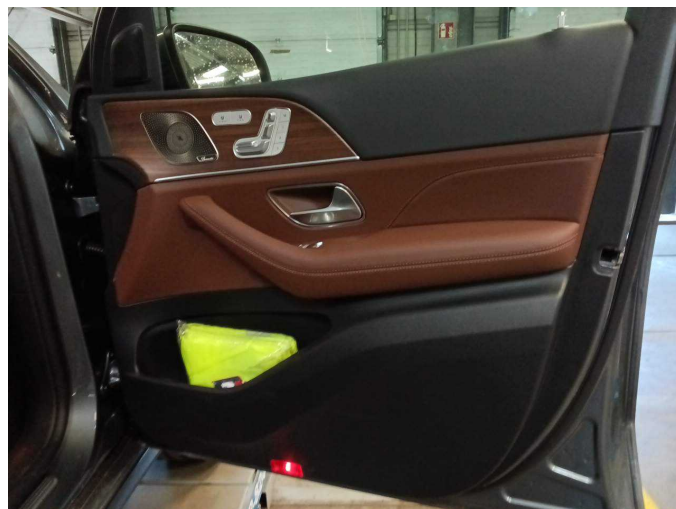


Damage 1: Trim / covers: Door trim - front right side - Scratch(es) - Smart repair




Damage 1: Trim / covers: Door trim - front right side - Scratch(es) - Smart repair



Damage 2: Tail light: Tail lamp - right side - Scratch(es) - Replace

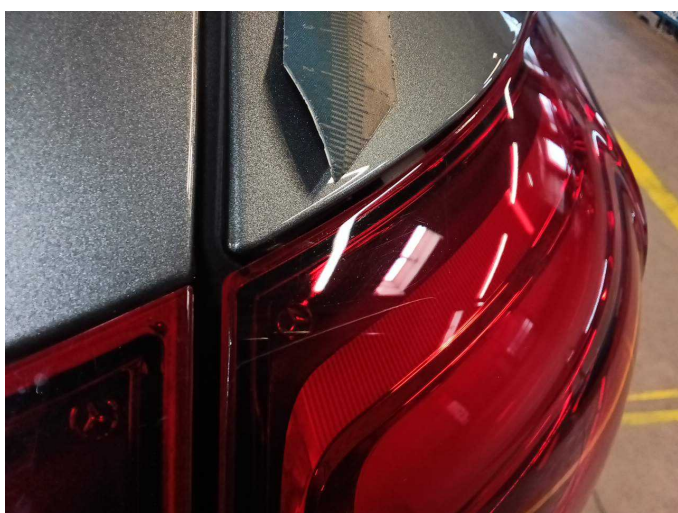


Damage 2: Tail light: Tail lamp - right side - Scratch(es) - Replace

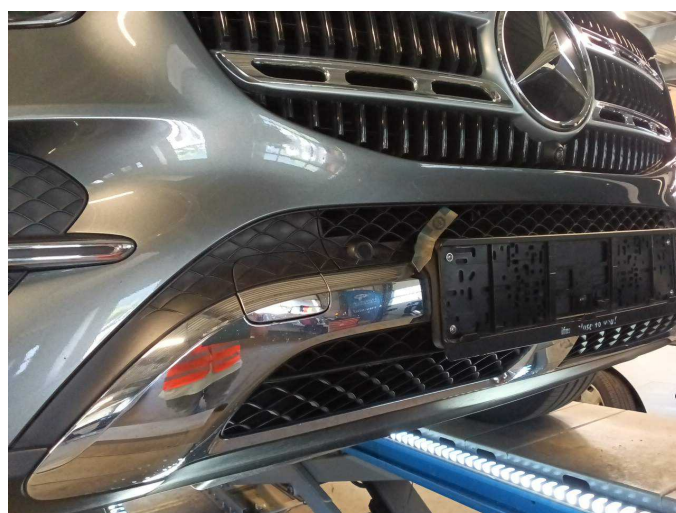

Damage 3: Front bumper: Spoiler - Scratch(es) - Replace



Damage 3: Front bumper: Spoiler - Scratch(es) - Replace

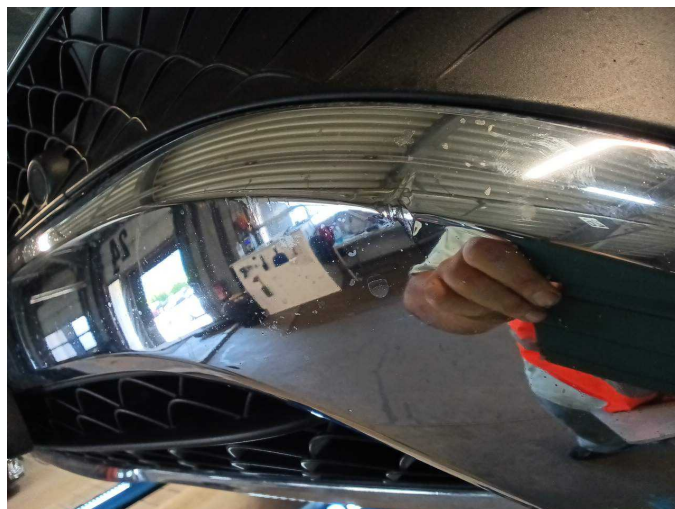


Damage 3: Front bumper: Spoiler - Scratch(es) - Replace



Damage 3: Front bumper: Spoiler - Scratch(es) - Replace



Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

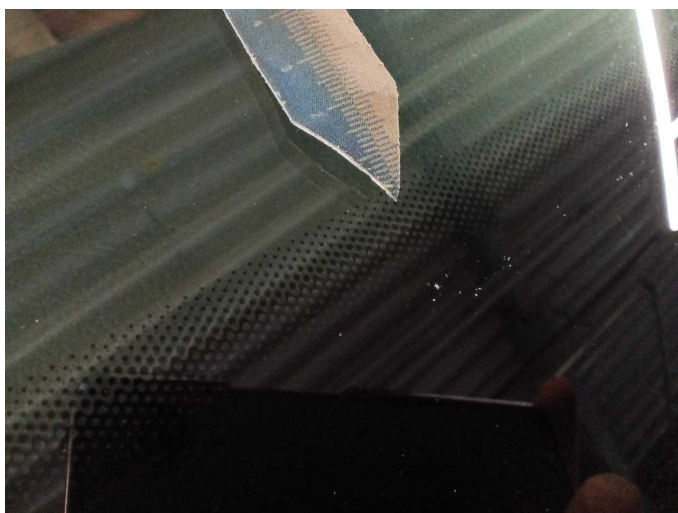

Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction



Wear and tear 2: Engine: Engine cowl - lower - Scratched - No deduction



Wear and tear 2: Engine: Engine cowling - lower - Scratched - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1NFB0GB9SB431626

Hersteller / Modell: MERCEDES-BENZ MB GLE 350 de 4Matic 9G-TRONIC Advanced

Datum	KM-Stand	Beschreibung
19.01.2026	23.573	Regelwartungsdienst