



Mercedes C: [redacted]

Vinnumber:	W1K2062541F047665	Versionname:	
First Registrationdate:	19/08/2022	Fiscalpower:	
Expertise Mileage:	115370	Power Kw:	
Bodytype:		Body colour	Blue
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	1329
Fueltype:	Hybrid Petrol		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Registration Certificate Home (BE)	Yes		

Options

Number of keys total	2	Seats electric F L	
Cruise Control		Seats electric F R	
Steering wheel multifunctional		Sun Roof electric	
Seats F heated		Panoramic roof	
Radio multimedia		Luggage cover	
Type of headlighting	Headlighting LED	Front parking sensors	
Type of GPS	GPS big screen color	Rear parking sensors	
Type of Lining	Lining artificial leather	Type of Tow bar	No Tow bar
Type of climate control	Autom climate control		
Sport seats			

Limited Technical Inspection

Tyres

225/45/18/98 Y				
Winter tyres:	Fr.L.	Kumho: 5 mm	Fr.R.	Kumho: 5 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 3 mm
Tyre profile depth FL				5
Tyre profile depth FR				5
Tyre profile depth RL				4
Tyre profile depth RR				3
Tyre size FL				225/45 R 18 98
Tyre size FR				225/45 R 18 96
Tyre size RL				255/45 R 18 99
Tyre size RR				255/45 R 18 99
Tyre type FL				Wint
Tyre type FR				Wint
Tyre type RL				Wint
Tyre type RR				Wint
Tyre make FL				248
Tyre make FR				248
Tyre make RL				26
Tyre make RR				26


Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	1		
Number of charging cables (rapid charge)	1		

Total cost ex VAT	3462,34
Interior, Damaged, Acceptable	0,00



Bonnet, Stone chip(s), Acceptable	0,00
-----------------------------------	------

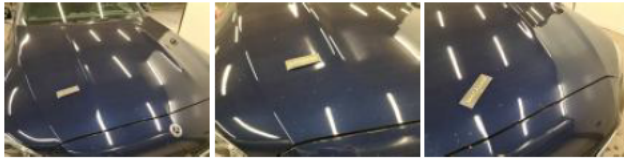

Wing RL, Chemical polution, Acceptable	0,00
--	------



Door seal RL, Broken, Replace	71,38
-------------------------------	-------



Tyre repair kit, Broken, Replace	0,00
----------------------------------	------



Bumper R, Broken, Replace and paint	1202,82
-------------------------------------	---------



Rear light R, Broken, Replace	320,44
-------------------------------	--------



Rear light R tailgate, Scratch(es), Replace	275,58
---	--------



Tailgate / Boot, Scratch(es), Repair and paint (complete)	422,44
---	--------



Rear window, Scratch(es), Replace	583,78
-----------------------------------	--------



Bumper moulding R, Missing, Replace	177,48
-------------------------------------	--------



Alloy rim FR polished, Scratch(es), Repair and paint (complete)	204,21
---	--------



Alloy rim RR polished, Scratch(es), Repair and paint (complete)	204,21
---	--------

