

## » Overview

**Order number:** 1002442125  
**Order completed:** 08.05.2026 15:19  
**Report number:** 10579653  
**VIN:** WVVZZZCD9PW018794



Front Left 3/4



Rear Right 3/4



Mileage

## » Vehicle Data

<b>Vehicle category:</b>	Passenger Car
<b>Vehicle type:</b>	Limousine
<b>Make:</b>	Volkswagen
<b>Model:</b>	Golf
<b>Manufacturers and type code:</b>	0603 / CNW
<b>Date of first registration:</b>	28.02.2023
<b>Mileage:</b>	60,982 km
<b>Proof of mileage:</b>	ReadOff
<b>Exterior colour:</b>	Mondsteingrau
<b>Roof colour:</b>	Mondsteingrau
<b>Propulsion:</b>	Front
<b>Fuel:</b>	Petrol
<b>Engine size (cc):</b>	1,500 ccm
<b>Performance:</b>	110 kW (150 PS)
<b>Length:</b>	
<b>Height:</b>	
<b>Width:</b>	
<b>Permitted total weight:</b>	
<b>Wheelbase:</b>	
<b>Number of powered axles:</b>	2
<b>Cylinders:</b>	4
<b>Euronorm:</b>	Euro 6
<b>Number of doors:</b>	5
<b>Number of seats:</b>	5
<b>Gearbox:</b>	Manual 6-speed
<b>Upholstery type:</b>	Lining fabrics
<b>Interior colour:</b>	Titanschwarz-Grau/Titanschwarz/Schwarz/Perlgrau
<b>Number of keys:</b>	2

## » Documents & Maintenance

<b>Statutory inspection date:</b>	07.2026
<b>Registration certificate available:</b>	Yes
<b>Registration certificate received:</b>	Yes
<b>License plate:</b>	None
<b>Maintenance book:</b>	Digital
<b>Maintenance:</b>	Not testable
<b>Maintenance last date:</b>	
<b>Maintenance last mileage:</b>	
<b>Remainder until next maintenance:</b>	650 Day(s)

"Active"	Disc brakes in front
"ACTIVE"	Disc brakes in rear
12-V outlet in luggage compartment	Diversity antenna for FM reception
2 LED reading lights in front and 2 in rear	Door and side trim panel
2 USB-C ports in the front, 2 USB-C charging sockets on the center console in rear, charging capacity up to 45 W	Driver alert system
3 head restraints in rear	Driver and front passenger airbag with front passenger airbag deactivation
30-color ambient lighting	Driving Mode Selection
3-point seat belt for center rear seat	Driving on the right
3-point seat belts for the outer rear seats	Dynamic headlight range control
3-point seat belts in front with height adjustment and seat belt pretensioners	Dynamic Road Sign Display
4 alloy wheels "Galway" 7J x 16, Black, diamond-turned surface	Electromechanical parking brake with Auto Hold function
4 all-season tires 205/55 R16	Electronic differential lock XDS
4-cylinder SI engine 1.5 l	Electronic engine sound
4-cylinder SI engine 1.5 l TSI, 110 kW	Electronic immobilizer
6+1 speakers	Electronic restriction of top speed
6-speed manual transmission	Electronic Stability Control and electromechanical brake booster
Activated carbon canister (Evaporative Emission Control System (EVAP))	Elimination of nameplate for engine designation on luggage compartment lid
Adaptive Cruise Control ACC stop & go incl. speed limiter	Emergency call service, 10-year contract duration as of initial delivery, condition: mob. phone network available
Air Care Climatronic 3 zone automatic climate control w/ allergen filter, enhanced air filter a. controls in rear	Emission standard EU6 AP
Alternator 140 A	Equipment options subset for Germany
App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto	Ext. mirrors, power-adjustable and heated, with memory feature and front passenger ext. mirror lowering function
Auto. Emergency Braking Front Assist with Pedestrian and Cyclist Monitoring	Extended pedestrian protection
Auto-dimming interior rearview mirror	Exterior mirrors: aspherical on driver side, convex on front passenger side
Automatic headlight control with LED separate daytime running light and entry and exit lighting	First aid kit, warning triangle and safety vest
Automatically-heated washer nozzles in front	Four-link suspension
Basic equipment variant	Front center armrest, height- and longitudinally adjustable
Battery 380 A (68 Ah)	Front seats with height adjustment
Body-colored bumpers, air intake with chrome fin	Front stabilizer bar
Body-colored exterior mirror housings and door handles	Front-wheel drive
Car2X	Fuel system for fuel-injected SI engine
Carpet mats in front and rear	Gearshift knob in leather
Chrome elements on power mirror and window regulator switches, chrome trims on the vents	Hatchback
Comfort equipment	Headliner
Comfort seats in front	Head-up Display
Cornering light and poor weather light	Heated front and outer rear seats
Curtain and side airbags in front and rear, center airbag	High-beam control Light Assist
Decorative inserts for special model	Illuminated door handle recesses
Digital radio reception DAB+	Illuminated vanity mirrors in sun visors
	Initial standard fuel filling

Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer	Rear shock absorption, basic version 1
IQ.DRIVE package without folding exterior mirrors	Rear spoiler
ISOFIX anchors for child seats on outer rear bench seats and on front passenger seat, compatible for i-Size	Rear stabilizer bar
Keyless Start without SAFELOCK	Rear view camera system
Laminated safety glass windshield, heat- and sound-insulating	Refrigerant R1234yf
Leather multi-function steering wheel, heated	Regional code " ECE " for radio
LED light unit in front footwell, selectable light color	Safety-optimized front head restraints
LED Plus headlamps	Seat trim covers for special model
LED Plus headlamps	Semi-automated driving assistance Travel Assist and lane keeping system Lane Assist
LED rear combination lamps	Service indicator 30 000 km or 2 years (variable)
Left-hand drive	Shock absorption in front
License plate carrier in front and rear (ECE)	Side airbags in front and rear incl. proactive passenger protection system
LongLife Service Regime	Smoker's package
Lumbar supports in front	Special identification label for EC for M1 passenger vehicles
Manual in German (Germany)	Standard battery/alternator capacity
Manual transmission MQ281	Standard climatic zones
Mobile phone interface "Comfort" with inductive charging feature	Standard curb weight range
Multi-color Digital Cockpit Pro, selection of different info profiles possible	Standard engine starter
Multifunction camera	Standard manufacturing sequence
Navigation system "Discover Pro" incl. Streaming & Internet	Standard paint coating
Navigation system "Discover Pro" incl. Streaming & Internet	Standard rear seat release
No special purpose vehicle, standard equipment	Standard roof
Non-folding front passenger seat backrest	Standard wheel bolts
Not hot country	Start-stop system with regenerative braking
Oncoming vehicle braking when turning and swerve support	Surround lighting with welcome light
Online service, with OCU, with head unit coding, without engine immobilizer interconnection	Suspension range 04 installation control only, no requirement forecast
Operating permit, alteration	Tailgate/trunk lid unlocking from outside
Operating voltage 12 V	Tire Mobility Set: 12-volt compressor and tire sealant
Park Assist with Park Distance Control	Tire Pressure Monitoring System
Parking heater and ventilation with radio remote control and timer	Tire suppliers for EU countries
Part set without country-specific prescriptive standard	Tool kit
Pedals in brushed stainless steel	Two-tone horn
Preparation for We Connect and We Connect Plus	Type approval country Germany
Privacy glass for rear side windows and rear window	Unsplit rear bench seat, asymmetric split folding backrest, with center armrest
Proactive passenger protection system in combination with Front Assist	UWB-capable country and carrier frequency, 433.92 to 434.42 MHz
Progressive steering	Vehicle class differentiation -5H0-
Radio	Vehicle repurchase
Rain sensor	Vehicles without special upgrade measures
Rear exhaust tailpipe (standard)	Voice control
Rear floor panel module, type 1	Warning signal and warning light for front and rear seat belts not fastened
Rear fog light on one side, back-up light on both sides	Weight range 3 installation control only, no requirement forecast

## Wheelbase

Winter package "Premium" incl. parking heater

Without additional decorative trims

Without additional front underbody guard

Without additional tires

Without alternative drive system

Without charging cable

Without decals and emblems

Without electric motor (hybrid)

Without fire extinguisher

Without headlamp washer system, with washer fluid level indicator

Without heat accumulator/auxiliary heater

Without hill start assist/hill descent control/comfort driving assist

Without lane change assist

Without locking and starting systems

Without mode 3 charging cable

Without partition

Without preparation for rotating beacon/siren combination

Without preparation for two-way radio installation

Without roof rails

Without seat ventilation/massage seat

Without second battery

Without special body measures

Without surface protection, with additional transport protection measures

Without trailer hitch

## » Tyres

### MOUNTED TYRES

Make	Location	Position	Type	Rim	Dimensions	Profile depth
Imperial	Front	Left	All season	Aluminium	205/55 R 16 91 H	4.0 mm
Imperial	Front	Right	All season	Aluminium	205/55 R 16 91 H	4.0 mm
Michelin	Rear	Left	All season	Aluminium	205/55 R 16 94 V	6.0 mm
Michelin	Rear	Right	All season	Aluminium	205/55 R 16 94 V	6.0 mm

**Permitted:** Yes

**Roadworthy:** Yes

### SPARE/EMERGENCY TYRE & ACCESSORIES

**Toolkit present:** Yes

**Repair kit present:** Yes

**Repair kit expiration date:** 10.2026

**Compressor present:** Yes

## » Devaluation Factors

Nr	Location	Damage type	Repair type
1	Alloy rim RL polished	Deviation from delivery condition/scope	Replace Safety relevant damage
2	Preparationtime metal painting	Paint preparation	Execute
3	Inner door sill RR	Dent(s) and scratch(es)	Repair and paint (complete)
4	Brand badge F	Deviation from delivery condition/scope	Replace
5	Steering wheel	Scratch(es)	Smart repair LEATHER
6	Door RR	Dent(s) and scratch(es)	Spot repair
7	Engine protection plate	Broken	Replace
8	Side wall RL	Bad repair	Polish

## » Usage Damages

Nr	Location	Damage type	Repair type
1	Windscreen	Stone chip(s)	Acceptable
2	Bumper spoiler F	Scratch(es)	Acceptable
3	Mirror side repeater L	Crack	Acceptable
4	Tailgate / Boot	Dent(s)	Acceptable
5	Tyres	Worn	Acceptable

## » Commercial devaluation

<b>Known previous damages:</b>	No
<b>Previous damages detectable:</b>	No
<b>Repainting present:</b>	Yes
<b>Repainting professionally executed:</b>	Yes
<b>Paint thickness measurement performed:</b>	Yes - with abnormalities/deviations

### PAINTTHICKNESS MEASUREMENT RESULTS

Part	Paint (µm)
Paint thickness Wing RL (µm)	198.0
Paint thickness Wing RR (µm)	197.0

At least 3 measurements were carried out per component.

**» Notes On The Assessment****Details of the assignment and the scope of the assessment:**

The order was placed to prepare a condition report on the described vehicle.

The vehicle condition assessment was carried out in accordance with the order on the basis of the standards for vehicle assessments specified by the client. The expert makes the findings in the individual case on the basis of his own expertise and at his own expert discretion.

**Vehicle identification:**

WVWZZZCD9PW018794

VIN checked and matches documentation

**Vehicle condition:**

Well maintained general condition

**Inspection condition:**

Sufficient

**Lifting platform/lifting equipment used:**

Yes

**Testdrive carried out:**

No

**Engine test carried out:**

Yes


» **Remarks**

This copy was generated electronically. It is valid without an original signature.

## » Commercial Pictures




Front Left 3/4

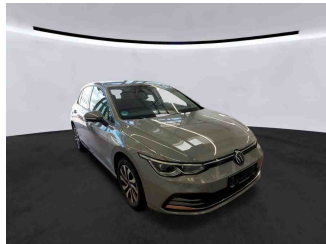

Front Right 3/4




Rear Left 3/4

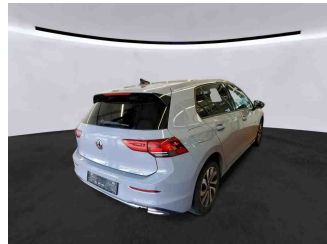

Rear Right 3/4




Mileage

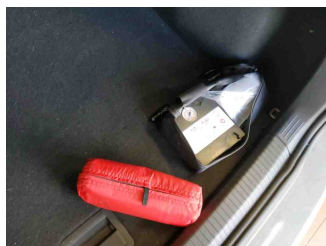

Tools




Sill outer L

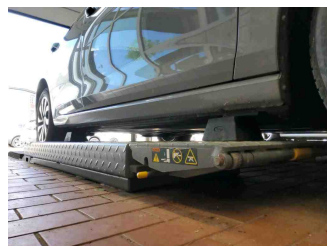


Sill outer R




Chassis nr

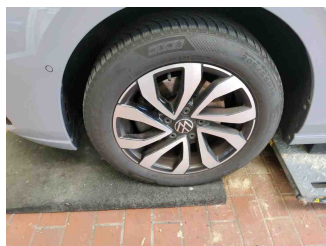


Wheel FL

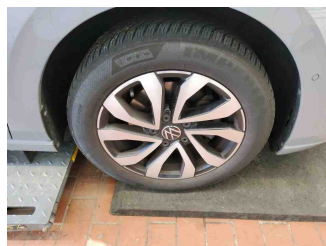

Wheel FR

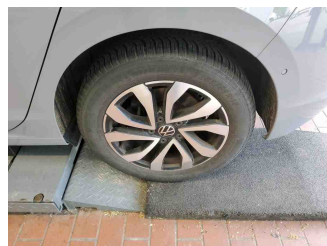


Wheel RL

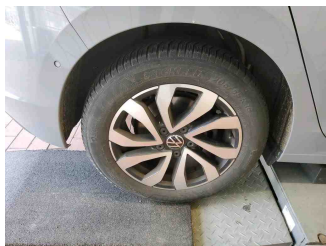


Wheel RR



Central console

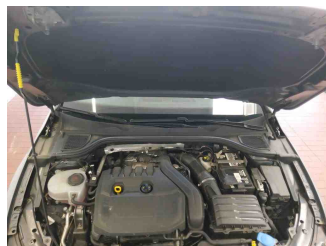


Engine compartment

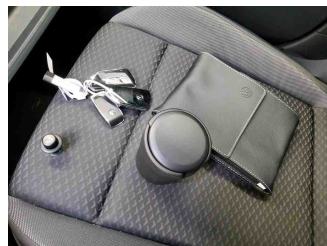


Documents




Interior arrangement

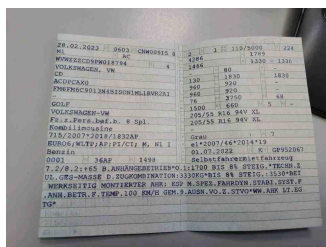


Registration Certificate

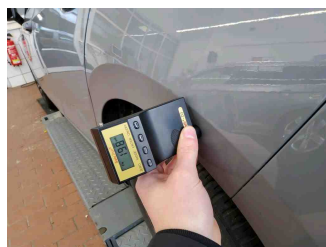


Paint thickness Wing RL

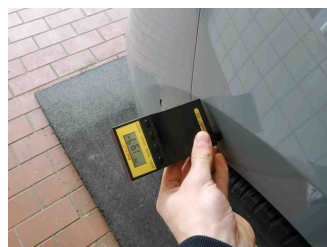


Paint thickness Wing RR

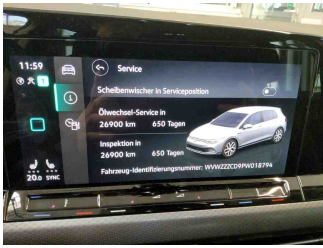


History Maintenance

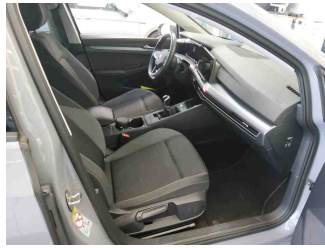

Interior - front

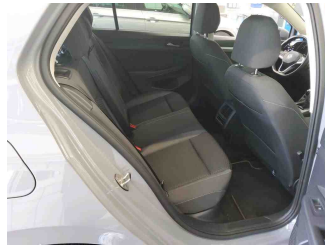


Interior - rear

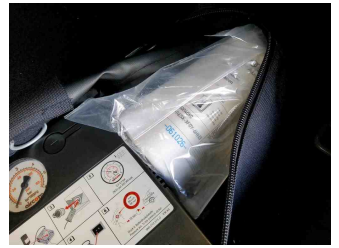

Tirefit expiration date



Underbody scan

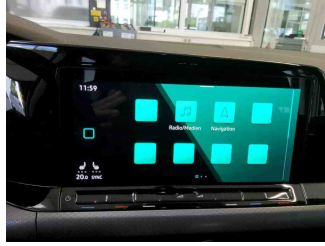




GPS/Radio

## » Devaluation Damages

### DEVALUATION FACTORS


1 - Alloy rim RL polished - Deviation from delivery condition/scope - Replace  
Safety relevant damage

Comment	Oberfläche nachgearbeitet, beginnende Oxidation.
---------	--

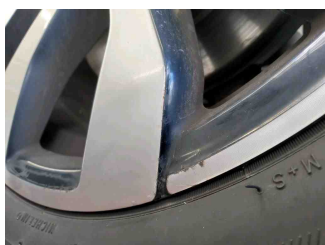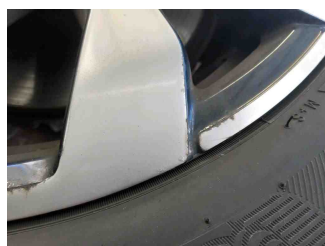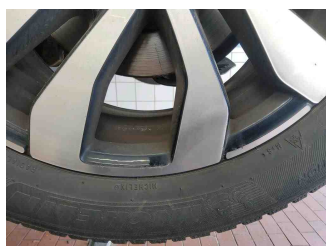


2 - Preparationtime metal painting - Paint preparation - Execute

3 - Inner door sill RR - Dent(s) and scratch(es) - Repair and paint (complete)

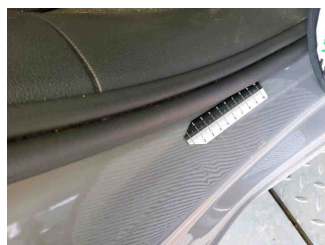


4 - Brand badge F - Deviation from delivery condition/scope - Replace

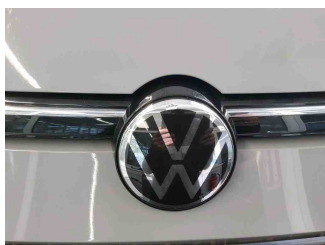

5 - Steering wheel - Scratch(es) - Smart repair LEATHER



6 - Door RR - Dent(s) and scratch(es) - Spot repair

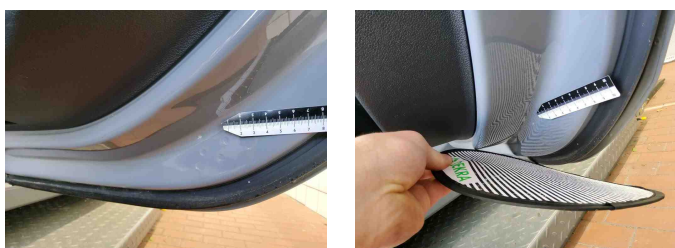

7 - Engine protection plate - Broken - Replace



8 - Side wall RL - Bad repair - Polish

Comment	Kratzer fachgerecht schleifen und polieren.
---------	---



## USAGE DAMAGES


1 - Windscreen - Stone chip(s) - Acceptable



2 - Bumper spoiler F - Scratch(es) - Acceptable



3 - Mirror side repeater L - Crack - Acceptable

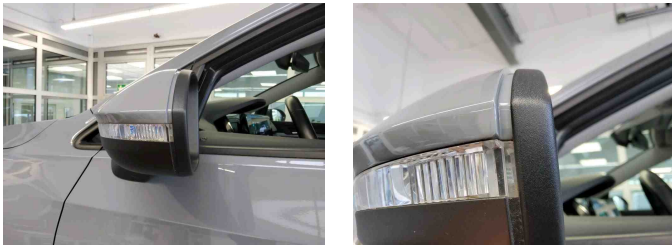

4 - Tailgate / Boot - Dent(s) - Acceptable



5 - Tyres - Worn - Acceptable

Comment

Reifen Vorderachse, Außenflanken stärker verschleifen, Luftdruck prüfen.

