



Expertise

Protocol number: 46638759
Order No. / Reference: 26685691
Inspection date: 22 Jul 2026

Manufacturer: Audi

Model: A6 Avant 45 TFSI quattro S tronic design

VIN: WAUZZZF25PN064135



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A6 Avant 45 TFSI quattro S tronic design	
Vehicle Identification number	WAUZZZF25PN064135
Mileage (Read)	48,540 km
First registration	30 May 2023
Number of holders	1
Fuel type	Hybrid Petrol / E
Engine displacement / Cylinder	1,984 ccm / 4
Power	195 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Station wagon
Colour / colour code	Brillantschwarz (Y9B)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	-3,600 km
Last service on / at	11/2024 at 26,854 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS545015
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0588 / BVY 01237		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,405 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R18 103V	Winter tyres on Light alloy	Goodyear	7mm / 7mm
2)	225/60 R18 103V	Winter tyres on Light alloy	Goodyear	7mm / 7mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	225/55 R18 102Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- "quattro" all-wheel drive with ultra technology
- Audi connect navigation & infotainment
- Audi drive select
- Audi pre sense front
- Exterior mirror housings in body color
- Fabric headliner
- Decorative inlays aluminum fragment
- Door sills with aluminum inlay front and rear
- Driver information system with color display
- Luggage compartment lid, electrically opening and closing
- Transmission: S tronic 7-speed
- Interior mirror dimming
- Interior elements in faux leather above
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Paint finish: Solid
- Steering wheel: Double-spoke leather steering wheel with multifunction and paddle shifters
- MMI navigation with MMI touch response
- Ambient lighting package
- Non-smoking package
- Wheel: Alloy wheels, multi-spoke design
- Wheel: Tire repair kit
- Radio accessories: 8 speakers (passive) front and rear
- Seat covers in Essenz/mono.pur 550 fabric combination (for standard seats)
- Sun visor on driver and passenger side
- Start-stop system
- Glazing: Rear window, rear door and side windows in clear glass
- Central locking
- Airbag: Front side airbags and head airbag system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service m.connect remote & control
- Electrically adjustable and heated exterior mirrors
- third brake light
- Aluminum roof rails
- Tachometer
- Electronic Stability Control (ESC)
- key fob
- Cruise control system including speed limiter
- Interior lighting
- Instrument panel and door trim, two-piece, single/multi-color
- 2-zone automatic climate control
- Headrests (4)
- LED headlights
- Steering column, manually adjustable in height and axis
- front center armrest
- Otto particulate filter
- Package Gloss
- Progressive steering
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus with MMI touch response
- Rail system with fixing set
- Seats: Standard front seats
- Seats: Split-folding rear seat backrest Avant
- Lane Departure Warning
- Glazing: Windscreen in heat-insulating glazing
- Electronic immobilizer
- Thermal insulation glazing on the sides and rear



Extra equipment

- Audi virtual cockpit plus (3 individual display options: Dynamic, Sport and Classic - operation via the multifunction steering wheel - configuration of on-board computer values in the tachometer - display of the navigation map as a 3D terrain model on the high-resolution 12.3-inch full HD color display - permanent display of navigation information in the speedometer area when route guidance is active - break recommendation)
- Black fabric headliner
- Deletion of model designation and performance/technology lettering
- High beam assist (within the system's limits, it automatically detects oncoming headlights, taillights of other road users, and built-up areas. Depending on the traffic situation, the high beam is automatically switched on or off.)
- Fuel tank (73 liters) (fuel tank for 73 liters of gasoline/diesel fuel)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus, shift paddles and steering wheel heating (height and distance of the steering wheel are manually adjustable - leather of the steering wheel and gear selector knob is color-matched to the selected color of the dashboard top - 12 multifunction buttons for convenient operation of the available infotainment features - shift paddles for manual changing of the driving modes)
- Business Package (Assistance Package Tour: Adaptive Driving Assistant supports the driver with acceleration, braking, maintaining speed and distance, and lane keeping. Adaptive Cruise Control, Speed Limiter. Efficiency Assistant supports the driver with predictive driving. Parking Aid Plus, 4-zone automatic climate control, heated front seats, Audi phone box, automatically dimming interior mirror, automatically dimming exterior mirrors, adaptive windscreen wipers with integrated washer nozzles, high-beam assistant)
- Wheel: 10-arm aero-design alloy wheels, graphite grey, polished (8 J x 18 with 225/55 R 18 tires)
- Radio accessories: Audi sound system (10 speakers including center speaker and subwoofer - 6-channel amplifier - total output of 180 watts)
- Telephone: Audi Phone Box (Up to two smartphones can be paired with the vehicle simultaneously via Bluetooth, allowing you to play music through the vehicle or make phone calls from either smartphone. The universal smartphone holder connects to the vehicle's antenna, improving both reception and call quality. The smartphone can also be charged wirelessly using the Qi standard or via USB.)
- Glazing: Sun protection glazing, tinted (rear window, rear door and side windows tinted)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for the passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles, aspherical mirror glass. The curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, providing the driver with a better view of the curb.)
- Decorative inlays aluminium fragment in conjunction with Audi design selection (for dashboard, door panels and center console; including aluminum-look trim)
- Comfort key with sensor-controlled luggage compartment unlocking including anti-theft alarm system (The vehicle can be opened by operating the door handle without actively using the key. To lock the vehicle from the outside, simply touch one of the sensor buttons on the door handles. The drive authorization is also activated without actively using the comfort key. The driver must be inside the vehicle and have the comfort key with them. The engine is started and stopped using the engine start/stop button in the center console.)
- Assistance Package Plus (Parking Assistance Package with Remote Parking Assist Plus (surround view cameras, Remote Parking Assist Plus) - City Assistance Package (Intersection Assist, Lane Change Warning, Exit Warning, Rear Cross Traffic Assist, Audi pre sense 360°) - Tour Assistance Package (Adaptive Driving Assist, Adaptive Speed Assist, Speed Limiter, Efficiency Assist, Turn Assist, Evasive Steering Assist, Camera-based Traffic Sign Recognition, Emergency Assist, High Beam Assist))
- Parking assistant with parking aid plus (The parking assistant supports parking maneuvers by making suitable steering corrections. Ultrasonic sensors search for suitable parallel and perpendicular parking spaces. For perpendicular parking spaces (forwards and backwards), the ideal parking path is calculated; for parallel parking spaces, the ideal entry and exit paths are calculated. The system takes over the steering. The driver only needs to follow the instructions on the display to change gears, accelerate, brake, and monitor the parking process.)
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and sport seats plus also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- Telephone: Audi smartphone interface (The Audi smartphone interface (Android Auto and Apple CarPlay) connects your smartphone to your Audi and seamlessly displays your smartphone content directly on the MMI display via USB. Navigation, telephony, music and selected third-party apps can be conveniently controlled via the MMI touchscreen as well as via voice control on your smartphone.)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair
3	Vehicle glazing	Windscreen - Stone chips - Smart repair
4	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
5	Misc.	Inspection / maintenance - Due - Perform
6	Side panel - rear left side	Side panel - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Side panel - Scratch(es) - No deduction
2	Bonnet	Bonnet - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Roof, Front, Provided by user / customer, from 8 Jun 2024	5.381,04 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der montierte Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

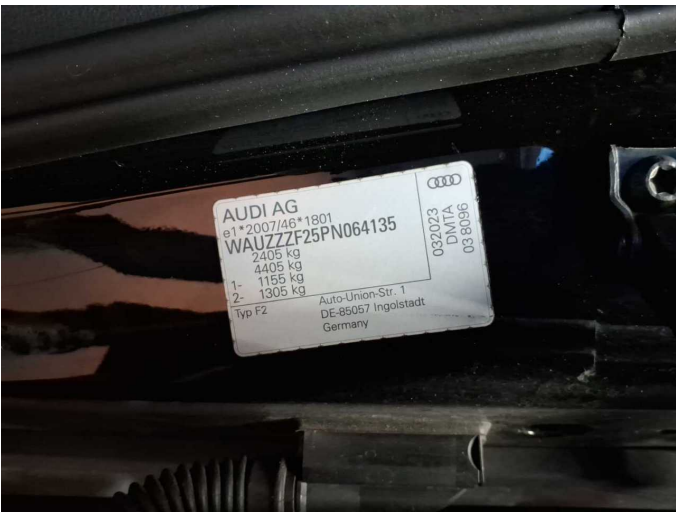


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

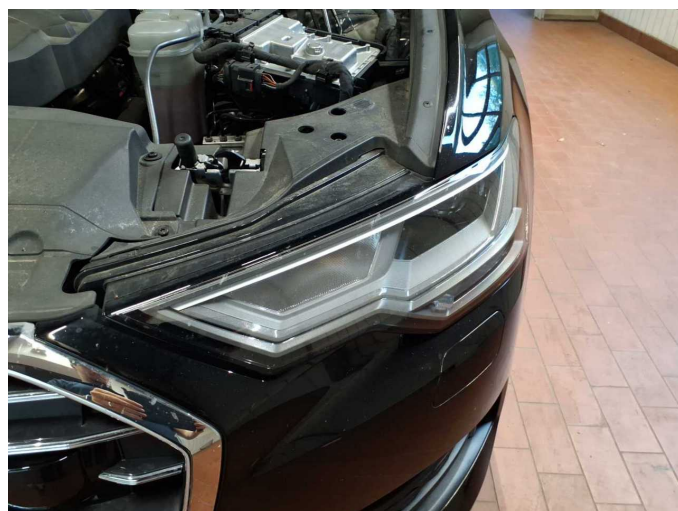


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

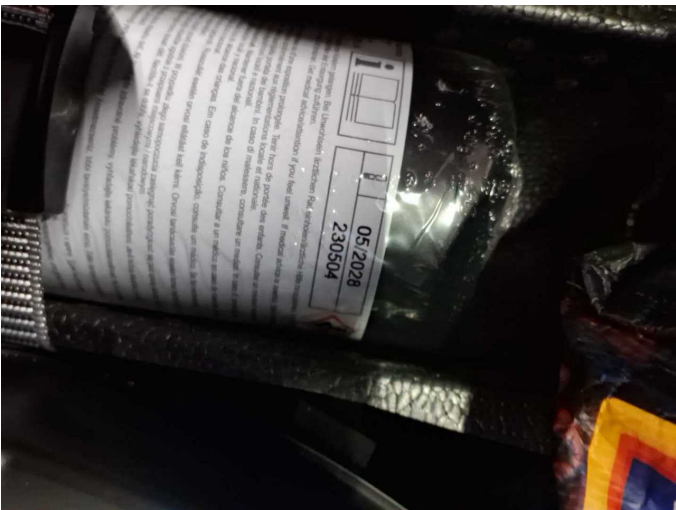


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

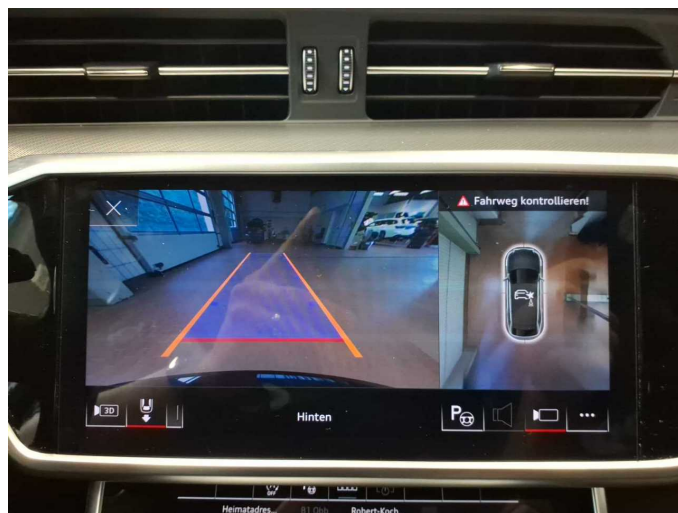


Figure 28: Misc.



Figure 29: Misc.

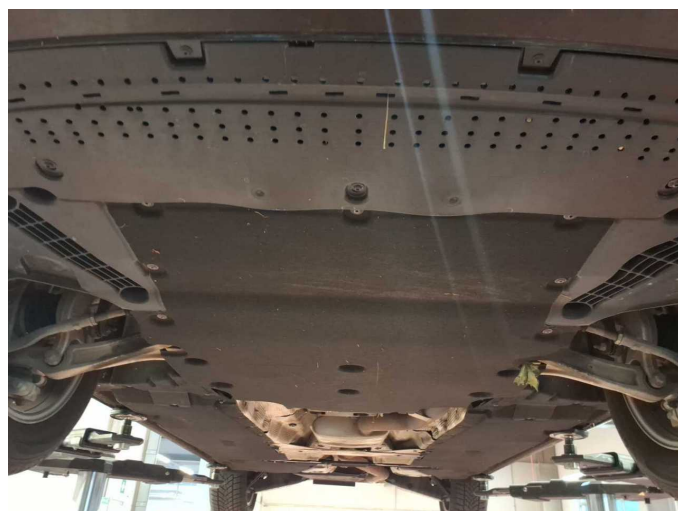



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.

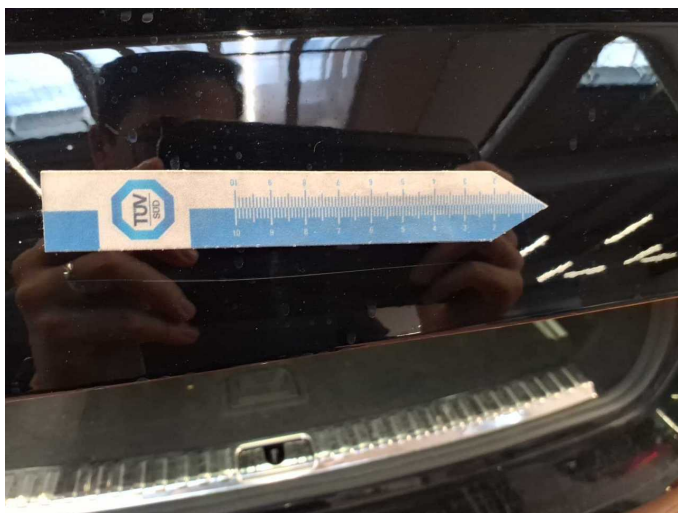

Damage 1: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

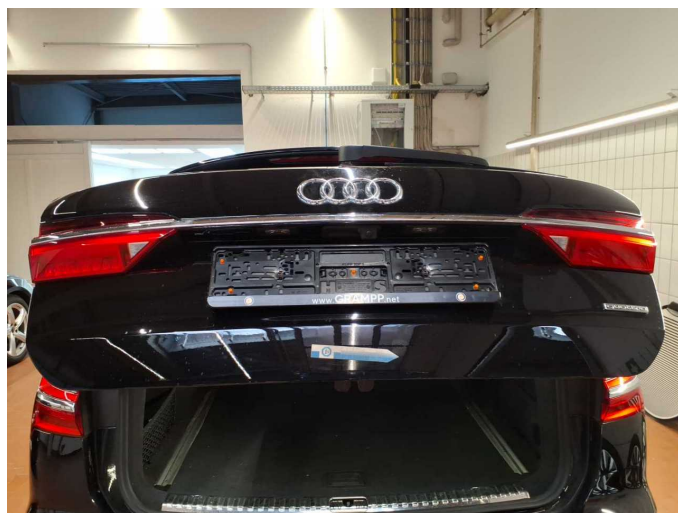

Damage 1: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Vehicle glazing: Windscreen - Stone chips - Smart repair

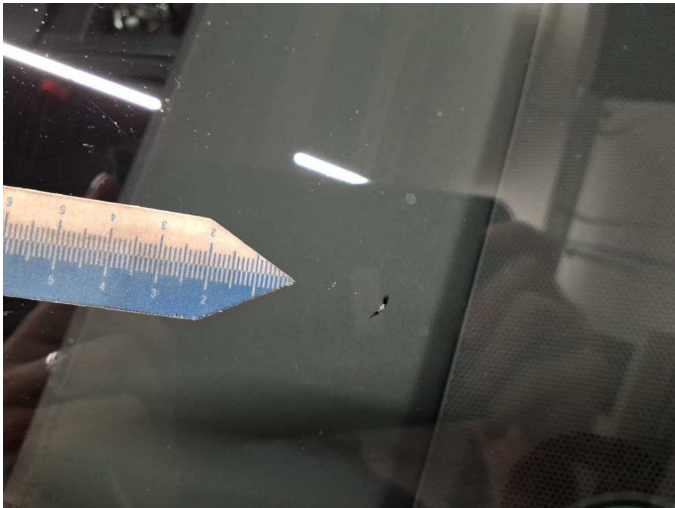


Damage 3: Vehicle glazing: Windscreen - Stone chips - Smart repair




Damage 3: Vehicle glazing: Windscreen - Stone chips - Smart repair



Damage 4: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

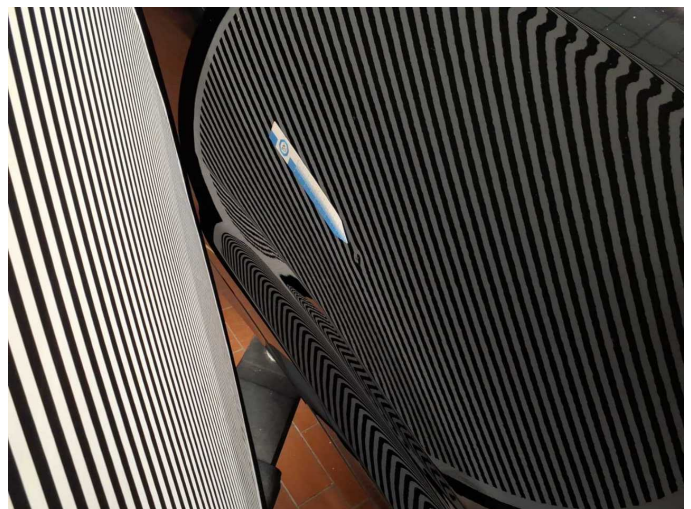

Damage 4: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

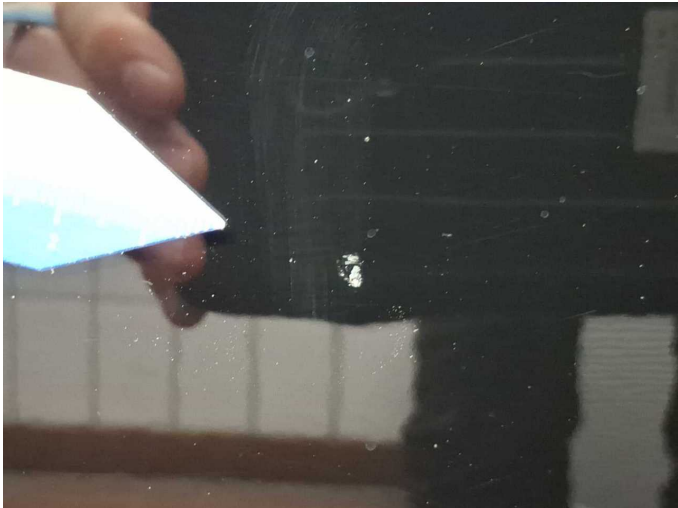

Damage 4: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 5: Misc.: Inspection / maintenance - Due - Perform



Damage 6: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 6: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 6: Side panel - rear left side: Side panel - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF25PN064135

Hersteller / Modell: AUDI AUDI A6 Avant 45 TFSI quattro S tronic design

Datum	KM-Stand	Beschreibung
05.12.2025	38.387	Bremsflüssigkeit; Bremsflüssigkeit ern
25.11.2024	26.854	Motoröl b. Wartung; Regelwartungsdienst