



Expertise

Protocol number: 46121644
Order No. / Reference: 26443239
Inspection date: 23 Jun 2026

Manufacturer: Ford

Model: S-Max 2.0 EcoBlue Aut. TITANIUM

VIN: WF0JXXWPCJNY73082



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford S-Max 2.0 EcoBlue Aut. TITANIUM	
Vehicle Identification number	WF0JXXWPCJNY73082
Mileage (Read)	96,957 km
First registration	22 Mar 2022
Number of holders	1
Next periodical technical inspection	03/2027
(Report on hand)	
Power / Engine displacement	110 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Obsidian-Schwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	10,000 km
Last service on / at	07/2025 at 88,857 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH427192
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BKM 01185		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,555 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	235/55 R17 103V	Winter tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	235/55 R17 103V	Summer tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartments (illuminated glove compartment - map pockets on the driver's and passenger's seat backrests)
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated turn signals and ambient lighting and electrically foldable)
- Attachment points for safety partition grilles (attachment points 2nd row of seats)
- Hill start assist
- third brake light
- Roof rails "aluminum look"
- Diesel particulate filter (DPF)
- Tachometer
- Driver information system display 25.4 cm color (on-board computer with fuel consumption and mileage information as well as outside temperature display)
- Electric front and rear windows (with anti-pinch protection and automatic opening and closing function)
- High Beam Assist
- Ford Easy Fuel (The Ford Easy Fuel convenience refueling system eliminates the need for a separate internal fuel filler cap and prevents misfueling by detecting the size difference between petrol and diesel nozzles. The filler neck only opens when the correct fuel is used.)
- Luggage compartment cover (removable)
- Cruise control system with intelligent speed limiter (interior mirror, automatically dimming - traffic sign recognition system)
- rear window wiper
- Interior mirror, automatically dimming
- Isofix mounting (on all seats in the 2nd row)
- Electric child safety lock
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Steering wheel: Steering column, adjustable in height and reach
- Steering wheel: Multifunction leather steering wheel
- Front center console with padded armrest (storage compartment and 2 cup holders)
- Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect (communication and entertainment with voice control - Android Auto, Apple CarPlay - Bluetooth hands-free system and audio streaming - eCall emergency call system - live traffic - Wi-Fi hotspot - radio/CD player, 2 USB ports, 8 speakers, steering wheel controls - 20.3 cm screen - DAB/DAB+ - acoustic and visual route guidance, dynamic navigation, lane keeping assist, road map for Europe - extended voice control and voice output - Michelin travel guide for Europe - quick address search)
- Upholstery: Cloth
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Ambient lighting in the front (including door storage, front door handle and footwell lighting)
- Anti-lock braking system (ABS) (with Electronic Stability Program (ESP), Roll Stability Control (RSC) and Traction Control System (TCS))
- Attachment points for safety partition grilles (attachment points 1st row of seats)
- Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires (in 5x2-spoke design)
- Overhead console (with glasses storage compartment and fold-out additional mirror for eye contact with rear passengers)
- Electronic Shifter
- Lane Assist including Lane Keeping Assist and Driver Alert (warns the driver of an unintentional lane change via short steering wheel vibrations (without activation of the turn signal) - additionally, active steering support assists in returning to the lane)
- Electronic parking brake
- Ford EasyFold: 2nd row seat backrests fold down electrically at the touch of a button.
- Ford Power Start function (keyless start)
- Ford Power Start function with Ford Key Free system (keyless starting and locking/unlocking)
- Luggage compartment lighting
- Transmission: 8-speed automatic transmission (with manual shift option)
- Back window, heater
- Interior lighting with delay circuit
- Intelligent Protection System (IPS): - Front headrests, 4-way height and tilt adjustable - Front airbag for driver and front passenger - Driver's knee airbag - Head and shoulder airbags, front and for 2nd row of seats - Side airbag for driver and front passenger - Side airbag for outer rear seats of the 2nd row - Seat belt tensioners and belt force limiters, front - 3-point seat belts on all seats, height adjustable in the front)
- Front and rear reading lights (with LED technology)
- MyKey key system (individually programmable second key) (setting options include: - Limiting the maximum speed and radio volume (to max. volume 15 out of 32) - Speed warning (when the set speed limit is exceeded) - Safety assistance systems cannot be deactivated - Extended warning system for unfastened seat belts)
- Fog light
- Emergency brake light (pulsating illumination of the brake lights during hard braking)
- Package: Winter (Heated windscreen - Heated leather steering wheel - Individually and variably heated front seats)
- Front and rear parking pilot system
- Tire repair kit (for use at a maximum speed of 80 km/h)
- LED taillights
- Headlight dipped beam with switch-off delay including "greeting function"



- Electro-mechanical power steering (EPAS - Electric Power Assisted Steering)
- Seats: Flexible seating system "FoldFlatSystem (FFS)" (2nd row of seats with 3 individual seats - adjustable longitudinally - seat backrests adjustable for tilt and individually foldable - headrests retractable)
- Power outlet: 12-volt connection in the luggage compartment and in the center console
- LED daytime running lights
- Traffic sign recognition system
- Lashing eyes in the luggage compartment
- Immobiliser
- Central locking with remote control (remote luggage compartment release - second folding vehicle key)

Extra equipment

- Detachable towbar (including ESP trailer stabilization)
- Paint finish: Metallic
- Rear leveling system, automatic
- Side windows from the 2nd row of seats and rear window, dark tinted.

- Seats: Driver and front passenger seats, 4-way manually adjustable (including manually adjustable lumbar support)
- Seats: Front sports seats (with enhanced lateral support)
- Seats: Front seats can be heated individually and variably.
- Start-stop system
- 230 volt socket
- Bumpers painted in body color
- Trays on the front seatbacks
- Premium carpet floor mats front and rear (as well as in the 3rd row of seats if ordered as an optional extra)
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats (as well as the 3rd row of seats if ordered as an optional extra)
- Cigarette lighter (and ashtray in the center console)

- Package: Business III (Automatic) (Sony Navigation incl. Ford SYNC 3, AppLink, Touchscreen, Voice Control, Radio/CD Player, MP3-compatible, 2 USB ports, 390-watt premium sound system, 12 speakers, steering wheel remote control, Bluetooth hands-free system, FordPass Connect, eCall, DAB/DAB+, Adaptive LED headlights with glare-free high beam, ACC, Traffic Jam Assist, Pre-Collision Assist, Forward Collision Warning, Emergency Brake Assist, Front and Rear View Camera, Blind Spot Assist, Cross Traffic Alert, Dynamic Distance Control, Power Tailgate with Sensors, Ford Key Free System, Park Assist)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
3	Sill - right side	Sill - dent(s) - Smart repair
4	Door - rear left side	Door - Scratch(es) - Smart repair
5	Door - front left side	Door - Scratch(es) - Smart repair
6	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
7	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
8	Rear bumper	Spoiler (Rechts) - Scratch(es) - Smart repair
9	Bonnet	Bonnet (Verätzungen-Mehrkosten möglich) - Paint defect - Conditioning
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Boot lid / rear door	Boot lid (+ Korrosion an Heckklappe) - Scratch(es) - Paint
12	Front bumper	Spoiler (Mit Blende / Loch) - Deformed - repair according to calculation

Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Side panel - Scratch(es) - No deduction
2	Interior	Interior - Abrasion - No deduction
3	Body	Underbody - Corrosion - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 12 Nov 2022	2.686,93 €
2	Front, Provided by user / customer, from 20 Nov 2022	5.481,63 €

Accident damages

No.	Accident
1	Side right

Paint coat thickness measurement

Boot lid / rear door	108 µm	Bonnet	97 µm
----------------------	--------	--------	-------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Das Fahrzeug weist der Laufzeit entsprechende Gebrauchsspuren auf.

Winter - Radsatz ist kein Bestandteil des Lieferumfangs.

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung, Mehrkosten und somit Abweichung der für die Stoßstange ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

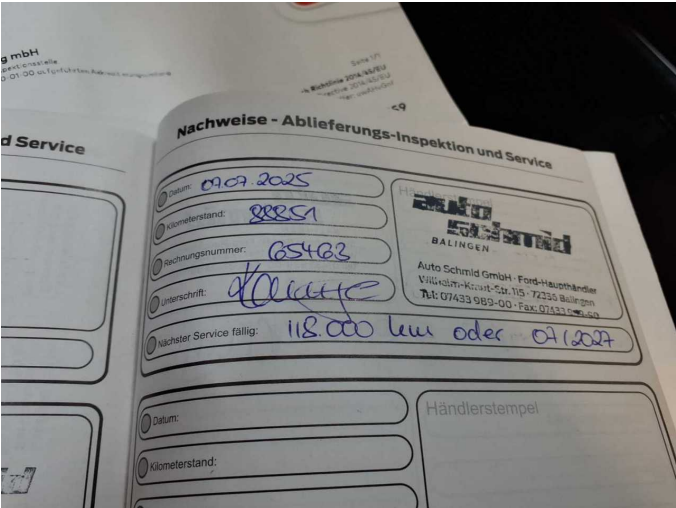


Figure 13: Documents

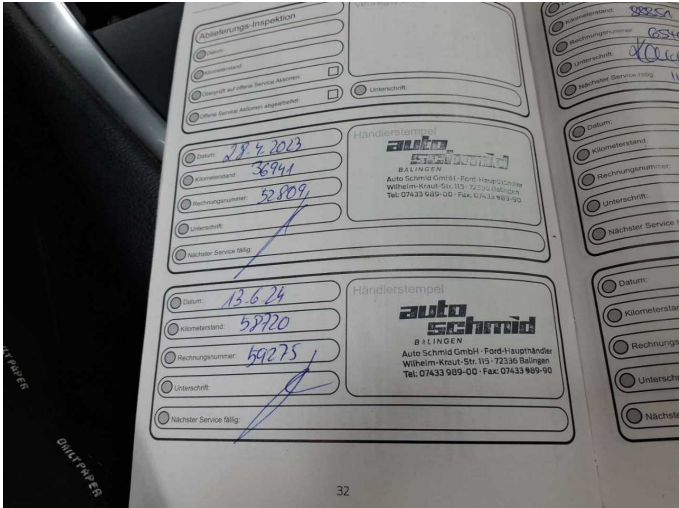


Figure 14: Documents

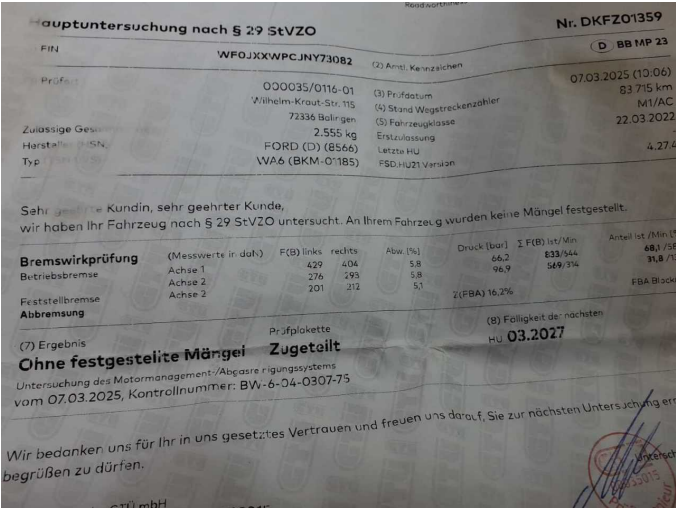


Figure 15: Documents

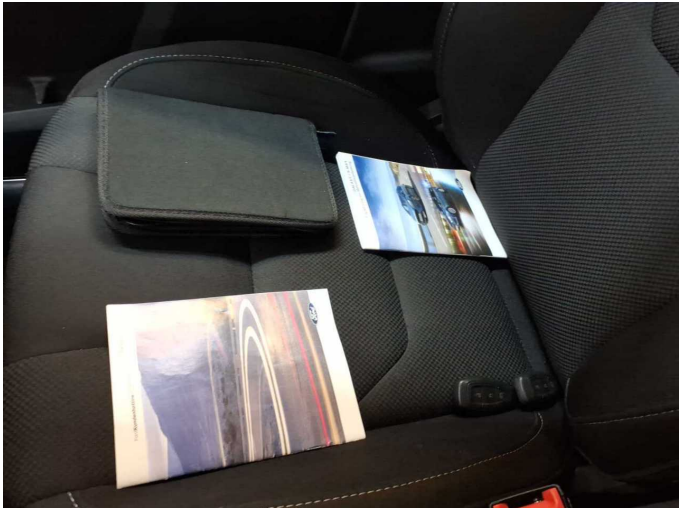


Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

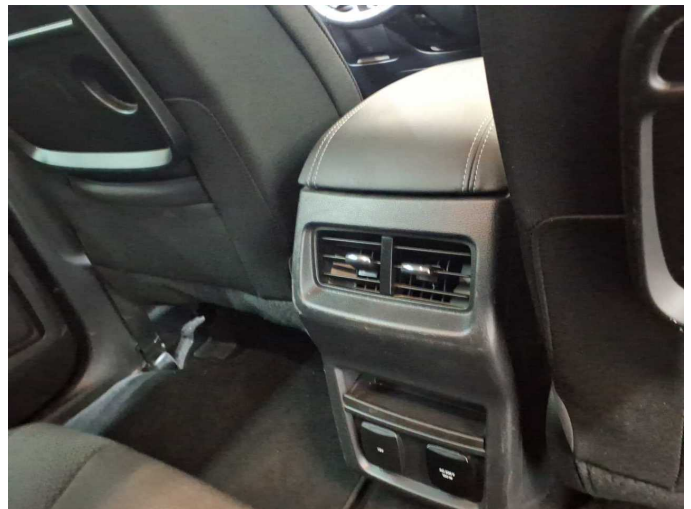


Figure 28: Misc.

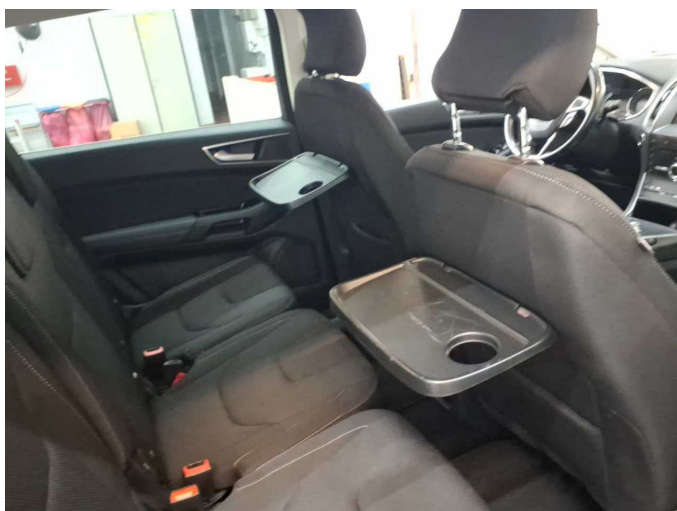


Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

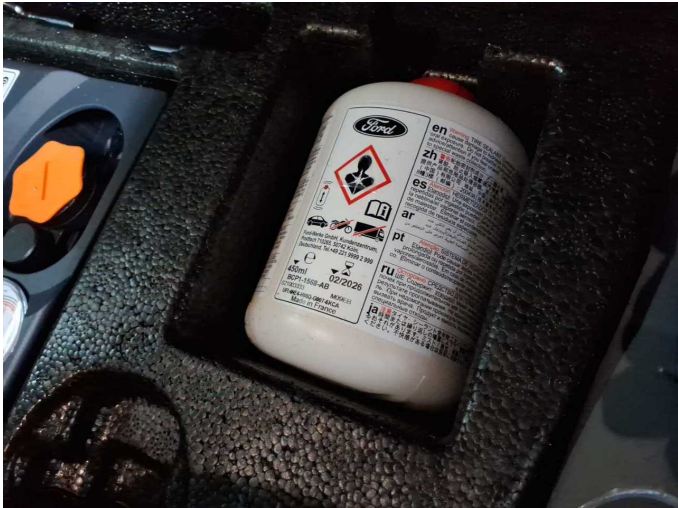

Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value




Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value




Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value

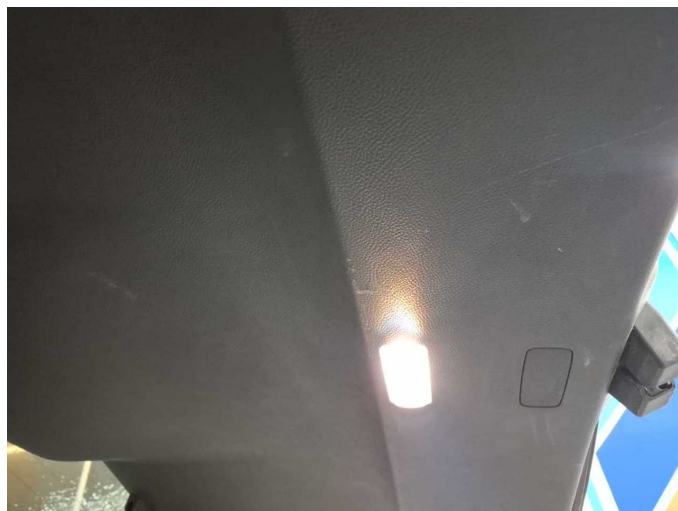


Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value

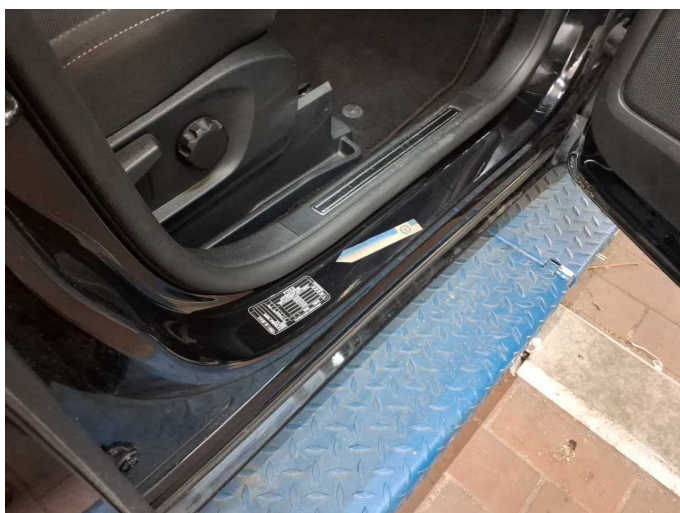


Damage 3: Sill - right side: Sill - dent(s) - Smart repair

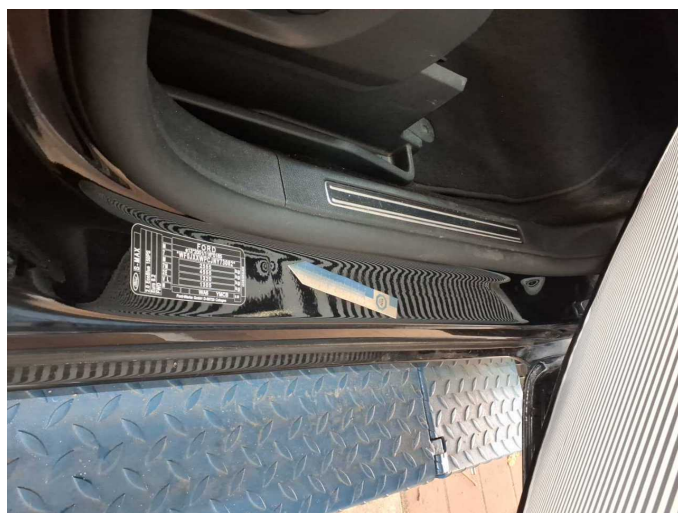

Damage 3: Sill - right side: Sill - dent(s) - Smart repair

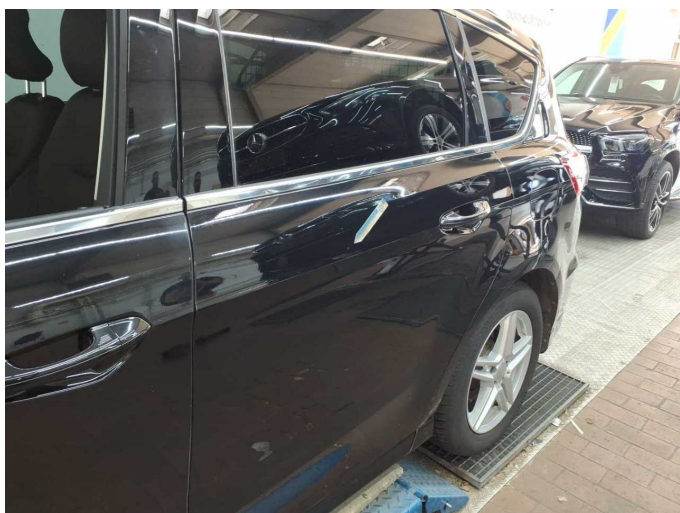

Damage 4: Door - rear left side: Door - Scratch(es) - Smart repair

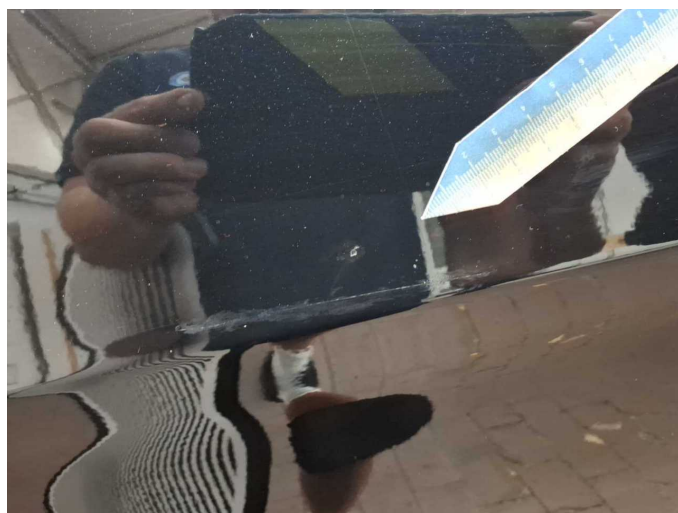


Damage 4: Door - rear left side: Door - Scratch(es) - Smart repair




Damage 5: Door - front left side: Door - Scratch(es) - Smart repair



Damage 5: Door - front left side: Door - Scratch(es) - Smart repair

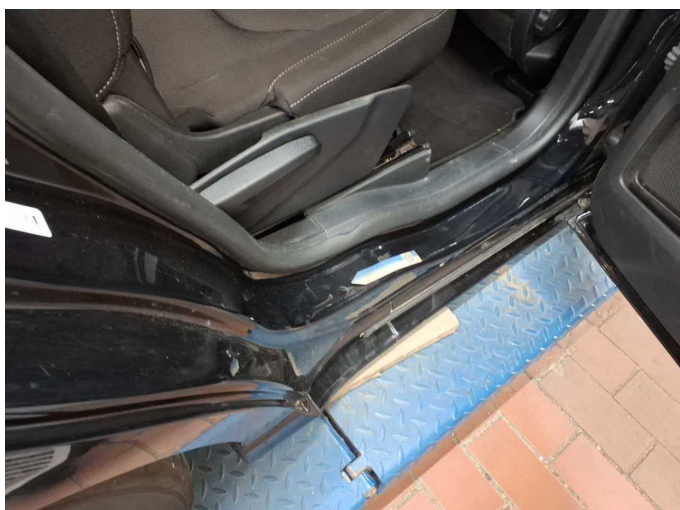

Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

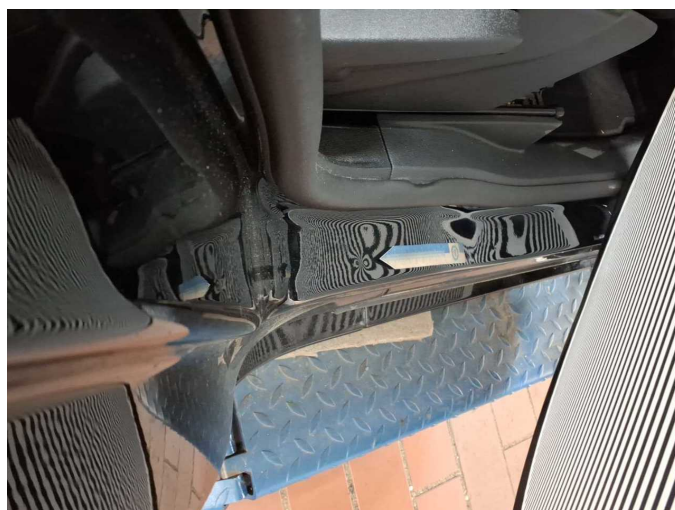


Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

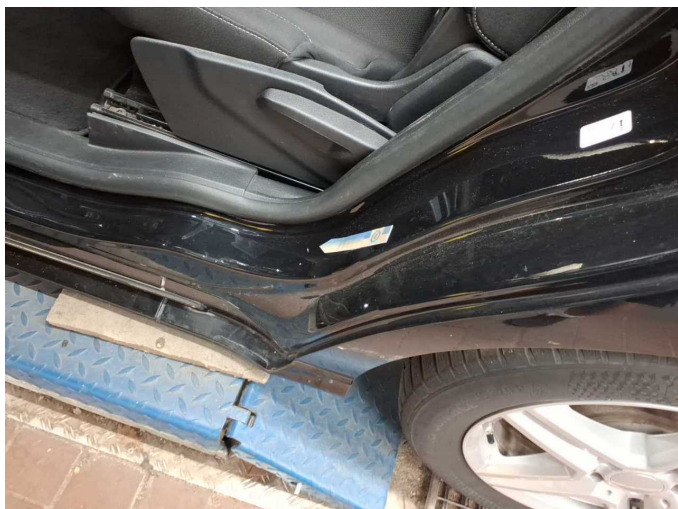


Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair




Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

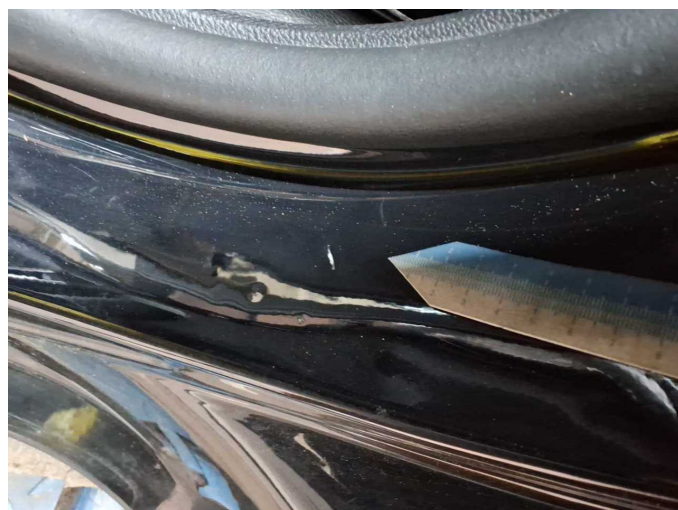

Damage 7: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

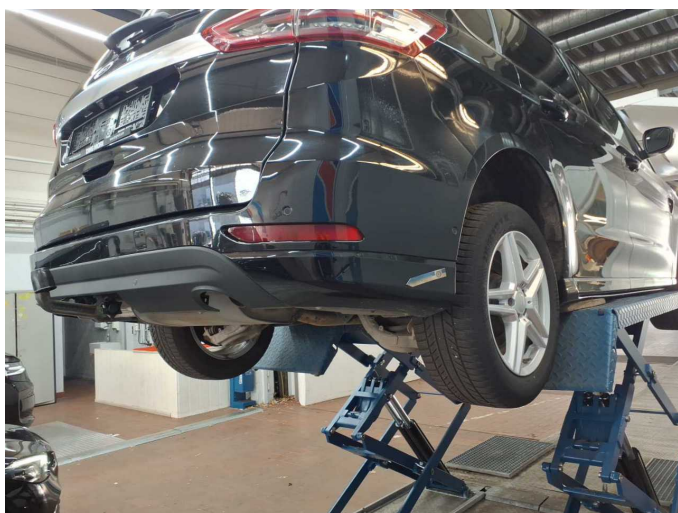

Damage 8: Rear bumper: Spoiler (Rechts) - Scratch(es) - Smart repair



Damage 8: Rear bumper: Spoiler (Rechts) - Scratch(es) - Smart repair




Damage 8: Rear bumper: Spoiler (Rechts) - Scratch(es) - Smart repair



Damage 9: Bonnet: Bonnet (Verätzungen-Mehrkosten möglich) - Paint defect - Conditioning



Damage 9: Bonnet: Bonnet (Verätzungen-Mehrkosten möglich) - Paint defect - Conditioning

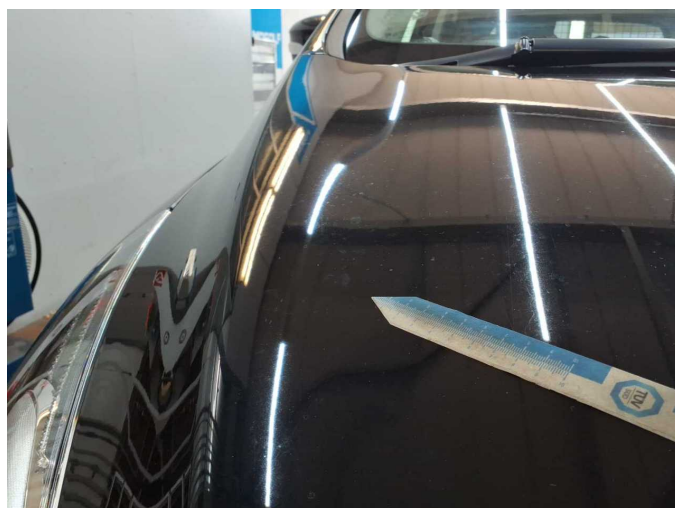

Damage 9: Bonnet: Bonnet (Verätzungen-Mehrkosten möglich) - Paint defect - Conditioning



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 11: Boot lid / rear door: Boot lid (+ Korrosion an Heckklappe) - Scratch(es) - Paint



Damage 11: Boot lid / rear door: Boot lid (+ Korrosion an Heckklappe) - Scratch(es) - Paint



Damage 11: Boot lid / rear door: Boot lid (+ Korrosion an Heckklappe) - Scratch(es) - Paint

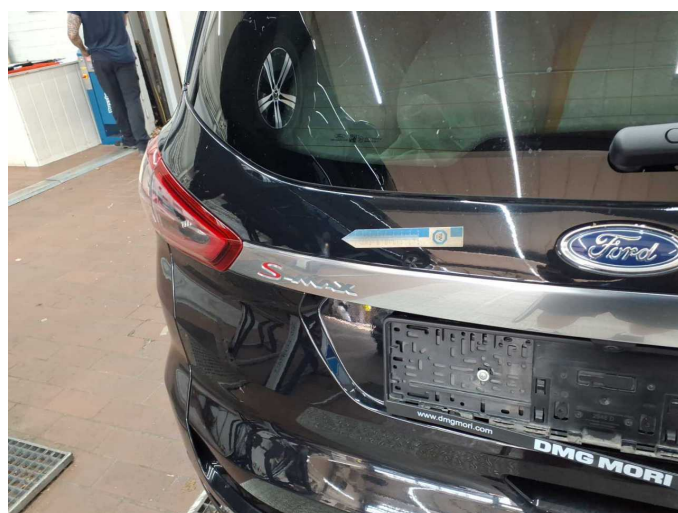

Damage 11: Boot lid / rear door: Boot lid (+ Korrosion an Heckklappe) - Scratch(es) - Paint



Damage 11: Boot lid / rear door: Boot lid (+ Korrosion an Heckklappe) - Scratch(es) - Paint



Damage 12: Front bumper: Spoiler (Mit Blende / Loch) - Deformed - repair according to calculation




Damage 12: Front bumper: Spoiler (Mit Blende / Loch) - Deformed - repair according to calculation




Damage 12: Front bumper: Spoiler (Mit Blende / Loch) - Deformed - repair according to calculation



Damage 12: Front bumper: Spoiler (Mit Blende / Loch) - Deformed - repair according to calculation

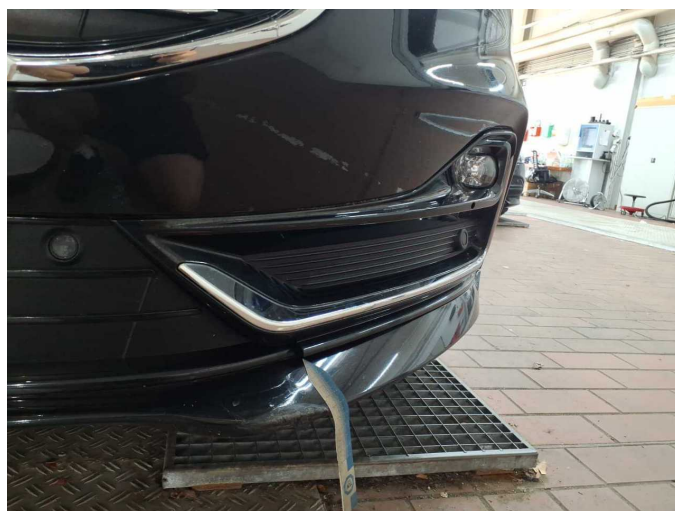


Damage 12: Front bumper: Spoiler (Mit Blende / Loch) - Deformed - repair according to calculation

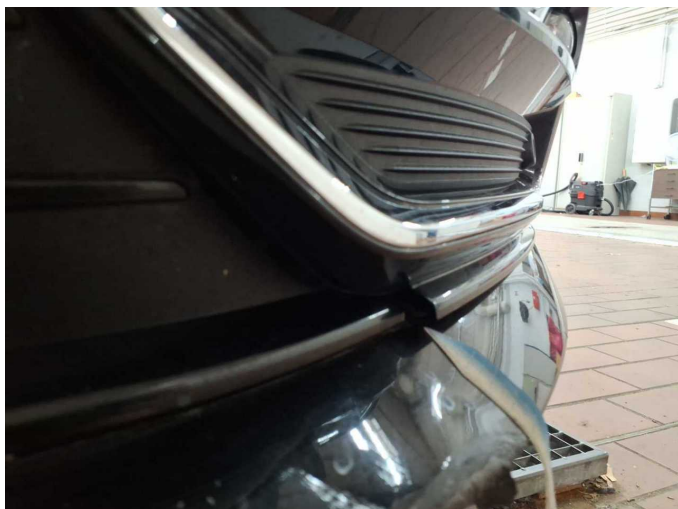


Damage 12: Front bumper: Spoiler (Mit Blende / Loch) - Deformed - repair according to calculation




Damage 12: Front bumper: Spoiler (Mit Blende / Loch) - Deformed - repair according to calculation

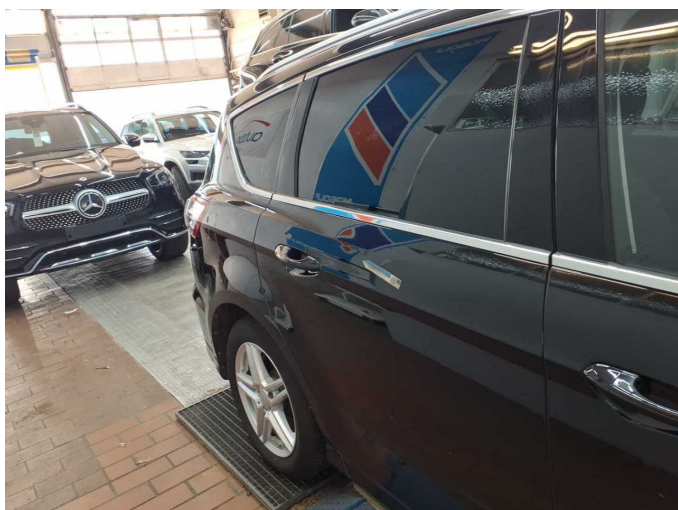


Accident 1: Side right

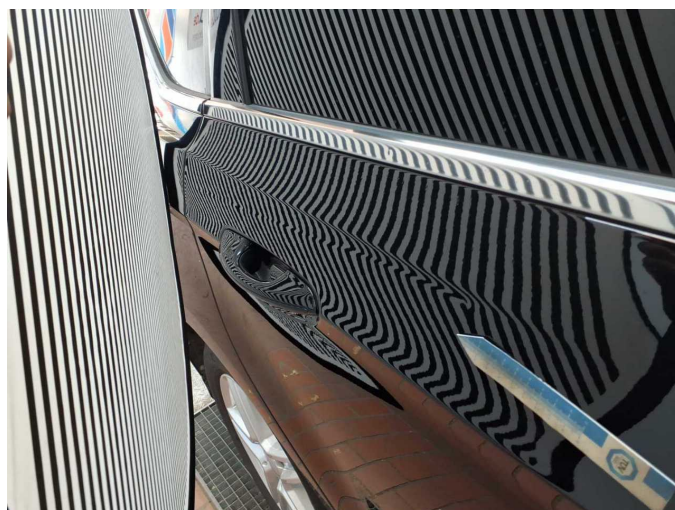

Accident 1: Side right

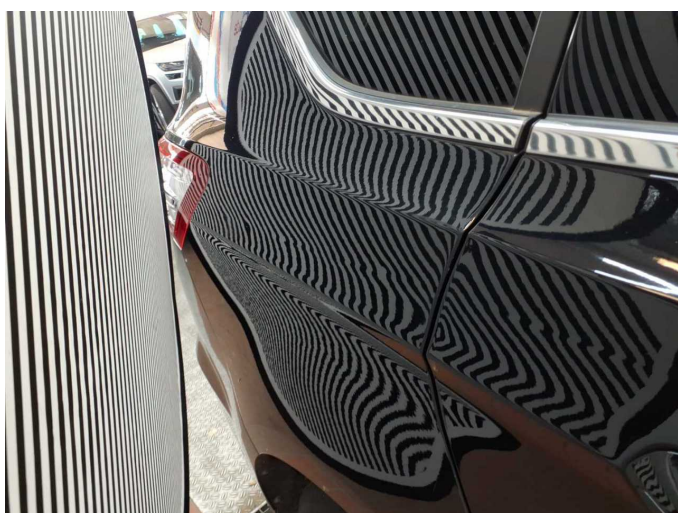

Accident 1: Side right

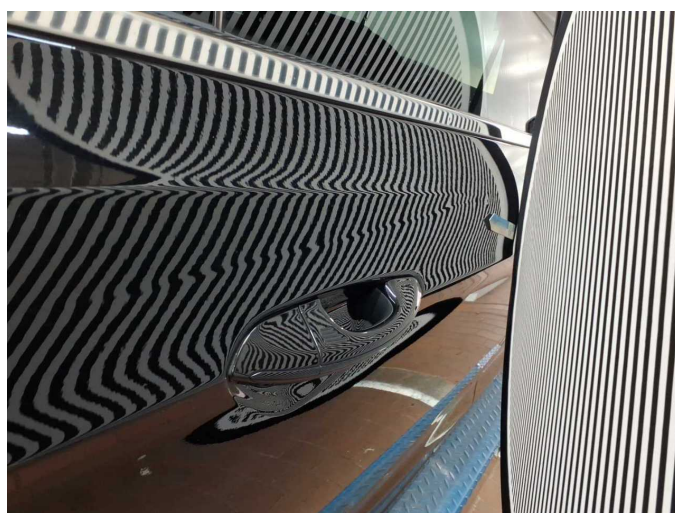

Accident 1: Side right



Accident 1: Side right



Previous damage 1: Rear



Previous damage 2: Front



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0JXXWPCJNY73082

Hersteller / Modell: FORD FORD S-Max 2.0 EcoBlue Aut. TITANIUM

Datum	KM-Stand	Beschreibung
11.07.2025	88.857	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.03.2025	83.715	AU; Batterie ern
06.12.2024	75.996	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
23.10.2024	72.197	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten
14.06.2024	59.275	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
02.05.2023	36.941	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges