



Expertise

Protocol number: 46172633
Order No. / Reference: 26550786
Inspection date: 26 Jun 2026

Manufacturer: Volkswagen
VIN: WVGZZZCDZNW008018

Model: Golf 2.0 TDI SCR DSG Life



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZZCDZNW008018
Mileage (Read)	131,841 km
First registration	18 Jan 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 5
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	0 km
Last service on / at	05/2025 at 111,205 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF433278
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CNX 00904		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,950 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Nexen	4mm / 4mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Nexen	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 08/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 USB-C ports on the front
- Turning brake function and evasive steering support (When making left turns, the Golf with the turning assistant automatically brakes to a standstill (with a simultaneous acoustic and visual warning) should a vehicle approach in the lane to be crossed. Depending on the speed of both vehicles, the turning assistant can, within the system limits, prevent the accident or mitigate its consequences.)
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- Vehicle tool kit
- Car2X (Using the WLANp ITS G5 standard, all Car2X-enabled vehicles and traffic systems such as traffic lights can transmit data at high speed without using the mobile network. This works over a distance of around 800 meters - enough to warn of an invisible traffic jam.)
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights (as well as welcome and farewell lights)
- Electric windows, front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment cover
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Rear headrests (3 pieces)
- Paint finish: Solid
- LED taillights
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Front center armrest adjustable in height and length
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection (detects critical distance situations to other vehicles and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive braking jolt with pedestrian and cyclist detection - also reacts to pedestrians and cyclists)
- Radio "Composition" (touchscreen with 21 cm screen diagonal - 4+1 speakers - output power 4 x 20 watts - FM radio reception - dual tuner with phase diversity for the best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - DAB+ digital radio reception - telephone interface (hands-free system, Bluetooth audio))
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt for the middle rear seat
- 2 USB charging ports on the rear of the center console
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Airbag: Head airbag system for front and rear passengers including front side airbags
- Ambient lighting, 10 colors
- App-Connect (selected smartphone apps can be displayed and operated on the touchscreen of the radio or navigation system - MirrorLink, Android Auto, Apple CarPlay)
- Exterior mirror housings and door handles in body color
- Third brake light
- Headliner in Storm Grey
- Decorative inlays "Nature Cross Brushed" (for instrument panel and front door trim)
- Diesel particulate filter and SCR catalyst
- Digital Cockpit Pro, multicolor (various info profiles selectable)
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster (Anti-lock braking system with brake assist - Electronic brake force distribution - Traction control - Electronic differential lock - Engine drag torque control - Trailer stabilization)
- Pedestrian protection measures expanded
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear spoiler in car color
- "Climatronic" air conditioning system (with active combination filter)
- Front headrests (safety-optimized)
- LED reading lights at the front (2) and 2 at the rear
- LED headlights
- Dynamic headlight range control
- Illuminated makeup mirrors in the sun visors
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Emergency call service (no registration required, service is activated upon delivery)
- Package: Seating comfort package (2 USB-C ports in the front, 2 USB-C charging ports on the rear center console; charging power up to 45 W - front center armrest adjustable in height and length - front seats with height adjustment)
- Tire pressure monitoring system (passive)
- Wheels: Alloy wheels (4) "Norfolk" 7 J x 16 (tires 205/55 R 16)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Electromechanical power steering (speed-dependent control)
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in fabric (seat center panels of the front seats and the outer rear seats in fabric)
- Seats: Front seats are height-adjustable
- Start-stop system (with brake energy recuperation)



- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet in the luggage compartment
- Telephone interface with inductive charging function
- Ambient lighting with logo projection
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

- Bumpers in body color
- Illuminated door handle recesses
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Central locking without safe locking, with remote control and 2 remote folding keys

Extra equipment

- Air conditioning system "Air Care Climatronic" (with active combination filter, rear controls and 3-zone temperature control)
- Package: "Business Premium" package including "Discover Media" navigation system (DSG) (6+1 speakers, App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto, Adaptive Cruise Control (ACC) stop & go with speed limiter, Travel, Lane Assist and Emergency Assist, Multifunction camera, Heated leather multifunction steering wheel with paddle shifters, Discover Media navigation system including streaming & internet, Heated windshield washer nozzles, Voice control, Comfort telephone interface, Textile floor mats front/rear, Heated front seats)

- Paint finish: Pearl effect
- Navigation system "Discover Media" incl. "Streaming & Internet" (6+1 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Multifunction camera - Navigation system "Discover Media" incl. "Streaming & Internet" - Radio - Traffic sign recognition)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Equipment	Tirefit filler - Expired - Replace
3	Trim / covers	Boot lining - Scratch(es) - Loss in value
4	Roof	Roof - dent(s) - Smooth repair work
5	Mudguard - left side	Mudguard - left side - dent(s) - Smooth repair work
6	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
7	Instrument panel	Indicator light (Getriebe) - on - Perform diagnosis
8	Misc.	Inspection / maintenance - Due - Replace
9	Side panel - rear left side	Side panel - Scratch(es) - Paint
10	Bonnet	Bonnet - Dent / paintcoat damage - Paint
11	Rear bumper	Rear bumper - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Side panel - rear left side	Side panel - dent(s) - Smooth repair work

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 12 Aug 2024	1.055,60 €
2	Side right, Provided by user / customer, from 24 Aug 2024	1.374,28 €

Repainting

No.	Repainting
1	Bonnet, Professionally carried out

Paint coat thickness measurement

Bonnet	239 µm
--------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

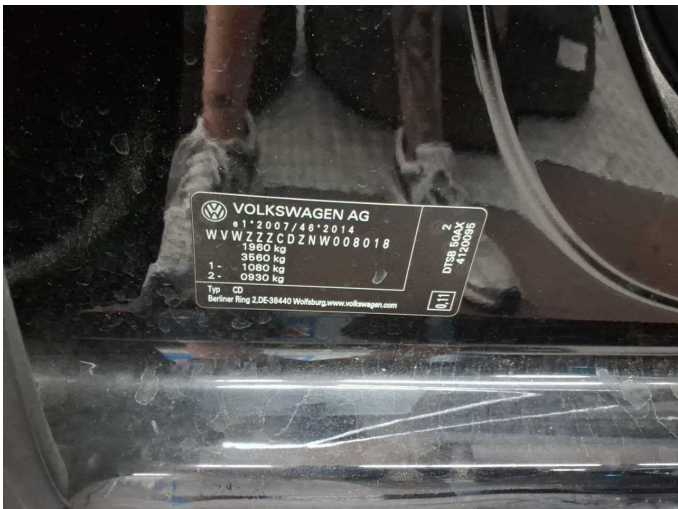


Figure 11: VIN



Figure 12: Mounted tyres

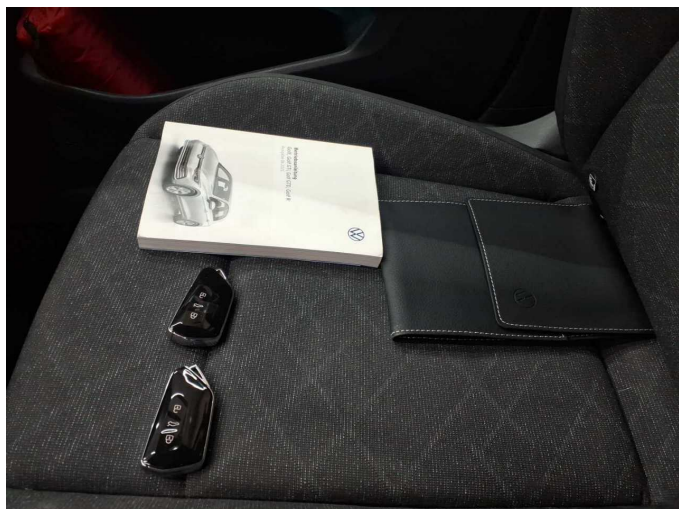


Figure 13: Documents

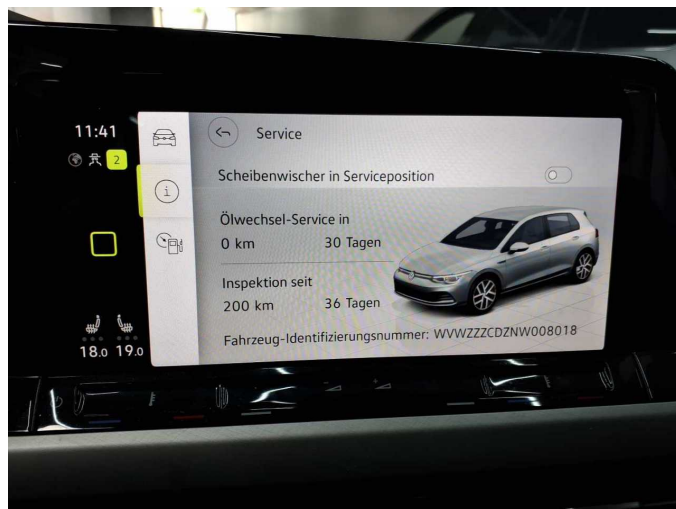


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

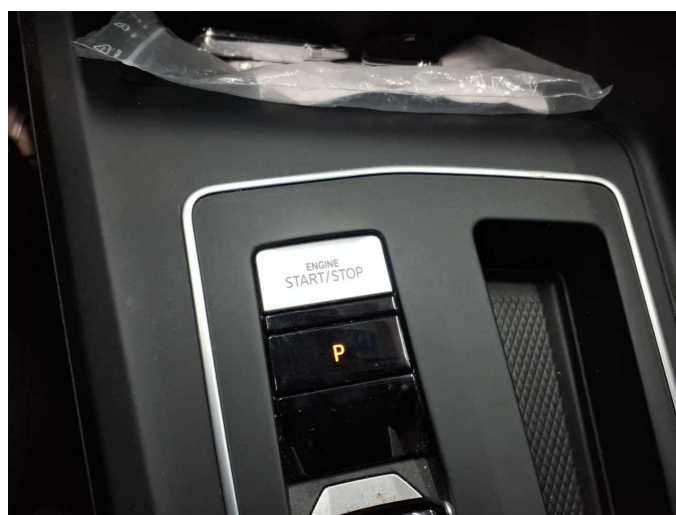


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

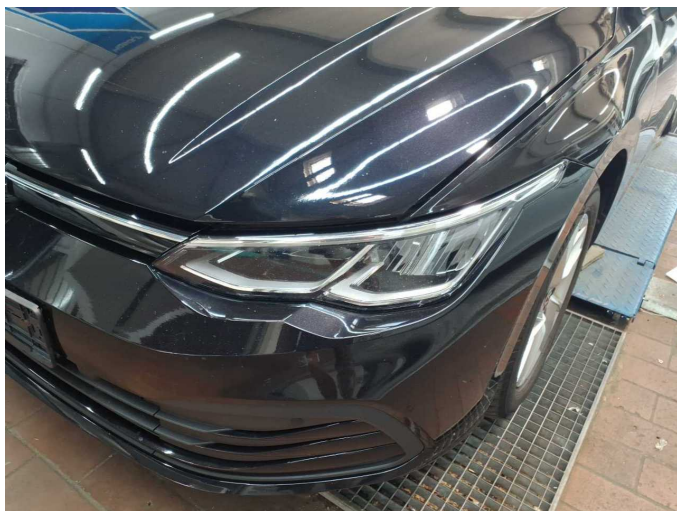


Figure 21: Misc.

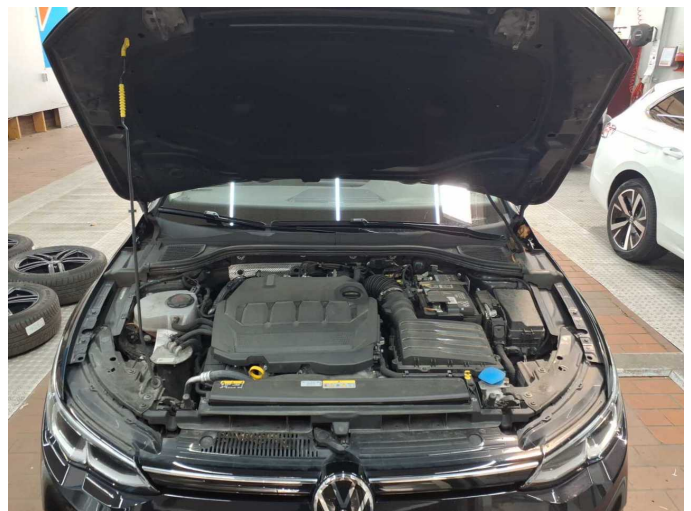


Figure 22: Misc.

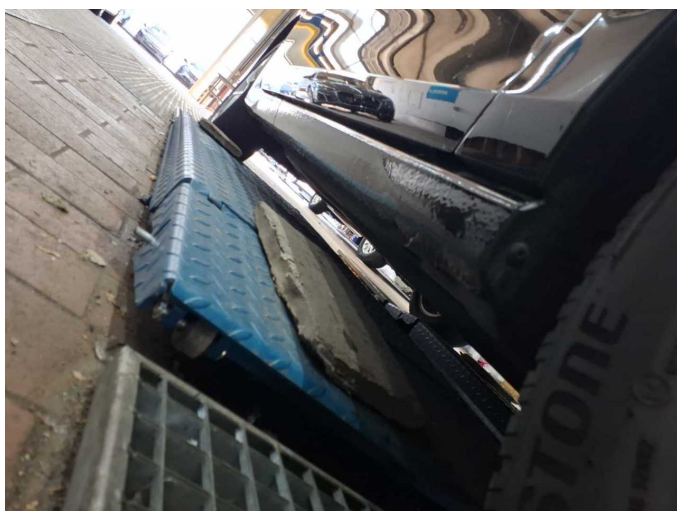


Figure 23: Misc.



Figure 24: Misc.


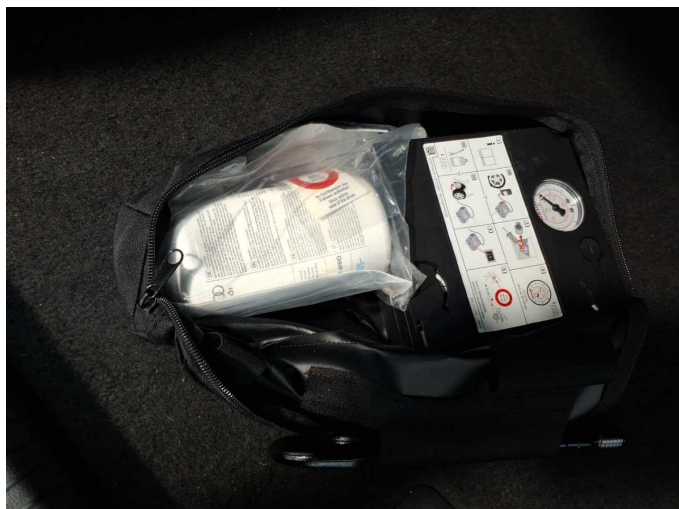


Figure 25: Misc.



Figure 26: Misc.

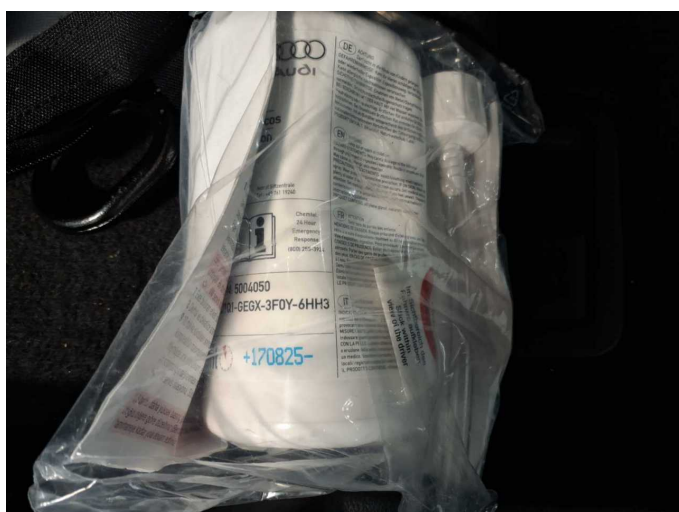

Damage 2: Equipment: Tirefit filler - Expired - Replace



Damage 3: Trim / covers: Boot lining - Scratch(es) - Loss in value




Damage 3: Trim / covers: Boot lining - Scratch(es) - Loss in value




Damage 4: Roof: Roof - dent(s) - Smooth repair work



Damage 4: Roof: Roof - dent(s) - Smooth repair work

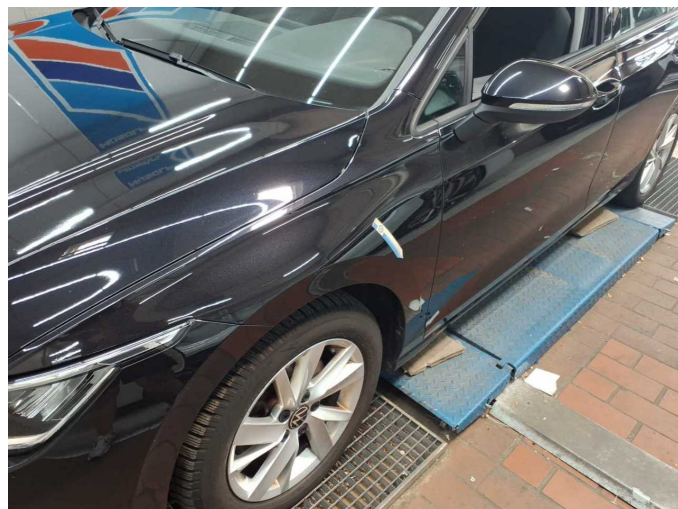


Damage 5: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work

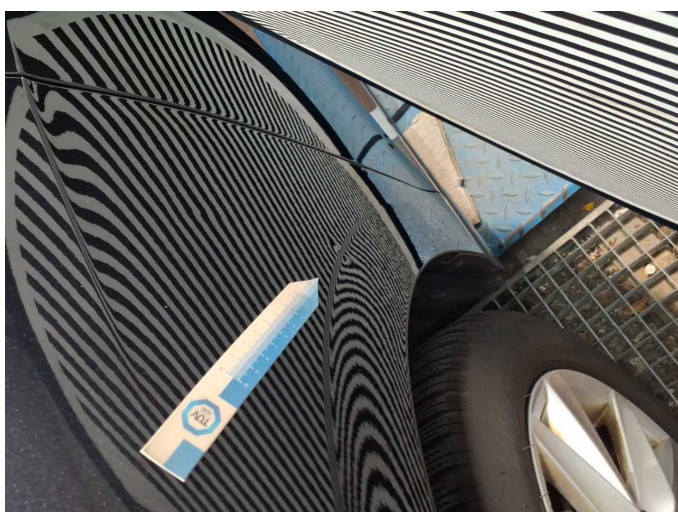

Damage 5: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work



Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

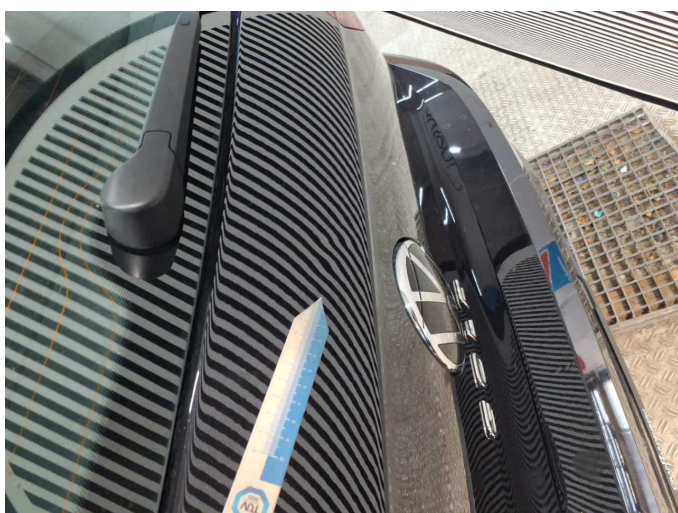


Damage 6: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 7: Instrument panel: Indicator light (Getriebe) - on - Perform diagnosis




Damage 8: Misc.: Inspection / maintenance - Due - Replace

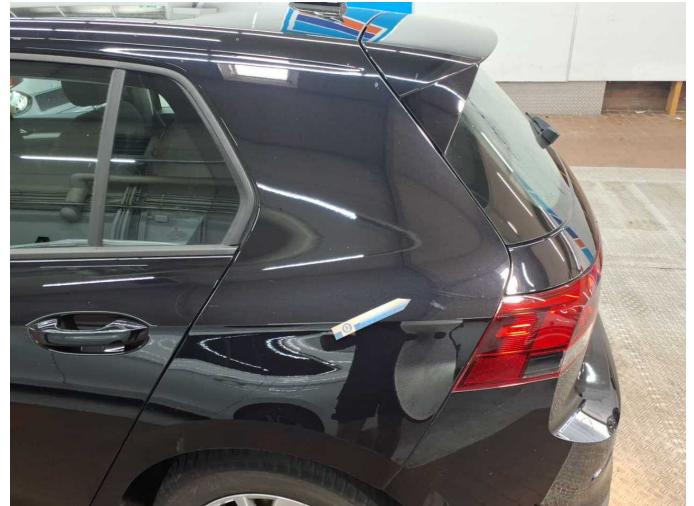


Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Paint

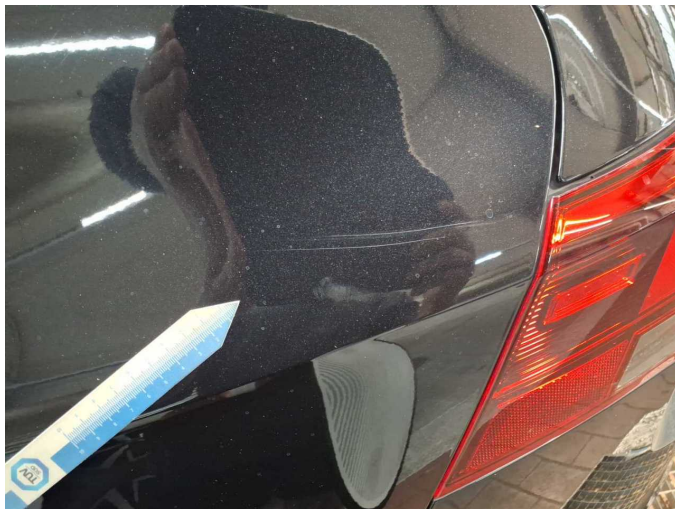


Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Paint

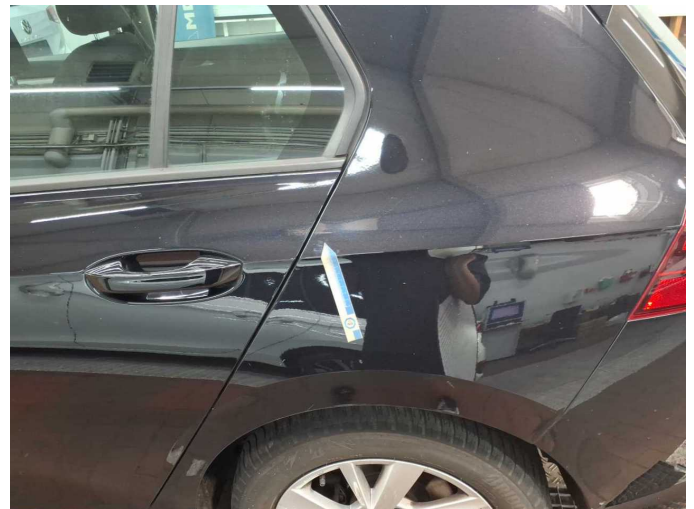


Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Paint

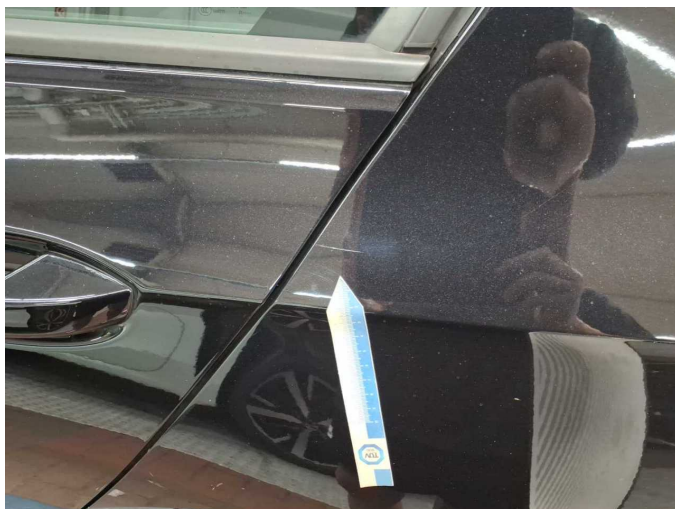


Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Paint

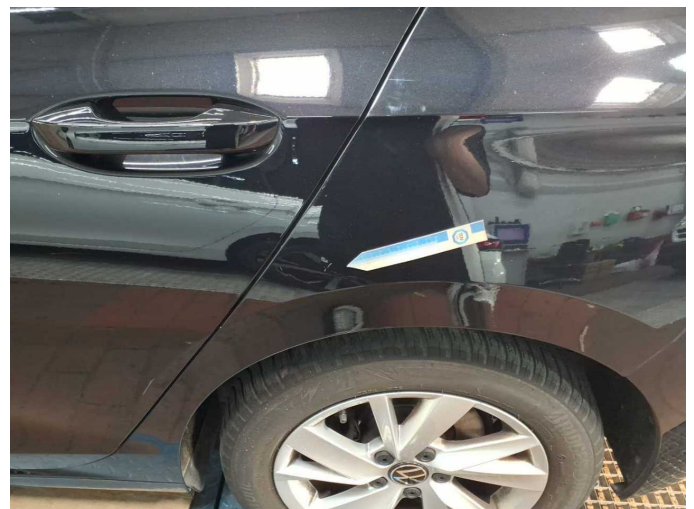


Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Paint

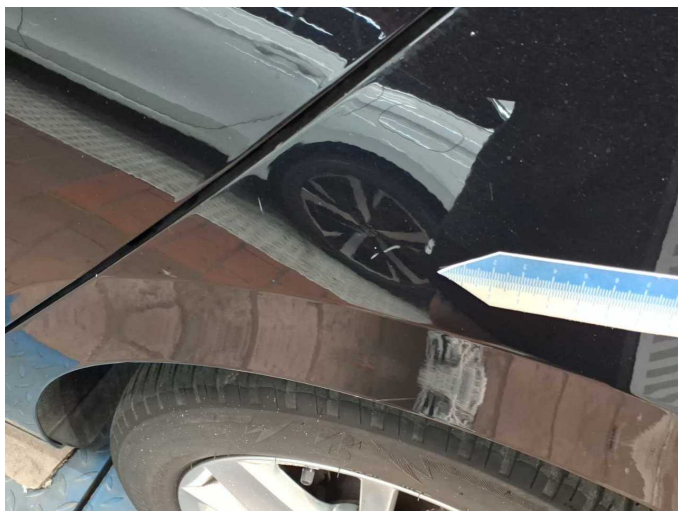

Damage 9: Side panel - rear left side: Side panel - Scratch(es) - Paint

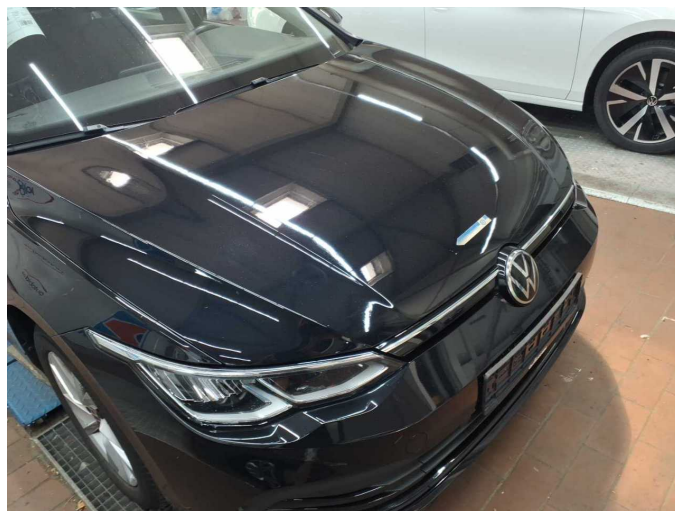


Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Paint

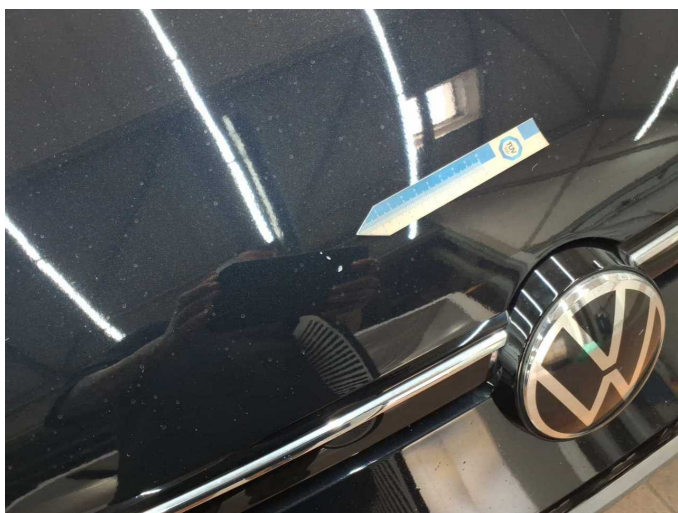

Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Paint




Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Paint

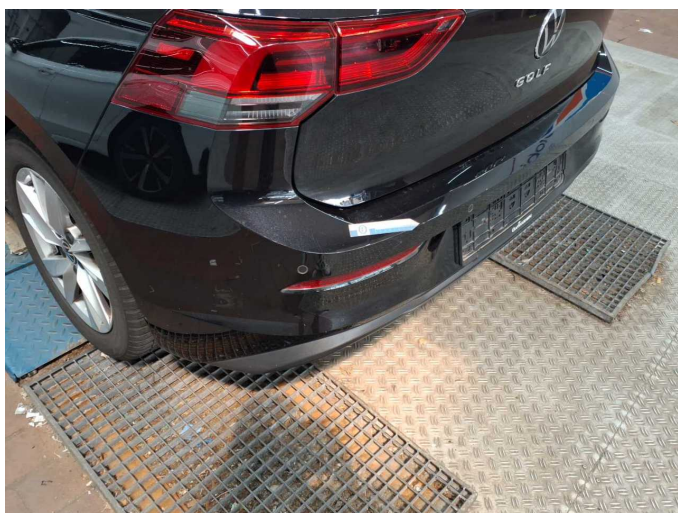

Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint

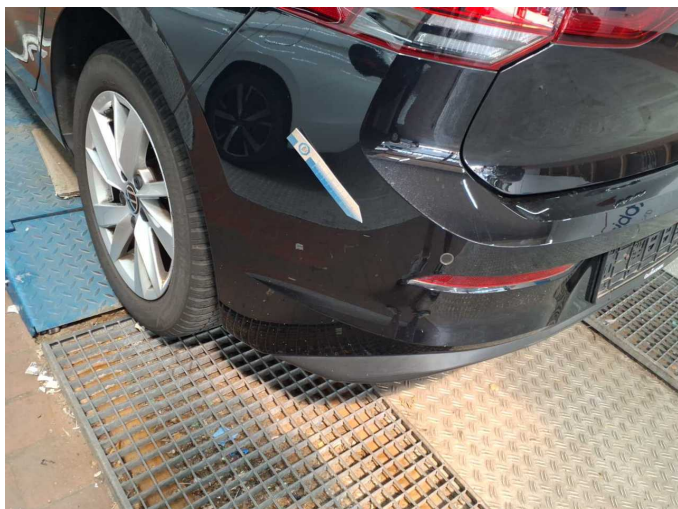

Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint

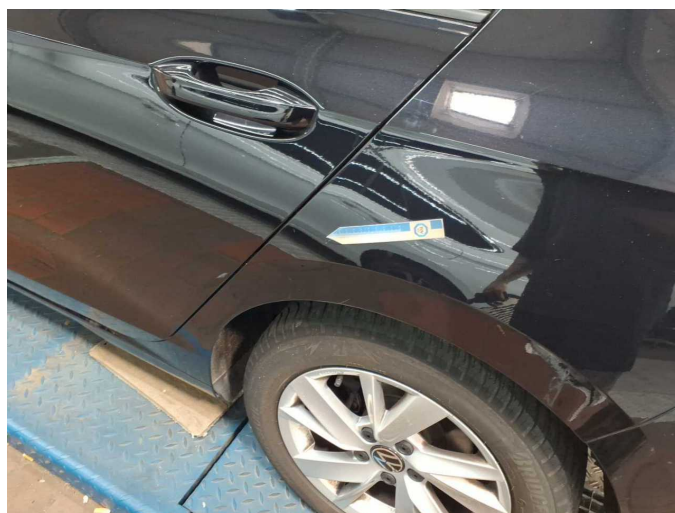

Wear and tear 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Wear and tear 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Previous damage 1: Front




Previous damage 1: Front



Previous damage 1: Front



Previous damage 1: Front

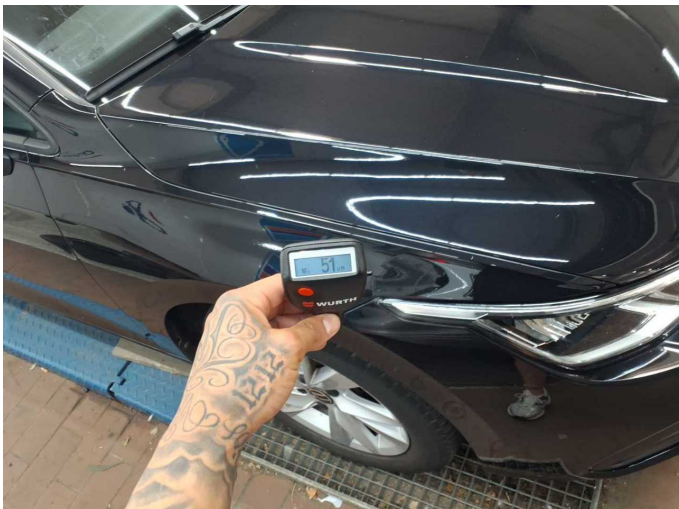

Previous damage 1: Front



Previous damage 1: Front



Previous damage 2: Side right



Previous damage 2: Side right



Previous damage 2: Side right



Previous damage 2: Side right



Previous damage 2: Side right



Previous damage 2: Side right



Previous damage 2: Side right



Previous damage 2: Side right



Repainting 1: Bonnet



Repainting 1: Bonnet



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCDZNW008018

Hersteller / Modell: VOLKSWAGEN VW Golf 2.0 TDI SCR DSG Life

Datum	KM-Stand	Beschreibung
12.05.2025	111.205	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
09.01.2025	107.600	HU + AU
24.05.2024	101.612	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
22.03.2023	59.591	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.09.2022	30.592	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges