

Volkswagen ID.4 '21 BEV

Vehicle information


Make:	Volkswagen	License:	
Gearbox:	Automatic	Body color:	
Model:	ID.4 '21 BEV	VIN:	WVGZZZE2ZMP007787
Fuel type:	Electric	Power:	150 kW
Version:	ID.4 77kWh 1st Max	First registration:	29/12/2020
Mileage:	205592 km	N° of doors:	

Damage summary

Front	①
Interior	①
Left	②
Rear	③
Right	⑤
Roof & others	①

Commercial pictures



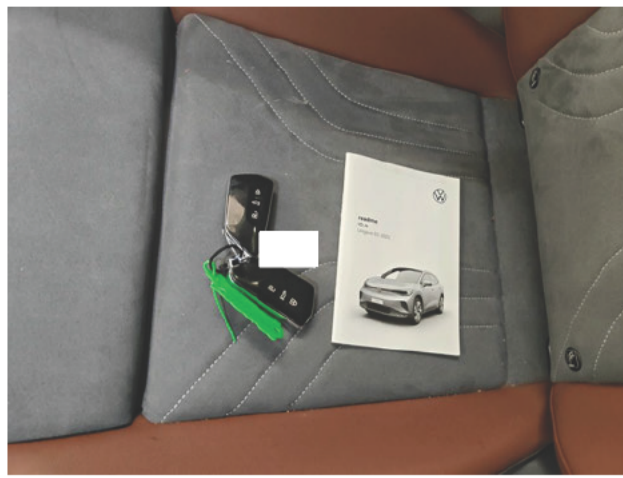

Batterijcertificaat
Datum van diagnose: 08/06/2026

89,87%
Status van de gezondheid (SOH)*

Volkswagen ID4
VIN : WVGZZZE2ZMP007787
Kilometerstand : 205.592 km

* SOH berekend op basis van fabrieksgegevens, informatie om rekening mee te houden voor de fabrieksgarantie

Meer weten over www.get-moba.com

CARA



Options according to the inspector

Central consol F
Panoramic roof

Yes GPS
Yes Radio multimedia

Yes Headlights Xenon/LED/Laser
Yes Telephone equipment

Yes
Yes

Damages

Alloy rim FL

Scratch(es)
Repair and paint (complete)
Left



Alloy rim FR

Scratch(es)
Repair and paint (complete)
Right



Alloy rim RL

Scratch(es)
Repair and paint (complete)
Left



Alloy rim RR

Scratch(es)
Repair and paint (complete)
Right



Bonnet

Stone chip(s)
Repair and paint (complete)
Front



Boot lid covering R

Scratch(es)
Smart repair
Rear



Bumper R

Dent(s)
Replace
Rear



Charging cable (normal)

Missing
Replace
Rear




Door trim FR

Scratch(es)
Replace
Right



Panoramic roof

Stone chip(s)
Replace
Roof & others

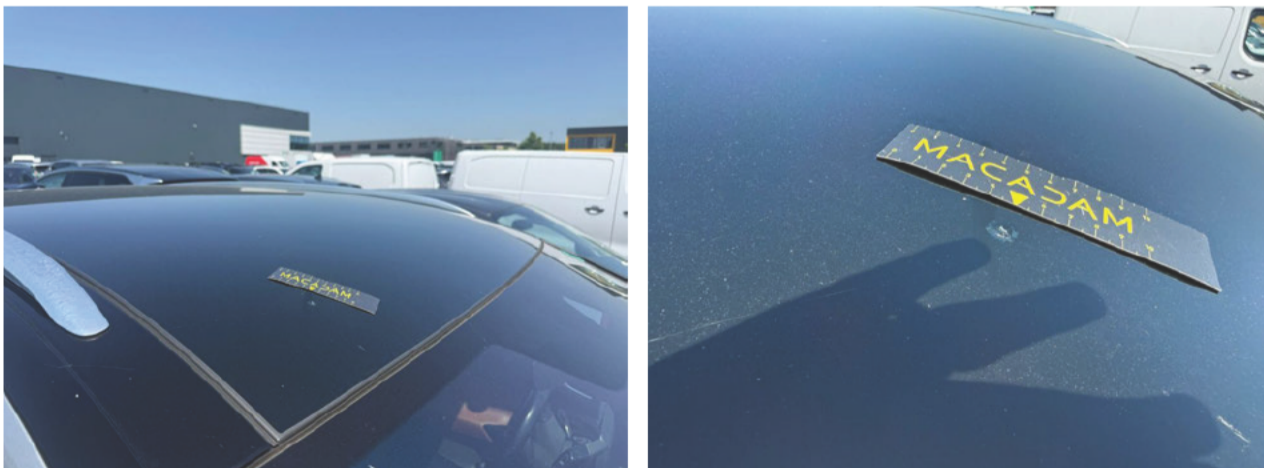

Seat cover FL

Worn
Replace
Interior



Sill trim R

Dent(s) and scratch(es)
Replace
Right



Wing trim RR

Deformed / Strained
Replace
Right



Tyres

Front Left

Summer

255/40/21/102/V

Continental

5.4 mm

Front Right

Summer

255/40/21/102/V

Continental

5.5 mm

Rear Left

Summer

255/40/21/102/V

Pirelli

5.7 mm

Rear Right

Summer

255/40/21/102/V

Pirelli

5.6 mm

Checks

Certificate of Conformity	No CO2 Emission	0
Digital maintenance	Yes GPS storage	Yes
GPS storage	HD Luggage cover	Yes
Number head rests	5 Number of charging cables (normal)	0
Number of charging cables (rapid charge)	1 Number of keys total	2
Service book	N/A User's manual	Yes

Information on the content and the scope of the inspection report:

- The assessment is based on the sales standards specified by the customer.
- Acceptable usage damages according to the sales standards are not always documented in this status report.
- The specified repair methods and/or resulting repair times have been determined, taking into account modern industrial repair methods.
- The purchasing dealer should assess individual repair costs.
- The inspection was carried out in a non disassembly condition. Macadam cannot be held responsible for any missing information. For further information, please contact the seller.