



Expertise

Protocol number: 46484948
Order No. / Reference: 26585215
Inspection date: 14 Jul 2026

Manufacturer: Volkswagen

Model: Touran 1.5 TSI ACT OPF Comfortline

VIN: WVGZZZ1T8PW015696



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Touran 1.5 TSI ACT OPF Comfortline

Vehicle Identification number WVGZZZ1T8PW015696
Mileage (Read) 69,343 km
First registration 22 Mar 2023
Number of holders 1
Next periodical technical inspection 03/2026
(Report not on hand)

Power / Engine displacement 110 kw / 1,498 ccm
Fuel type / Cylinder Petrol / 4
Gearbox / Number of gears Manual / 6
Type of drive Front drive
Type of vehicle Van

Colour / colour code Uranograu
Doors / Seats 5 / 7
Upholstery type Cloth
Colour of upholstery Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	20,400 km
Last service on / at	12/2025 at 59,665 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS419241
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CJC 01088		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,110 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2026		
Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.				

Equipment

Standard equipment

- 2 USB-C ports on the front
- Storage compartments in the overhead console
- Airbag for driver and front passenger
- Adaptive Cruise Control (ACC) with speed limiter
- Exterior mirror housings and door handles in body color
- Headliner in Storm Grey
- Decorative inlays "New Brushed Design"
- Digital Cockpit, multicoloured
- Parking assistance
- Electronic Stability Program (ESP) with counter-steering support
- Pedestrian and cyclist detection as well as active front hood
- Luggage compartment cover
- Height-adjustable luggage compartment floor
- Glove compartment with cooling option
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- ISOFIX mounting points on rear seats
- Front headrests
- Paint finish: Solid
- Headlight range control
- front center armrest
- Fatigue detection
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery in fabric
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy (4) "Karlstad" 6.5 J x 16
- Wheels: Tire Mobility Set
- Keyless start system without safe locking
- electromechanical power steering
- Seats: 3 individual seats in the 2nd row
- Seats: Folding tables on the backs of the front seats
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- Lane change assistant "Side Assist" and parking assistant
- 12V power outlet on the rear of the center console
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened front seat belts
- Green thermal insulation glazing
- Black trim strips on the side windows
- Storage compartment with lid on the instrument panel
- Active Cylinder Technology ACT
- Airbag, head airbag system for front and rear passengers
- Electrically folding exterior mirrors
- third brake light
- black roof rails
- Decorative inlays "Piano Black"
- Tachometer
- Electronic parking brake including auto-hold function
- Automatic headlight control with daytime running lights
- Windscreen made of laminated safety glass, heat and sound insulating
- Baggage management package
- Additional luggage compartment lighting
- Transmission: 6-speed manual transmission
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Headrests (3) in the 2nd row of seats
- Black radiator grille with chrome strips on the slats
- Steering wheel: Multifunction steering wheel in leather
- Illuminated makeup mirrors in the sun visors
- Multifunctional camera
- Non-smoking version
- Emergency call service
- Otto particulate filter
- Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist"
- Rain sensor
- Wheels: Tire pressure monitoring system
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear
- Seats: Front passenger seat backrest folds down completely
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- Start-stop system
- Bumpers in body color
- Textile floor mats
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote folding keys



Extra equipment

- Airbag: Side airbags for the outer seats of the 2nd row (including front side airbags and head airbag system)
- High beam control "Light Assist"
- "Discover Media" navigation system including "Streaming & Internet" (radio)
- Package: Family (foldable and removable reversible luggage compartment mat - electric child safety lock for rear doors, operable from the driver's seat - sunshade roller blind on the rear door windows)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- Keyless locking and starting system "Keyless Access" with safe locking mechanism
- Seats: 2 individual seats in the 3rd row, foldable into the luggage compartment floor (3 individual seats in the 2nd row with armrest, 2 individual seats in the 3rd row, with headrests and "Easy Fold" folding function)
- "Comfort" telephone interface with inductive charging function (hands-free system)
- Anti-theft alarm system (with interior monitoring, backup horn and tow-away protection)
- LED headlights (LED headlights with daytime running lights - dynamic headlight range control)
- Package: Business Premium incl. Navigation (Air Care Climatronic air conditioning - Lumbar support front, electrically adjustable on driver's side, massage function driver's side - Multifunction leather steering wheel - Cargo net partition - Automatically heated windshield washer nozzles front - Headlight cleaning system - Drawer under the right front seat - Microfleece seat center panels "ArtVelours" - Top comfort seats front - Heated front seats - Height-adjustable front seats, ergoActive seat on the driver's side - Washer fluid level warning light)
- Voice control
- 230V power outlet in the luggage compartment on the left (additional luggage compartment lighting, removable and usable as a flashlight)
- Traffic sign recognition

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Sill - right side	Sill - dent(s) - Smooth repair work

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 4 Apr 2024	2.360,42 €



Repainting

No. Repainting

- 1 Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
- 2 Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side	271 µm	Side panel - rear right side	231 µm
-----------------------------	--------	------------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

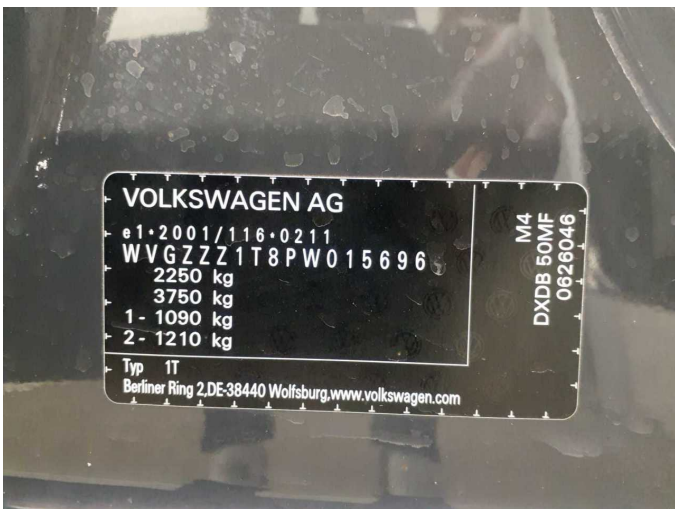


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

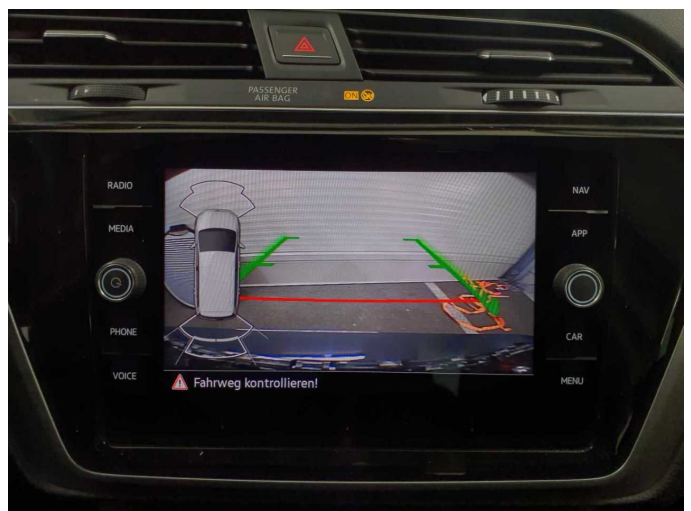


Figure 24: Misc.

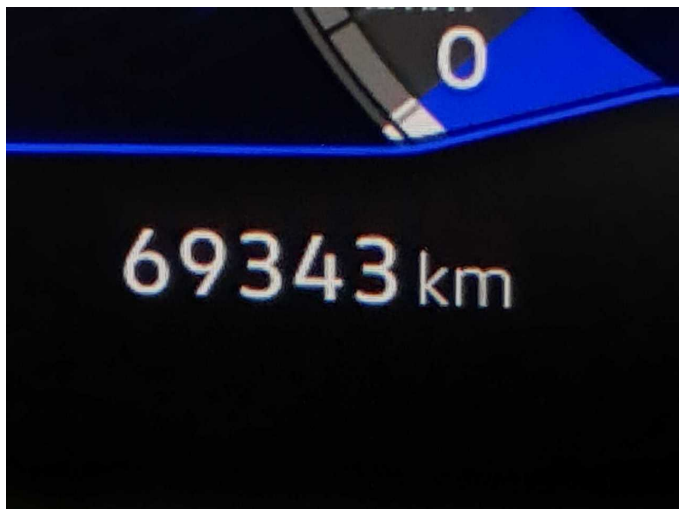


Figure 25: Misc.

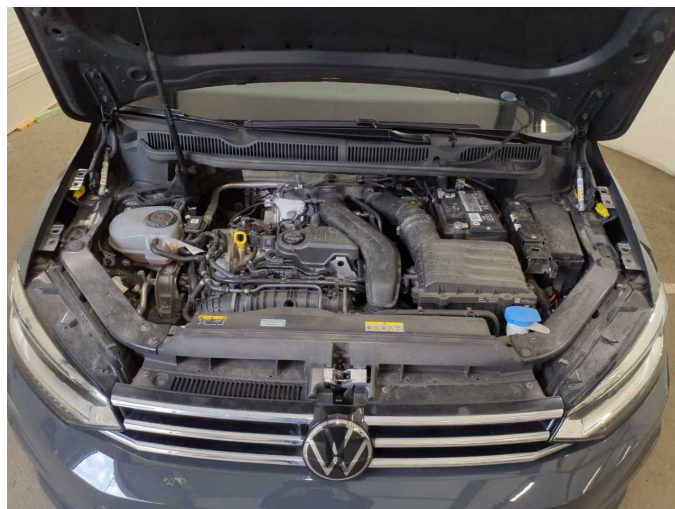


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

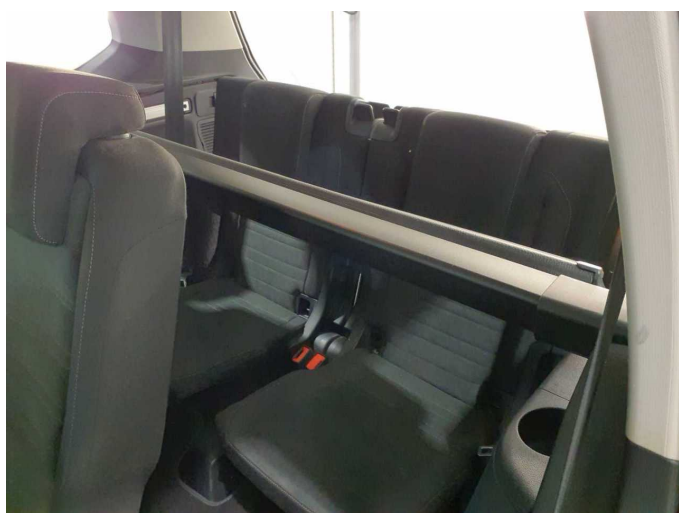


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

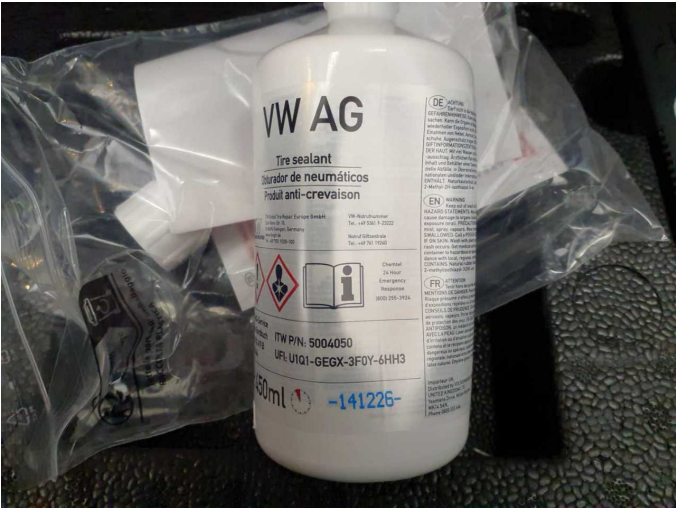


Figure 33: Misc.



Figure 34: Misc.




Damage 1: Sill - right side: Sill - dent(s) - Smooth repair work




Damage 1: Sill - right side: Sill - dent(s) - Smooth repair work



Wear and tear 1: Trim / covers: Boot lid - interior trim - Scratch(es) - No deduction

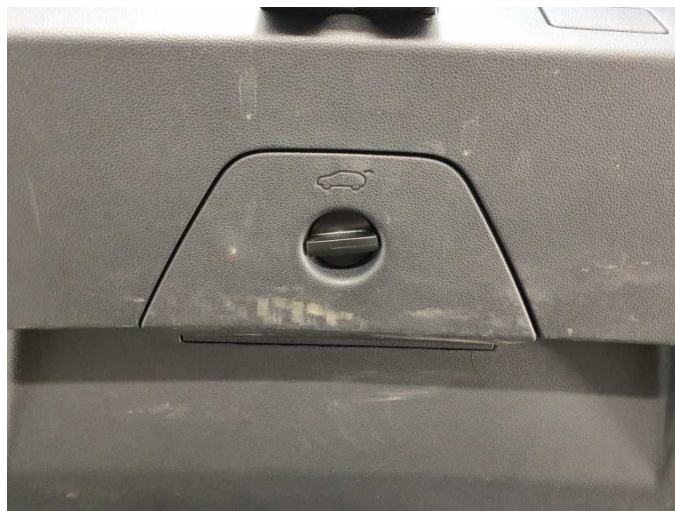

Wear and tear 1: Trim / covers: Boot lid - interior trim - Scratch(es) - No deduction

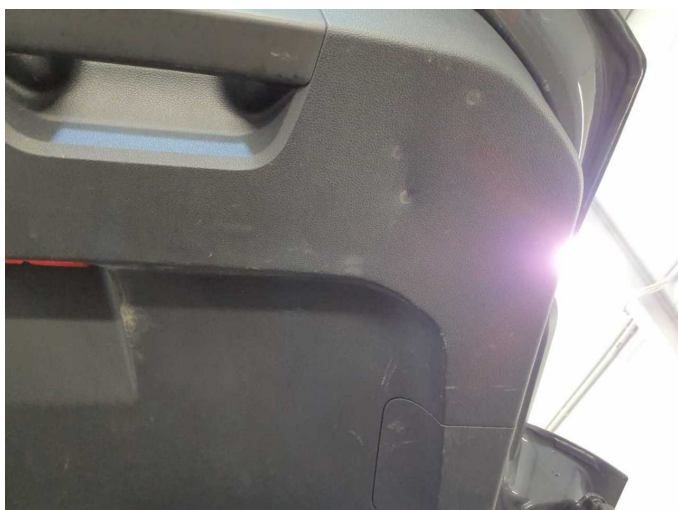

Wear and tear 1: Trim / covers: Boot lid - interior trim - Scratch(es) - No deduction



Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side



Repainting 2: Side panel - rear right side



Repainting 2: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1T8PW015696

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touran 1.5 TSI ACT OPF
Comfortline

Datum	KM-Stand	Beschreibung
19.12.2025	59.665	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
17.07.2024	30.321	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges