



Expertise

Protocol number: 46480346
Order No. / Reference: 26649788
Inspection date: 13 Jul 2026

Manufacturer: Skoda
VIN: TMBJC7NY0PF049225

Model: Enyaq iV 80



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Enyaq iV 80	
Vehicle Identification number	TMBJC7NY0PF049225
Mileage (Read)	26,883 km
First registration	7 Jun 2023
Number of holders	1
Power / Engine displacement	70 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Moon-Weiß Perleffekt
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	321 Tag(e)
Last service on / at	05/2025 at 18,881 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT098376
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	8004 / AWS 00125		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,600 kg	Empty weight	
Dimensions	4653 x 1879 x 1612		

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R21 101T	Summer tires (with run-flat tires) on Light alloy	Bridgestone	5mm / 5mm
2)	255/40 R21 102T	Summer tires (with run-flat tires) on Light alloy	Bridgestone	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	Winter tyres on Light alloy	Bridgestone	7mm / 7mm
2)	255/50 R19 107V	Winter tyres on Light alloy	Bridgestone	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag, driver and passenger
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Evasive steering assist including turn assist
- Outdoor temperature display
- Hill start assist
- Design Selection Loft
- Third brake light
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Cruise control
- Transmission: 1-speed (EV)
- Heated rear window
- Automatic interior mirror dimming
- Isofix anchorage on the outer rear seats including top tether
- Removable boot cover
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A) (Fast charging connector (CCS / Combo 2))
- Manual headlight range adjustment
- Package: Drive BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel with multifunction buttons - steering wheel with hands-off detection)
- Rain sensor and driving light assistant with coming and leaving home function
- Power steering
- Safety lights in the front side doors
- Skoda Care Connect
- Speed limiter
- 12V socket - in the trunk
- Immobiliser
- Airbag, center airbag front
- Airbag, front and rear head airbags
- acoustic windscreen
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- Grey headliner
- Digital instrument cluster (Virtual Cockpit)
- E-Sound
- Increased battery charging power max. 125 kW incl. 1 year free monthly basic fee at Ionity
- Front radar assistant with pedestrian and cyclist detection and city emergency braking function
- Tinted windows
- Rear window wiper including windshield washer system
- Isofix anchorage on the front passenger seat
- Child safety locks on the rear doors
- Climatronic air conditioning (2-zone)
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- LED taillights
- Steering wheel adjustable for height and reach
- Package: Chrome
- Package: Parking BASIC (front and rear parking sensors - reversing camera)
- Radio accessories: SmartLink
- Radio accessories: Wireless SmartLink
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Seat belts
- Seats: Front seats height-adjustable including manually adjustable lumbar support
- Lane keeping assistant (Lane Assist)
- Traffic sign recognition
- Central locking including remote control integrated into the key



Extra equipment

- Anti-theft alarm system including safe system (interior monitoring and tilt sensor)
- heat pump
- Luggage net partition
- Mobile charging station "iV Universal Charger" with interchangeable connection adapters
- Package: Drive SPORT BASIC (paddle shifters for adjusting recuperation strength - driving profile selection - heated leather steering wheel in sport design with multifunction buttons - steering wheel with hands-off detection - progressive steering)
- Package: Infotainment PLUS (Navigation system - Infotainment Online 3 years (Online map updates for navigation; display of weather data, news, headlines; charging station and parking space search; Online POI search; Online destination import) - Augmented reality head-up display)
- Package: Seating comfort BASIC (electrically adjustable driver's seat with memory function - electrically adjustable lumbar support in the driver's seat)
- Wheels: 21" alloy wheels Betria black gloss turned (8.5Jx21 mixed tires 235/45 R21 101T, 255/40 R21 102T Seal)
- Package: Convenience PLUS in conjunction with anti-theft alarm system (Sportline) (electric tailgate operation incl. comfort opening - removable glasses compartment - free remote vehicle access for 3 years)
- Package: Driving Assistance PLUS (Predictive Adaptive Cruise Control (pACC) incl. Traffic Jam Assist - Lane Change and Parking Assist - Proactive Occupant Protection - Traveller Assistance System incl. Emergency Assist (Traffic Sign Recognition, Adaptive Lane Keeping Assist))
- Package: Light & Sight PLUS (LED matrix headlights incl. AFS and dynamic high beam assist - headlight cleaning system - full LED taillights with animated turn signals - illuminated front grille "Crystal Face")
- Package: SPORTLINE (80) (Design Selec. SPORTLINE - 20" LM Vega Anthracite/diamond-turned - Sport suspension - Side skirts in body color - Black radiator grille frame - Black exterior mirror caps - Roof rails and window frames in gloss black - Pedals in stainless steel look - Heated sport steering wheel with paddle shifters for adjusting recuperation strength - Matrix LED headlights - Headlight cleaning system - Progressive steering - KESSY - Phone box - Driver fatigue detection - Sunset)
- Paint finish: Pearl effect

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
2	Wheel / tyres	Tyre - rear left side - Broken / torn - Replace
3	Wheel / tyres	Tyre - front right side - Broken / torn - Replace
4	Front bumper	Front bumper - Scratch(es) - Paint
5	Wheel / tyres	Alloy rim - rear left side (Materialabtrag) - Scratched - Replace
6	Wheel / tyres	Alloy rim - front left side - Scratched - Replace
7	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Missing parts

Description

Equipment - Umbrella

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten sind möglich.
- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

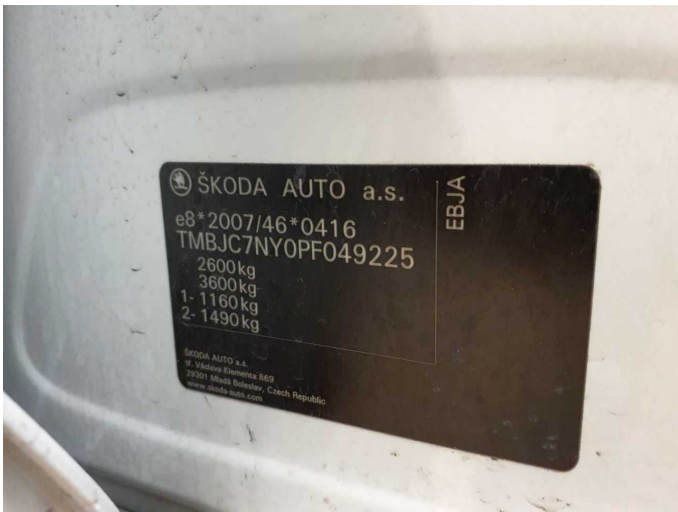


Figure 11: VIN



Figure 12: Mounted tyres

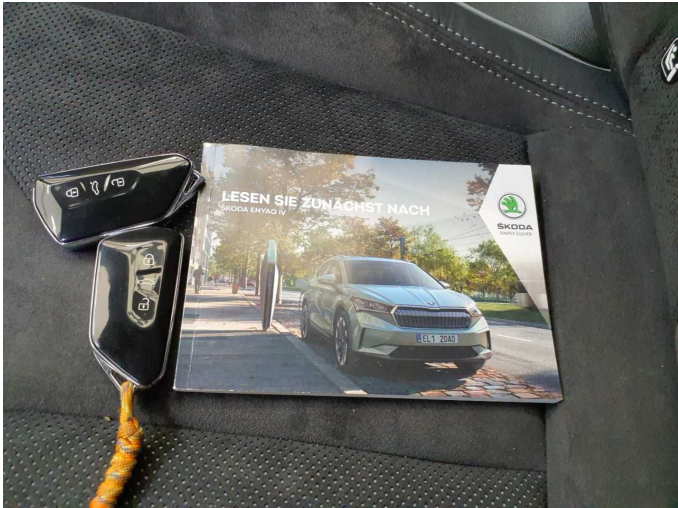


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

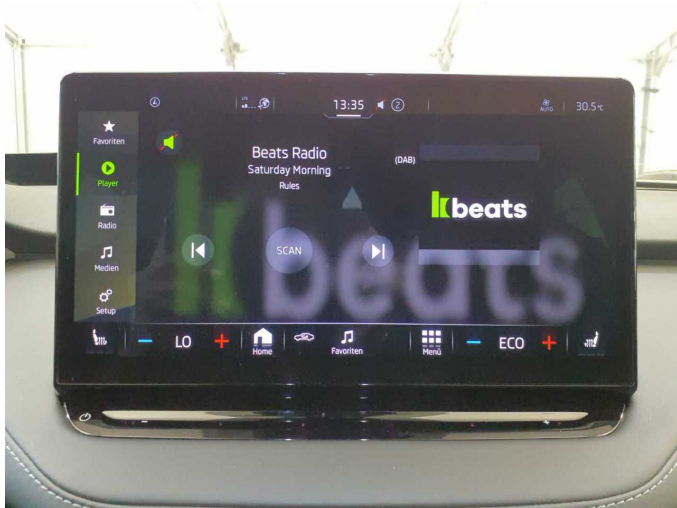


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

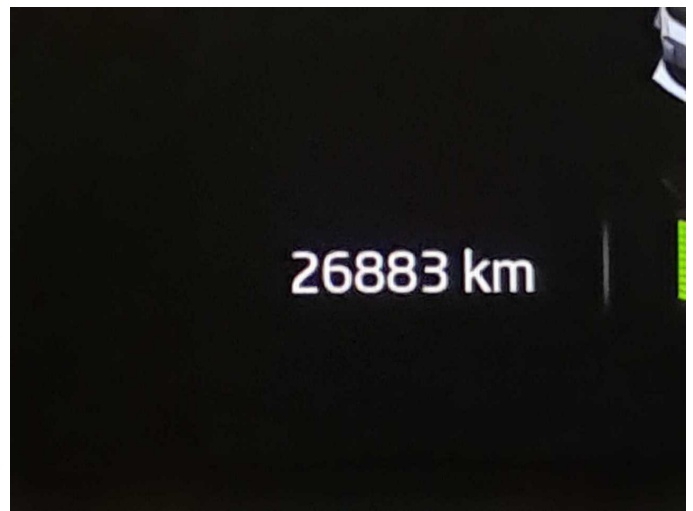


Figure 28: Misc.

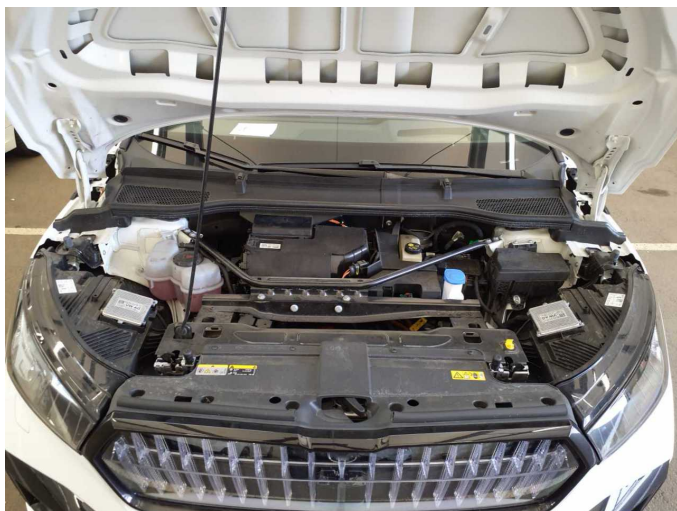


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 2: Wheel / tyres: Tyre - rear left side - Broken / torn - Replace



Damage 2: Wheel / tyres: Tyre - rear left side - Broken / torn - Replace



Damage 2: Wheel / tyres: Tyre - rear left side - Broken / torn - Replace



Damage 3: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 3: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 4: Front bumper: Front bumper - Scratch(es) - Paint



Damage 4: Front bumper: Front bumper - Scratch(es) - Paint



Damage 5: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - front left side - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - front left side - Scratched - Replace



Damage 6: Wheel / tyres: Alloy rim - front left side - Scratched - Replace




Damage 7: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Scratched - Replace

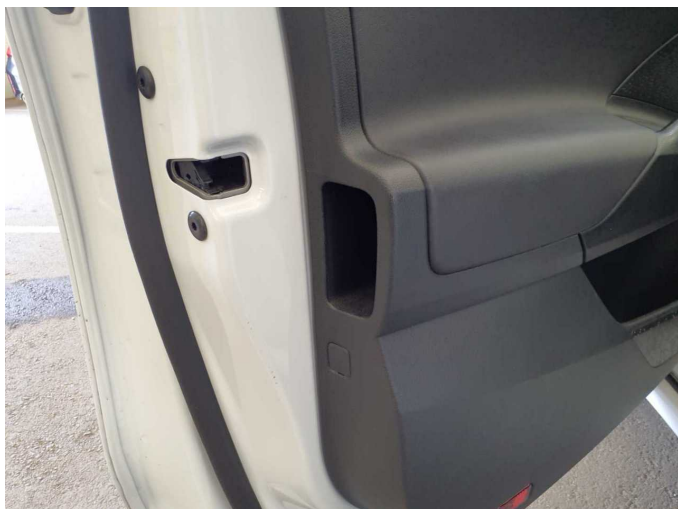

Missing part 1: Equipment: Umbrella - Missing - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJC7NY0PF049225
Hersteller / Modell: SKODA SKODA Enyaq iV 80

Datum	KM-Stand	Beschreibung
30.05.2025	18.881	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst