



Expertise

Protocol number: 46570335
Order No. / Reference: 26712702
Inspection date: 15 Jul 2026

Manufacturer: Volvo

Model: XC90 T8 AWD Recharge Ultimate Bright

VIN: YV1LFH5V9P1969020



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC90 T8 AWD Recharge Ultimate Bright	
Vehicle Identification number	YV1LFH5V9P1969020
Mileage (Read)	81,075 km
First registration	27 Feb 2023
Number of holders	1
Next periodical technical inspection	03/2028
(Report on hand)	
Power / Engine displacement	228 kw / 1,969 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Silver Dawn Metallic
Doors / Seats	5 / 7
Upholstery type	Leather
Colour of upholstery	Anthracite-Black
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	244 Tag(e)
Last service on / at	03/2026 at 75,224 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ217414
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	9101 / BUL 00009		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,950 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/35 R22 104W	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	275/35 R22 104W	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbags (airbags for driver and front passenger with two-stage deployment system - knee airbag for driver - side airbags for driver and front passenger - head/shoulder airbags for all occupants)
- Aluminum roof rails (integrated)
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports (compatible with Apple iPod/iPhone/iPad))
- Attachment system for carrier bags in the luggage compartment
- Automatic climate control with 4-zone temperature control (Individual climate control for driver, front passenger and rear passengers left and right (2nd row of seats) including climate display for the 2nd row of seats)
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Auxiliary heater with timer (fuel-operated)
- Central locking with two remote controls and integrated emergency key (including automatic locking of the glove compartment and doors while driving (can be deactivated), panic function (integrated in the remote control), comfort opening/closing of the side windows and, if applicable, sunroof via remote control, luggage compartment lid release via remote control or from the driver's seat)
- Charging cable Schuko/Type 2 (Mode 2) (7 m length, 1-phase, 10A (for connection to a standard 230-volt household socket))
- Child safety lock for the rear doors (electric)
- Chrome applications in the front bumper
- Digital Services including Google Maps navigation system (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, contacting the Volvo On Call service center at the touch of a button and additional convenience services via the Volvo CarsApp) - Usage is time-limited and will be subject to charges thereafter. Further information on renewal is available from a Volvo dealer partner.)
- Driver Awareness (Blind Spot Information System (BLIS) - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles - Cross Traffic Alert (CTA) - Cross Traffic Warning with braking intervention - Warning of vehicles, cyclists and pedestrians approaching from the side when reversing out of a parking space, including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - Preventive protection in case of impending rear-end collisions)
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically folding exterior mirrors
- Electronic stability control
- Fog sensor for automatic activation of the defroster function
- Front center armrest including cup holder
- ABS - Anti-lock Braking System
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Active safety belts with belt tensioners (pre-activation of the belt tensioners in dangerous situations and belt force limiter)
- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Air conditioning for the 3rd row of seats
- All-wheel drive (AWD) (depending on the driving mode)
- Aluminum door sill plates with Recharge lettering, front and rear
- Aluminum loading sill protector in the luggage compartment
- Armrests with integrated storage compartment and cup holders for the 3rd row of seats (left and right)
- Automatic tailgate (electric)
- Bottle holder in the luggage compartment
- Brake energy recuperation
- Cargo area roller blind (semi-automatic)
- Charging box under the cargo floor
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area with Recharge lettering
- Chrome window surround
- Dashboard and door trim in leather look with contrasting stitching
- Deactivation of the high-voltage battery (in case of a collision)
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Assistance (Emergency Stop Assist (automatic emergency stopping system in case of failure to heed warnings due to lack of steering, braking and acceleration activity by the driver, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h) - Adaptive cruise control)
- Electric parking brake
- Electrically adjustable exterior mirrors
- Electronic differential lock
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- First aid kit and warning triangle
- Front grille in waterfall design in chrome
- Headrests (7)
- Headrests of the 2nd row of seats can be folded down (electrically)
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- Illuminated makeup mirror for driver and front passenger
- Interior and exterior mirrors automatically dimming
- ISOFIX mounting for the outer rear seats



- Glazing: Colored glazing
- Head-up display: Graphic projection of driving information onto the windshield
- Headliner and door pillars in nubuck fabric (including leather trim for sun visors and grab handles)
- Heated exterior mirrors and rear window (automatic)
- Immobiliser
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Keyless Start (electronic engine start system)
- On-board computer (with vehicle control functions)
- Package: Lighting Package (Headlight cleaning system - Full LED headlights "Thor's Hammer" Active High Beam with extended high beam, dynamic cornering lights, intelligent high beam assist with adaptive headlight range control and integrated LED daytime running lights - Ambient lighting Extended: Ambient lighting front/rear, on the upper dashboard, on the doors Exit lights front/rear Illuminated door pockets - openers front/rear Front entry lights with lettering Rear footwell lighting Work light on the tailgate)
- Paint finish: Solid
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Power outlet (12-volt connection in the luggage compartment)
- Premium textile floor mats, front and rear
- Preparation for Trailer Stability Assist (TSA)
- Radio accessories: Two USB-C ports on the back of the center console
- Rear view camera
- rear window wiper
- Run-off Road Protection (preventive protection system in case of unintentional road leaving or impending rollovers including pre-activation of the seat belt tensioners, deactivation of the battery (plug-in hybrid only), emergency call via Volvo On Call and door unlocking)
- Safety Assistance (Ultimate) (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assist and emergency braking assist for oncoming traffic - Connected Safety - Distance warning - Driver Alert - Attention warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assist - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Seats: Child seat integrated in the middle rear seat (2nd row).
- Seats: Heated front seats
- Seats: Heated rear seats (outer seats of the 2nd row)
- Steering wheel: Multifunction buttons on the steering wheel
- Textile floor mat for the 3rd row of seats
- third brake light
- Transmission: 8-speed automatic transmission
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, illuminated door handles and floor lights)
- Lashing eyes in the luggage compartment (foldable)
- LED turn signals integrated into the exterior mirrors
- Luggage compartment partition net
- Outdoor temperature display
- Package: Seat Comfort Package (Electrically adjustable front passenger seat (8-way) - Electrically adjustable driver's seat (8-way) with memory function for driver's seat and exterior mirror settings (stored in the remote control) - Lumbar support (4-way electrically adjustable) for driver and front passenger seats - Memory function for front passenger seat - Adjustable leg support for driver and front passenger seats)
- Parking assistance, front and rear (with automatic braking intervention)
- Parking ticket holder
- Passenger side airbag can be deactivated
- Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad)
- Pollen filter
- Radio: Audio system High Performance Sound Pro by Harman/Kardon (600 watts of power - 14 speakers - Fresh Air - Subwoofer - Dirac Unison - Sound optimization)
- Rain sensor with automatic light function
- Roof edge spoiler
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Seat belt height adjustment front and rear (2nd row of seats)
- Seats: Rear bench seat of the 2nd row in a 40/20/40 ratio or completely foldable (incl. individual backrest angle adjustment)
- Seats: Third row of seats (7-seater) (manually adjustable and retractable with longitudinal adjustment (120 mm) for the 2nd row of seats and easy-entry function)
- Speed-sensitive power steering
- Start/Stop technology
- Steering wheel adjustable for height and reach
- Steering wheel: Steering wheel heating
- Sun blinds for the rear side windows (integrated)
- Tachometer
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Wheels: 20" 5-spoke alloy wheels, diamond cut/high-gloss black (with all-season tires 275/45 R20; rims 9 x 20")
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions)



- Upholstery: Leather/leatherette comfort seats (incl. rear center armrest (2nd row of seats) - Aluminum inlay: Metal Mesh - Headliner: Light Beige)

Extra equipment

- Alarm system with motion/tilt sensor and security lock
- Paint finish: Metallic paint
- Upholstery: Nappa leather sports seats (perforated side bolsters of the front seats) (incl. rear center armrest (2nd row of seats) - sports steering wheel and gearshift lever made of Swedish crystal glass by Orrefors - aluminum inlay: Metal Mesh - headliner: anthracite)
- Glazing: Side and rear windows tinted (from the B-pillar back)
- Towbar (semi-electric)
- Parking camera with 360° surround view (including front, side and rear parking aid with automatic braking intervention (rear))
- Wheels: 22" 5-twin-spoke sport design alloy wheels, diamond cut/ high-gloss black (tires 275/35 R22; rims 9 x 22")

Retrofitted equipment

- glasses holder
- Luggage compartment divider
- Cargo securing net
- neck pillow
- Stainless steel bumper protection strip
- Luggage compartment grille
- Dog door
- Charging cable pouch
- Tray mat for dog compartment

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Misc.	Misc. (BRILLENHALTERUNG) - Missing - Replace
2	Misc.	Misc. (NACKENKISSEN) - Missing - Replace
3	Misc.	Misc. (LADEKABELTASCHE) - Missing - Replace
4	Rear bumper	Spoiler - Scratch(es) - Smart repair
5	Sill - left side	Trim - Scratch(es) - Smart repair
6	Side panel - rear right side	Sill - Scratch(es) - Smart repair
7	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
8	Misc.	Misc. (HUNDETÜR) - Missing - Replace
9	Wheel / tyres	Tyre - rear left side - Broken / torn - Replace
10	Wheel / tyres	Tyre - front right side - Broken / torn - Replace
11	Mudguard - right side	Wheel well extension - Scratched - Paint
12	Side panel - rear left side	Wheel well extension - Scratched - Paint
13	Front bumper	Spoiler - Scratched - Paint
14	Wheel / tyres	Alloy rim - front right side - Scratched - Replace
15	Vehicle glazing	Windscreen - Stone chips - Replace



Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Wheel well extension - Scratch(es) - No deduction
2	Roof	Roof - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Equipment (SCHALENMATTE HUNDEABTEIL)

Interior - Luggage net (LADEGUT-SICHERUNGSGNETZ)

Equipment - Equipment (GEPÄCKRAUMTEILER)

Equipment - Equipment (GEPÄCKRAUMGITTER)

Interior - Separation net

Equipment - charging cable (Schuko/Typ2)

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 6 Jul 2023	2.391,45 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

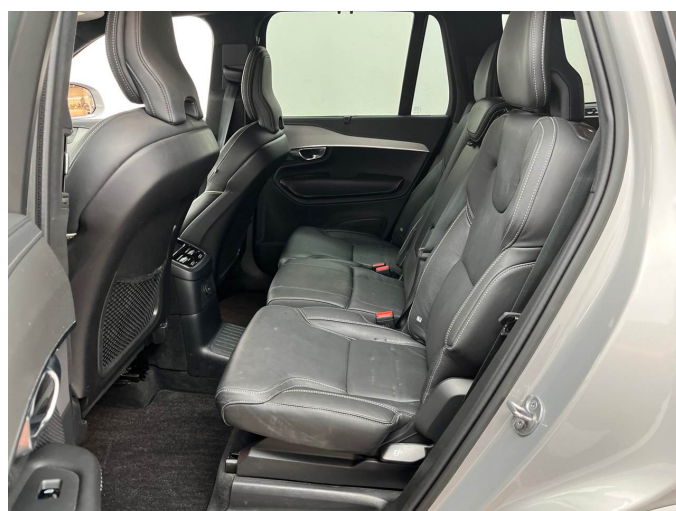


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

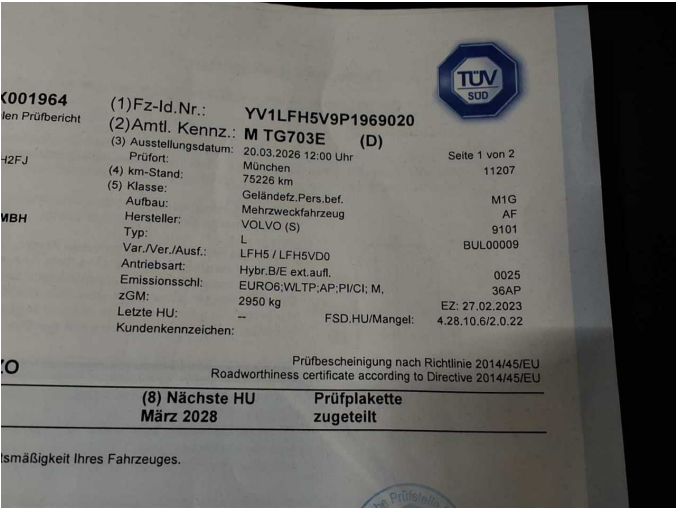


Figure 13: Documents

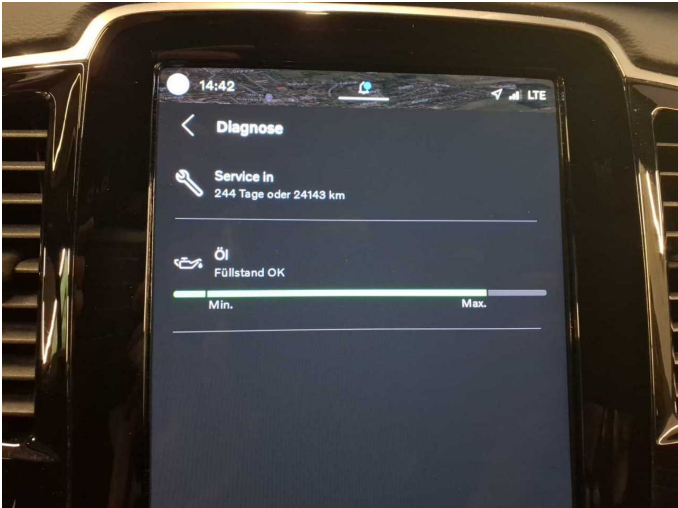


Figure 14: Documents



Figure 15: Documents

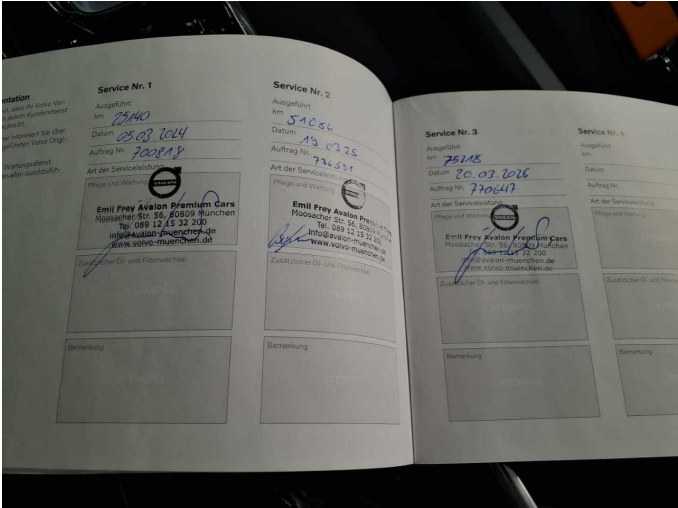


Figure 16: Documents

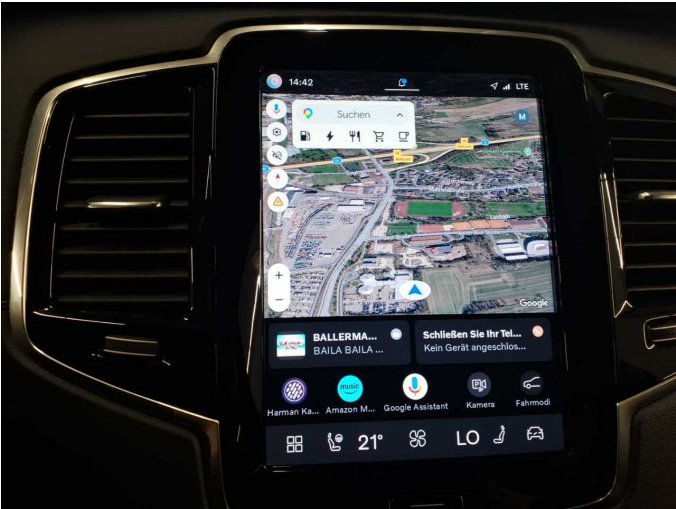


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.



Damage 4: Rear bumper: Spoiler - Scratch(es) - Smart repair

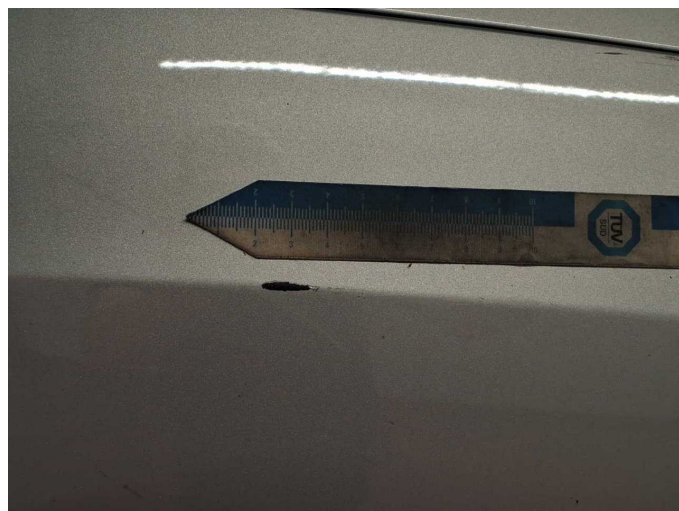

Damage 4: Rear bumper: Spoiler - Scratch(es) - Smart repair



Damage 5: Sill - left side: Trim - Scratch(es) - Smart repair



Damage 5: Sill - left side: Trim - Scratch(es) - Smart repair



Damage 6: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 6: Side panel - rear right side: Sill - Scratch(es) - Smart repair




Damage 7: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 7: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 9: Wheel / tyres: Tyre - rear left side - Broken / torn - Replace

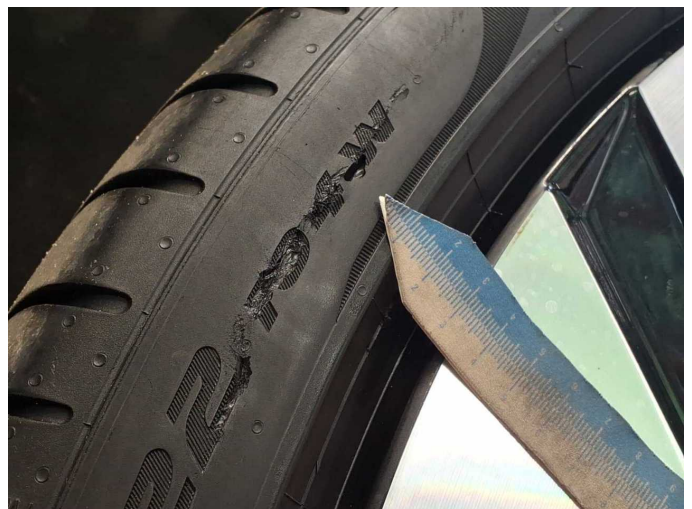

Damage 9: Wheel / tyres: Tyre - rear left side - Broken / torn - Replace



Damage 10: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 10: Wheel / tyres: Tyre - front right side - Broken / torn - Replace



Damage 11: Mudguard - right side: Wheel well extension - Scratched - Paint



Damage 11: Mudguard - right side: Wheel well extension - Scratched - Paint



Damage 12: Side panel - rear left side: Wheel well extension - Scratched - Paint



Damage 12: Side panel - rear left side: Wheel well extension - Scratched - Paint



Damage 12: Side panel - rear left side: Wheel well extension - Scratched - Paint




Damage 13: Front bumper: Spoiler - Scratched - Paint



Damage 13: Front bumper: Spoiler - Scratched - Paint



Damage 13: Front bumper: Spoiler - Scratched - Paint

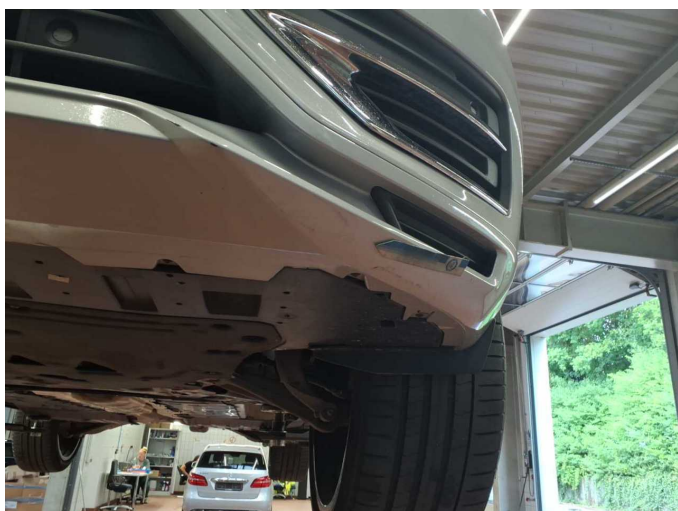

Damage 13: Front bumper: Spoiler - Scratched - Paint



Damage 13: Front bumper: Spoiler - Scratched - Paint



Damage 14: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 14: Wheel / tyres: Alloy rim - front right side - Scratched - Replace




Damage 14: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 14: Wheel / tyres: Alloy rim - front right side - Scratched - Replace



Damage 15: Vehicle glazing: Windscreen - Stone chips - Replace

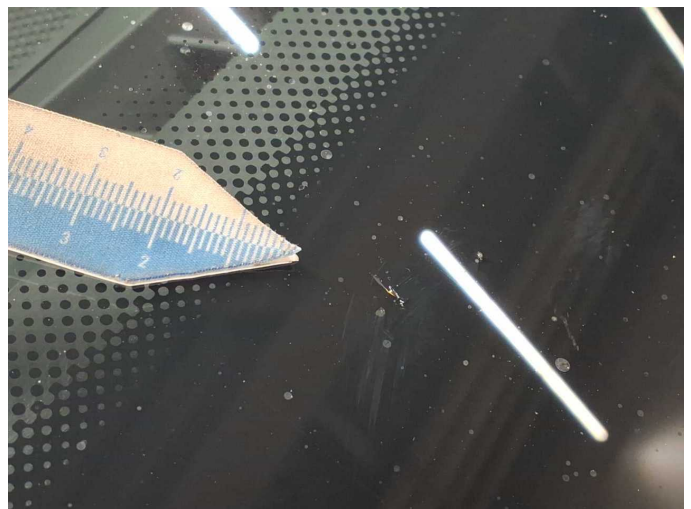

Damage 15: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 1: Side panel - rear right side: Wheel well extension - Scratch(es) - No deduction



Wear and tear 2: Roof: Roof - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1LFH5V9P1969020

Hersteller / Modell: VOLVO VOLVO XC90 T8 AWD Recharge Ultimate Bright

Datum	KM-Stand	Beschreibung
20.03.2026	75.224	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
12.06.2025	54.944	Systemtest/Eigendiagnose
19.03.2025	51.086	Bremsflüssigkeit; Bremsflüssigkeit ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges; Zündkerzen ern
05.03.2024	25.140	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges