



Expertise

Protocol number: 46400805
Order No. / Reference: 26605142
Inspection date: 8 Jul 2026

Manufacturer: Ford

Model: Grand Tourneo Connect 1.5 EcoBlue Aut. Start/Stop Trend

VIN: WF0UXXWPGUNL42077



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Grand Tourneo Connect 1.5 EcoBlue Aut. Start/Stop Trend

Vehicle Identification number	WF0UXXWPGUNL42077
Mileage (Read)	141,932 km
First registration	1 Mar 2022
Number of holders	1
Next periodical technical inspection	04/2027
(Report on hand)	

Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van

Colour / colour code	Blazer-Blau
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	88 %
Last service on / at	05/2026 at 139,571 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH412844
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BLK 00408		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,320 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	205/60 R16 96V	Summer tyres on Light alloy	Continental	4mm / 4mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Michelin	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Michelin	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/60 R16 96H C	Summer tyres on Steel	Continental	6 mm
Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.				



Equipment

Standard equipment

- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Hill start assist
- On-board computer
- Diesel particulate filter (DPF)
- Electronic Safety and Stability Program (ESP)
- Rear power windows, right and left, electric
- Front electric windows with one-touch down function for the driver's side
- Cruise control
- Glove compartment with lid
- Interior lighting for passenger/cargo compartment
- Interior lighting front and rear with delay function
- Intelligent security system
- Front air conditioning, manual, with semi-electronic recirculation function
- Radiator grille with 5 crossbars, black plastic
- Steering wheel: Multifunction leather steering wheel, 4 spokes
- Fog light
- Pollen and dust filter
- Pre-Collision Assist
- Windscreen wipers with rain sensor
- Black plastic side protection strips
- Safety Brake Assist (EBA)
- Sun visor with mirror on driver and passenger side (for drivers with ticket holder)
- Concealed storage compartment on dashboard
- Power outlet: 12-volt connection on the center console, front and rear
- Front bumper painted in body color
- Carpet floor mats for the front (2-piece set)
- Traffic sign recognition system
- Immobilizer EPATS
- Heat-insulating glazing, lightly tinted
- Black exterior mirror caps (plastic)
- Tires: 6.5 J x 16 alloy wheels (4) with 205/60 R 16 tires and wheel lock
- Front overhead storage compartment
- Third brake light
- Lane keeping assist including lane keeping assist and driver fatigue warning
- FordPass Connect including live traffic information and Wi-Fi hotspot
- Transmission: 8-speed automatic transmission
- Rear swing door including heated rear window and wiper/washer system
- Intelligent battery management system
- Isofix bracket
- Rear headrests (3)
- Headrests 2 front, height adjustable
- Paint finish: Solid
- Adjustable steering column
- Front center console, open, with storage area
- Emergency brake light
- Pollen filter and dust filter
- Tire pressure monitoring system
- Sliding door, right and left
- Electromechanical power steering
- Bench seat (in the 2nd row, 3 seats). 60:40 split, foldable.
- Front spoiler lip
- Start-stop system
- 12-volt socket in storage compartment on dashboard (driver's side)
- Rear bumper, black plastic
- Daytime running light
- Child safety lock on sliding doors
- Warning system for unfastened driver and front passenger seat belts
- Central locking with remote control (door lock only on driver's door)



Extra equipment

- Exterior mirrors, electrically adjustable, heated and folding (housing painted in body color on Titanium models - incl. electric front and rear windows with quick-up/down function - mirrors fold in automatically when the vehicle is locked)
- Heated windshield
- Adaptive cruise control with intelligent speed limiter (Pre-Collision Assist, radar and camera-based, with pedestrian and cyclist detection2) - Lane Keeping Assist including Lane Departure Warning and Driver Alert - Leather multifunction steering wheel - Traffic Sign Recognition System)
- Fog lights (with static cornering lights)
- Package: Seat Package 6 (fabric, Capitol/City in Ebony (black) - driver's seat, 3-way manually adjustable (forward/backward, height, backrest), with lumbar support - single passenger seat, 2-way manually adjustable (forward/backward, backrest) and foldable - map pocket for driver's seat - seat heating for driver and single passenger seats)
- Parking assistant with parking and exiting function (Active Park Assist) (for perpendicular and parallel parking spaces as well as with exiting assistant and parking pilot system front and rear)
- Crosswind Assist and Rollover Protection ((RSC Roll Stability Control))
- Safety partition net for separating passenger and luggage compartments (including attachment points)
- Reinforced battery ((12V 80Ah, 800 CCA, AGM))
- Tires: Spare wheel, steel wheel (6.5 J x 16)
- Anti-theft alarm system with interior monitoring (including double locking and 2 remote control keys in the overhead storage compartment including glasses storage compartment - with fold-out additional mirror for eye contact with rear passengers)
- Navigation: Ford Audio System 9 navigation systems, including Ford SYNC 3 with AppLink, touchscreen, and reversing camera (Ford SYNC 3 communication and entertainment system with voice control, 6" color touchscreen, high resolution, 15.2 cm screen diagonal, radio (FM/AM), 2 USB ports, 6 speakers, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, premium center console, reversing camera including rear parking assist system, phase-differentiated antenna, DAB/DAB+, voice control for audio and telephone, support for Android Auto and Apple CarPlay, dynamic navigation TMCpro, live traffic, 3D display)
- Radio accessory: CD player (for storage compartment on the Ford audio or navigation system)
- Headlight assistant with day/night sensor (including headlight dipped beam with switch-off delay, windshield wipers with rain sensor, automatically dimming interior mirror)
- Carpet floor mats for the 2nd row of seats

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
2	Engine	Engine - Leaking - Diagnosed and repair if necessary
3	Seat - front	Seat cover - right side - Burn hole (cigarettes) - Smart repair
4	Door - rear left side	Door - Dent / paintcoat damage - Smart repair
5	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
6	Door - front left side	Door - Scratch(es) - Paint
7	Side panel - rear left side	Side panel - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Body	Underbody panelling - Scratched - No deduction
2	Interior	Interior - Scratch(es) - No deduction
3	Mudguard - left side	Mudguard - left side - Stone chips - No deduction
4	Instrument panel	Centre console - front - Scratch(es) - No deduction
5	Front bumper	Front bumper - Stone chips - No deduction
6	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

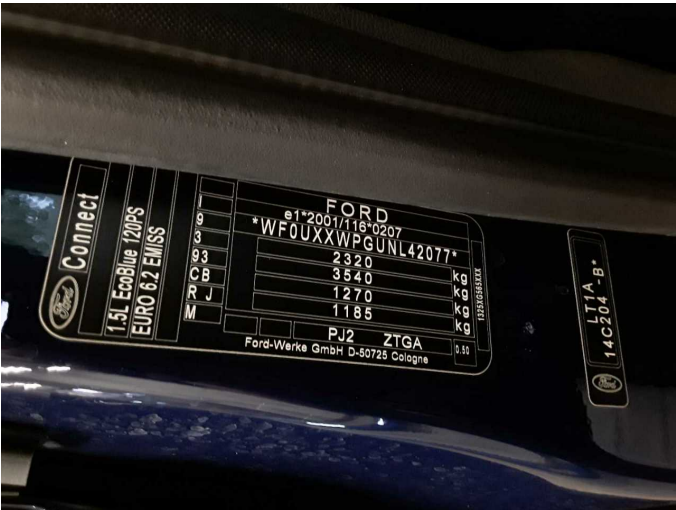


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

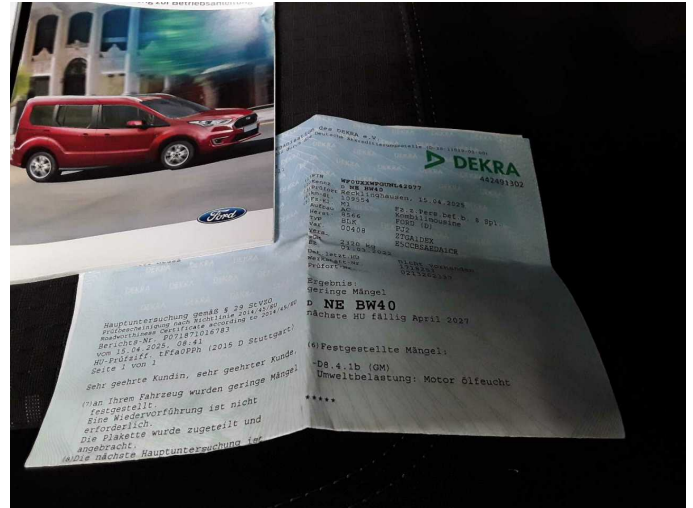


Figure 14: Documents

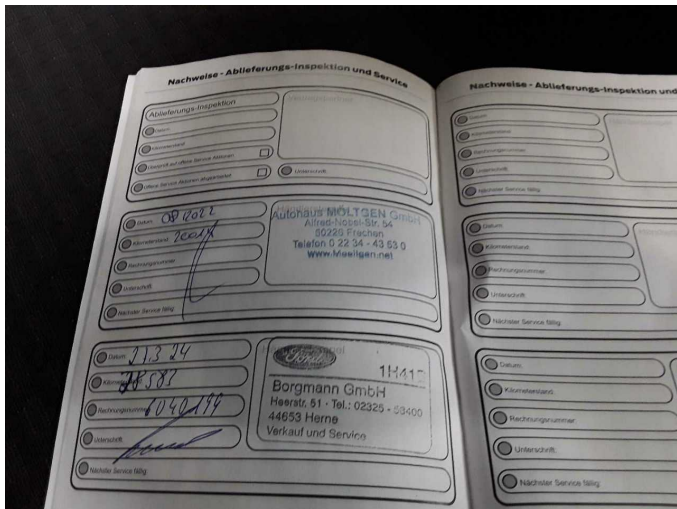


Figure 15: Documents



Figure 16: Additional tyres

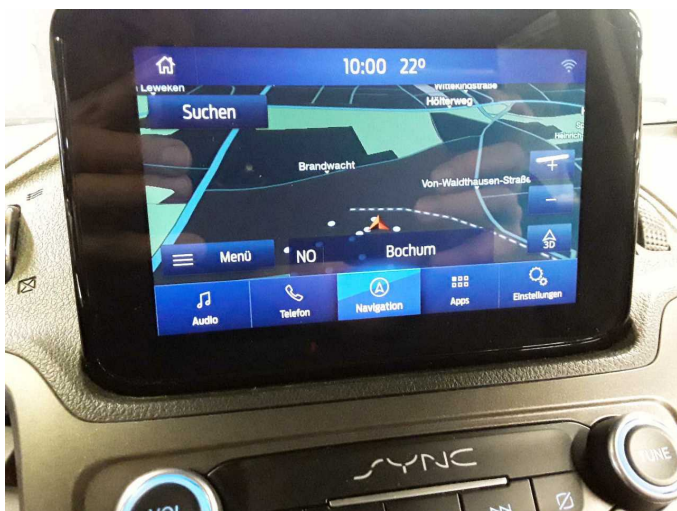


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

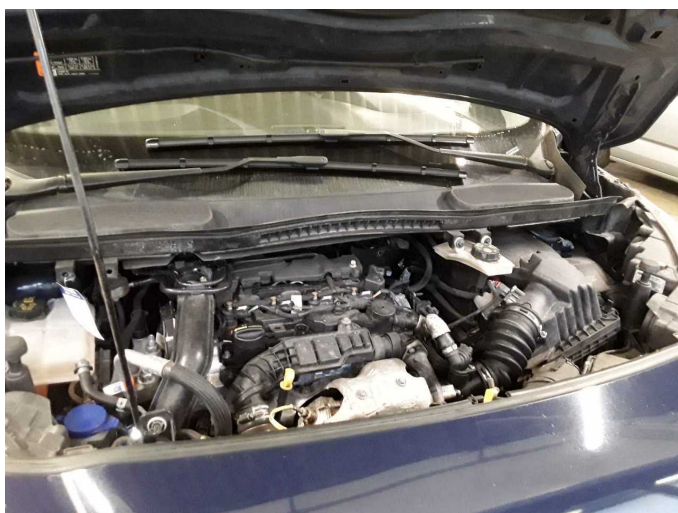


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 2: Engine: Engine - Leaking - Diagnosed and repair if necessary



Damage 3: Seat - front: Seat cover - right side - Burn hole (cigarettes) - Smart repair




Damage 3: Seat - front: Seat cover - right side - Burn hole (cigarettes) - Smart repair

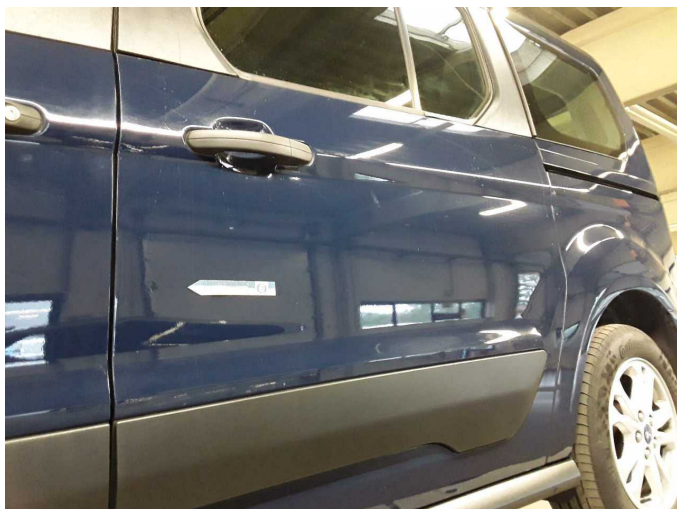


Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

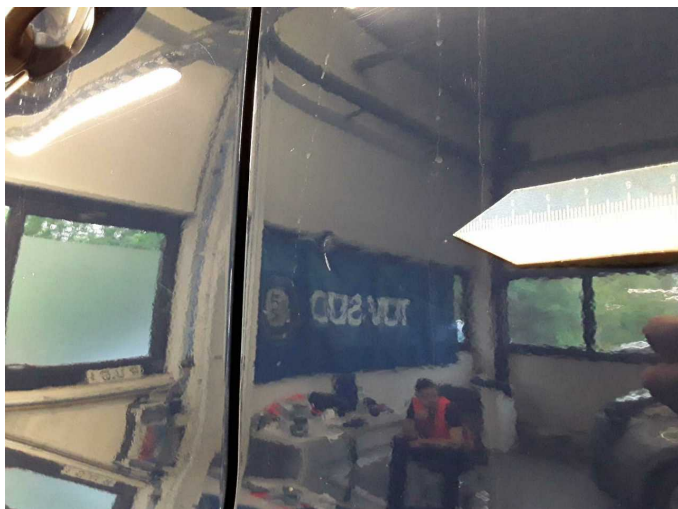

Damage 4: Door - rear left side: Door - Dent / paintcoat damage - Smart repair

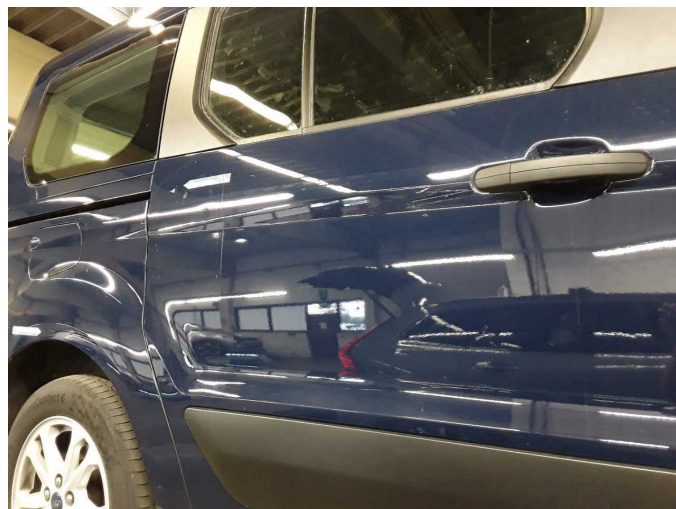


Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 5: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 6: Door - front left side: Door - Scratch(es) - Paint

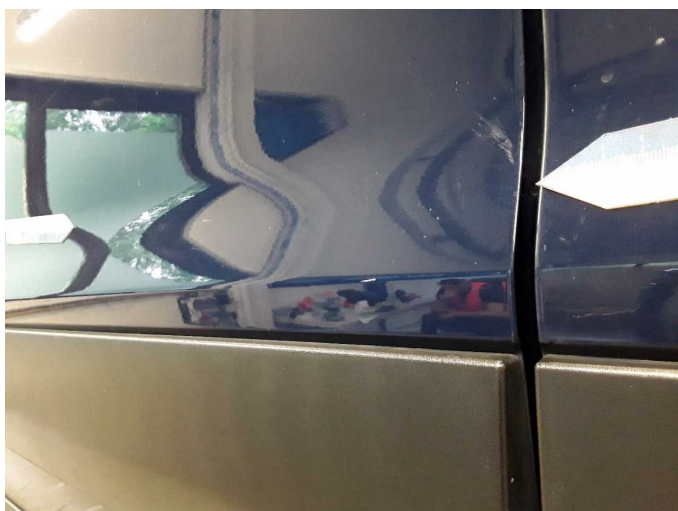

Damage 6: Door - front left side: Door - Scratch(es) - Paint

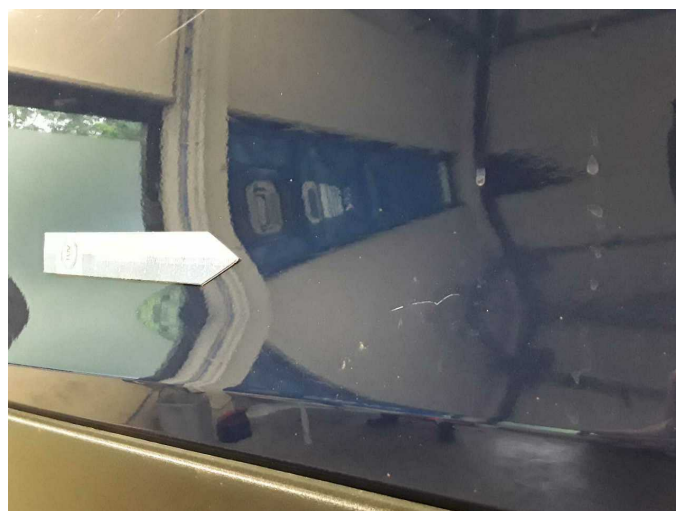

Damage 6: Door - front left side: Door - Scratch(es) - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0UXXWPGUNL42077

Hersteller / Modell: FORD FORD Grand Tourneo Connect 1.5 EcoBlue Aut. Start/Stop
Trend

Datum	KM-Stand	Beschreibung
15.05.2026	139.571	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose
05.01.2026	129.125	Reparatur Sonstiges; Systemtest/Eigendiagnose; Wasserpumpe ern; Zahnriemen/Steuerkett ern
12.11.2025	124.547	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.08.2025	117.341	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.07.2025	117.330	Getriebeöl ern/prüfen; Reparatur Sonstiges; Systemtest/Eigendiagnose
07.04.2025	109.544	AU; Getriebeöl ern/prüfen; Systemtest/Eigendiagnose
02.01.2025	101.794	Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.11.2024	97.389	Bremsklötze vorne
26.03.2024	78.583	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.08.2023	60.494	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.01.2023	40.284	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
23.08.2022	20.014	Motoröl b. Wartung; Regelwartungsdienst