



Expertise

Protocol number: 46376122
Order No. / Reference: 26431408
Inspection date: 7 Jul 2026

Manufacturer: Ford

Model: Kuga 2.5 Duratec FHEV ST-LINE

VIN: WF0FXXWPMHPD67312



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 2.5 Duratec FHEV ST-LINE	
Vehicle Identification number	WF0FXXWPMHPD67312
Mileage (Read)	60,073 km
First registration	10 May 2023
Number of holders	1
Power / Engine displacement	112 kw / 2,488 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 4
Gearbox / Number of gears	Automatic / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Chrome Blue Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Red
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	76 %
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT888664
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BUS 00086		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,215 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/60 R18 104V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/60 R18 104V	Summer tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Acoustic Vehicle Alerting System (AVAS)
- Anti-lock braking system
- Electrically adjustable, heated and folding exterior mirrors (painted in body color - with integrated turn signals and ambient lighting)
- Tires: Tire repair kit (maximum speed 80 km/h when used)
- third brake light
- Fabric headliner
- Roof rails, black
- Roof spoiler (painted in car color)
- 12.3-inch digital instrument panel
- Tachometer
- Selective driving mode switch (5 driving modes to choose from: Normal, Sport, Eco, Slippery and Unpaved Roads)
- Chassis: Sport chassis
- Electric parking brake with auto hold function
- Ford Easy Fuel (Ford Easy Fuel comfort refueling system (Eliminates the need for a separate internal fuel cap and prevents misfueling by detecting the size difference between petrol and diesel nozzles. The filler neck only opens when the correct fuel is used.)
- Luggage compartment cover, roller blind, removable
- Luggage compartment lighting
- Transmission: continuously variable automatic transmission (CVT)
- rear window wiper
- Intelligent Protection System (IPS) (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts in all seats, height-adjustable in the front - warning system for unfastened driver and front passenger seat belts)
- LED fog lights
- Steering column, adjustable in height and reach
- Front center console with integrated armrest (2 front cup holders)
- Navigation system: Ford navigation system incl. Ford SYNC 3 (AppLink, Android Auto, Apple CarPlay - 8" touchscreen (20.3cm screen diagonal) - DAB/DAB+ radio reception (Digital Audio Broadcasting) - 6 speakers - Steering wheel controls - Bluetooth® hands-free system and audio streaming - 2 USB ports - Voice control for audio and telephone - SMS text-to-speech function - Road map for Europe)
- Tire Pressure Monitoring System (TPMS)
- Rear view camera
- Headlights with delayed shut-off
- Power steering (electro-mechanical, speed-dependent (EPAS - Electric Power Assisted Steering))
- Seats: Map pockets on the driver's and front passenger's seat backrests
- Seats: Front seats, individually and variably heated
- Power outlet: 12-volt connection in the luggage compartment
- Immobiliser
- Ambient lighting (front including front door storage, footwell and cup holder lighting with LED technology)
- Passenger airbag deactivation
- Tires: 7.5 J x 18 light alloy wheels (4) in 5x2-spoke design in Rock Metallic (with tires 225/60 R 18)
- Body styling kit (upper radiator grille in honeycomb design with black surround - ST-Line front bumper with front lip and inserts in body color - ST-Line rear bumper with sporty diffuser in body color - side skirts and wheel arch trim painted in body color)
- Dual exhaust system
- Electronic Stability Program (ESP) (with hill start assist, traction control and emergency brake assist)
- Lane keeping assist including lane keeping assist
- Electric front and rear windows (with quick-down function including all-around closing function)
- Ford EcoCoach (shows the efficiency of current driving behavior)
- Ford Power Start function & Ford Key Free system (keyless locking/unlocking)
- FordPass Connect (including eCall, live traffic information and Wi-Fi hotspot)
- Cruise control
- Illuminated glove compartment
- Heated rear window
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Front and rear headrests (5) height adjustable
- LED taillights
- Steering wheel: ST-Line design, flattened at the bottom and with red decorative stitching, in Sensico synthetic leather
- MyKey key system (individually programmable second key)
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Front and rear parking pilot system
- Upholstery: Cloth
- Post-Collision Assist
- Pre-Collision Assist (including forward alert system (FA) with pedestrian and bicycle detection - active from approx. 5 km/h to 130 km/h, pedestrian and bicycle detection up to approx. 80 km/h.)
- Windscreen wipers with rain sensor
- Headlight assistant with day/night sensor
- Seats: Driver and front passenger seats, 8-way manually adjustable (including adjustable lumbar support)
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front sports seats with integrated headrests
- Sun visor on driver and passenger side
- Carpet floor mats front and rear



- Black trim around the side windows
- Central locking with remote control and remote luggage compartment release

Extra equipment

- Paint finish: Special metallic paint finish
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Panoramic sliding sunroof, electric, including roof console with glasses storage compartment
- Safety partition net (including attachment points behind the first and second rows of seats)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - dent(s) - Smart repair
2	Door - rear left side	Door - dent(s) - Smart repair
3	Rear bumper	Rear bumper - Scratched - Smart repair

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Provided by user / customer, from 20 May 2024	6.773,48 €

Repainting

No.	Repainting
1	Bonnet, Door - front left side, Professionally carried out

Paint coat thickness measurement

Bonnet	101 µm	Door - front left side	177 µm
--------	--------	------------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

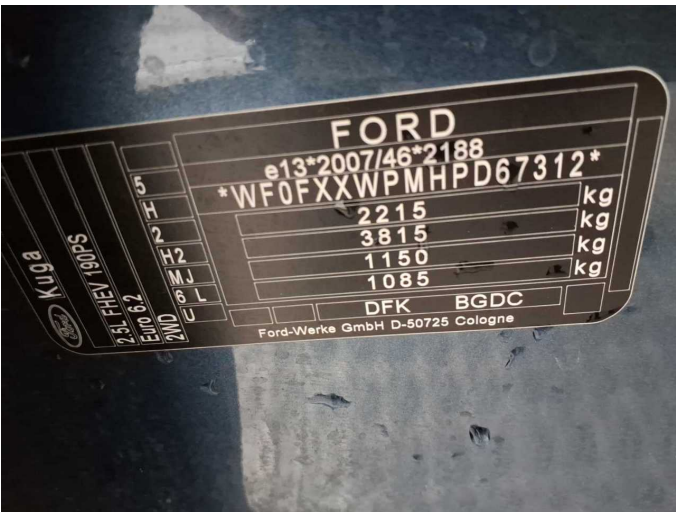


Figure 11: VIN



Figure 12: Mounted tyres

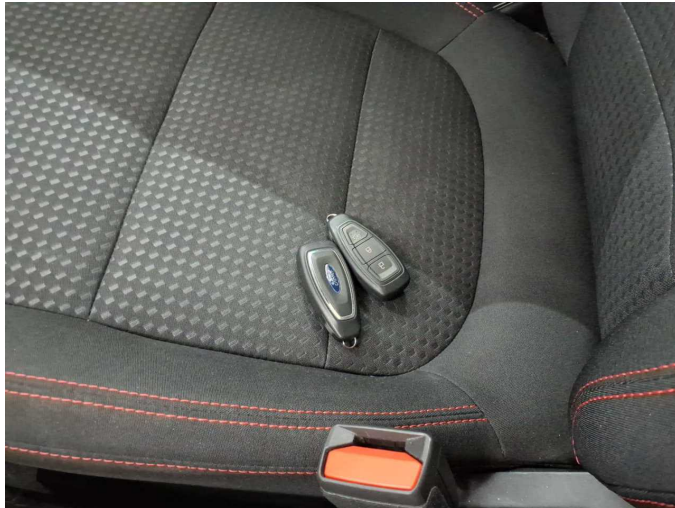


Figure 13: Documents

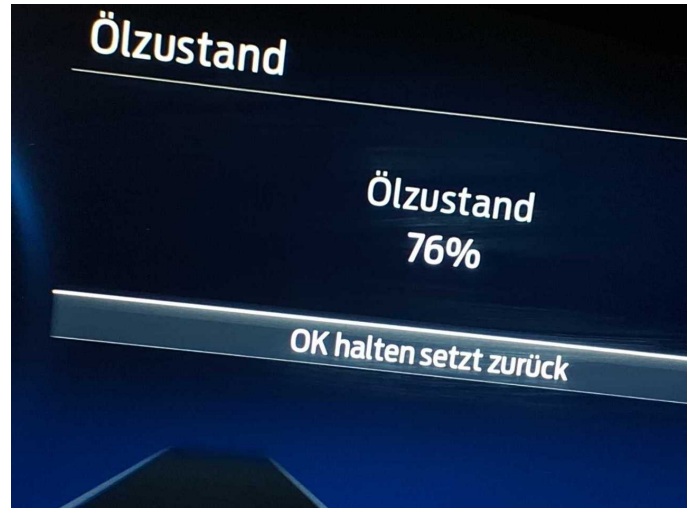


Figure 14: Documents

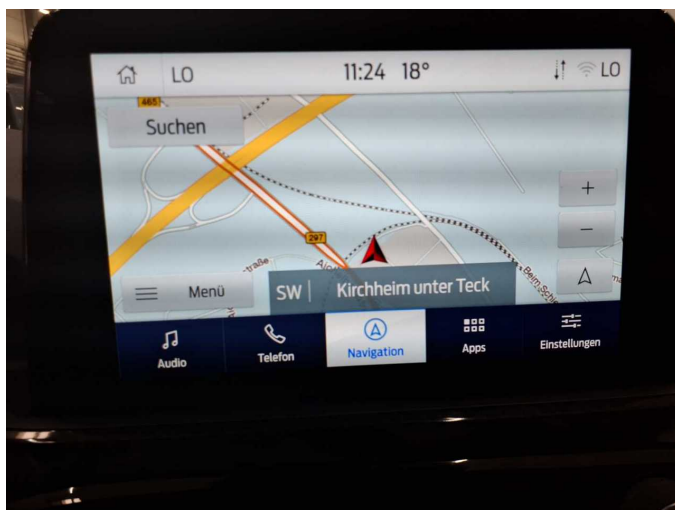


Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

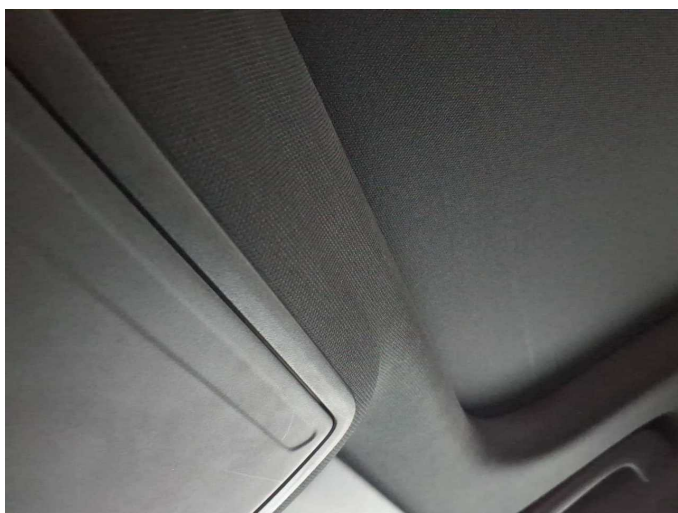


Figure 21: Misc.

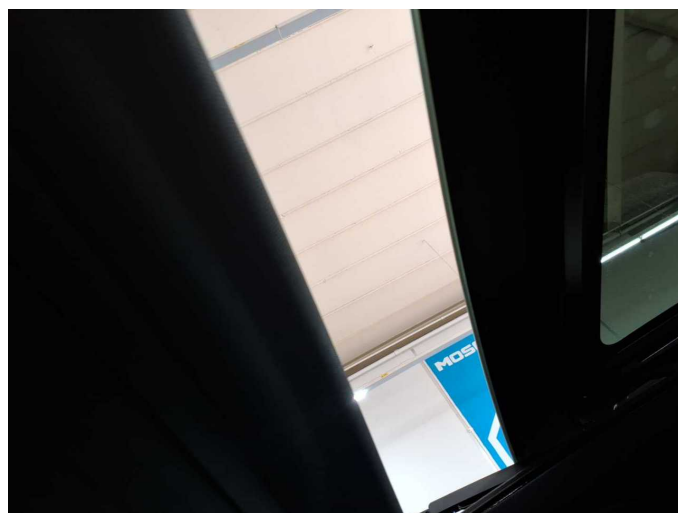


Figure 22: Misc.

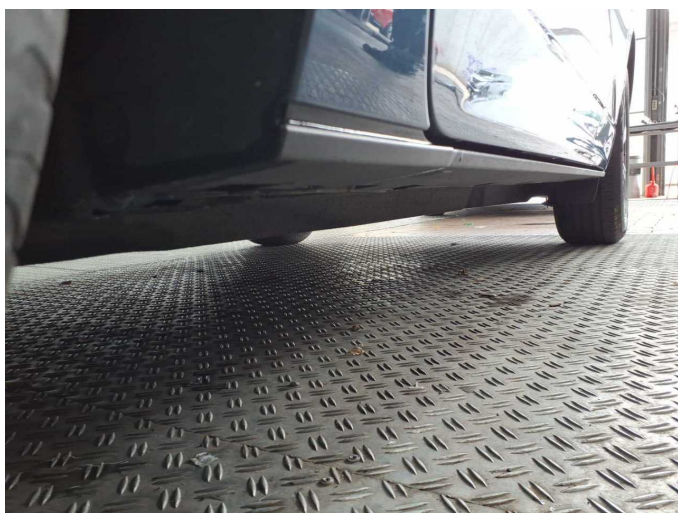


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

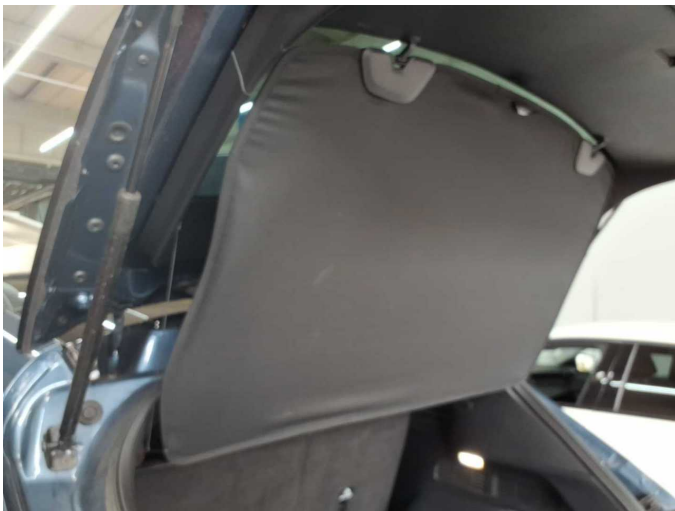


Figure 27: Misc.




Figure 28: Misc.




Figure 29: Misc.




Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smart repair

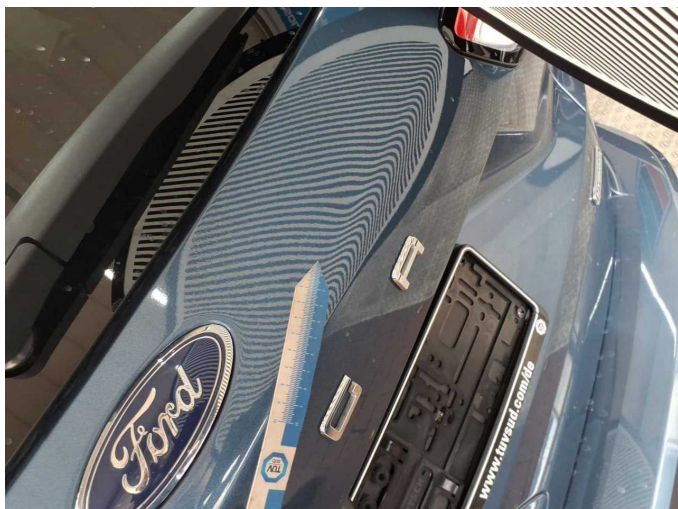


Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smart repair

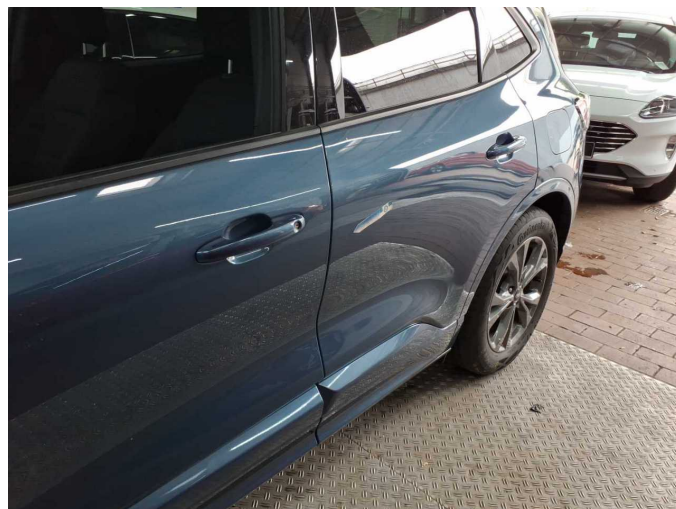

Damage 2: Door - rear left side: Door - dent(s) - Smart repair

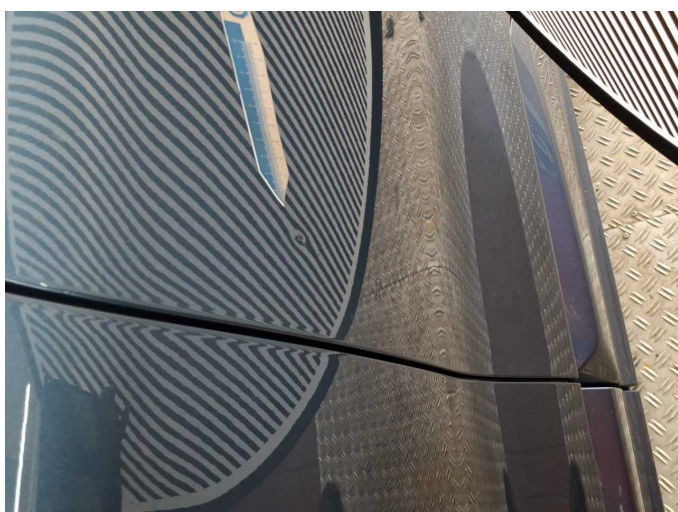

Damage 2: Door - rear left side: Door - dent(s) - Smart repair

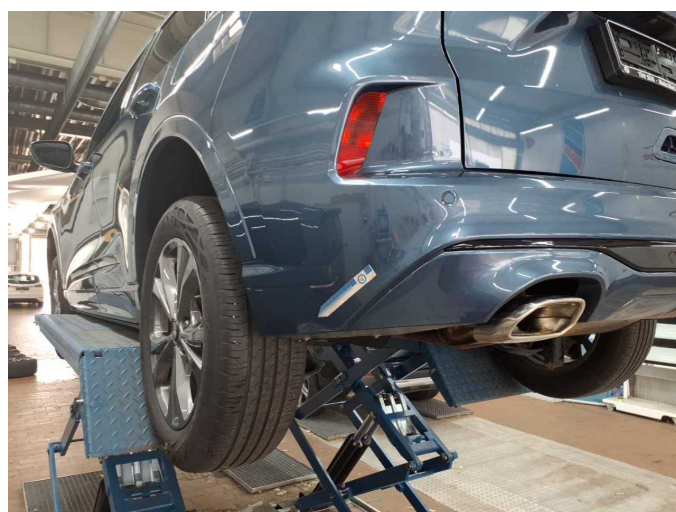

Damage 3: Rear bumper: Rear bumper - Scratched - Smart repair



Damage 3: Rear bumper: Rear bumper - Scratched - Smart repair



Repainting 1: Bonnet, Door - front left side



Repainting 1: Bonnet, Door - front left side



Repainting 1: Bonnet, Door - front left side



Repainting 1: Bonnet, Door - front left side