



RENAULT CLIO: GD-455-EM

Vinnumber:	VF1RJA00667890917	Versionname:	RENAULT CLIO Business E-Tech hybride 140 -21N
First Registrationdate:	26/11/2021	Fiscalpower:	VP [5P] bva 6-140CH-5cv (bi-corps)
Expertise Mileage:	128528	Power Kw:	103
Bodytype:	Berline	Body colour:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Interior colour:	Anthracite
Fueltype:	Petrol	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Anthracite
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Headlights Xenon/LED/Laser	
Windows electric F		Rear parking sensors	
Cruise Control		Seat cover lining	Lining Other
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	Manual climate control		

Tyres

	195/55/16/91 V			
Summer tyres:	Fr.L.	Bridgestone: 85%	Fr.R.	Bridgestone: 95%
	Re.L.	Bridgestone: 45%	Re.R.	Bridgestone: 50%
Tyre profile depth FL				2.6
Tyre profile depth FR				1.8
Tyre profile depth RL				5.2
Tyre profile depth RR				5.0
Tyre size FL				195/55 R 16 91 V
Tyre size FR				195/55 R 16 91 V
Tyre size RL				195/55 R 16 91 V
Tyre size RR				195/55 R 16 91 V
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				255
Tyre make FR				255
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Armrest F M, Broken, Replace



Dashboard, Scratch(es), Acceptable




Interior, Stain, Cleaning



Remote ignition key, Missing, Repair/replace (lump sum)



Seat cover FL, Burned, Replace

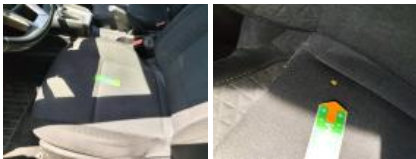

Tyre FL, Out of tolerance, Replace



Tyre FR, Out of tolerance, Replace



Wheel cover FL, Broken, Replace



Outside rear-view mirror housing L, Scratch(es), Polish



Outer sill L, Dent(s), Repair and paint (complete)



Door trim FL, Scratch(es), Replace



Door RL, Dent(s), Repair and paint (complete)



Door RR, Dent(s), Repair and paint (complete)



Outer door handle FR, Scratch(es), Acceptable



Outside rear-view mirror housing R, Scratch(es), Paint



Luggage compartment cover, Missing, Replace



Rear roof pillar covering L, Broken, Replace



Internal boot lining R, Broken, Replace



Bumper R, Scratch(es), Paint



Bodywork, Not original part, Sticker removal small



Historique Maintenance

Immatriculation: **GD-455-EM** Date de 1ère immatriculation: **26/11/2021**

Modèle: **Renault CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
13/03/2026	122.103	AGENCE DE LUCA	REVISION ET CLIM
13/03/2026	122.103	AGENCE DE LUCA	REVISION
04/03/2026	121.562	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
22/01/2026	119.363	AGENCE DE LUCA	BOITIER D ALLUMAGE RPLT
	0		SERENITE
	0		FILTRE A AIR RPLT
27/02/2025	92.105	SATAC FREJUS	HUILE MOTEUR
	0		LIQUIDE DE REFROIDISSEMENT RPLT
	0		ESSAI
	0		HUILE BV RPLT
	0		DIVERS TRANSMISSION
	0		DIAG
	0		GEOMETRIE CTRL
	0		RECHARGE CLIM
	0		DIVERS ELEC
16/01/2025	92.086	SATAC FREJUS	BALAI ESSUIE GLACE AR
	0		REVISION ET CLIM
	0		LIQUIDE DE FREIN
	0		PLAQUETTES AV RPLT
	0		BALAIS ESSUIE GLACE AV
28/10/2024	83.869	EUROFLEET TYRES AND SERVICES	REMPLACEMENT PNEUS 4 SAISONS
06/03/2024	66.343	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS ETE
06/02/2024	62.460	SATAC FREJUS	DISQUES PLAQUETTES AV RPLT
	0		REVISION
29/03/2023	32.879	EUROFLEET TYRES AND SERVICES	REMPLACEMENT PNEUS 4 SAISONS
10/03/2023	29.782	SA SAMVA	BALAIS ESSUIE GLACE AV
	0		RECYCLAGE
	0		BALAI ESSUIE GLACE AR
	0		PLAQUETTES AV RPLT
	0		REVISION ET CLIM
09/03/2023	28.399	EUROFLEET TYRES AND SERVICES	REMPLACEMENT PNEUS 4 SAISONS