



Expertise

Protocol number: 46534026  
Order No. / Reference: 26732869  
Inspection date: 14 Jul 2026

Manufacturer: Audi

Model: A5 Sportback 35 TDI S tronic advanced

VIN: WAUZZZF51NA021989



| Vehicle details                            |                               |
|--------------------------------------------|-------------------------------|
| Manufacturer / Type / Model / Equipment    |                               |
| Audi A5 Sportback 35 TDI S tronic advanced |                               |
| Vehicle Identification number              | WAUZZZF51NA021989             |
| Mileage (Read)                             | 212,030 km                    |
| First registration                         | 14 Feb 2022                   |
| Number of holders                          | 1                             |
| Power / Engine displacement                | 120 kw / 1,968 ccm            |
| Fuel type / Cylinder                       | Hybrid Diesel / E / 4         |
| Gearbox / Number of gears                  | Automatic / 7                 |
| Type of drive                              | Front drive                   |
| Type of vehicle                            | Coupe                         |
| Colour / colour code                       | Mythos-schwarz Metallic (Y9T) |
| Doors / Seats                              | 5 / 5                         |
| Upholstery type                            | Cloth                         |
| Colour of upholstery                       | Black-Anthracite              |
| Vehicle with smoke odor                    | no                            |



## Vehicle details

|                                                      |                                     |                                |                                                            |
|------------------------------------------------------|-------------------------------------|--------------------------------|------------------------------------------------------------|
| <b>Maintenance booklet / proof</b>                   | digital proof / complete            | <b>Next maintenance in</b>     | -4,700 km                                                  |
| <b>Last service on / at</b>                          | 02/2026 at 192,184 km               |                                |                                                            |
| <b>Key is / should be</b>                            | 2 / 2                               | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                                      |                                     | <b>Letter No.</b>              | GH985888                                                   |
| <b>Previous damage / Accident</b>                    | Detectable                          | <b>Repainting</b>              | None detectable                                            |
| <b>Inspection conditions</b>                         | sufficient                          | <b>Lifting equipment / pit</b> | yes                                                        |
| <b>Test drive</b>                                    | short drive on the company premises | <b>Engine function test</b>    | Performed                                                  |
| <b>Manufacturer key number/<br/>type code number</b> | 0588 / BPN 00583                    |                                |                                                            |
| <b>Emission standard</b>                             | EURO6;WLTP;AP;PI/CI; M, N1 I        | <b>fine dust sticker</b>       |                                                            |
| <b>Permitted total weight</b>                        | 2,120 kg                            | <b>Empty weight</b>            |                                                            |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 245/40 R18 97Y | Summer tyres on Light alloy | Semperit     | 6mm / 6mm   |
| 2) | 245/40 R18 97Y | Summer tyres on Light alloy | Semperit     | 6mm / 6mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 235/50 R17 98H | Winter tyres on Light alloy | Continental  | 7mm / 7mm   |
| 2) | 235/50 R17 98H | Winter tyres on Light alloy | Continental  | 5mm / 5mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 11/2025 |              |             |

**Legend:** Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment

## Standard equipment

- AdBlue tank (12 liters)
- Airbag: Front side airbags and head airbag system (front side airbags integrated into the seatbacks; with additional head airbag system; deploys in front of the side window area and thus helps to protect front and outer rear passengers in the event of a side impact)
- Drive slip control
- Audi drive select (adjustment of vehicle characteristics in the available modes auto, comfort, dynamic, individual by adapting the steering assistance, accelerator pedal and shift characteristics and other optional equipment. The individual mode allows the combination of different settings of the respective systems.)
- Audi pre sense city (Within system limits, an impending collision with vehicles and pedestrians can be detected at speeds up to approximately 85 km/h. In this case, the system warns the driver visually, audibly, and, if necessary, with a braking jolt. It can initiate full deceleration if required to reduce the collision speed or, if possible, avoid the collision altogether.)
- Decorative inlays diamond lacquer silver grey (for dashboard, door panels and center console)
- Tachometer
- Rear parking aid (supports reversing by acoustically indicating the distance to a detected object behind the vehicle; measured by discreetly integrated ultrasonic sensors in the bumper, active when reverse gear is engaged)
- Electronic Stability Control (ESC) (networks ABS, EBV, ASR and EDS with its own sensors and compares the driving data with reference data; ensures greater stability at any speed by selectively braking individual wheels and intervening in engine management)
- Chassis: Standard chassis (The standard chassis combines very good ride comfort with good driving dynamics. Shock absorbers and coil springs on the front and rear axles - with 5-link lightweight front axle, stabilizer bar; front axle carrier rigidly bolted to the body - with 5-link lightweight rear axle with independent suspension, stabilizer bar; rear axle carrier elastically mounted)
- Front and rear floor mats (made of velour in black; in conjunction with interior design selection, interior S line or in the S model with contrast stitching color-matched to the respective interior color)
- Cruise control with adjustable speed limiter (The cruise control maintains the individually set speed above 20 km/h, provided the engine power allows it. The adjustable speed limiter helps to prevent exceeding a previously set maximum speed from approximately 30 km/h, e.g., within built-up areas.)
- Transmission: S tronic (7-speed)
- Interior lighting (front and rear roof module including capacitively operated front reading lights, illuminated make-up mirror, ambient light on center console, glove compartment light)
- Airbag for driver and front passenger (full-size airbag, with front passenger airbag deactivation)
- Accent surfaces in matte black (for dashboard, trim panels in door sills and center console insert)
- Anti-lock braking system (ABS) (with electronic brake force distribution (EBD) and brake assist)
- Audi connect Emergency Call & Service including vehicle control (Emergency Call & Service: - Emergency call - Online breakdown call - Audi damage service - Audi service appointment online Vehicle control: - Vehicle status report - Remote control locking/unlocking - Parking position - Remote control auxiliary heater - Anti-theft alarm notification)
- Electrically adjustable/heated exterior mirrors (with integrated LED indicator, convex, flat or aspherical mirror glass, including heated windshield washer nozzles)
- Exterior mirror housings in body color
- Outdoor temperature display
- third brake light
- Headliner in fabric (atlas beige or titanium grey, color-matched to the respective interior color)
- Diesel particulate filter (DPF) with DeNox catalyst and AdBlue tank
- Door sill trims with aluminum inlay (on the door sills)
- Electromechanical parking brake (includes parking brake function when stationary - starting aid by automatic release when starting and emergency braking function while driving via all four wheels)
- Driver information system (with high-resolution 5-inch monochrome display, display content: speed (digital speedometer), time, mileage, outside temperature, fuel warning with remaining range, gear shift recommendation, current radio station or music track, radio and media lists, telephone menu, navigation information (if available). The integrated efficiency program supports the driver with consumption data overviews and fuel-saving tips for more economical driving; including break recommendation.)
- Electric front windows (with one-touch up/down function (including excess force limitation) and comfort operation)
- Remote key, without Safe-Lock (locks and unlocks doors, luggage compartment and fuel filler flap - including Keyless-Go - including comfort closing/opening of windows)
- Electrically opening and closing tailgate (opening via the button on the vehicle key, the button in the driver's door panel, or the soft-touch button in the tailgate handle recess, or by a foot gesture (kick movement) in conjunction with the comfort key including sensor-controlled tailgate release; closing via the button on the inside of the tailgate, the button in the driver's door, or via the comfort key (continuous press), or by a foot gesture (kick movement) in conjunction with the comfort key including sensor-controlled tailgate release)
- Interior mirror dimming
- Manual child lock



- ISOFIX and Top Tether child seat anchorage for the outer rear seats (standard mounting for practical attachment of ISOFIX child seats - Incl. additional attachment point (Top Tether) - The recommended child seats are available from your Audi partner)
- boot floor mat
- Headrests (4) (height adjustable front and rear)
- LED rear lights (indicator, brake, tail, reversing and rear license plate lights in LED technology. Brake lights in LED technology enable earlier detection by following traffic due to faster activation.)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction (with 6 multifunction buttons for operating the basic functions of the existing infotainment system; height and distance adjustable, with full-size airbag; leather steering wheel rim)
- front center armrest
- Non-smoking version (one 12-volt socket each in the center console at the front in front of the gearshift/selector lever and at the rear for the 2nd row of seats - no cigarette lighter)
- Gloss package (roof frame and window channel strips in anodized aluminum)
- Wheel: Alloy wheels "5-V-spoke Y-design" (8.5 J x 18 with tires 245/40 R 18)
- Wheel: Tire pressure monitoring system (visual and audible warning in case of pressure loss in one or more wheels)
- Radio: MMI Radio Plus (10.1" color display (1,540 × 720) including MMI touch operation - Driver information system with 5" mono display - Audi music interface with 1 USB-A and 1 USB-C port, each with data and charging function - Bluetooth interface (hands-free calling and audio streaming) - 8 passive speakers - AM/FM phase diversity - speed-dependent volume adjustment - voice control system with natural language for controlling infotainment and vehicle functions - WLAN hardware - DAB+ digital radio)
- Front seats (standard seats) (with manual adjustment of seat height, seat longitudinal position, backrest angle, headrest and seat belt height)
- Telephone: Bluetooth interface (The smartphone can be connected to the vehicle via Bluetooth to play music or make phone calls. Two mobile phones can be connected simultaneously for hands-free calling. Complete contact data is only displayed from the first primary phone registered in the MMI. Depending on the smartphone model, emails and SMS messages can also be displayed in the MMI via Bluetooth.)
- Electronic immobilizer (integrated into engine control unit, activated by vehicle key)
- Automatic climate control (1-zone - electronically regulates air temperature, volume and distribution, sun position-dependent control - air distribution can be set using 5 main positions - 3 LEDs integrated into the seat heating/ventilation buttons provide feedback on the selected setting (optional) - buttons for defrosting the front and rear windows - manual recirculation control - with key recognition and humidity sensor - dust and odor-removing cabin air filter)
- LED headlights (using LED technology; low beam, high beam, daytime running lights and position lights in LED; turn signals in incandescent technology, with all-weather light)
- Mild hybrid (Mild hybrid features an enhanced start-stop function, extended energy recuperation during braking to charge the starter battery, and additional lithium-ion storage. This allows the system to recover more energy and switch off the engine more frequently. A supplementary belt-driven starter generator (BSG) is conceptually included for mild hybrid systems. Purely electric driving is not possible.)
- Upholstery: Fabric upholstery Index (for standard seats: - Seat center panels in fabric Index rock grey or black - Seat side bolsters, headrests and center armrest in fabric solid rock grey or black)
- Wheel: Tire repair kit (12V compressor and tire sealant, maximum speed 80 km/h)
- Wheel: Low rolling resistance tires, speed-limited (size 245/40 R18, maximum permissible speed 210 km/h)
- Radio accessories: 8 speakers
- Radio accessories: Data module Europe
- Rear seat backrest foldable (split in a 40:20:40 ratio or fully foldable, with center armrest)
- Electromechanical power steering (maintenance-free rack and pinion steering with speed-dependent steering assistance; precise steering feel at high speeds, excellent support when parking.)
- Seat belts: Three-point automatic seat belts for all seats (front seat belt wearer detection, color-coordinated with the interior, front belt force limiter, front belt tensioner)
- Start-stop system (helps reduce fuel consumption and CO2 emissions by switching off the engine during stationary phases, e.g. at traffic lights. For restarting, the starting process is initiated as soon as the foot brake is released. Can be deactivated at any time via a button.)
- First aid kit with warning triangle (warning triangle - first aid kit - 2 high-visibility vests)
- Glazing: Windscreen in heat-insulating and acoustic glazing (windscreen in heat-insulating glazing, green tinted - improved external noise insulation)
- Green heat-insulating glazing (green tinted - for rear window, door and side windows - rear window heated, with timer)

## Extra equipment

- AdBlue tank (24 liters)
- Mechanically swiveling towbar (The mechanically swiveling towbar can be conveniently locked and unlocked via a release mechanism. - Ball head mechanically swiveling with electric release - Ball rod and head made of forged steel, operated via a button in the luggage compartment - Trailer stabilization via the electronic stability control (ESC))
- Black fabric headliner
- Audi exclusive piano black decorative inlays (for dashboard, door panels and center console)
- Deletion of model designation and performance/technology lettering
- Comfort automatic climate control 3-zone (in addition to the automatic climate control: - climate control unit with large TFT display and capacitive rocker switches - electronically regulates the air temperature and distribution individually for driver and front passenger - additional climate control unit for setting the rear passenger compartment temperature in the rear center console - automatic recirculation control via air quality sensor, with dust and odor-removing allergen filter - ventilated glove compartment - dust and odor-removing cabin air filter - residual heat utilization)
- Steering wheel: Leather steering wheel in a 3-spoke design with multifunction plus (height and reach of the leather steering wheel are manually adjustable. For convenient operation of the extensive standard and optional infotainment features, the steering wheel is equipped with 12 multifunction buttons. Includes a leather gearshift/selector lever knob and a leatherette handbrake grip.)
- Business package (front seat heating - comfort package mirrors - infotainment package smartphone - navigation package - leather steering wheel in 3-spoke design with multifunction plus)
- Package: Ambient Lighting Package Plus (in addition to the Ambient Lighting Package: interactive and individual color profile. The interactive color profile is controlled by the Audi drive select modes. The individual color profile offers a choice of 30 colors. The color adjustments apply to the following contour and ambient lighting elements: - Rear footwell lighting - Front cupholders (multicolor) - Front/rear ambient door lighting (multicolor) - Front/rear door contour lighting (multicolor))
- Radio accessories: Bang & Olufsen sound system with 3D sound (20 speakers (including center speaker/2 subwoofers and additional 3D sound tweeters and midrange drivers) - 755-watt 16-channel amplifier - illuminated front speaker grilles - speed-dependent volume adjustment - spatial sound reproduction thanks to the new 3D sound feature. This is created by additional speakers in the A-pillar, the midrange drivers, and Fraunhofer Symphoria technology.)
- Glazing: Privacy glazing (tinted windows) (rear window, rear door and side windows tinted)
- Airbag: Rear side airbags
- Audi virtual cockpit with 12.3" color display (Innovative, fully digital instrument cluster for flexible and needs-based display of relevant information according to driver requirements: speed/RPM, map display, Audi connect services, radio/media information, etc.; the VIEW button on the multifunction steering wheel allows switching between two different-sized displays of the round instruments. The display with smaller instruments enables large, clear graphics of the on-board computer and MMI content)
- Entry-level LED headlights with logo projection at the front (projected logo: - for basic or advanced: Audi rings - for S line and S model: diamond-shaped S logo)
- Fuel tank (54 liters)
- Paint finish: Metallic
- LED matrix headlights with dynamic turn signals front and rear (daytime running lights, low beam, high beam, position lights, turn signals, cornering lights, static curve lighting (supplementing lateral illumination in tight curves and when turning), all-weather light (to reduce glare in poor visibility conditions), maneuvering light (illuminating the swivel area when reversing), motorway light (extended beam range from a speed of 110 km/h), automatic dynamic headlight range control)
- Driving Assistance Package (Audi active lane assist - Audi adaptive cruise control - Audi pre sense rear and basic - Traffic jam assist - Predictive efficiency assist - Evasive steering assist - Left turn assist - High beam assist - Driver information system with color display - Camera-based traffic sign recognition - Lane change warning)
- Parking Assistance Package (Parking Aid Plus - Parking Assist - Rearview Camera)
- Comfort package seats (variable headrests for the front seats - 4-way lumbar support for the front seats, electrically adjustable horizontally and vertically - comfort center armrest in the front, longitudinally adjustable and tiltable; additional storage option in the integrated storage compartment)
- Package: Black Optics Package Plus (Black optics package with Audi rings front and rear and model designation on the rear in black. On the S model, the model designation in the radiator grille is also finished in black/red)
- Panoramic glass roof (electric operation for tilting and opening the glass element, automatic opening and closing, tinted glass insert with continuously adjustable electric sunshade. Comfort opening and closing from the outside via the remote key; the extra-large glass surface provides a pleasant, light-flooded interior ambience, good acoustics when the roof is tilted or fully open. Integrated wind deflector reduces wind noise when the roof is open.)
- Three-seater rear seating system (distinctive outer rear seats, visually adapted to the front seats and an additional middle seat - 3 rear L-shaped headrests, manually height-adjustable for better rear visibility; rear seat backrest split in a 40:20:40 ratio or fully foldable)



## Brief expert findings

|                      |                                                                                                                                                                              |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy) |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.    |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and/or a pit were available for examining the vehicle.                     |
| Test drive           | A short maneuvering and shunting exercise was carried out on the company premises.                                                                                           |
| Engine function test | An engine test run was performed.                                                                                                                                            |

## Value reducing factors

| No. | Component group              | Description                                              |
|-----|------------------------------|----------------------------------------------------------|
| 1   | Misc.                        | Main inspection - No evidence - No deduction             |
| 2   | Engine                       | Toothed belt - No evidence - No deduction                |
| 3   | Equipment                    | Tirefit filler - Due - Replace                           |
| 4   | Boot lid / rear door         | Boot lid - Soiled - Conditioning                         |
| 5   | Side panel - rear right side | Sill - Scratch(es) - Smart repair                        |
| 6   | Side panel - rear left side  | Sill - Scratch(es) - Smart repair                        |
| 7   | Door - front left side       | Door edge - Scratch(es) - Smart repair                   |
| 8   | Wheel / tyres                | Alloy rim - rear left side - Scratched - Loss in value   |
| 9   | Wheel / tyres                | Alloy rim - rear right side - Scratched - Loss in value  |
| 10  | Rear bumper                  | Spoiler - dent(s) - Replace                              |
| 11  | Sill - left side             | Trim - Scratched - Paint                                 |
| 12  | Misc.                        | Inspection / maintenance - Due - Perform                 |
| 13  | Seat - rear                  | Backrest cover - Broken / torn - Replace                 |
| 14  | Wheel / tyres                | Alloy rim - front right side - Scratched - Replace       |
| 15  | Side panel - rear right side | Side panel - Dent / paintcoat damage - Repair and paint  |
| 16  | Rear bumper                  | Rear bumper - Dent / paintcoat damage - Repair and paint |
| 17  | Door - rear right side       | Door - Scratch(es) - Paint                               |
| 18  | Bonnet                       | Bonnet - Stone chips - Paint                             |
| 19  | Front bumper                 | Front bumper - Scratched - Paint                         |

## Wear and tear

| No. | Component group       | Description                                        |
|-----|-----------------------|----------------------------------------------------|
| 1   | Mudguard - right side | Mudguard - right side - Stone chips - No deduction |
| 2   | Body                  | Body - Scratch(es) - No deduction                  |
| 3   | Roof                  | Roof - Scratch(es) - No deduction                  |
| 4   | Instrument panel      | Cover - Scratch(es) - No deduction                 |

The vehicle shows signs of wear and tear commensurate with its age and use.

## Previous damages

| No. | Previous damage                                      | Extent of damage (Net) |
|-----|------------------------------------------------------|------------------------|
| 1   | Front, Provided by user / customer, from 27 May 2023 | 2.113,36 €             |





## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

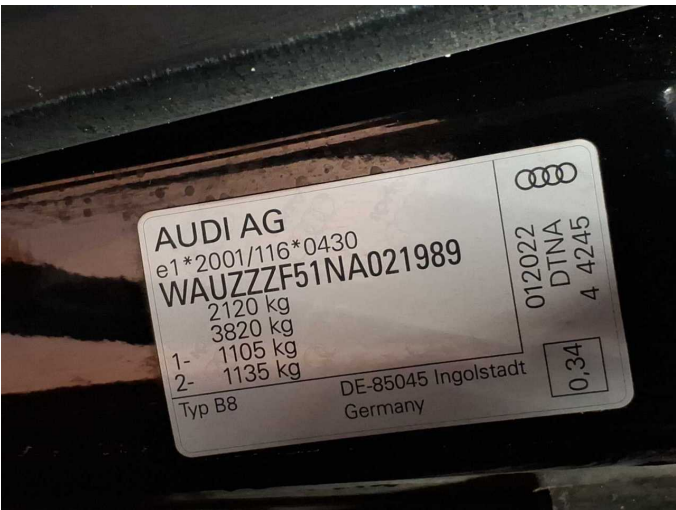


Figure 11: VIN



Figure 12: Mounted tyres





Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres

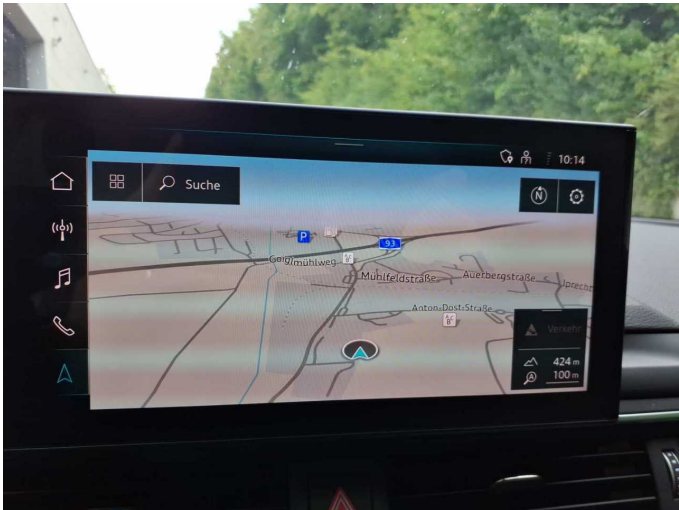


Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.

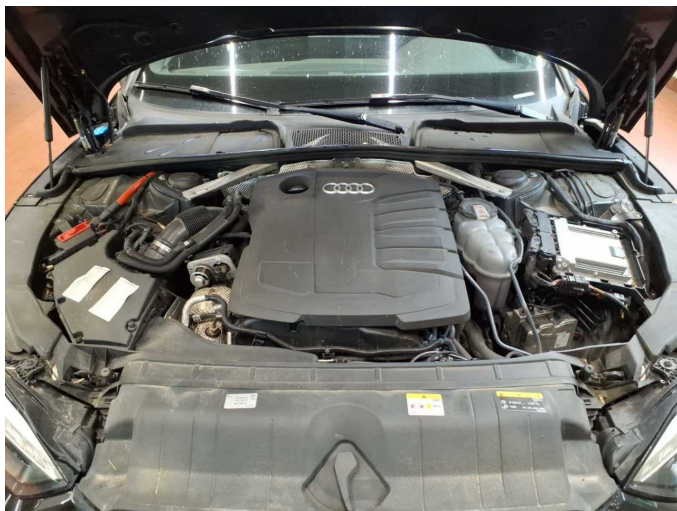


Figure 21: Misc.



Figure 22: Misc.

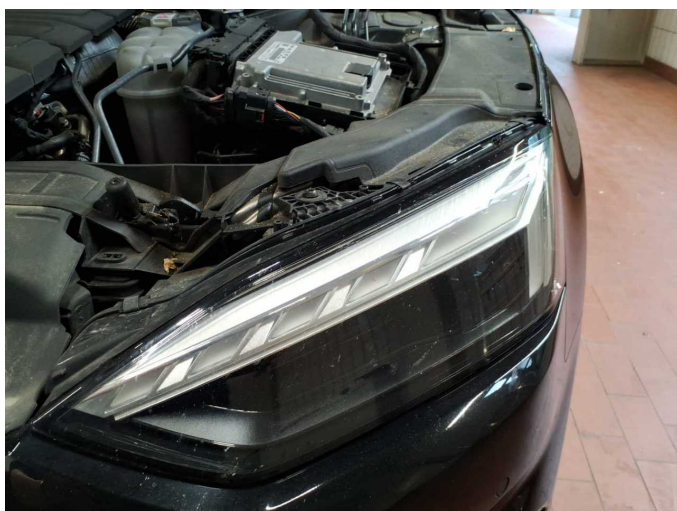


Figure 23: Misc.

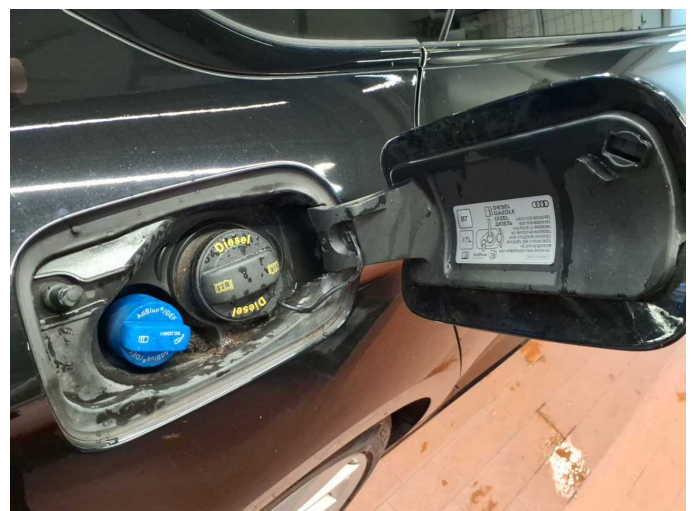


Figure 24: Misc.





Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

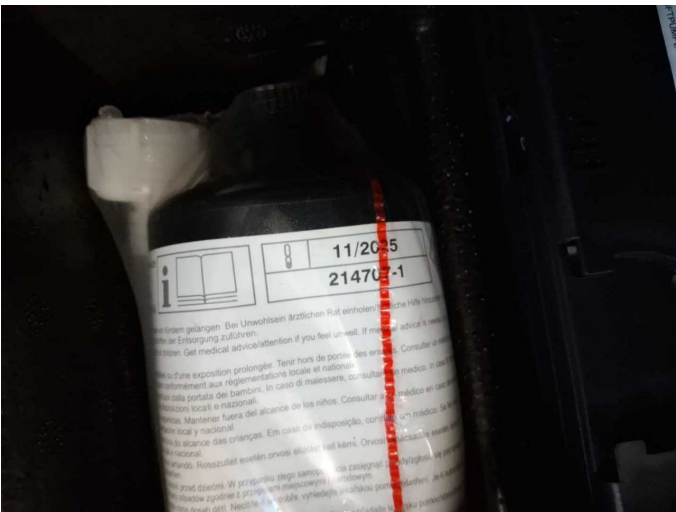


Figure 29: Misc.



Figure 30: Misc.






Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

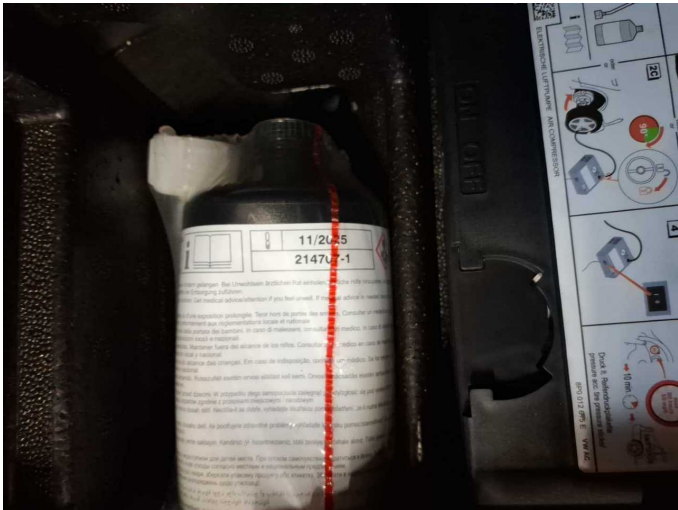

Damage 3: Equipment: Tirefit filler - Due - Replace




Damage 4: Boot lid / rear door: Boot lid - Soiled - Conditioning



Damage 4: Boot lid / rear door: Boot lid - Soiled - Conditioning



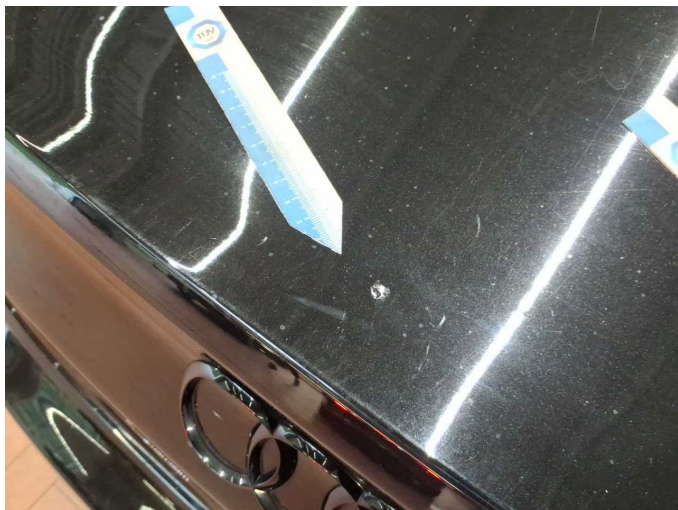


**Damage 4:** Boot lid / rear door: Boot lid - Soiled - Conditioning



**Damage 5:** Side panel - rear right side: Sill - Scratch(es) - Smart repair



**Damage 5:** Side panel - rear right side: Sill - Scratch(es) - Smart repair

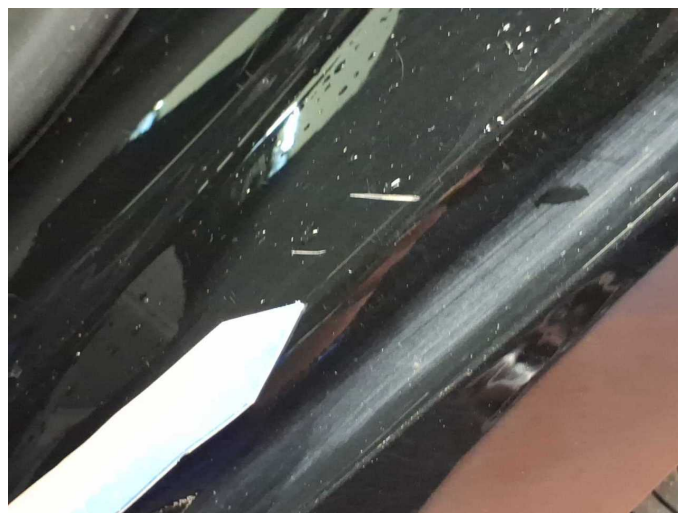

**Damage 6:** Side panel - rear left side: Sill - Scratch(es) - Smart repair




**Damage 6:** Side panel - rear left side: Sill - Scratch(es) - Smart repair



**Damage 7:** Door - front left side: Door edge - Scratch(es) - Smart repair



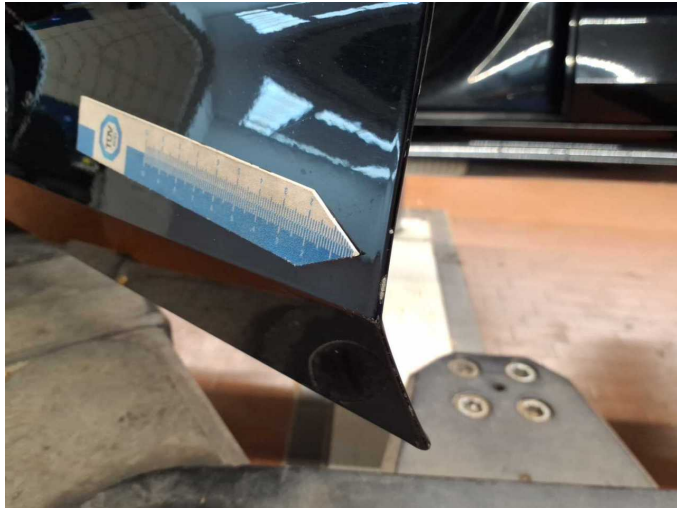

**Damage 7:** Door - front left side: Door edge - Scratch(es) - Smart repair



**Damage 7:** Door - front left side: Door edge - Scratch(es) - Smart repair



**Damage 8:** Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



**Damage 8:** Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value




**Damage 9:** Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



**Damage 9:** Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



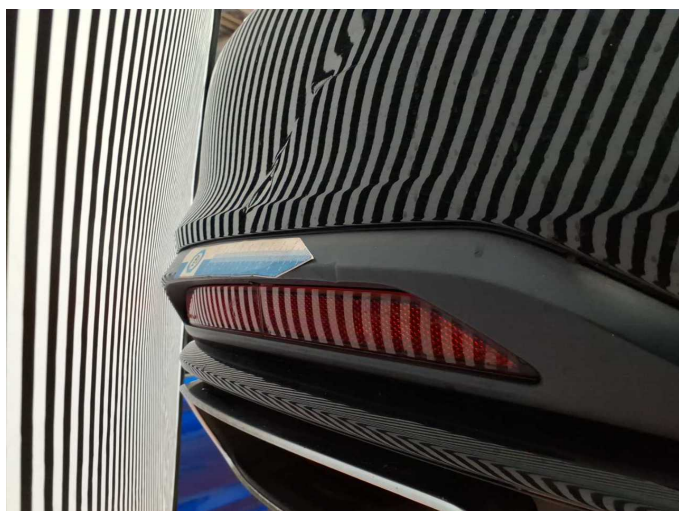

**Damage 10:** Rear bumper: Spoiler - dent(s) - Replace



**Damage 10:** Rear bumper: Spoiler - dent(s) - Replace




**Damage 10:** Rear bumper: Spoiler - dent(s) - Replace



**Damage 11:** Sill - left side: Trim - Scratched - Paint



**Damage 11:** Sill - left side: Trim - Scratched - Paint

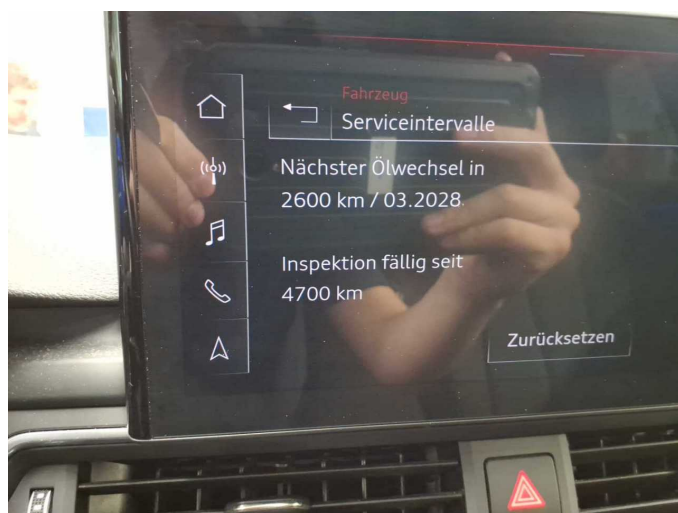


**Damage 12:** Misc.: Inspection / maintenance - Due - Perform





**Damage 13:** Seat - rear: Backrest cover - Broken / torn - Replace

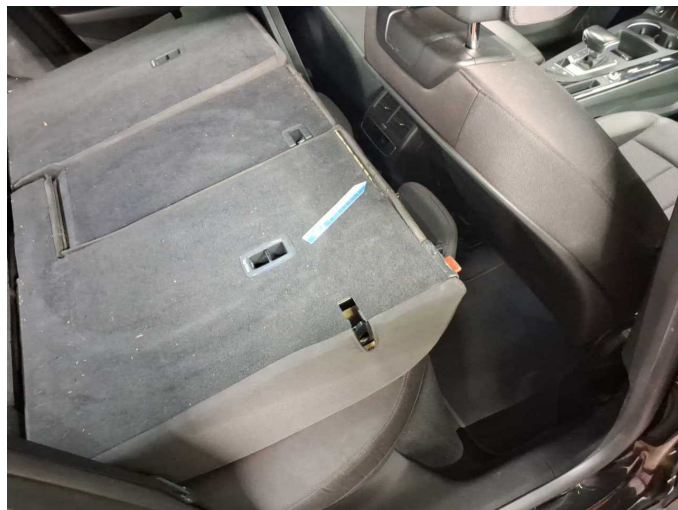

**Damage 13:** Seat - rear: Backrest cover - Broken / torn - Replace




**Damage 14:** Wheel / tyres: Alloy rim - front right side - Scratched - Replace



**Damage 14:** Wheel / tyres: Alloy rim - front right side - Scratched - Replace



**Damage 15:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

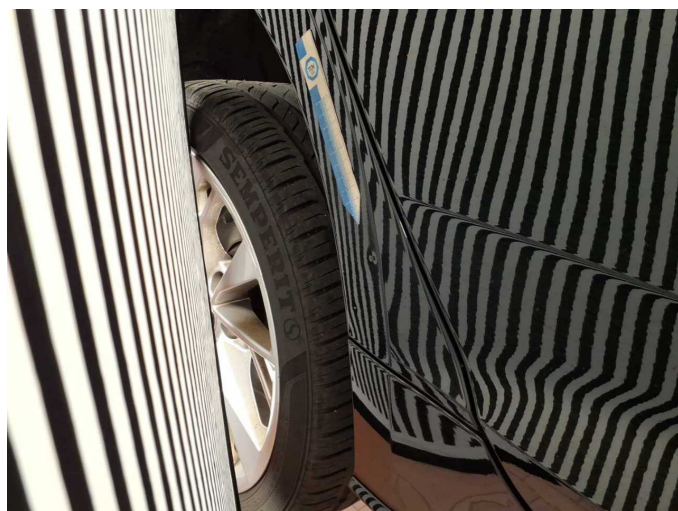

**Damage 15:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint






**Damage 15:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 15:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




**Damage 16:** Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

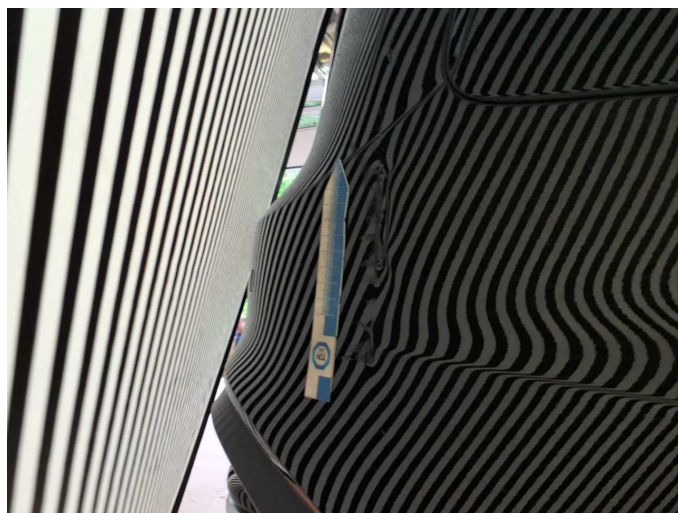

**Damage 16:** Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



**Damage 16:** Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

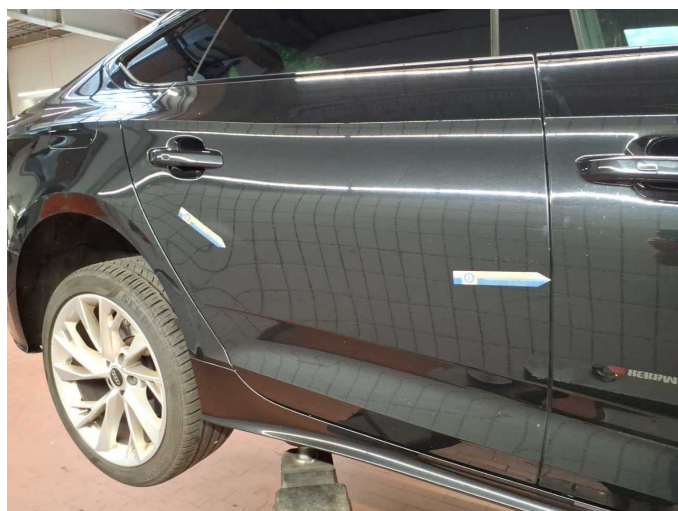


**Damage 17:** Door - rear right side: Door - Scratch(es) - Paint






**Damage 17:** Door - rear right side: Door - Scratch(es) - Paint

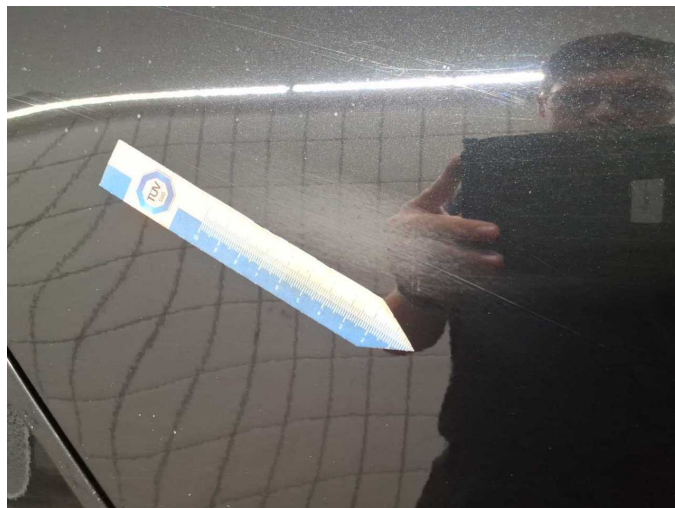


**Damage 17:** Door - rear right side: Door - Scratch(es) - Paint



**Damage 18:** Bonnet: Bonnet - Stone chips - Paint

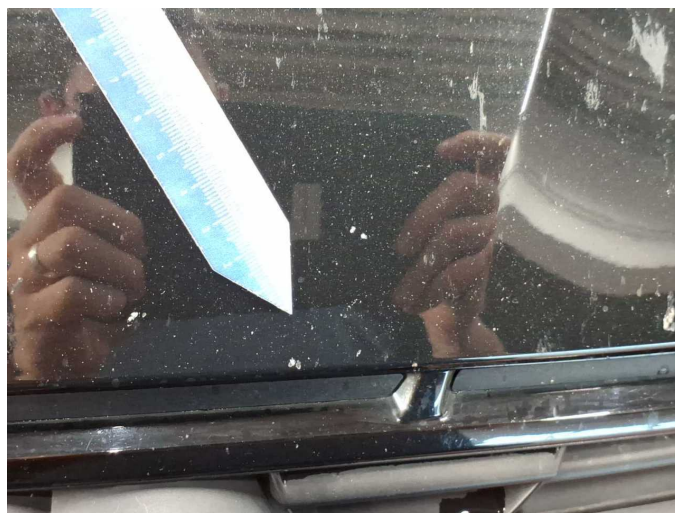

**Damage 18:** Bonnet: Bonnet - Stone chips - Paint

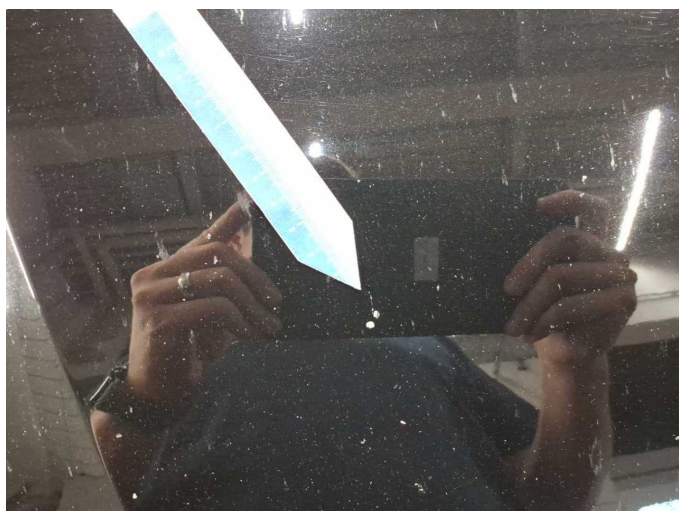


**Damage 18:** Bonnet: Bonnet - Stone chips - Paint



**Damage 18:** Bonnet: Bonnet - Stone chips - Paint




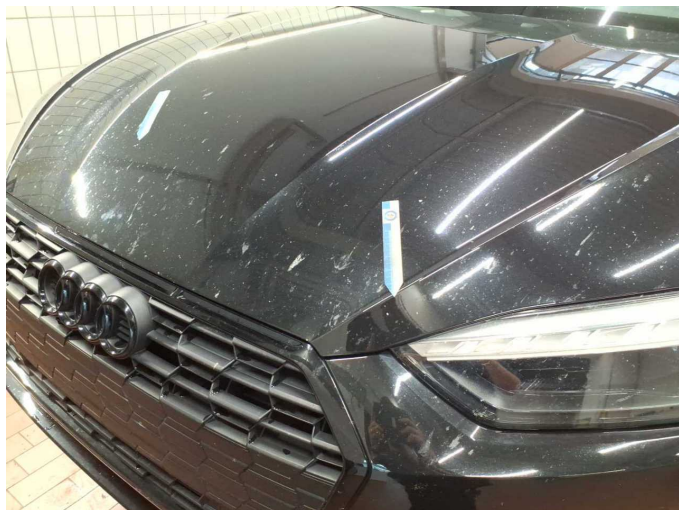

**Damage 18:** Bonnet: Bonnet - Stone chips - Paint



**Damage 19:** Front bumper: Front bumper - Scratched - Paint

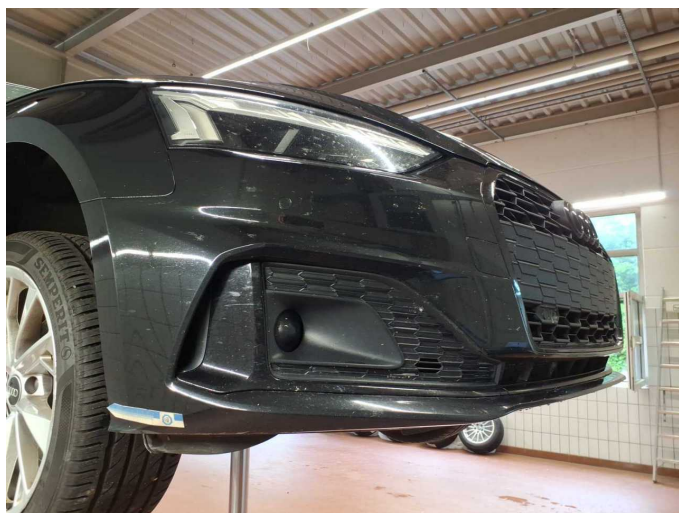

**Damage 19:** Front bumper: Front bumper - Scratched - Paint



**Wear and tear 1:** Mudguard - right side: Mudguard - right side - Stone chips - No deduction



**Wear and tear 1:** Mudguard - right side: Mudguard - right side - Stone chips - No deduction



**Wear and tear 3:** Roof: Roof - Scratch(es) - No deduction





**Wear and tear 3:** Roof: Roof - Scratch(es) - No deduction



**Wear and tear 3:** Roof: Roof - Scratch(es) - No deduction



**Wear and tear 4:** Instrument panel: Cover - Scratch(es) - No deduction



**Wear and tear 4:** Instrument panel: Cover - Scratch(es) - No deduction



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF51NA021989  
Hersteller / Modell: AUDI AUDI A5 Sportback 35 TDI S tronic advanced

| Datum      | KM-Stand | Beschreibung                                                                                   |
|------------|----------|------------------------------------------------------------------------------------------------|
| 18.05.2026 | 205.622  | Reparatur Sonstiges                                                                            |
| 31.03.2026 | 199.546  | Bremsscheiben + Klötze v                                                                       |
| 12.02.2026 | 192.184  | Motoröl b. Wartung; Ölwechsel                                                                  |
| 30.10.2025 | 177.246  | Getriebeöl ern/prüfen; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst        |
| 07.07.2025 | 161.327  | Motoröl b. Wartung; Ölwechsel                                                                  |
| 15.04.2025 | 146.856  | Bremsbelagfühler ern; Bremsscheiben + Klötze h; Regelwartungsdienst                            |
| 06.03.2025 | 143.413  | Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges                                 |
| 12.11.2024 | 130.429  | Bremsscheiben + Klötze v; Motoröl b. Wartung; Ölwechsel                                        |
| 25.07.2024 | 119.292  | Getriebeöl ern/prüfen; Kraftstofffilter ern; Regelwartungsdienst                               |
| 23.04.2024 | 103.351  | Motoröl b. Wartung; Ölwechsel                                                                  |
| 08.04.2024 | 103.351  | Bremsflüssigkeit ern; Wartung Sonstiges                                                        |
| 11.12.2023 | 88.793   | Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Luftfiltereinsatz ern; Regelwartungsdienst |
| 16.08.2023 | 72.521   | Motoröl b. Wartung; Ölwechsel                                                                  |
| 17.04.2023 | 59.010   | Getriebeöl ern/prüfen; Kraftstofffilter ern; Regelwartungsdienst                               |
| 07.03.2023 | 49.720   | Bremsklötze vorne                                                                              |
| 09.01.2023 | 42.248   | Motoröl b. Wartung; Ölwechsel                                                                  |
| 27.09.2022 | 30.449   | Motoröl b. Wartung; Regelwartungsdienst                                                        |
| 29.07.2022 | 17.039   | Motoröl b. Wartung; Ölwechsel                                                                  |