



Expertise

Protocol number: 46220259
Order No. / Reference: 26554009
Inspection date: 29 Jun 2026

Manufacturer: Ford

Model: Mustang Mach-E

VIN: WF0TK1E78MMA54129



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Mustang Mach-E	
Vehicle Identification number	WF0TK1E78MMA54129
Mileage (Read)	154,707 km
First registration	22 Dec 2021
Number of holders	1
Power / Engine displacement	100 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Iridium Schwarz Mica
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	
Last service on / at	07/2025 at 122,600 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GH390840
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BVE 00006		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,605 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	225/60 R18 104V	Summer tyres on Light alloy	4mm / 4mm
2)	225/60 R18 104V	Summer tyres on Light alloy	4mm / 4mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 10/2026	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Acoustic Vehicle Alerting System (AVAS)
- Anti-lock braking system (ABS)
- Exterior mirrors painted in car color
- Tires: Tire repair kit
- Light-colored woven fabric headliner
- Electronic Stability Program (ESP)
- Electric front and rear windows with all-around closing function
- Electric parking brake with auto hold function
- Ford EcoCoach
- Front trunk with Ford MegaBox
- Heated windshield
- Transmission: 1-speed direct drive
- Heated rear window
- Rear spoiler
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- Air conditioning with automatic temperature control
- Front headrests are height-adjustable
- Charging cables: 2 charging cables for charging the high-voltage battery
- Illuminated makeup mirrors in the driver's and passenger's sun visors
- Rear center armrest with two cup holders
- MyKey key system
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Pollen and dust filter
- Post-Collision Assist
- Radio accessories: Ford SYNC 4
- Reversing camera with reversing parking assistant
- Keys: Classic car key and up to 4 digital keys (Phone as a Key)
- Servotronic
- Seats: Front seats, individually and variably heated
- Seats: Comfort seats, front
- Power outlet: 12-volt connection in the luggage compartment
- Carpet floor mats front and rear, velour
- Traffic sign recognition system
- Immobiliser
- Towbar preparation kit
- Electrically adjustable and heated exterior mirrors
- Tires: 7 J x 18 light alloy wheels (4) in 5-spoke design
- third brake light
- Theft alarm system
- Driver information system with digital instrument panel, 10.2" screen diagonal (25.9 cm)
- High Beam Assist
- Ford Co-Pilot360 incl. Ford Intelligent Drive Assist
- FordPass Connect including eCall, live traffic information and Wi-Fi hotspot
- Flexible luggage compartment cover and luggage compartment lighting
- rear window wiper
- Interior decor with grey decorative stitching
- Intelligent Protection System (IPS)
- Map reading light at the rear
- Map pocket on the driver's and passenger's seat backrest
- Rear headrests (3) height adjustable
- Coating: Mica
- LED headlights in projection lens design
- Steering wheel: Multifunction leather steering wheel, heated
- Media console with two USB ports
- Mustang LED taillights
- Fatigue warning
- One Pedal Drive
- Front and rear parking pilot system
- Upholstery: Premium Sensico upholstery in leather look in black with grey decorative stitching
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Seat: Rear seat backrests, foldable, 60:40 split
- Seats: Driver and front passenger seats, 6-way manually adjustable
- Power outlet: 12-volt connection at the front
- Telephone: Inductive charging station for mobile devices
- Electric door child safety lock
- Lashing eyes in the luggage compartment
- Central locking system with overall locking function

Extra equipment

- Trailer hitch
- Package: Technology Package 2 (as Technology Package 1, additionally with: - Panoramic roof - Electrically folding exterior mirrors with Mustang pony projection onto the ground - Premium Sensico upholstery in leather look, perforated, in black with grey decorative stitching - Front seats, 8-way electrically adjustable, with adjustable lumbar support and memory function)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Smart repair
2	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
3	Seat - front	Seat cover - left side - Porous / cracked - Replace
4	Side panel - rear left side	Side panel - Scratch(es) - Paint
5	Door - front left side	Door - Deformed - Repair and paint
6	Bonnet	Bonnet - Scratch(es) - Paint
7	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side right, Provided by user / customer, from 14 Nov 2024	2.552,40 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

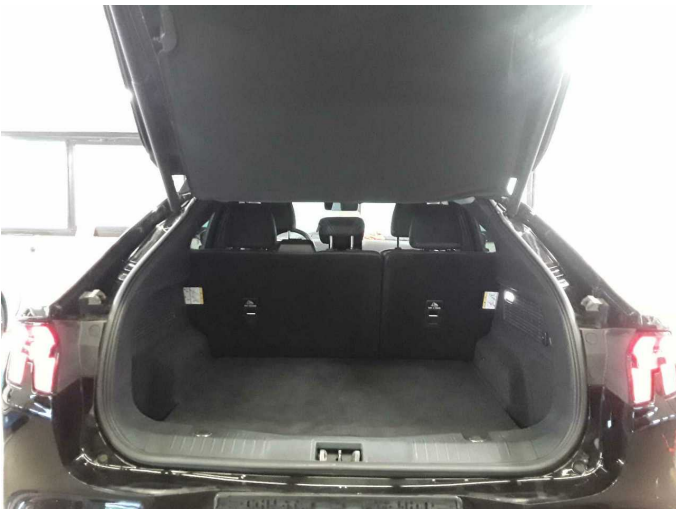


Figure 11: Cargo area

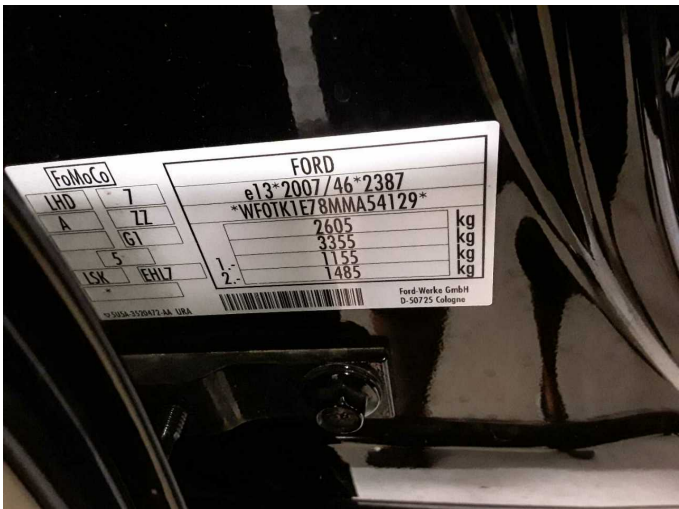


Figure 12: VIN



Figure 13: Mounted tyres

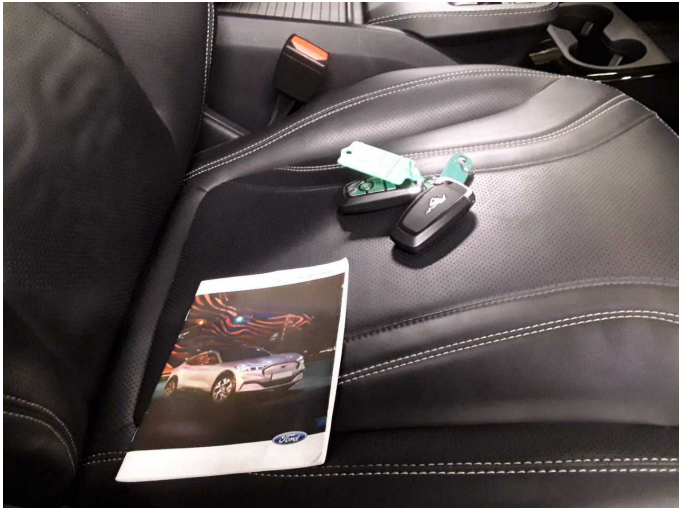


Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

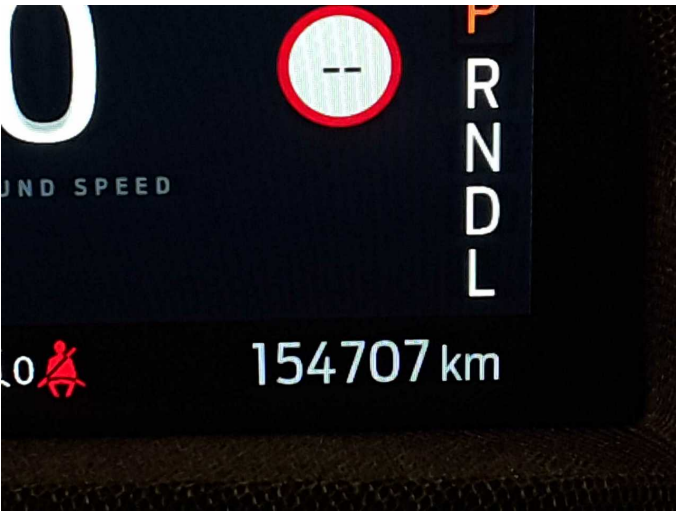


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.




Figure 30: Misc.



Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Smart repair




Damage 1: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Smart repair

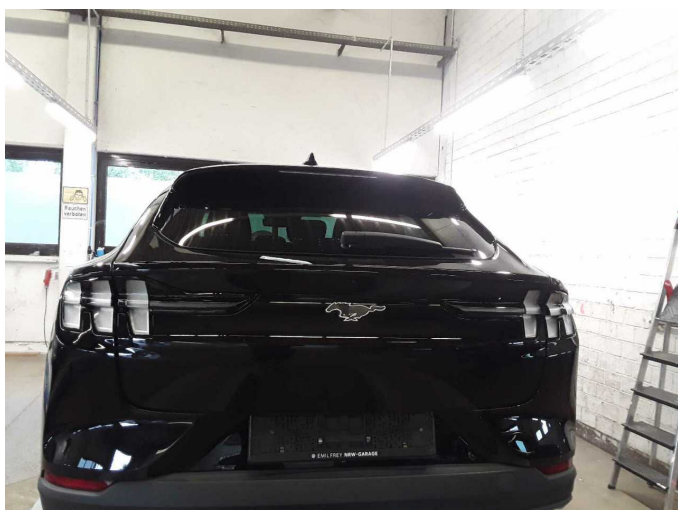

Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

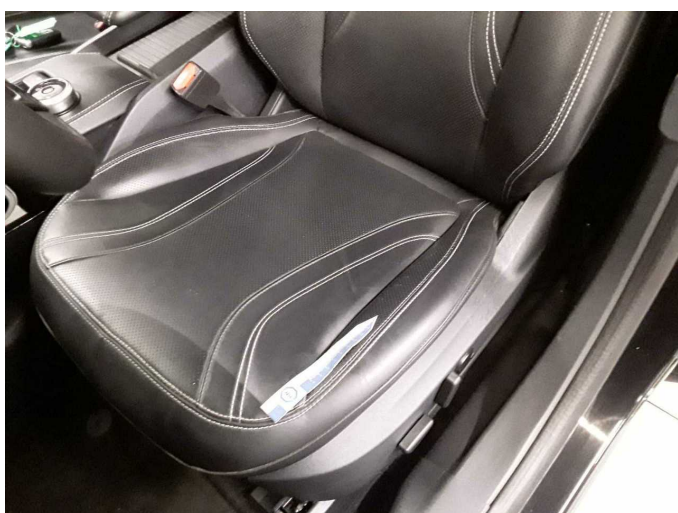


Damage 3: Seat - front: Seat cover - left side - Porous / cracked - Replace




Damage 3: Seat - front: Seat cover - left side - Porous / cracked - Replace



Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Paint

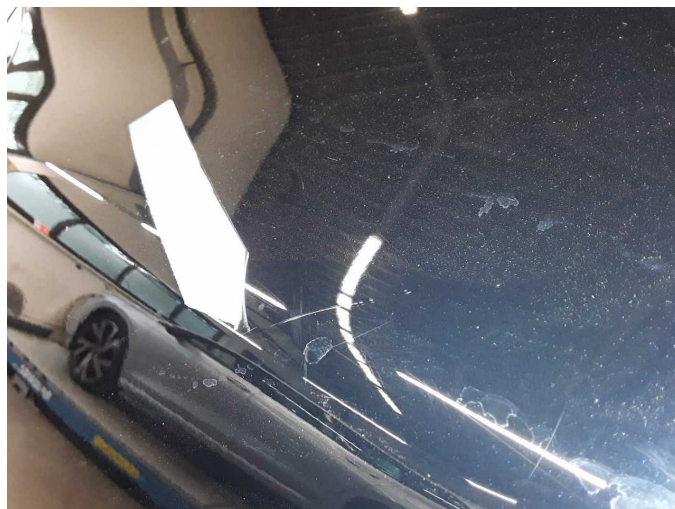


Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Paint

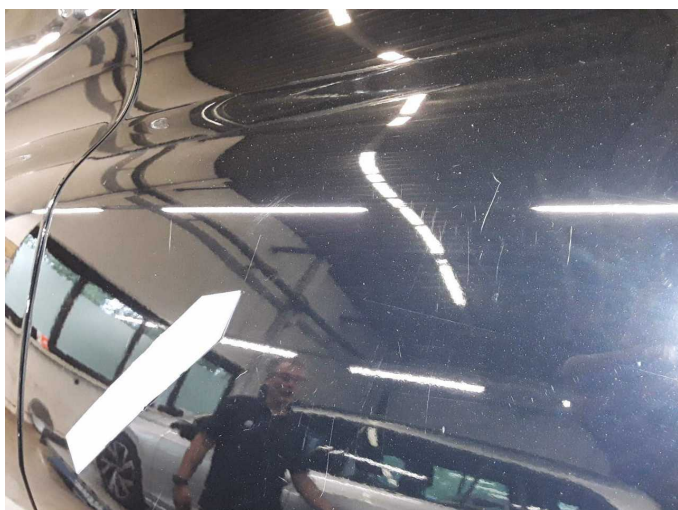

Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Paint



Damage 5: Door - front left side: Door - Deformed - Repair and paint

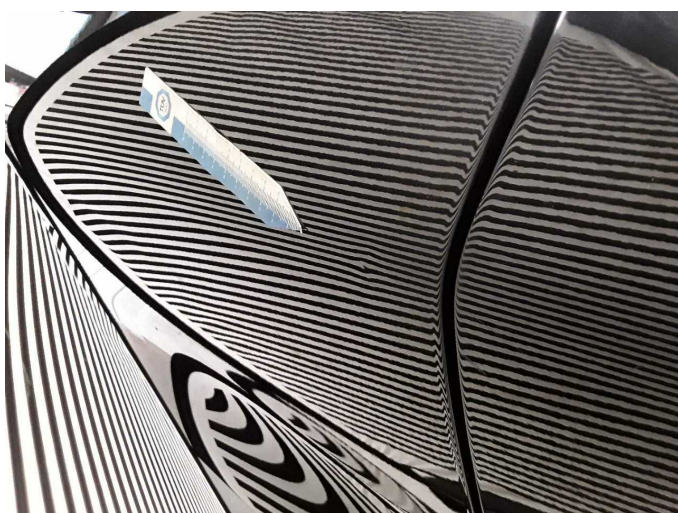


Damage 5: Door - front left side: Door - Deformed - Repair and paint



Damage 5: Door - front left side: Door - Deformed - Repair and paint




Damage 6: Bonnet: Bonnet - Scratch(es) - Paint

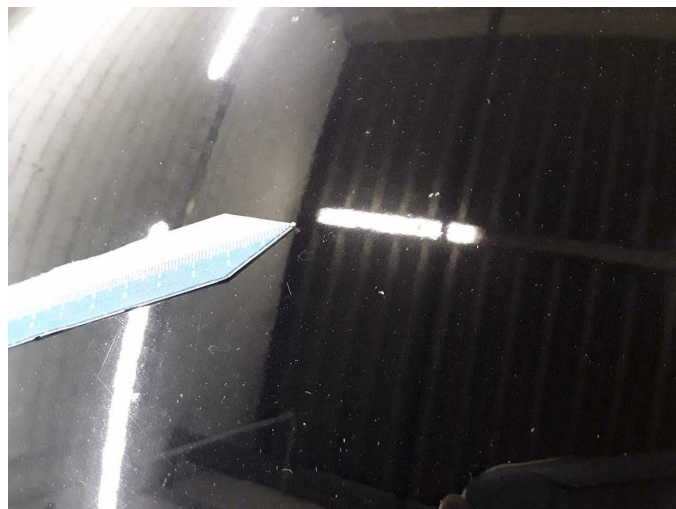

Damage 6: Bonnet: Bonnet - Scratch(es) - Paint




Damage 6: Bonnet: Bonnet - Scratch(es) - Paint

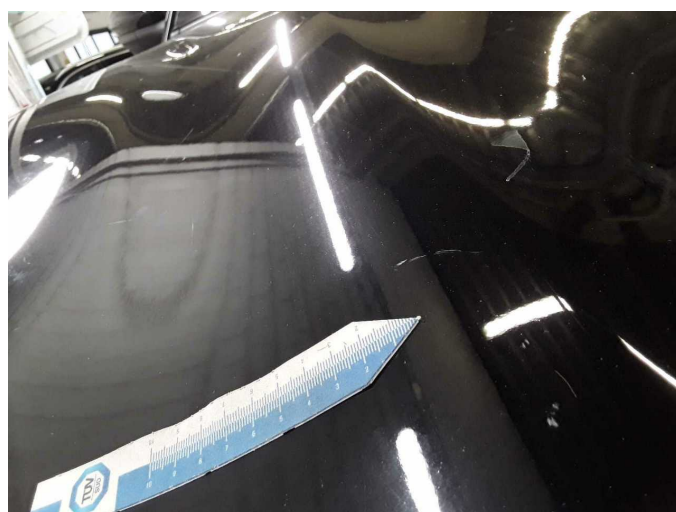

Damage 6: Bonnet: Bonnet - Scratch(es) - Paint



Damage 7: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace

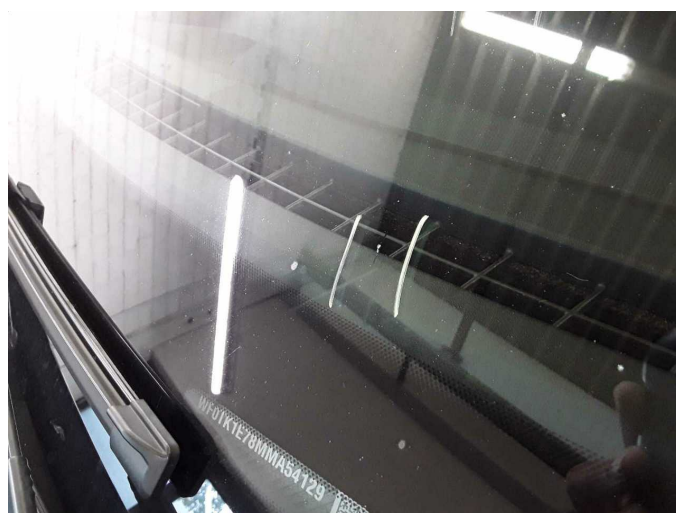

Damage 7: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 7: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0TK1E78MMA54129
Hersteller / Modell: FORD FORD Mustang Mach-E

Datum	KM-Stand	Beschreibung
05.02.2026	141.093	Systemtest/Eigendiagnose
18.07.2025	122.600	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
06.01.2025	107.757	Reparatur Sonstiges; Systemtest/Eigendiagnose
27.11.2024	104.416	Reparatur Sonstiges; Systemtest/Eigendiagnose
29.09.2023	63.014	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Systemtest/Eigendiagnose