



Expertise

Protocol number: 47181734
Order No. / Reference: 26823166
Inspection date: 11 Aug 2026

Manufacturer: Volkswagen

Model: Passat Variant 2.0 TDI SCR DSG Business

VIN: WVGZZZ3CZPE066726



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 2.0 TDI SCR DSG Business	
Vehicle Identification number	WVGZZZ3CZPE066726
Mileage (Read)	186,600 km
First registration	6 Jul 2023
Number of holders	1
Next periodical technical inspection	07/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	18,000 km
Last service on / at	05/2026 at 176,515 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS624682
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BQS 05905		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 ZR19 96Y	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	235/40 ZR19 96Y	Summer tyres on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	215/60 R16 99H	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Adaptive Cruise Control (ACC) "stop & go", including speed limiter
- Cup holders (2) front
- third brake light
- Headliner in Mistral Grey
- Diesel particulate filter
- Parking aid - warning signals for obstacles in the front and rear area
- Electronic stability program and electromechanical brake booster
- Windscreen made of laminated safety glass, heat and sound insulating
- Transmission: 7-speed DSG
- rear window wiper
- ISOFIX mounting points
- Front headrests
- LED taillights
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- "Premium" multifunction display with multicolor screen
- Fatigue detection
- Non-smoking version
- Emergency call service
- Package: Light and Sight Package "Plus"
- Proactive occupant protection system in conjunction with "Front Assist"
- Rear bench seat, undivided, backrest asymmetrically split and foldable, with center armrest
- Power steering
- Seats: Comfort seats in the front
- Seats: Front seats are height-adjustable
- Start-stop system
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking with remote control
- Airbag, head airbag system for front and rear passengers
- App-Connect
- Electrically adjustable and heated exterior mirrors, ambient lighting
- Hill start assist
- Chrome trim on the side windows
- black roof rails
- Tachometer
- Entry/warning lights in LED technology in the front doors
- Electronic parking brake including auto-hold function
- Automatic headlight control
- Remote release for luggage compartment lid
- Pedestrian detection
- Adjustable luggage compartment floor
- Rear window heated
- Interior lights with delayed shut-off and dimming function
- Rear headrests (3)
- LED fog lights and cornering lights
- LED headlights with daytime running lights
- Headlight range control
- Front center armrest, height and length adjustable, with storage box
- Mesh partition
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Upholstery: "Business" fabric
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system (passive)
- Gearshift knob in leather
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12V power outlet on the rear of the center console
- Textile floor mats
- Warning tone and light for unfastened seat belts front and rear



Extra equipment

- App-Connect Wireless (Volkswagen offers three interfaces for connecting smartphones with numerous possibilities: - Apple CarPlay - Android Auto from Google - MirrorLink)
- High beam control "Light Assist" (automatically switches on the high beam in darkness from 65 km/h - detects vehicles ahead and oncoming vehicles and automatically dims the headlights before they are blinded)
- Paint finish: Pearl effect
- Package: "Business Premium" package incl. navigation (from Business trim level) (2 USB-C ports in the front, USB-C charging socket in the rear, 230V socket, App-Connect incl. wireless, Apple CarPlay, Android Auto, "Travel Assist" driver assistance system and "Lane Assist" lane keeping assist system, Air Care Climatronic with 3-zone temperature control, active combination filter and rear controls, lumbar support in the front, electric on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Package: Luggage management package (fixing strap and lashing eyes that can be fixed on 4 rails - sliding luggage compartment floor - stainless steel loading sill protector)
- Package: R-Line, Volkswagen R (DSG) (Titanium Black headliner - Aluminum decorative inlays - Stainless steel front/rear door sill trims - LED fog lights and cornering lights - Multifunction leather sports steering wheel with shift paddles - Stainless steel pedals - R-Line rear spoiler in body color - Chrome lower side trim - Fabric seat centers for front seats and outer rear seats, leather side bolsters - Sport comfort seats in front - Bumpers and side skirts in "R" styling, design trim in the rear bumper)
- Wheels: Tire Mobility Set omitted
- "Comfort" telephone interface with inductive charging function (hands-free system)
- Exterior mirrors with ambient lighting and passenger-side mirror lowering function (foldable and heated - dimming on the driver's side)
- Tailgate with electric opening and closing, electric opening for luggage compartment cover (extendable and removable luggage compartment cover with electric opening - tailgate with electric opening and closing)
- Navigation system "Discover Media" incl. "Streaming & Internet" (4x20 watts, user interface with proximity sensor, dual tuner with phase diversity, vehicle menu, speed, volume adjustment, map, 2D display, tone control, 3-way TFT display with touchscreen operation, navigation "Discover Media" incl. "Streaming & Internet", MP3 radio, telephone contact addresses for navigation, telephone interface, 2 USB ports also for iPod/iPhone, traffic sign recognition "VW Media Control", We Connect Plus, 3 years, incl. We Connect route guidance, dynamic RDS, TMC tuner)
- Package: Ambient lighting (ambient lighting, 1-color - entry/warning lights in LED technology in all doors)
- Package: R-Line Sport package (progressive steering - rear side windows and rear window tinted, 65% light-absorbing - electronic differential lock XDS - sport suspension, body lowered by approx. 15mm)
- Package: Winter (front windshield washer nozzles automatically heated - front seats heated)
- Proactive occupant protection system and lane change assistant "Side Assist" (Proactive occupant protection system in conjunction with "Front Assist" and "Side Assist" - lane change assistant "Side Assist" and parking assistant)
- Wheels: 4 alloy wheels 8 J x 19 "Verona" Volkswagen R (AirStop tires 235/40 R 19 - wheel locks with enhanced theft protection)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Door - rear right side	Door - dent(s) - Smooth repair work
2	Side panel - rear left side	Sill - dent(s) - Smooth repair work
3	Side panel - rear left side	Side panel - Scratched - Smart repair
4	Side panel - rear left side	Elbow - Scratched - Smart repair
5	Wheel / tyres	Alloy rim - front right side - Scratched - Smart repair
6	Sill - left side	Sill - Damaged - Smart repair
7	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
8	Front bumper	Front bumper (Sandstrahleffekt) - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Brightware - Scratched - No deduction
2	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Owner's manual

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

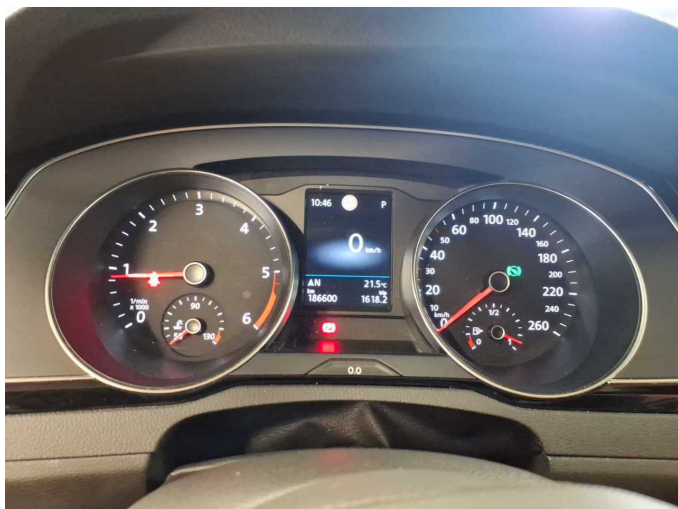


Figure 7: Instrument cluster



Figure 8: Instrument panel

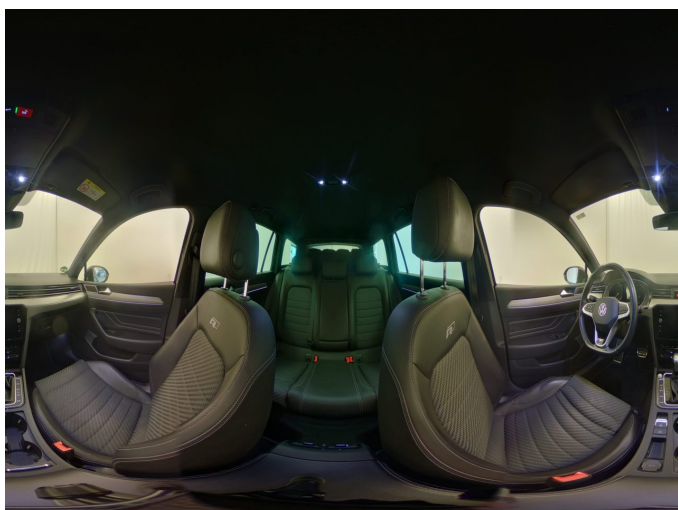


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

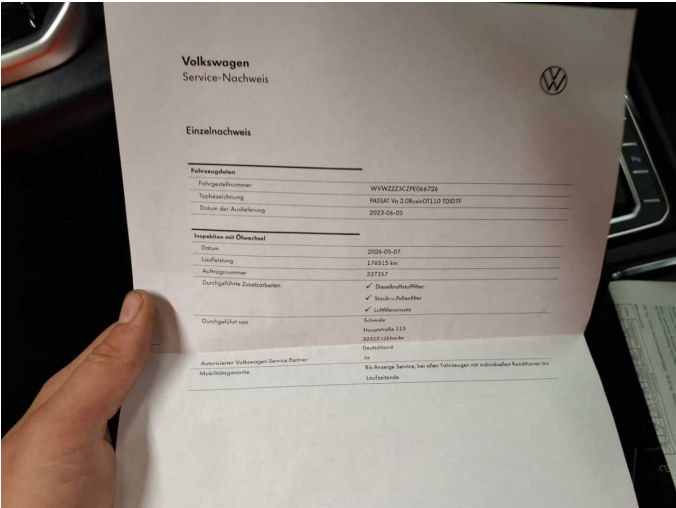


Figure 13: Documents

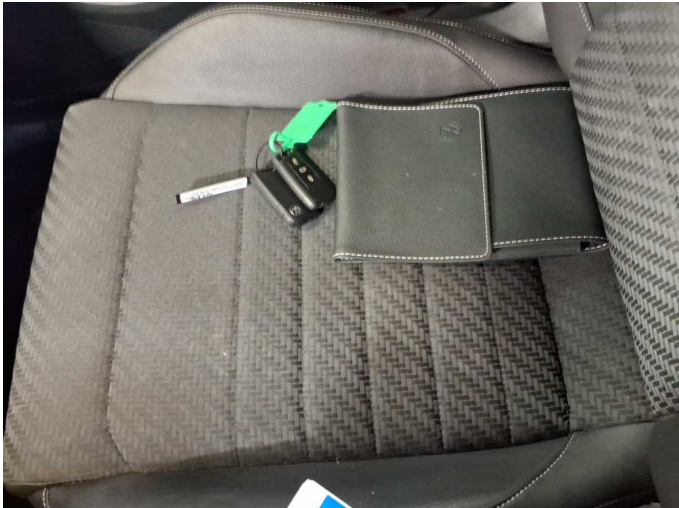


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

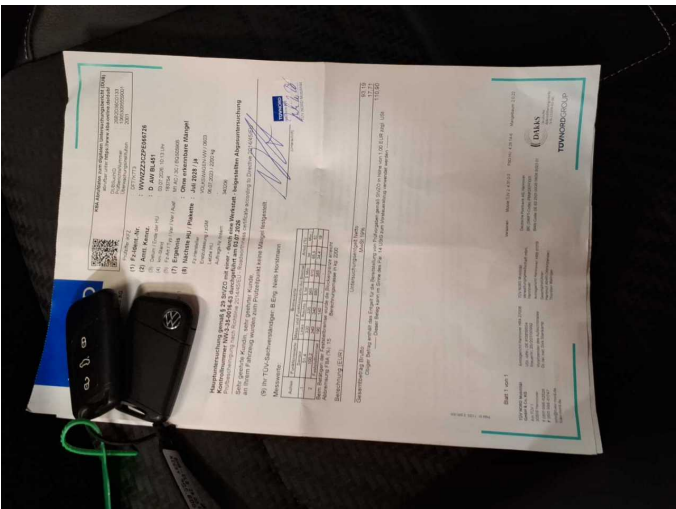


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

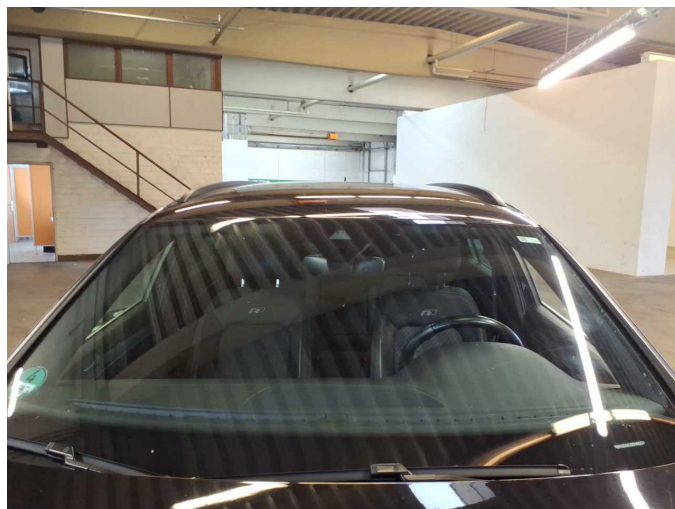


Figure 26: Misc.

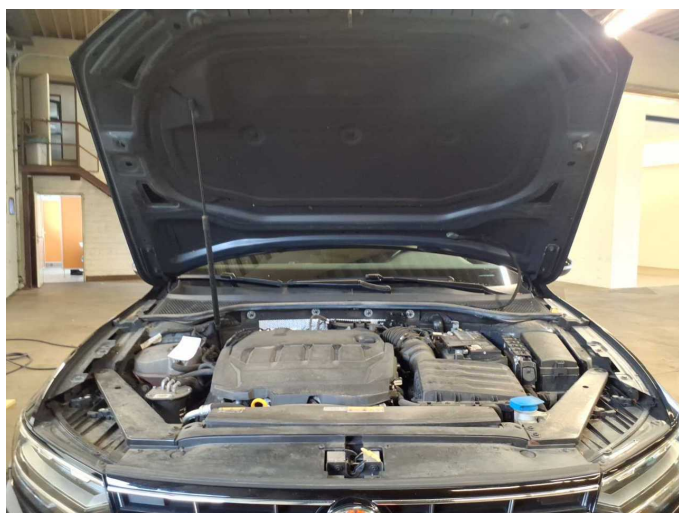


Figure 27: Misc.



Figure 28: Misc.

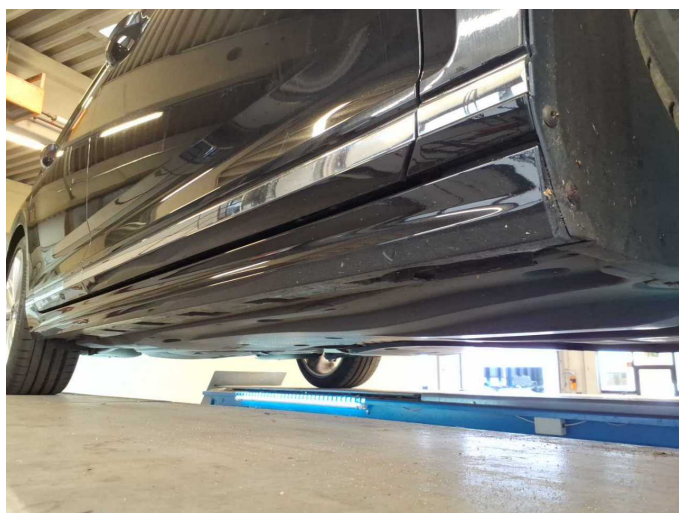


Figure 29: Misc.

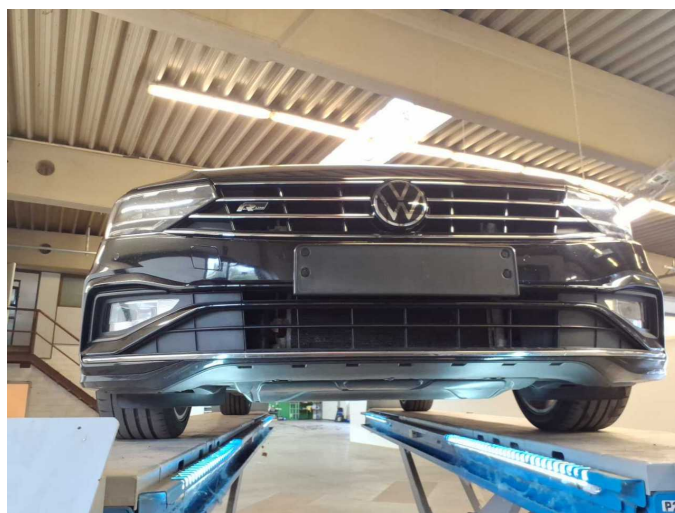


Figure 30: Misc.

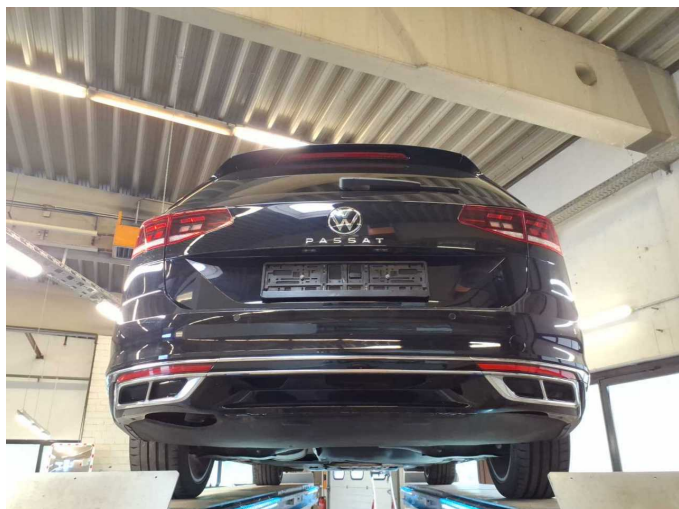


Figure 31: Misc.



Figure 32: Misc.



Damage 1: Door - rear right side: Door - dent(s) - Smooth repair work




Damage 1: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 2: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 2: Side panel - rear left side: Sill - dent(s) - Smooth repair work

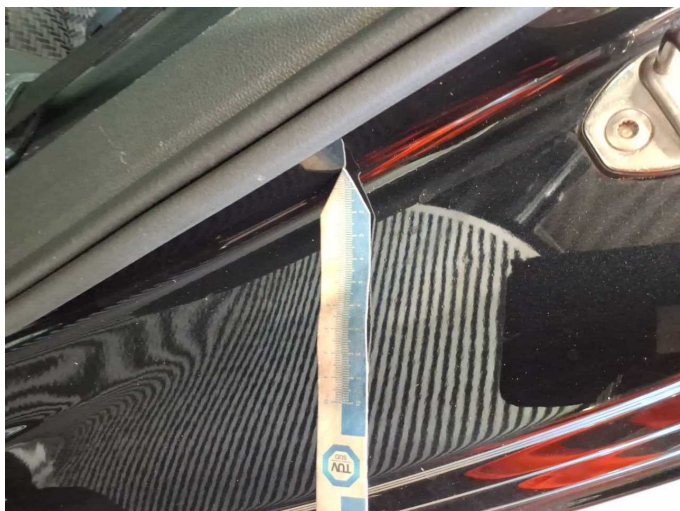


Damage 2: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 2: Side panel - rear left side: Sill - dent(s) - Smooth repair work




Damage 3: Side panel - rear left side: Side panel - Scratched - Smart repair

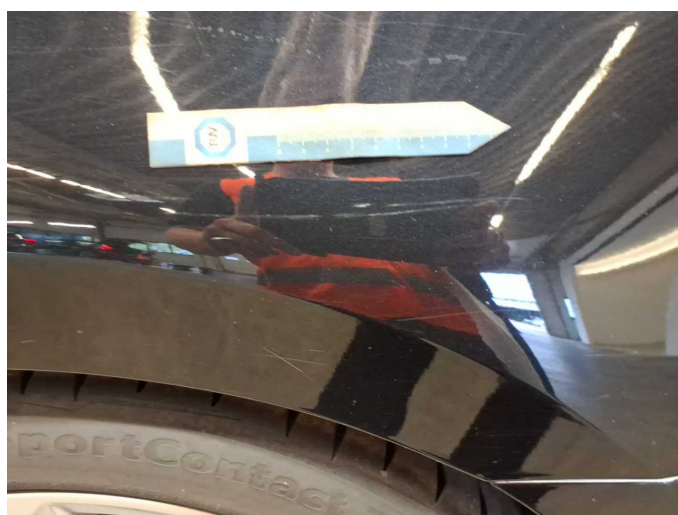

Damage 3: Side panel - rear left side: Side panel - Scratched - Smart repair



Damage 3: Side panel - rear left side: Side panel - Scratched - Smart repair

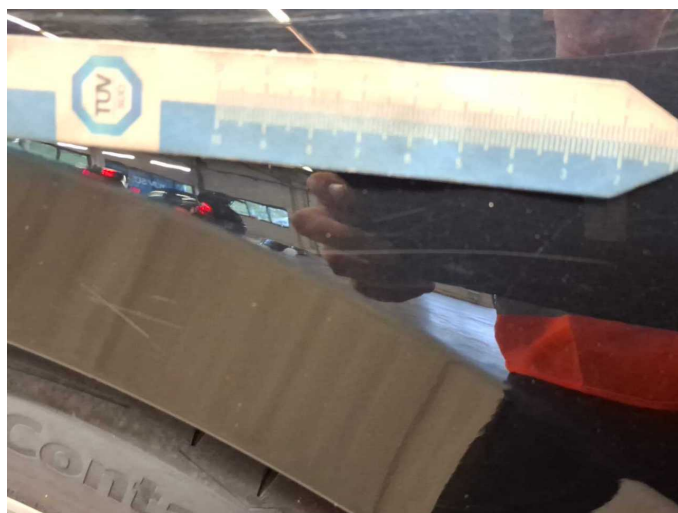

Damage 3: Side panel - rear left side: Side panel - Scratched - Smart repair



Damage 4: Side panel - rear left side: Elbow - Scratched - Smart repair




Damage 4: Side panel - rear left side: Elbow - Scratched - Smart repair



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair

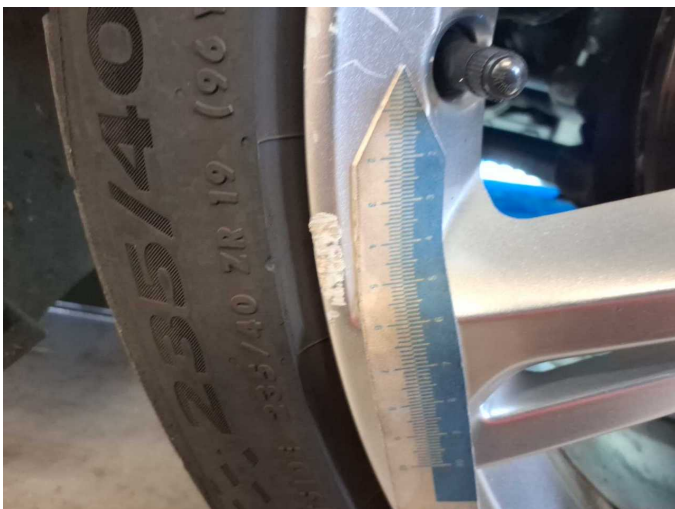


Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Smart repair



Damage 6: Sill - left side: Sill - Damaged - Smart repair




Damage 6: Sill - left side: Sill - Damaged - Smart repair

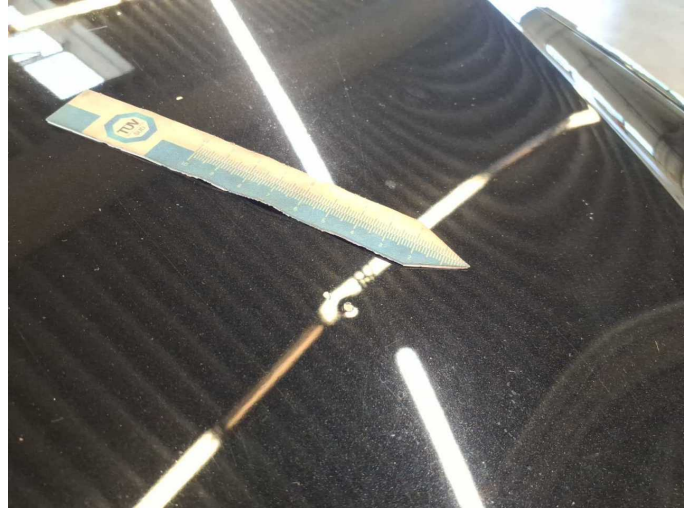

Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

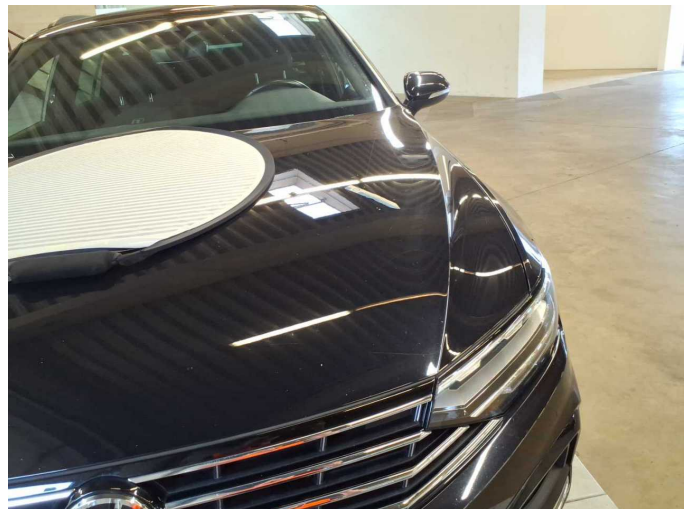


Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

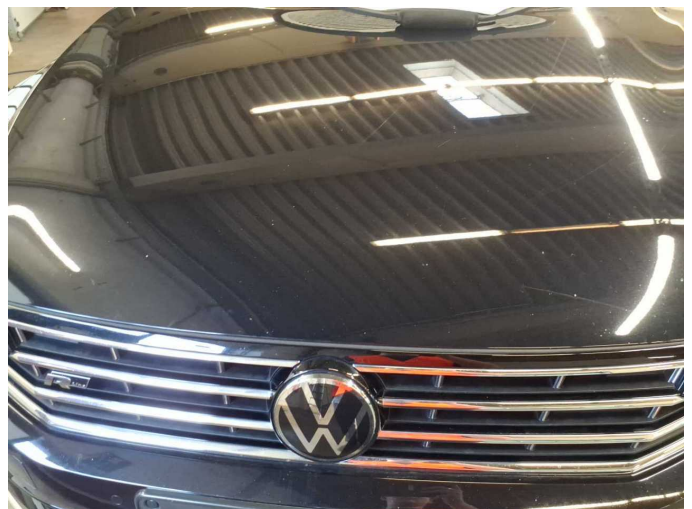


Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

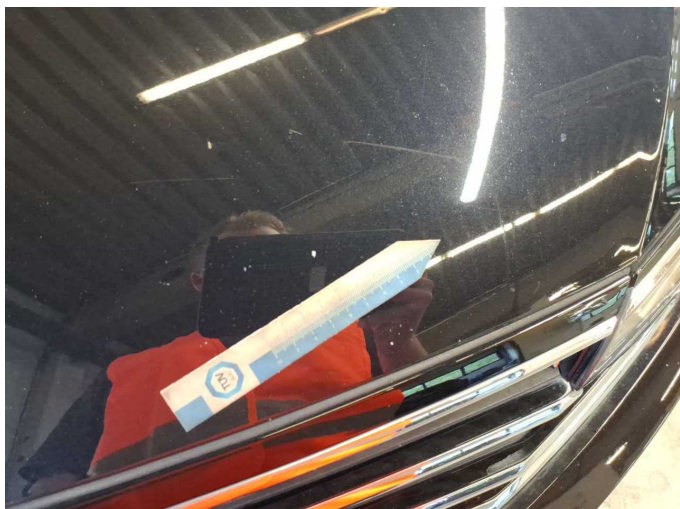


Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

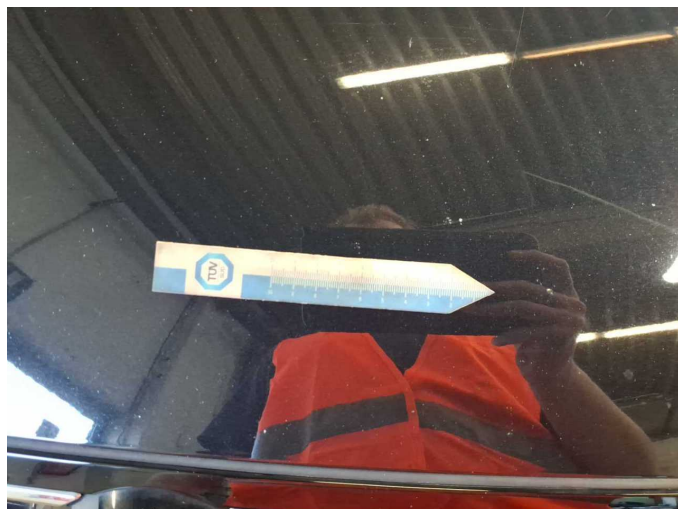


Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

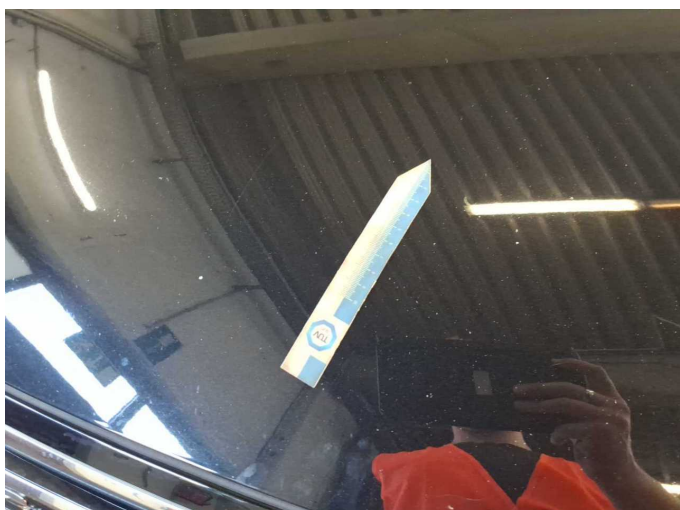

Damage 7: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

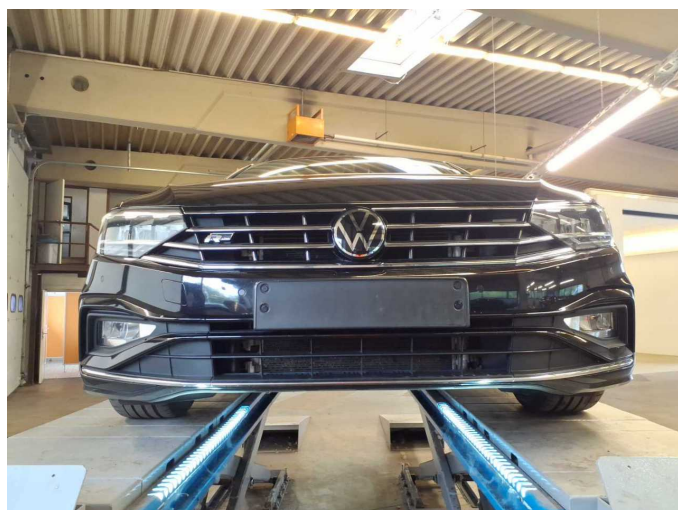

Damage 8: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint

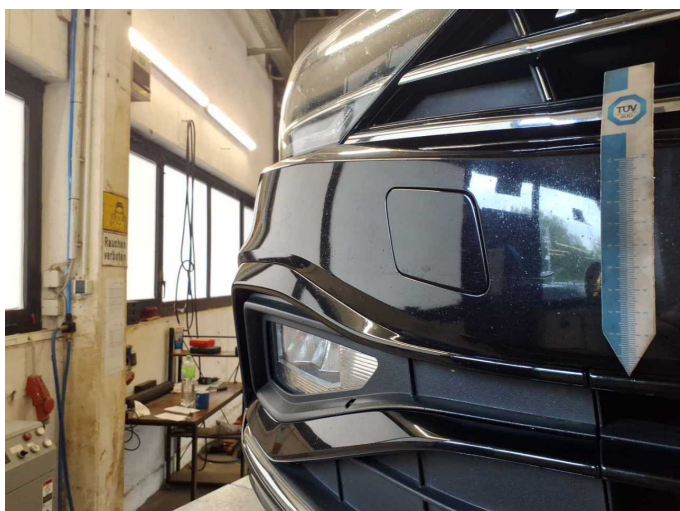

Damage 8: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint



Damage 8: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint



Damage 8: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint



Damage 8: Front bumper: Front bumper (Sandstrahleffekt) - Stone chips - Paint




Wear and tear 1: Side panel - rear left side: Brightware - Scratched - No deduction



Wear and tear 1: Side panel - rear left side: Brightware - Scratched - No deduction



Wear and tear 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

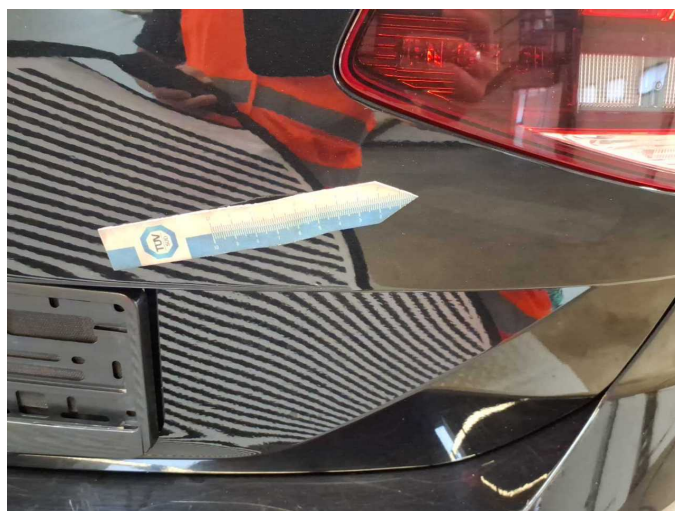

Wear and tear 2: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVWZZZ3CZPE066726

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Passat Variant 2.0 TDI SCR DSG
Business

Datum	KM-Stand	Beschreibung
30.06.2026	183.754	AU
07.05.2026	176.515	Kraftstofffilter ern; Kraftstofffilter ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Luftfiltereinsatz ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Motoröl b. Wartung; Motoröl b. Wartung; Ölfilter ern; Ölfilter ern; Regelwartungsdienst; Regelwartungsdienst; Regelwartungsdienst; Systemtest/Eigendiagnose; Systemtest/Eigendiagnose; Wartung Sonstiges; Wartung Sonstiges
14.01.2026	157.647	Bremse Sonstiges; Bremsscheiben + Klötze v; Bremsscheiben vorne
18.11.2025	147.466	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.05.2025	114.292	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
04.12.2024	83.692	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
28.06.2024	58.557	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.01.2024	29.925	Motoröl b. Wartung; Regelwartungsdienst