MACADAM








Seat Arona (UKL): 2EDJ016

Vinnumber:	**VSSZZZKJ2PR126145**	Versionname:	**Arona Move 1.0TSi 95pk/cv 5p**
First Registrationdate:	**5/09/2023**	Fiscalpower:	
Expertise Mileage:	**43638**	Power Kw:	**70**
Bodytype:		Type of rims (mounted)	**Aluminium**
Gearbox:	**MAN 5 VIT**		
Transmission:			
Fueltype:	**Petrol**		
Maintenance	**OK**		
Maintenance	**plus 14100 km**		
Battery functioning	**Yes**		
Type of rims (mounted)	**Aluminium**		
Certificate of Conformity	**Yes**		
Category	**Passenger Car**		
Registration Certificate Car (BE)	**Yes**		

Options

Number of keys total	**2**	Luggage cover	
GPS		Type of Tow bar	**No Tow bar**
Type of Maintenance book	**Digital maintenance**		
Type of GPS storage	**HD**		

Tyres

Summer tyres:	**205/60/16/96 H**			
	Fr.L.	**Vredestein: 4 mm**	Fr.R.	**Vredestein: 4 mm**
	Re.L.	**Vredestein: 3 mm**	Re.R.	**Vredestein: 5 mm**

Tyre profile depth FL	**4.0**
Tyre profile depth FR	**4.0**
Tyre profile depth RL	**3.0**
Tyre profile depth RR	**5.0**
Tyre size FL	**205/60 R 16 96 H**
Tyre size FR	**205/60 R 16 96 H**
Tyre size RL	**205/60 R 16 96 H**
Tyre size RR	**205/60 R 16 96 H**
Tyre type FL	**All seasons**
Tyre type FR	**All Seasons**
Tyre type RL	**All seasons**
Tyre type RR	**All Seasons**
Tyre make FL	**2480**
Tyre make FR	**2480**
Tyre make RL	**2480**
Tyre make RR	**2480**

Assistance equipment

Repair kit	**Yes**	Compressor	**Yes**

Seat cover FL, Stain, Cleaning




Door panel RL, Scratch(es), Acceptable




Bumper moulding F, Scratch(es), Acceptable





Bumper F, Scratch(es), Acceptable




Windscreen, Stone chip(s), Windscreen repair



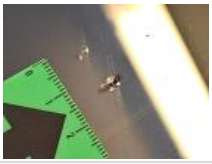

Roof pillar L, Dent(s), Acceptable





Door FL, Scratch(es), Acceptable




Door RL, Chemical polution, Repair and paint (complete)







Bumper R, Scratch(es), Acceptable






Boot lid covering R, Scratch(es), Acceptable




Door RR, Dent(s) and scratch(es), Acceptable




Wing FR, Dent(s) and scratch(es), Repair and paint (complete)





A-pillar right, Dent(s) and scratch(es), Acceptable





Onderhoudshistorie van: VSSZZZKJ2PR126145

ALPHABET

Kenteken	2EDJ016
Merk Model	Seat Arona Move 1.0TSi 95pk/cv 5p
Brandstofsoort	Benzine
Datum deel1	9/5/23

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
12/19/25	27,728	batterij	Vervangen
12/19/25	27,728	luchtfilter interieur	Vervangen
12/19/25	27,728	oliezeef	Vervangen
12/19/25	27,728	onderhoud 12 maand	Uitvoeren
12/19/25	27,728	remvloeistof	Vervangen
12/19/25	27,728	ruitenwisserrubber achter	Vervangen
12/19/25	27,728	ruitenwisserrubber vooraan	Vervangen
12/19/25	27,728	ruitenwisservloeistof	Bijvullen/-laden