



RENAULT CLIO: GD-043-KY

Vinnumber:	VF1RJA00167890999	Versionname:	RENAULT CLIO Business E-Tech hybride 140 -21N
First Registrationdate:	8/12/2021	Fiscalpower:	VP [5P] bva 6-140CH-5cv (bi-corps)
Expertise Mileage:	142821	Power Kw:	103
Bodytype:	Berline	Body colour:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Interior colour:	Anthracite
Fueltype:	Hybrid	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Anthracite
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Rear parking sensors	
Steering wheel multifunctional		Seat cover lining	Lining Other
Steering wheel leather			
Type of climate control	Autom climate control		

Tyres

	195/55/16/87 H			
Summer tyres:	Fr.L.	Goodyear: 55%	Fr.R.	Goodyear: 65%
	Re.L.	Goodyear: 55%	Re.R.	Goodyear: 70%
Tyre profile depth FL				4.5
Tyre profile depth FR				4.1
Tyre profile depth RL				4.6
Tyre profile depth RR				3.7
Tyre size FL				195/55 R 16 87 H
Tyre size FR				195/55 R 16 87 H
Tyre size RL				195/55 R 16 87 H
Tyre size RR				195/55 R 16 87 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				259
Tyre make FR				259
Tyre make RL				259
Tyre make RR				259

Assistance equipment

Inner door sill RR, Dent(s) and scratch(es), Repair and paint (complete)



Armrest F M, Broken, Replace



Dashboard, Tear, Repair/replace (lump sum)




Interior, Stain, Cleaning



Tyre RR, Out of tolerance, Replace



Tyre FR, Out of tolerance, Replace

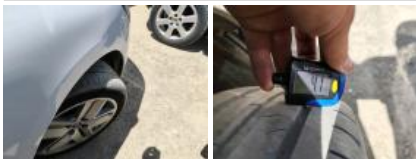

Wheel cover RR, Broken, Replace



Wheel cover RL, Broken, Replace



Tyre FL, Tear, Replace



Wheel arch cover FL, Unclapsed, Dismount/Mount



Wing FL, Dent(s), Repair and paint (complete)



Outside rear-view mirror housing L, Scratch(es), Polish



Bumper F, Scratch(es), Repair and paint (complete)



Headlight L, Scratch(es), Acceptable



Door RR, Dent(s), Repair and paint (complete)



Outer sill R, Dent(s), Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Paint



Wing FR, Dent(s), Repair and paint (complete)



Tailgate / Boot, Dent(s), Repair and paint (complete)



Bumper R, Scratch(es), Paint



Bumper spoiler Rear, Scratch(es), Repair and paint (complete)



Rear roof pillar covering L, Scratch(es), Replace



Luggage compartment cover, Broken, Replace



Internal boot lining R, Glue residues, Replace



Boot lid covering R, Scratch(es), Replace



Bodywork, Not original part, Sticker removal small



Historique Maintenance

Immatriculation: **GD-043-KY** Date de 1ère immatriculation: **08/12/2021**

Modèle: **Renault CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
09/02/2026	127.754	GRAND SUD AUTO	BALAI ESSUIE GLACE AR
	0		LIQUIDE DE FREIN
	0		BALAI ESSUIE GLACE AV
	0		DISQUES PLAQUETTES AV RPLT
	0		RECYCLAGE
11/12/2025	121.502	DEKRA AUTOMOTIVE S.A	CONTROLE TECHNIQUE
26/11/2025	114.996	GRAND SUD AUTO	REVISION ET CLIM ET AIR ET BOUGIES
01/04/2025	99.021	L'OCCITANE AUTOMOBILES	POSE EQUILIBRAGE ROUES
	0		JANTES RPLT
	0		REMPLACEMENT PNEUS ETE
01/04/2025	99.021	L'OCCITANE AUTOMOBILES	PLAQUETTES AV RPLT
	0		GEOMETRIE CTRL
	0		RECYCLAGE
29/04/2025	96.000	HERTZ FRANCE	VR SINISTRE CAT. B
	0		FRANCHISE POUR VR
	0		DIVERS ECHAPPEMENT
08/11/2024	94.968	GRAND SUD AUTO	REVISION ET CLIM
27/06/2024	73.638	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS ETE
15/04/2024	63.362	GRAND SUD AUTO	REVISION
	0		LAMPE RPLT
	0		DISQUES PLAQUETTES AV RPLT
	0		BALAI ESSUIE GLACE AV
29/01/2024	54.339	FLEET SOLUTIONS FRANCE	GEOMETRIE CTRL
29/01/2024	54.339	FLEET SOLUTIONS FRANCE	REMPLACEMENT PNEUS ETE
12/06/2023	37.950	HERTZ FRANCE	DIVERS
	0		FRANCHISE POUR VR
	0		RETOUR EXTERIEUR VR
	0		VR SINISTRE CAT. B
	0		CARBURANT
	0		FRAIS DE GESTION CARBURANT
31/03/2023	30.456	GRAND SUD AUTO	REVISION ET CLIM
	0		BALAI ESSUIE GLACE AV

Historique Maintenance

Immatriculation: **GD-043-KY**

Date de 1ère immatriculation: **08/12/2021**

Modèle: **Renault CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
03/01/2023	21.145	NORAUTO SAS (PRODUIT SPE)	REPLACEMENT PNEUS ETE